



HomeSnagger pro Example Report -Warranty Snag List By Www.homesnaggerpro.co.uk

snag list for items to be addressed before warranty expiry Sunday, 16 April 2023 Prepared For Removed For Privacy

52 Items Identified

David

Www.homesnaggerpro.co.uk



Cover Photo Suggested Assigned To: N/a

Red / Amber / Green Ratings :

These labels are purely to help the home owner understand the importance or urgency of the item listed and are not linked to any official rating of a fault. These are based on the following:

Green items - are the most common items and 99% of them the builder is obliged to put right for you...

They are snags that if left, would not necessarily affect the quality of living in your house.

On the odd occasion (if stated), a green item may be pointing out best practice to the builder and not technically a fault, which, although they are not obliged to put right as it may be their spec, they still should. (such as some screw caps not fitted for example)

Whether or not the developer chooses to put the "best practice" items right, (if you have any), would give a good indication to the quality of customer care of the builder.

Amber items- are generally functional items which would affect the use of your home, would require a specialist to resolve, or come as a significant cost to the home owner to rectify themselves. As a general rule, 100% of Amber / orange items should be rectified by the developer (if you want them to be).

Red items - I would have explained thoroughly any red items that may have been found during your report. They are either urgent, or potentially severe items which pose an immediate or imminent threat to either the building or health of the residents.

In other instances a red item may be a high value item that may have a longer term Detrimental effect on your property.

Jargon Buster:

Elevation/ Facade - the face of your property. WE.g. front or rear elevation if you are looking at your property

LHS - Left Hand Side RHS - Right Hand Side FED - Front Entrance Door

Soffit - the underside of the (usually white plastic) part at the bottom of your roof which circles The whole roof. A 'vented' soffit will have obvious vent holes cut into it from the factory, otherwise the soffit will usually have a solid smooth surface

Soffit vent - and extractor vent that has been cut into the soffit

Fascia - the vertical front face joined to the soffit surrounding the bottom of the roof (also usually white plastic)

Gable - the apexed / triangular shaped part of your roof if applicable

Wall cavity - the space behind the front face of your property that can been seen (usually brickwork or render) and the internal wall build up of your property (usually Thermalite blocks or similar) Cabity is usually 100 -150mm wide

Weep hole / vent - a vent in the brickwork that allows moisture to exit your wall cavity

Cavity tray - a plastic tray within your wall cavity which directs captures moisture and expels it via the weep vents

DPC - Damp Proof Course , a plastic barrier within the brickwork which prevents rising damp

Ridge - the top line of tiles on your roof

Verge - the edge of the roof tiles running down the side of your roof, often covered or pointed in with mortar for a presentable finish

Flue - the chimney exhaust from your boiler



Perished Pointing To Garden Wall

Suggested Assigned To: Brick Layer

Green item - repoint where necessary on garden wall



Chips To Top Of GRP Entrance Porch

Suggested Assigned To: Surface Specialist

Green item - touch up fibreglass porch where damaged



Clean Down Various Snots To Feature Brick Banding Suggested Assigned To: Brick Layer

Green item - various muck snots remain around the house where fallen on the feature brick band



End Cap Missing To Weather Bar On Front Door

Suggested Assigned To: Door Manufacturer Green item - replace end cap to weather bar. See next item for example of what is missing.

Also note black paint does not continue under weather bar





See Previous Item Where End Cap See Here Is Missing

Blocked Weep Vent Above Electric Meter Box


Suggested Assigned To: Brick Layer Amber item - drill out / replace blocked Cavity weep vent so that it is functional



Hockey Stick Out Of Plumb

Suggested Assigned To: Ground Worker

Green cosmetic item - hockey stick for power cable is significantly out of plumb and it's obvious when approaching the house. Dig up and reseat straight

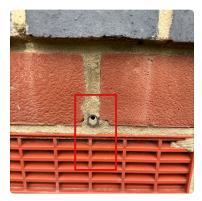

Blocked Weep Vent Above Air Brick Front Elevation Suggested Assigned To: Bricklayer

Amber item - clear Cavity weep vent so that it is functional



Mains Gas Pipe Not Seal Into House

Suggested Assigned To: Plumber / Mastic

Amber / red item - means if some how meter or external pipe got damaged or leaked it could enter the property directly through the Cavity sleeve (bypassing wall cavity)



Lintel Cover Cut Short Suggested Assigned To: Brick Layer Green items - extend / over cover and seal white lintel cover.



Lazy Block Paving Work

Suggested Assigned To: Ground Worker

Significant green item - very poor finish round drain covers.

Not only are they not perpendicular to the path (or anything) which is so easy to do, as a result has made them difficult to block pave and there are off cuts and large gaps which have just been filled with muck which is not breaking away.

Recommend straightening out covers to look neat and block paving properly with block cuts round the covers instead of sand and cement



Another Drain Pot Cover With Cracked Pointing Surrounding It Suggested Assigned To: Groundworkers

See previous item



Perished Gas Box Lid

Suggested Assigned To: Decorator ?

Green item --- replace or paint tires looking perished gas box lid



Lead Sealant Broken In Various Places To Bay Window Flashing Suggested Assigned To: Roofer

Green / Amber item - refresh lead sealant to bay window flashing where sealant has perished in various places (example shown)



Similar To Item On Front Door, End Cap To Side Door Weather Strip Missing

Suggested Assigned To: Door Supplier


Green item - fit missing end cap



Similar To Previous Items - Blocked Weep Vent Above Driveway Side Door

Suggested Assigned To: Brick Layer


Amber item - clear weep

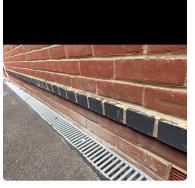

Mortar Stained Splash Course On Driveway

Suggested Assigned To: Brick Layer

Green item - clean down splash course on driveway side

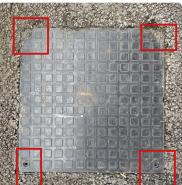

Driveway Drain Pots Missing Screws

Suggested Assigned To: Plumber

Green / Amber item - replace

Missing screws to the 2 drain pot covers to driveway



Driveway Floor Latexed For Some Reason (and Is Failing) Suggested Assigned To: Groundworker / Site / Floorer Amber item - latex is failing to garage floor all over



Damaged Brick Work To Front Of Garage Suggested Assigned To: Brick Layer / Surface Specialist Green item - replace / fix damaged brick

Wash Down Garage Brickwork

Suggested Assigned To: Brick Layer

Green item - wash down required to garage brick work


Hole To Garage Fascia By Poly Top Nail

Suggested Assigned To: Surface Specialist Green item - repair nail hole

> Paint / Stain Garage Personelle Door Sill Suggested Assigned To: Decorator Green item - treatment required to garage door sill

Garage Personelle Door Missing Hinge Caps Suggested Assigned To: Door Supplier Green item - fit missing hinge caps



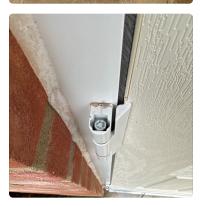







Hungry Perp By Garage Personelle Door

Suggested Assigned To: Brick Layer

Green item - point in the perp joint as necessary



Point In Perp Above Garage Personelle Door

Suggested Assigned To: Brick Layer

Green item - repoint peep



Tanking / Damp To Garage Needs To Be Assessed Suggested Assigned To: Groundworker

Amber item - moisture is entering garage from underneath Personelle door.




Resident Has Reported Water Ingress Via The Floor Of The Garage

Suggested Assigned To: Groundworker / Site

Amber item - the failing latex and cracked concrete underneath this suggest that this could be the case and garage floor has issue with water ingress.

Assess when changing the perished latex (as also mentioned in previous item)



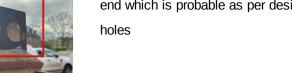




Loose Paving Slab Suggested Assigned To: Groundworker Green item - reseat loose paving slab as indicated



Loose Roof Tile Garden Side Of Garage Roof Suggested Assigned To: Roofer

Amber item - secure refit / repoint bottom tile as necessary

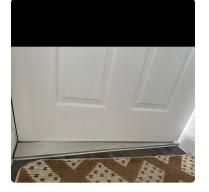

Ease Front Door - Scraping On Bottom Suggested Assigned To: Carpenter Amber item - door needs significant adjustment

Perforated Bricks Used To Finish Garden Wall Capping

Suggested Assigned To: Brick Layer

Green cosmetic item - easy fix for a proper finish , use a solid brick for the end which is probable as per design or use mortar dye to fill the perforation holes



Front Door Bottom Hinge Pin Loose And Cover Missing Suggested Assigned To: Carpenter

Amber item - reseat pin and fit missing cap (as seen on the other hinges)



Front Door Locking Mechanism Needs Adjustment


Suggested Assigned To: Carpenter

Amber item - adjust keeps as necessary as is very difficult to lock as it is



Front Door Ramp Threshold Not Finished Suggested Assigned To: Site

Green item - remove temporary nails and seal

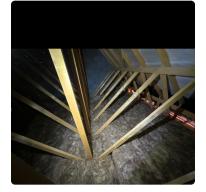


No Issues Found In Loft Space Suggested Assigned To: N/a Looks particularly tidy and well finished



En Suite Door Needs Easing - Plasterboard Above Cracked As Result

Suggested Assigned To: Carpenter / Decorator

Amber item - ease door so that it doesn't rub and make good walk above which has occurred from where door has had to be forced shut

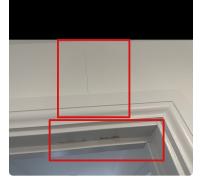

Similar To Previous Issue - Main Bathroom Door Needs Easing Suggested Assigned To: Carpenter / Decorator Amber item - ease bathroom door and make good movement cracks that had occurred from this



Perished Mastic And Lifting Amtico In Main Bathroom Suggested Assigned To: Mastic And Floor Layer Green item - sort flooring and refresh sealant



Loose Amtico Tile RHS of Toilet In Main Bathroom. Suggested Assigned To: Floor Layer Green item sort out lifting flooring



Main Bathroom Floor Significantly Not Level

Suggested Assigned To: Floorers

Green item - floor is 11mm out of level over 600mm

Seen by bottom edge of bath panel gap going from nothing one side to 20mm on other side



Back Child's Bedroom Ease Door

Suggested Assigned To: Carpenter

Amber item - ease door

Switch Screw Pip Missing To Front Study Suggested Assigned To: Electrician

Green item - fit missing screw pip



Random Sockets Test Ok Suggested Assigned To: N/a No action required





Pipe Rosette Missing From Behind Wc Basin

Suggested Assigned To: Plumber

Green item - fit pipe rosette cover

Previously Reported Scratches To Glass

Suggested Assigned To: DW Green items - resident had previously reported these scratches. apparently DW should have record of this.

Lots Of Builders Debris Under Sink Base Unit Suggested Assigned To: Site Green item - clear out under kitchen units



Adjust Sink Base Unit Door Margin Suggested Assigned To: Kitchens / Site

Green item - adjust doors to even out gap / not found when closing

