



SERVICE • BULLETIN

DATE 11-13-70

BULLETIN NUMBER 1943

Of Interest General Manager Sales Manager Service Manager Parts Manager Service Technician

SUBJECT: BODY AND SHEET METAL
SUJET: DOOR GLASS SCRATCHING

MODELS: 1970/71 BARRACUDA AND
MODELES: CHALLENGER

The following information will assist in the correction of a scratching condition which may occur on the outside rear surface of the front door glass.

Should this condition be brought to your attention, inspect the rear outboard glass anti-rattle stabilizer for loose screws or worn insulator tip, causing metal to glass contact. (See illustration).

If worn, obtain a new stabilizer, Part No. 3499849. Wrap the stabilizer in a shop cloth to protect the knap on the insulator tip. Place the tip end in a vise and crush the stabilizer approximately 1/8 inch.

Install the stabilizer and inspect the other stabilizers for loose screws. Check window for correct operation.

W. F. CHISHOLM
Service Manager

(THIS BULLETIN IS SUPPLIED AS TECHNICAL INFORMATION ONLY AND IS NOT AN AUTHORIZATION FOR REPAIRS)
(CE BULLETIN VOUS EST FOURNI À TITRE DE RENSEIGNEMENT TECHNIQUE SEULEMENT; IL N'AUTORISE AUCUNE RÉPARATION)

