

NANO-CLEAR® APPLICATION INSTRUCTIONS



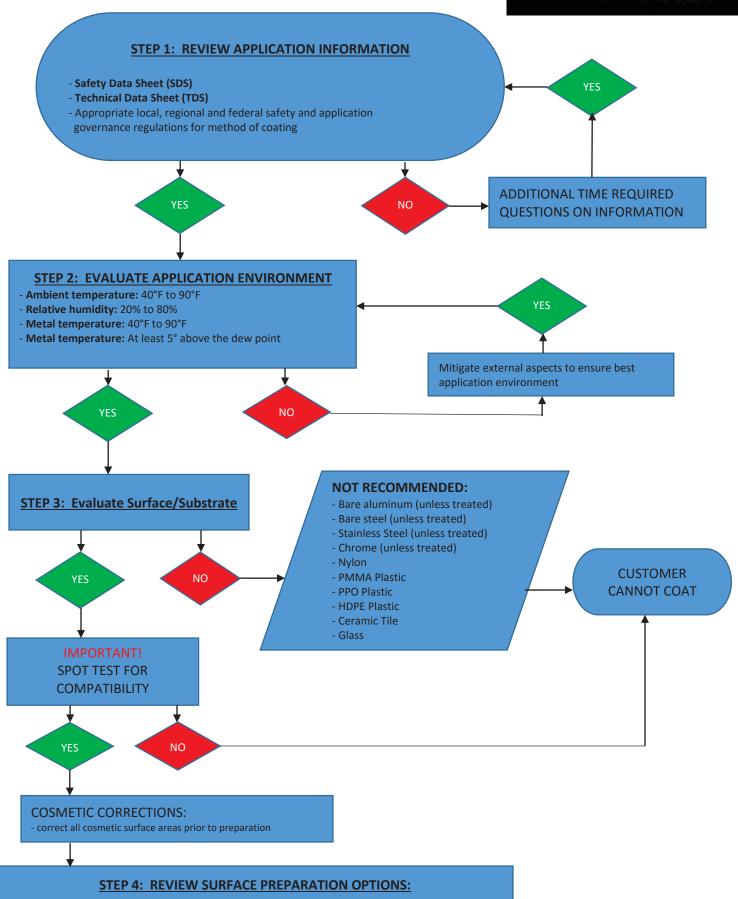

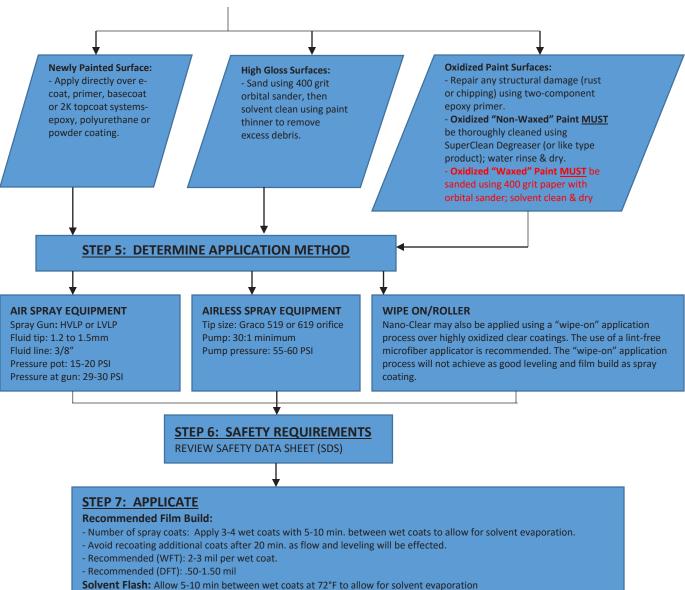

Thinning: None required as Nano-Clear® has very low viscosity

** Nano-Clear® is a moisture sensitive system. It is important to close containers immediately after use to avoid moisture contamination. **

STEP 8: CLEAN UP/DISPOSITION

- Clean equipment immediately using paint thinner, MEK or acetone. Never clean spray equipment with water or alcohol.
- Dispose of waste products per applicable local regulations.

STEP 9: CURING COATING

- Cure time @ 72°F, 50% R.H.
- Dust free: ~20-30 minutes
- Tack Free: ~30-40 minutes
- Handle: ~4 hours
- Dry Hard: 24 hours @ 72°
- * Lower temperatures and lower humidity conditions will slow-down the curing rate.
- * Higher temperatures and higher humidity conditions will speed-up the curing rate.

