

**SUMMARY** 1234 Main Street Saskatoon SK S7H Buyer Name 21/01/2025 9:00AM



Maintenance Item

2.2.1 Siding, Flashing & Trim

### SIDING REQUIRES RE-INSTALLATION

Re-install siding. Consider aluminum nails/fastener's to prevent reoccurrence

Recommendation Contact a handyman or DIY project





Reinstall Siding

Re-install Siding

#### 2.2.2 Siding, Flashing & Trim

### PROPER FLASHING / RAINPROOFING **REQUIRED**

Siding cut out or vent is possibly required to keep abandoned fireplace chase vented. Consider installing proper flashing or vent cover, similar to dryer vent cap. This will support keeping rain out of cavity.

Recommendation Contact a handyman or DIY project



2.4.1 Decks, Balconies, Porches & Steps

### **GUARD RAILS AND STEP RAILINGS SHOULD BE TIGHTENED**

Recommendation Contact a handyman or DIY project





Iron Guard Inspections Ltd. Page 1 of 8

### PROVIDE PROPER GRADING



Considering the basement foundation type grading should be a number one concern.

Recommendation Contact a qualified professional.







Sidewalk has Sunken

### 2.7.1 Walkways, Patios & Driveways

### DRIVEWAY AND SIDEWALK CRACKING - MAJOR



Major cracks observed. Recommend driveway contractor evaluate and repair or replace.

To extend life of current driveway consider crack repair/sealing to prevent further water penetration

Recommendation

Contact a qualified driveway contractor.







### 3.1.1 Coverings

### DAMAGED (GENERAL)



Roof coverings showed obvious deteriation. Recommend a qualified roofing professional evaluate and repair.

Recommendation

 
Contact a qualified roofing professional.

Iron Guard Inspections Ltd. Page 2 of 8



### 4.1.1 Foundation and Basement

### WATER INTRUSION



Water intrusion and negative grading was evident on the exterior. This can compromise the soil's ability to stabilize the structure and could cause damage. Recommend a qualified contractor identify potential sources of moisture and remedy.

Recommendation Contact a qualified professional.



# 5.1.1 Equipment FURNACE FILTER COVER MISSING



Recommendation Contact a handyman or DIY project





Iron Guard Inspections Ltd. Page 3 of 8

6.3.1 Water Supply, Distribution Systems & Fixtures




### **POLYBUTYLENE SUPPLY PIPES**

Water supply pipes were made from polybutylene material. This material can be prone to fail without warning, causing damage to the home structure. Recommend a qualified plumber replace pipes and fittings with an approved material like PEX.

You can read more about polybutylene piping here and here.

Recommendation Recommend monitoring.

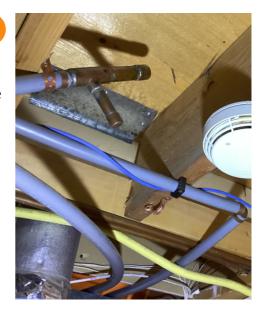

6.3.2 Water Supply, Distribution Systems & Fixtures

### Maintenance Item

### KITCHEN SINK HOT AND COLD ARE REVERSED

**KITCHEN** 

Hot and Cold appear reversed, acceptable but consider reverting to typical standard for sink fixtures.

Recommendation Contact a handyman or DIY project



6.5.1 Fuel Storage & Distribution Systems



# NATURAL GAS PIPING FOR BBQ NOT SECURED

Piping and Valve Box should be secured to prevent damage and possible pipe leaking natural gas.

Recommendation Contact a qualified professional.



7.4.1 Lighting Fixtures, Switches & Receptacles

### **COVER PLATES MISSING**



One or more receptacles are missing a cover plate. This causes short and shock risk. Recommend installation of plates.

Recommendation

Contact a handyman or DIY project

Iron Guard Inspections Ltd. Page 4 of 8





7.4.2 Lighting Fixtures, Switches & Receptacles

### Maintenance Item

## ELECTRICAL SWITCHES NOT OPERATING ANY DEVICE

Electrical Switches not appearing to operate a light or receptacle. Investigate further. Cause may be as simple as burnt out bulbs.

Recommendation
Contact a handyman or DIY project



7.4.3 Lighting Fixtures, Switches & Receptacles

### **OUTDOOR RECEPTACLE NOT WATERPROOF**



Outdoor receptacle along north wall of deck requires waterproofing, no photo available

Recommendation Contact a handyman or DIY project

7.5.1 GFCI & AFCI

# NO GFCI PROTECTION INSTALLED



Major Issue or Safety Hazard

No GFCI protection present in required locations. Recommend licensed electrician upgrade by installing ground fault receptacles in all locations.

Here is a link to read about how GFCI receptacles keep you safe.

Recommendation

Contact a qualified electrical contractor.



7.6.1 Smoke Detectors and Carbon Monoxide Detectors

# SMOKE AND CARBON MONOXIDE DETECTORS REPLACE WITH NEW



Must be replaced every 10 years, even if they are hard-wired. Exact install dates are not investigated as part of visual home inspection.

Information from the City of Saskatoon cane be referenced here: City of Saskatoon Smoke Detectors

Iron Guard Inspections Ltd. Page 5 of 8

### 8.1.1 Attic Inspection ROOF VENT MAY BE LEAKING



Signs of water infiltration. Investigate and repair.

Recommendation Contact a qualified roofing professional.



### 9.1.1 Doors and Windows

### **BASEMENT DOOR NOT CLOSING**

Recommendation Contact a handyman or DIY project





### 9.1.2 Doors and Windows

### **CABINET HINGE BROKEN**

BASEMENT Recommendation Contact a handyman or DIY project





### 9.4.1 Walls and Ceilings

### WALL AND CEILING MINOR REPAIRS REQUIRED

Recommendation Contact a handyman or DIY project





Maintenance Item

Iron Guard Inspections Ltd. Page 6 of 8



### 9.6.1 Countertops & Cabinets CABINET HINGE LOOSE

### Maintenance Item

One or more cabinet hinges were loose or require lubrication. Recommend a qualified handyman or cabinet contractor repair.

Recommendation Contact a handyman or DIY project



Loose Slider

### 9.8.1 Fire Extinguisher

#### FIRE EXTINGUISHERS REPLACEMENT

Replace with new to ensure FE's are current and operable

Recommendation Contact a handyman or DIY project



#### 10.4.1 Central Vacuum

### CENTRAL VACUUM EXHAUST PORT NOT PIPED TO OUTSIDE



It is recommended exhaust port be piped to outside to mitigate exhaust dust into home Recommendation

Contact a handyman or DIY project



**Exhaust Port** 



Excessive Dust Accumulation

### 11.6.1 Attached Garage Inspection

### GARAGE FLOOR TILE AND VEHICLE ENTRANCE REPAIRS



Iron Guard Inspections Ltd. Page 7 of 8

# Requires Repair Recommendation Contact a handyman or DIY project





Iron Guard Inspections Ltd. Page 8 of 8