

### MOTOR AND RELATED EQUIPMENT PROBLEMS

SHARING PICTURES AND STORIES FROM AN ELECTRO-MECHANICAL REPAIR SHOP

by

WAYNE HALL and EDWARD JENKINS
Vibration Institute, Piedmont Chapter #14
20 January 2017



# Repair Shops See Many Pieces of Equipment





# We All Try To Solve Mysteries

- Things that go bump
- Things that wiggle
- Things that shake and rattle
- Things that smell (stink!)
- Things that break and fall apart
- Things that wear and wallow out
- Things where Electricity "gets out"




## An Elevator that goes bump .... Bump...

- Passenger elevator in a hospital
- Few were willing to ride it
- Motor was suspect, no fault found
- Electronic Drive was suspect, replaced
- €Then, \$ 90,000 later, an elevator mechanic had a thought



# A Bumpy Elevator Ride in a Hospital



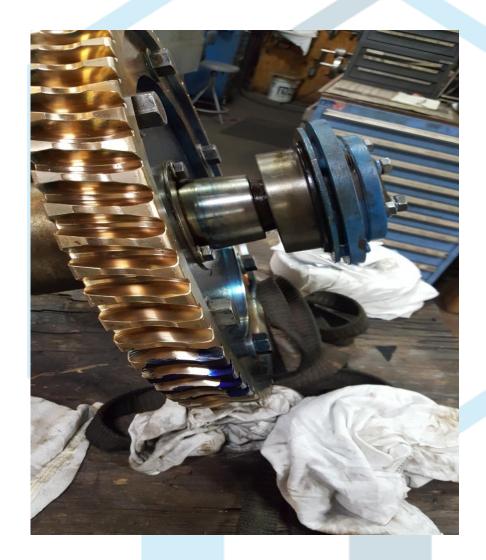



#### **Loose Internal Fan**

#### **Repaired Blower**

#### The last of the several times it was

- Put together for dispatch.
- A little clicking noise kept appearing each time it was run.
- Nothing showed up on vibration monitor.
- Finally discovered a loose internal fan on the rotor inside the motor.






# **Further Blower Views**







# Gearless Elevator Drive at Duke Energy Bldg.

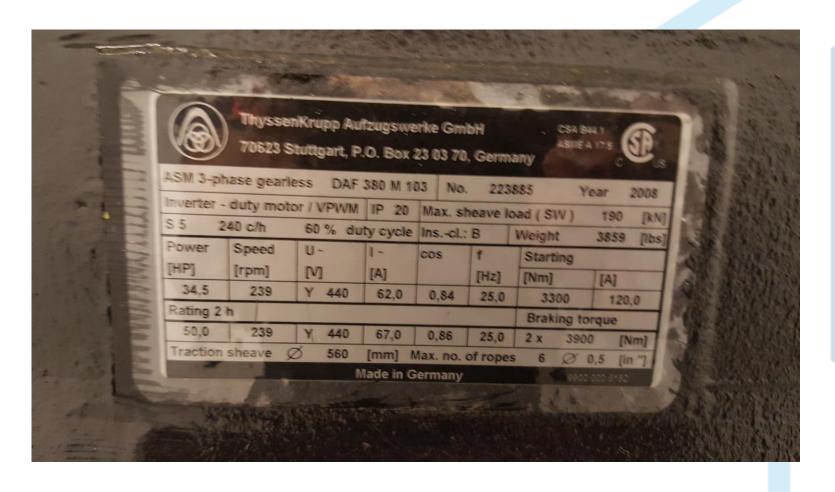





#### **Rotor Moves Before Shaft Starts Turning**

- Gearless Elevator Drive built into an office building
- After it warmed up, it would "clunk" every time it started or stopped.
- Rotor loose on shaft, keyway bad
- Some temporary repairs are done with epoxy
- Other attempts involve welding.





# Coupling and Key






## Some body knows!

- Many times an operator or floor employee is aware of problems
- Other times a maintenance job is skipped or ignored
- Occasionally an intelligent process is followed for many years
- Procedures change/ improve, but the word does not get out

You and I are lucky when we get to talk to the right person to help solve their problems



# **Vertical Hydro Generator**

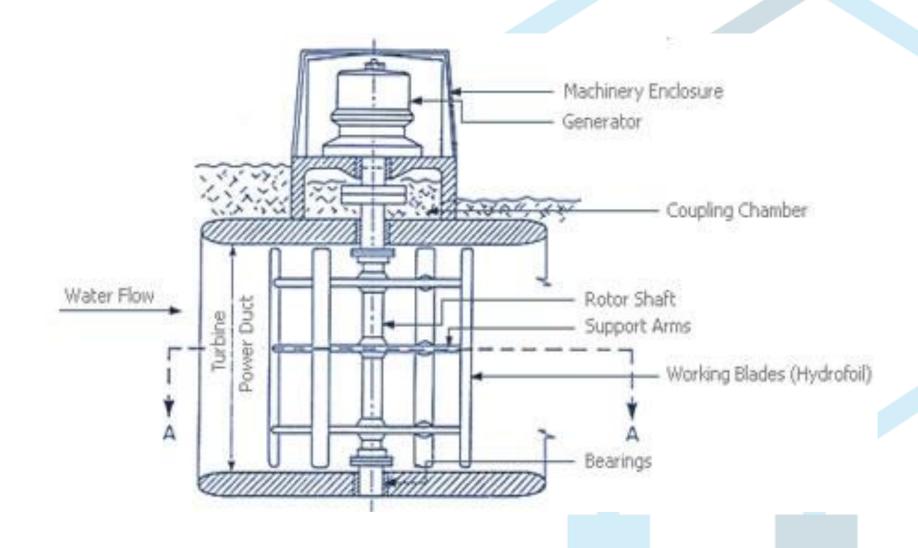



# **Waterwheel Drive Connecting Shaft**

#### **Shaft**



#### **One of the Cracks**





# **View Of Another Crack**





#### Many Motors Run in Difficult Situations

- Blowing off the dust/ dirt occasionally does help
- Watching for bad connections is needed
- Some motor designs are especially resilient
- The next motor illustrated runs in the open air in a rock quarry




# **Rock Quarry Crusher Motor**

#### **Disassembled motor**



#### **Note Collector Ring Failure**

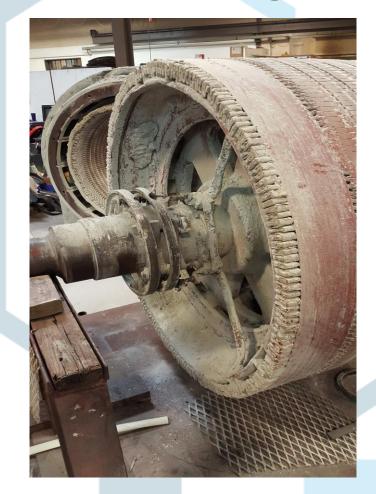




#### "Running a route is useful... until

- The following motor was monitored about six weeks before it failed
- ELubrication may be needed more often than the route is run
- ©On line monitoring may have been needed
- An observant operator noted problems and had the motor removed from service
- Shaft journal needed repair, but no other damage occurred



# **Bearing Failure in Service – Recently Checked**



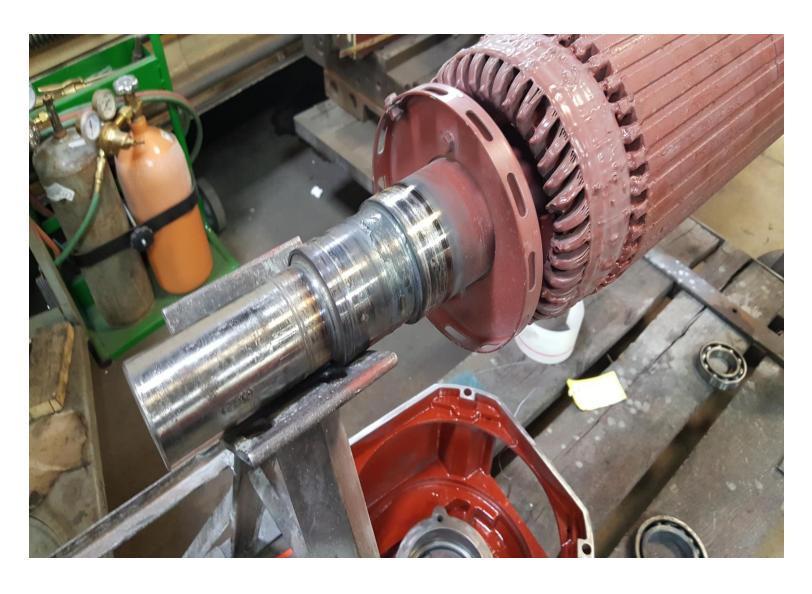




### Spectrum a month ago

- Note that the maximum vibration level observed was at running speed and well below alarm.
- No unusual peaks occurred at bearing frequencies
- No evidence bearing was greased in service





# Spectrum a month ago

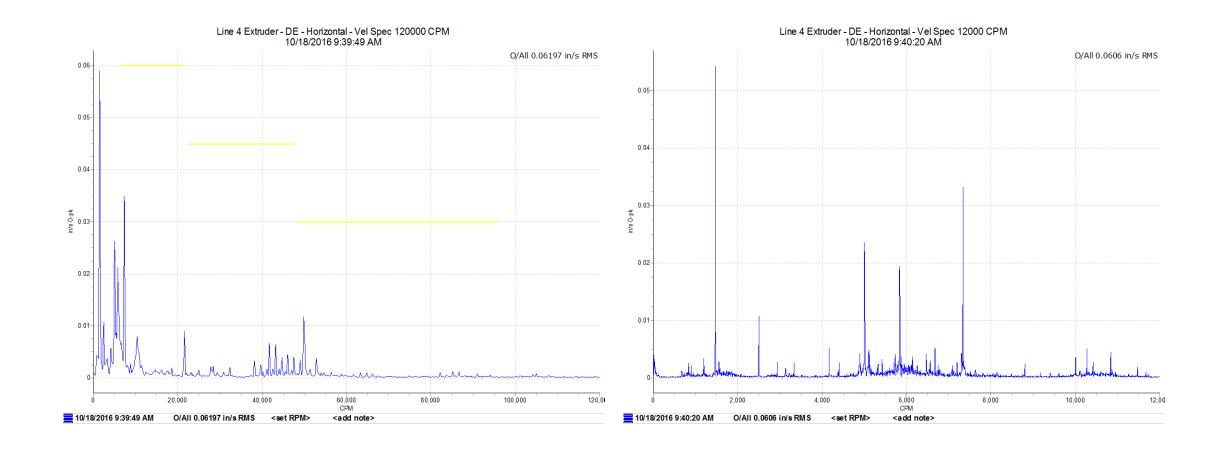



### Planned maintenance can pay off

- ☼Tooth paste manufacture is a never ending process
- Mixing/ grinding require high torque and low speeds
- Reliable Gear Boxes are vital
- Running to problem detection or failure may not make economic sense
- This gear box is removed from service every two years and all bearings and seals are replaced



# **A Well Planned Maintenance Procedure**







#### **Balance May Help Reduce Vibration**

#### **Provided You Have:**

- Firm equipment foundation
- Structural integrity
- Properly supported rotating elements
- Concentric and smooth bearings
- These conditions do not always occur

# Roll Balance







# Final Balance of Roll - Trim by Weight Removal







#### **Balance Report**

- ⊕Two plane balance
- Operating speed 1150 rpm
- ☼ Target Residual Unbalance 5 grams, regardless of roll size or weight??
- **Results:** 
  - €0.001 and 0.003 inch/second
  - €0.91 and 2.12 grams Residual
  - €0.04 and 0.13 mils

#### Computerized Dynamic Balancung Report

Date: 1/12/2017 //me: 10:18:48 V Operator: Shub Job mo.: 311251

Job mo.: 311251 -შ. მ. თი.: 29722

Chatomer: STRINSMAAN ROLLS

Own plane becames
Item palanced: 16125"dia | X | 57"iq RCLL
Belancing specification: ISO & Scale
Item operating speed: IISO.00 REM

Item weight: 1190.00 lb Balancing grade: 1.000

Allowable uncalance in each place: 3.204 ox-in

Balancing RPM: 504-51

#### - Balance Conditions

	97.5	art	Finish			
Right End	Mils:	0.75	Mod.s.:	0.04	159/83	0.001
	Angla:	211.19	Anglet	260.79		
1016 <b>հո</b> ձ	Mila:	0.36			in/a:	0,003
•	emple:	105,60	Angle:	152,10		

Beginning unbolance: 128.178 g-in, -4.521 by-in Right Side -42.338 g in, -1.493 by-in Left Side

Socidual unbalance: 0.91 g, 0.03 by Right Side 7.12 g, 0.07 by Left Side,

This there's balanced to: 6.608 g-in, 0.233 oz in Right Side 15.470 g-ln, 0.548 oz-in Iol. Side

Rey Coed Prive End: 0.99 in wide z=0.29 in thick x=3.50 in long Rear End: 0.00 in wide z=0.50 in thick x=0.00 in long

ROLL #: 4986261 - 13 - 026



### Balanced rotating elements help, but...

- This external blower had a heavy steel blade
- The blade was balanced within specs
- The drive motor was balanced within spec
- Excess Vibration still occurred



# **External Blower Motor**





# **Heavy Steel Fan Blade**





# **Broken Supports**





## **Vibration in Sewage Pump**

- ©Once the "Stuff" was cleaned out, the pump ran smoothly.
- No problems in bearings





## **Balance Weights Must Be Applied Securely**


- Epoxy balance compound relies on adhesion /support
- Sometimes mixed with lead shot to increase weight
- Welds on weights can crack
- Balancing rings provide many angular positions
- Weights on fan blades? Stress, air flow, appearance?



# **Balance Weights Can Come Off**

# Photo of balance ring on rotor – not available



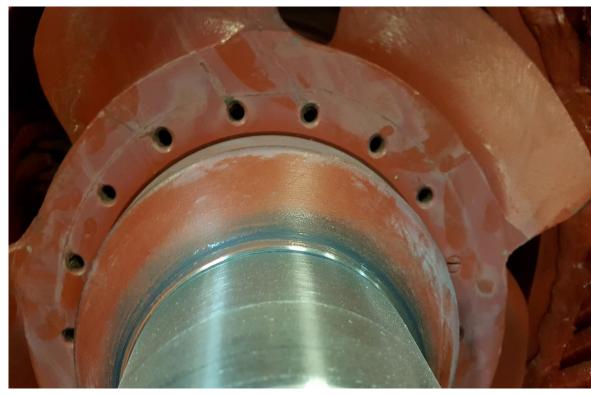



#### **Our Five Senses Are Very Useful**

- Hearing irregular operation
- Smell insulation or hot grease
- ☼Taste digestive safety
- Sight observation of normal and abnormal situations

- **SAFE OPERATION?**
- Ear Muffs Plugs
- Masks dust and gas control
- Safety Glasses with Side Panels
- Arc Flash Protection Clothing



# **Protective Gear**







# Heat Sensing Can Also Be Useful

in tw

front I this

an e

com

is e



#### How Augmented Reality Is Changing the Way We Work

AR devices can assist in a number of ways BY AMANDA DAVIS

ustry is a test bed for AR's abilities. Workers on constructions sites, in water treatment plants, I elsewhere are trying smart mets and headsets that can distep-by-step instructions to help fix faulty machinery. And they ommunicate and share what re looking at with colleagues, sk their advice, even if they're sands of kilometers apart. Lese are just some of the benefits arables like the DAQRI Smart tet (DSH) [photo, center] and the booft HoloLens headset [bottom].

#### DS-FREE

be awkward to repair or recalia piece of complicated machinhile holding onto an operator's ial to read instructions. AR helfrom DAQRI will overlay the actions on the machinery, freeing e worker's hands. "This reduces me it takes to complete a task and lown on errors," says Paul SweeAlso, thermal cameras in the DSH can visualize for the wearer the temperature of the surrounding area. That view can help predict equipment failures before they happen because, notes Sweeney, many machines "run hot" before they break.



notes Sweeney, many machines "run hot" before they break.

is exploring possible applications for AR and VR devices for its customers.





The DAQRI Smart Helmet [top] projects instructions on machinery to let people work hands-free. The Microsoft HoloLens [bottom] projects images in front of the wearer and allows workers to collaborate with each other in the form of avatars.




#### **Intermittent Connections**

- Disconnect, fuse block
- Wiring to starter / vfd or scr drive
- Breaks or grounds in conduit
- Poor connections in terminal box
- Vibration loosened winding connections
- Bad solder joints / lugs not crimped tight



# **Smell is Useful**



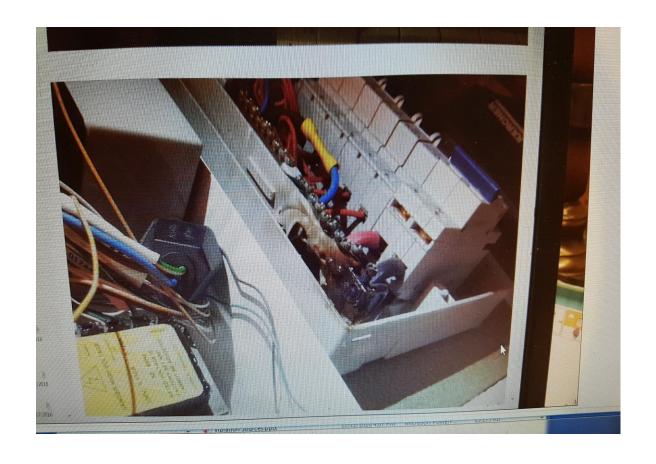




# **Hearing Is Useful**





#### **Rotor Problems**

- Difficult to diagnose
- Construction varies
- Subject to extreme heat on start
- Slot has to be large enough to allow bars to be inserted
- Steel coefficient of expansion differs from those of copper and aluminum

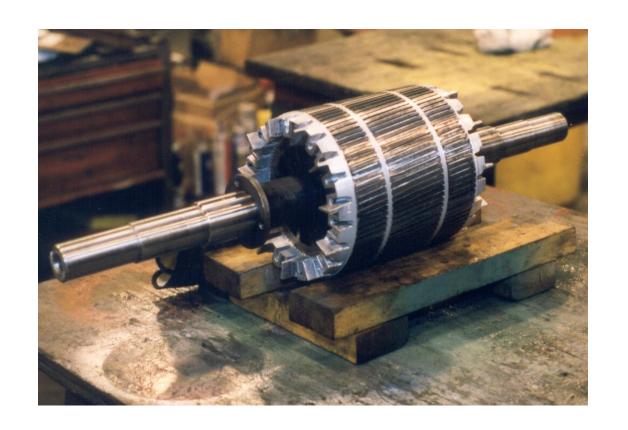



## **Questionable Rotor for Compressor**








#### **High Frequency Vibration in Motor**




Here is the Vibration data taken on the Charlotte Pipe with loose rotor bars.

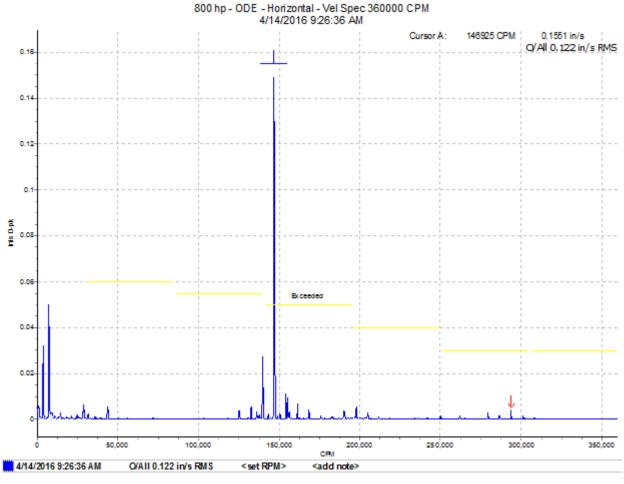



## **Rotor Bars Have Varied Shapes**



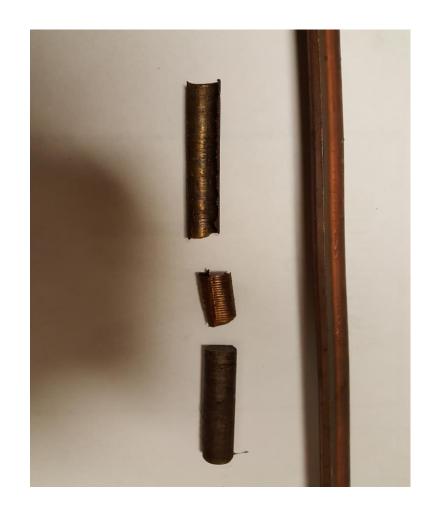




## **Broken Rotor Bars**





## **1250 HP Compressor Motor**

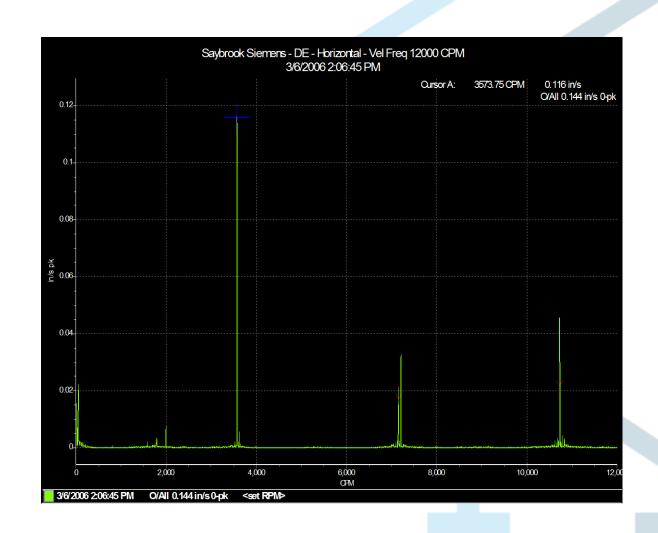



#### Bearings Have An Impossible Job . . . They Cannot Last Forever

- Sleeve Bearings properly lubricated and kept clean have very long lives and can be repaired
- Ball and roller bearings have a finite life
- Proper application and loading are essential
- Lubrication is a major factor in bearing life



# **Eccentricity – Bearing**





# **Roughness In Bearing**






## Water Pump Thrust Bearing Failure – Inner Race





#### **Thrust Bearing Inner Race Spectrum**

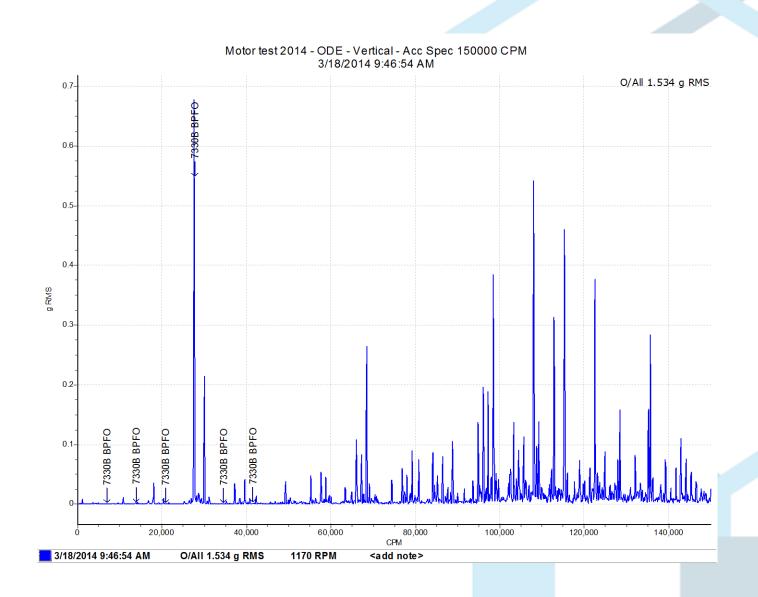




# **Bearing Failure – Outer Race**





## **Outer Race Spectrum**

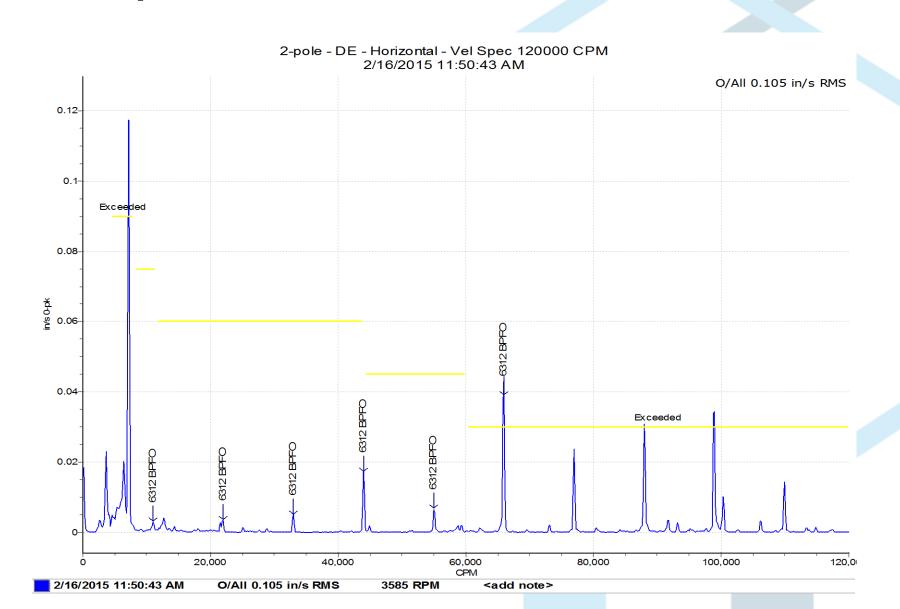



# **Rubbing - Bearing**








## **Alignment Is Important**

Three bearing units are always difficult




# Misalignment

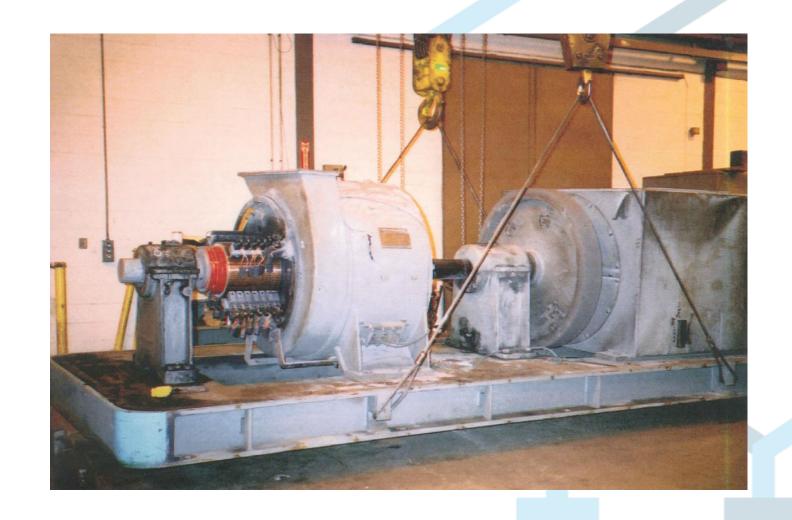



## **Amplifier Effects – Looseness – Pedestal**

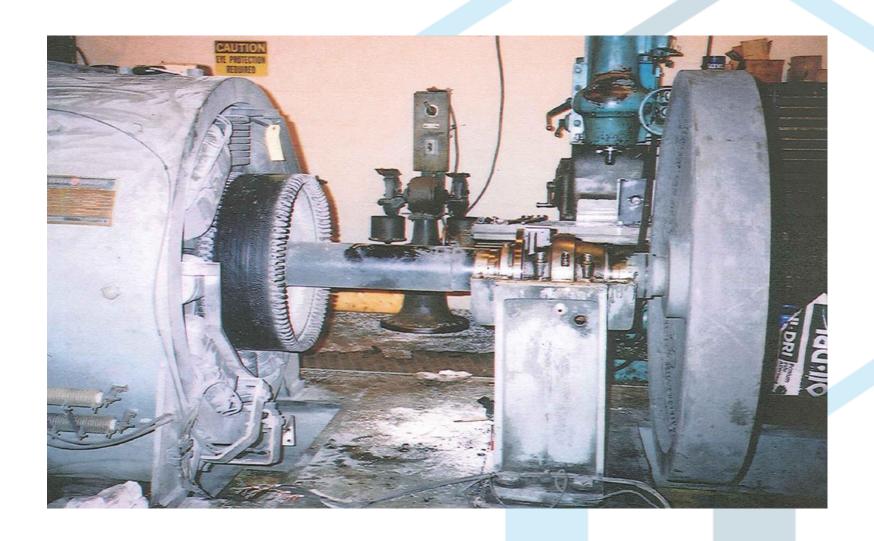



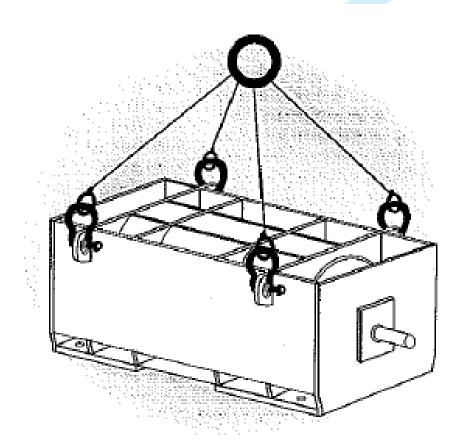


Figure 1. <u>Always</u> use the manufacturer provided lifting points.



# **Amplifier Effects – Soft Foot**





## As Received, 125 hp, 1750 rpm Compressor Motor








#### **Error in Machining the End Brackets**


- Motor received with both end brackets oversize and one journal undersize.
- Repairs made, but DE end bracket slipped in the lathe and was bored cocked, 0.004 inch.
- ♥Vibration levels OK (0.02 in/sec), but Roller bearing was noisy.
- ODE readings out 170 degrees.

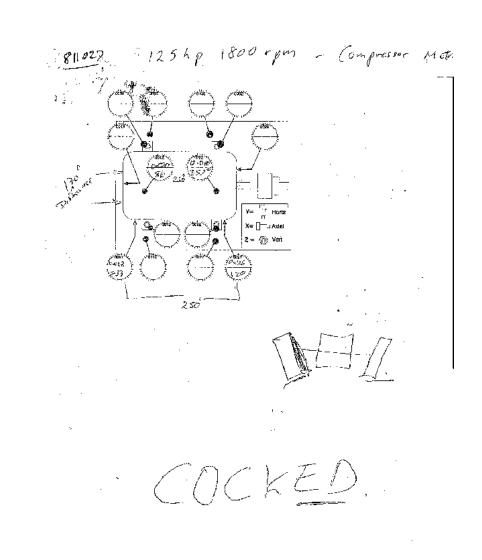




#### **Cocked End Bell(s)**

#### MISALIGNMENT MISALIGNED BEARING COCKED ON SHAFT

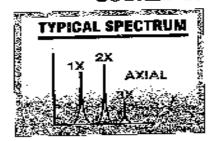

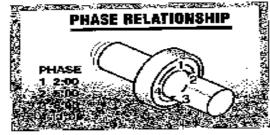


Cocked Bearing will generate considerable axial vibration. Will cause Twisting Motion with approximately 180° phase shift top to bottom and/or side to side as measured in axial direction of same bearing housing. Attempts to align coupling or balance the rotor will not alleviate problem. Bearing must be removed and correctly installed.

Mechanical Looseness

Rolling Element

Resonance

Rotor Rub

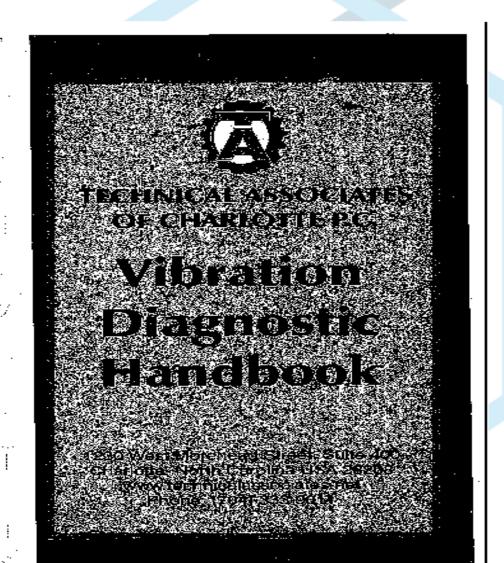




#### **Resonance Will Occur**

- All systems will have some degree of imbalance
- ©Operating at a resonant frequency is dangerous.



#### **Harmonics From Motor Or Drive**

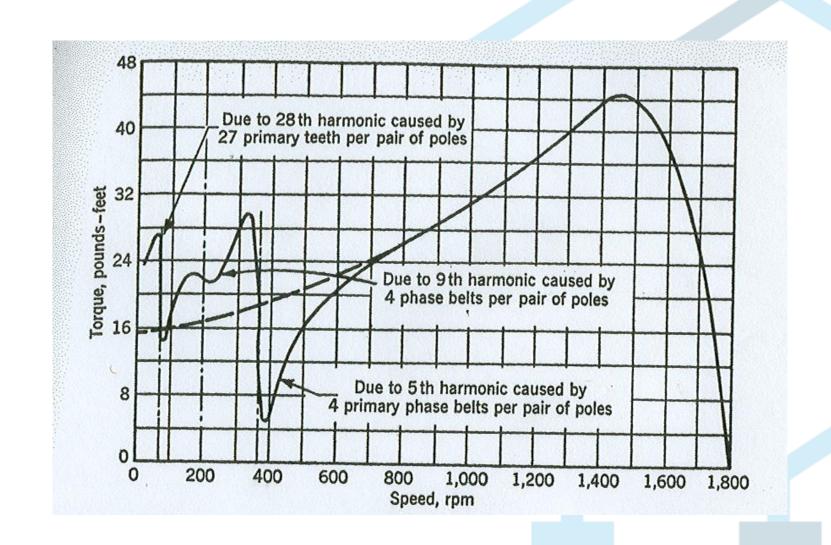



#### **A Troubled History**

- Pump motors manufactured in Brazil
- Moved to Mexico for acceptance testing
- One hit a bridge during road transport
- Installed in water supply pump station
- **Excess vibration occurred**
- Rotors were balanced
- Reed vibration occurred... strengthening required in motor frame
- Final trim balance was acceptable




# **Amplifier Effects - Resonance**






## **2750 Hp Vertical Pump Motor**

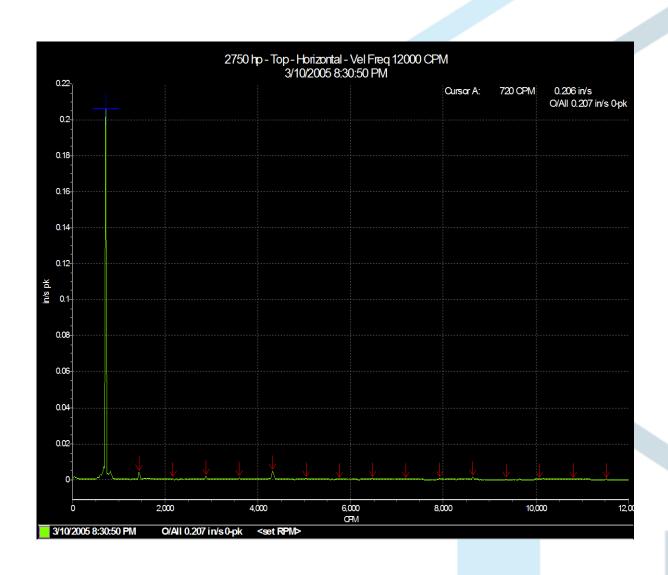




#### 2750 Hp 720 rpm Vertical Pump Motor Bump Test

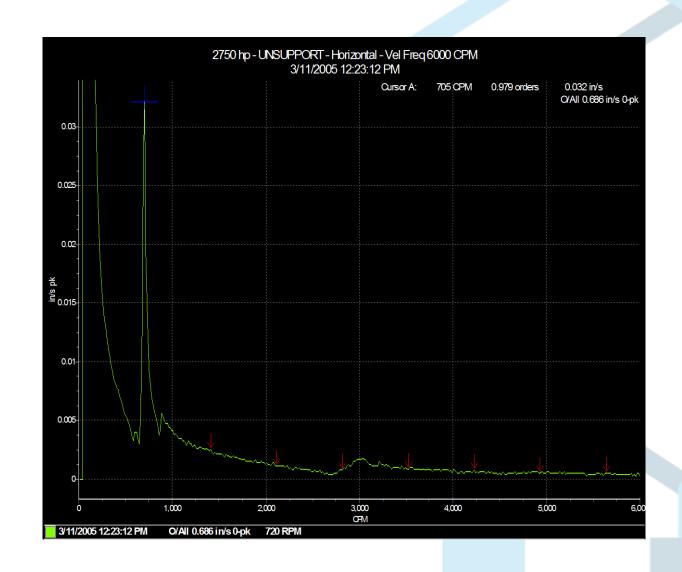



## **After Balancing**

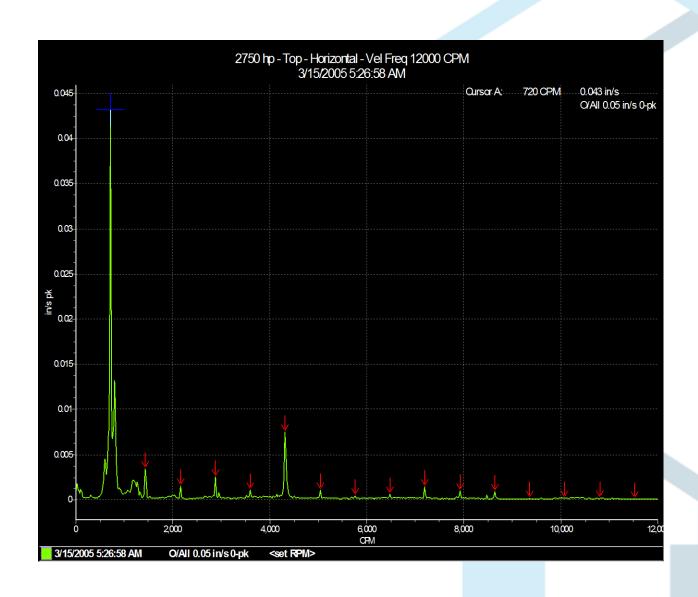



#### **Balancing Report**

© Date/Time: 3/14/2005 2:36:18 PM


Single Plane Balance, Velocity (in/s pk)

#### Magnitude/Mass Angle

Initial Reading0.232 in/s pk326 deg



## **Amplifier Effects – Looseness – Stator Core**

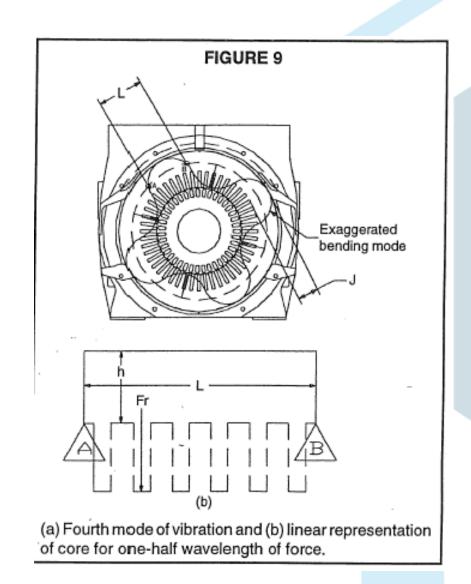




# Amplifier Effects – Looseness – Pedestal/ Base







#### **Effect of Loose Base**

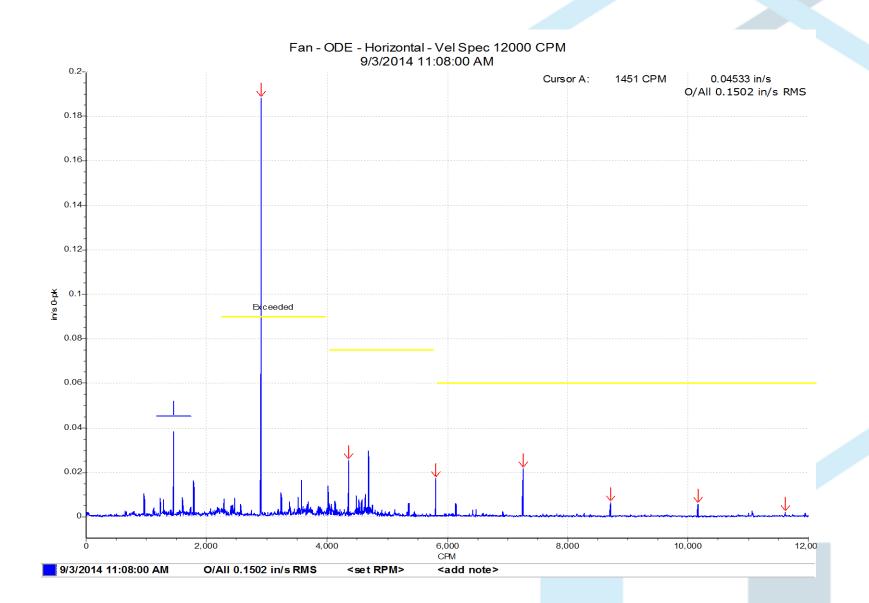



## **Balancing Report**

Folder: Jenkins Electric

Machine: Fan

© Date/Time: 9/3/2014 12:43:45 PM

Single Plane Balance, Velocity (in/s pk)

	wagnitude/wass	Angle
Initial Reading	0.03164 in/s rms	126 deg
	240.0 grams	0 deg
	0.01123 in/s rms	331 dea




## Some Systems Provide Many "Opportunities"

- ELarge 30 HP blower on shredded paper transport
- ©Tools, etc may enter the waste stream and impact the blade
- Paper can coat the TEFC motor fan cover
- The system base had many loose bolts
- Some foundation bolts were missing




# **Blower Configuration**

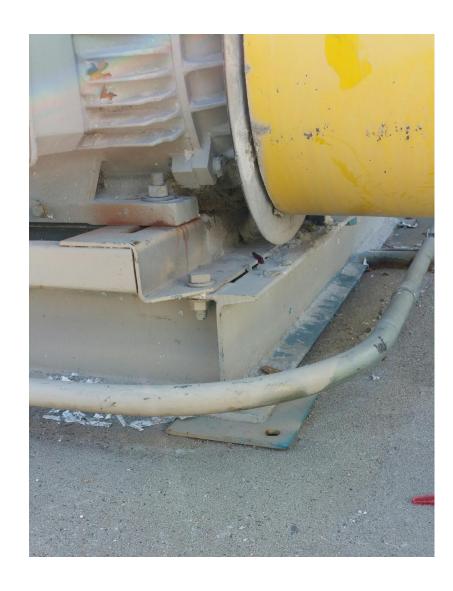



# Thanks For Listening

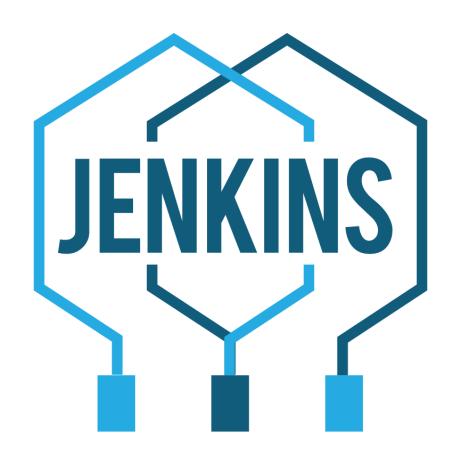



#### References

- 1. William R. Finley, Mark M. Hodowanec, and Warren G. Holter, "An Analytical Approach to Solving Motor Vibration Problems," EASA Tech Note 40, Electrical Apparatus Service Association, Inc., St. Louis, March 2002, 16 pages.
- 2. Tom Bishop, "Motor and Drive System Resonance Problems and Solutions," EASA Currents, pages 4 to 8, March 2007.
- 3. Richard L. Nailen, <u>Managing Motors</u>, Barks Publication, Inc. Chicago, 1991.
- 4. S.A. Naser, <u>Handbook of Electric Machines</u>, McGraw Hill, NY, 1987
- 5. Richard L. Nailen, "Motor installation depends upon foundation design", Electrical Apparatus, Vol. 67, No. 12, pp.19-25.
- 6. Amanda Davis, "How Augmented Reality is Changing the Way We Work", The Institute (IEEE), Vol. 40, No. 4, p. 6.
- 7. Richard L. Nailen, "Solving the rotor bar dilemma," Electrical Apparatus, Vol. 70, No. 1, pp. 25 30.