

**THREE YEAR REINSPECTION**  
Meeting the requirements of AHERA, 40 CFR Part 763.85(b)

for

**Mason Consolidated School District**  
2400 Mason Eagles Drive  
Erie, Michigan 48133

DMD Project No. 24-M004.11

Conducted July 10, 2024

by

**DMD ENVIRONMENTAL, INC.**  
3424 West Laskey Road  
Toledo, Ohio 43623-4032  
Telephone (419) 473-1980  
Facsimile (419) 473-1985  
DMDEnv@att.net  
www.DMDEnv.com

July 15, 2024

DMD Project No. 24-M004.11

Mr. Eric Hoogendoorn  
Mason Consolidated School District  
2400 Mason Eagles Drive  
Erie, Michigan 48133  
734-845-9303  
hoogendoorn@eriemason.k12.mi.us

**RE: 2024 AHERA THREE YEAR REINSPECTION**

Dear Mr. Hoogendoorn:

Attached you will find Mason Consolidated School District's Asbestos Hazard Emergency Response Act (AHERA) Three Year Reinspection report. The Reinspection was accomplished by Chad Thomas of DMD Environmental, Inc. (DMD) on July 10, 2024. Mr. Thomas is a Michigan Department of Labor and Economic Opportunity (MDLEO) Asbestos Inspector All damage was reviewed and recommendations provided by Edward Rinckey of DMD. Mr. Rinckey is a MDLEO Asbestos Management Planner. Attached are copies of their certifications.

The reinspection was accomplished in accordance with AHERA, 40 CFR Part 763.85(b). Assessments made were based upon the assessment procedure outlined in the EPA document "Guidance for Controlling Asbestos Containing Materials in Buildings".

This report should be inserted into the management plans in the record keeping section. Only one (1) electronic copy of the report is attached to facilitate updating the Management Plans which are located in the individual school buildings.

We hope this report fulfills your needs. If you have any questions or require further assistance, please contact our office.

Respectfully Submitted,

**DMD Environmental, Inc.**

Chad Thomas  
Project Manager

Attachments  
CT/II  
Mason 3yr 24

# AHERA THREE YEAR REINSPECTION REPORT

Mason Consolidated School District  
Mason High School - Page 1 of 4

Date Performed: July 10, 2024

Performed By: Chad Thomas, DMD Environmental, Inc.

HA No. 01: Hard TSI

Assessment: Good condition with potential for damage  
Areas: Boiler room, Custodial in boiler room, Art room, Room 242, Room 119 closet, Stage

Assessment: Damaged with potential for damage  
Areas: Receiving/maintenance room (mezzanine area), West tunnel, East tunnel, Pool filter room, Industrial arts (back storage)

**Recommendation: Repair with rewettable cloth**

Assessment: Removed  
Areas: Fan room in boys locker room

HA No. 02: Mud packed elbows on hard TSI lines

Assessment: Good condition with potential for damage  
Areas: Boiler room, Industrial arts, Art room, Stage, Room 242, Room 119 closet, Custodial in boiler room

Assessment: Damaged with potential for damage  
Areas: Receiving/maintenance room (mezzanine area), Pool filter room, West tunnel, East tunnel

**Recommendation: Repair with rewettable cloth**

Assessment: Removed  
Areas: Fan room in boys locker room

HA No. 03: Mud packed elbows on fiberglass lines

Assessment: Good condition with potential for damage  
Areas: Receiving/maintenance, Gym, Room 309 - pipe chase

Assessment: Damaged with potential for damage  
Areas: East tunnel, Pool filter room

**Recommendation: Repair with rewettable cloth**

Assessment: Removed  
Areas: Room 216, Pool chemical closet

## AHERA THREE YEAR REINSPECTION REPORT

Mason Consolidated School District  
Mason High School - Page 2 of 4

HA No. 04: Exhaust duct TSI

Assessment: Good condition with potential for damage  
Areas: Each functional area

HA No. 05: South condensation tank TSI

Assessment: Good condition with potential for damage  
Areas: Boiler room

HA No. 08: Brown condensation insulation jacket

Assessment: Damaged with potential for damage  
Areas: Boiler room – north bottom of tank  
**Recommendation: Repair with rewettable cloth**

HA No. 09: Spray-on ceiling

Assessment: Good condition with potential for damage  
Areas: Stage transition to cafeteria, Library (media center)

Assessment: Damaged with potential for damage  
Areas: Planetarium - minor damage at southwest HVAC vent  
**Recommendation: Repair**

Assessment: Removed  
Areas: Cafeteria

HA No. 10: 1' x 1' ceiling tile with big and small holey pattern

Assessment: Good condition with potential for damage  
Areas: Room 113, Room 216, Room 220, Room 237, Room 248, Room 249, Room 250, Room 252, Room 300, Room 303, Room 309, Room 402, Room 404, Room 405, Room 407, Room 408, Room 410, Room 411, Room 413, Room 415, Room 417, Room 420, Room 422, Library offices, Sup. offices, School office, Art room, Planetarium

Assessment: Damaged with potential for damage  
Areas: Room 301 (flag damage), Room 302 (1 tile falling out), Room 304 (flag damage), Room 305 (flag damage), Room 306 (flag damage), Room 409 (flag damage), Room 104 - now 9C (1 minor spot), Music room hall and storage/practice rooms (1 tile falling out),

**Recommendation: Repair, remove, or replace**  
**Note: Mount flags lower to avoid damaging the friable material**

Assessment: Removed  
Areas: Drafting, Coach's office, Hallway from Room 252 to cafe, Hall from cafe to 220, Custodial in boiler room, 400's hall, 300's hall

## AHERA THREE YEAR REINSPECTION REPORT

Mason Consolidated School District  
Mason High School - Page 3 of 4

HA No. 10: 1' x 1' ceiling tile with big and small holey pattern (continued)

HA No. 11: Vinyl floor tile

Assessment: Good condition  
Areas: Room 216, Room 248, Room 250, Room 252, Drafting, Art room, Custodial room, Planetarium, Custodial in boiler room, Library offices, Sup. offices, School office, Printing room, Kitchen office (getting a lot of wear from chair wheels, put a runner under the chair), Receiving/maintenance, Band storage/practice rooms

Assessment: Damaged  
Areas: Coach's office, Room 410/404 prep area (30+ tiles)  
**Recommendation: Remove if possible**

Assessment: Damaged  
Areas: Room 101 (loose, missing tiles at sink base)  
**Recommendation: Reglue/replace**

Assessment: Carpeted  
Areas: Room 239, Library

Assessment: Removed  
Areas: Band/choir, Room 237, Room 103, Room 104 (now 9C), Room 249, Room 300, Room 301, Room 302, Room 303, Room 304, Room 305, Room 306, Room 402, Room 404, Room 405, Room 407, Room 408, Room 409, Room 410, Room 411, Room 413, Room 415, Room 417, Room 420, Room 422, Industrial arts

HA No. 16: Hard gray TSI

Assessment: Good condition with potential for damage  
Areas: Custodial in boiler room, Room 242

HA No. 21: East boiler gasket

Assessment: Removed  
Areas: Boiler room

HA No. 22: Green chalk boards

Assessment: Good condition  
Areas: Room 115, Room 117, Room 252

**AHERA THREE YEAR REINSPECTION REPORT**

Mason Consolidated School District  
Mason High School - Page 4 of 4

HA No. 23: Sink undercoating

Assessment: Good condition  
Areas: Each functional area

HA No. 24: Vent vibrator damper

Assessment: Good condition  
Areas: Room 242, Room 309, Kitchen storage room

HA No. 25: Transite

Assessment: Good condition  
Areas: Room 107 welding (1 sheet remains)

Inspector Signature: 

Management Planner Signature: 

NOTE: The minimum response for each HA is to continue the Operations and Maintenance Program.

# AHERA THREE YEAR REINSPECTION REPORT

Mason Consolidated School District  
Mason Junior High School - Page 1 of 2

Date Performed: July 10, 2024

Performed By: Chad Thomas, DMD Environmental, Inc.

HA No. 01: Hard TSI lines

Assessment: Good condition with potential for damage  
Areas: Gym, Tunnel

Assessment: Damaged with potential for damage  
Areas: Boiler room  
**Recommendation: Repair with rewettable cloth**

Assessment: Removed  
Areas: Room 1, Hallway at Room 1

HA No. 02: Mudpack joints on hard TSI

Assessment: Good condition with potential for damage  
Areas: Gym, Tunnel

Assessment: Damaged with potential for damage  
Areas: Boiler room  
**Recommendation: Repair with rewettable cloth**

Assessment: Removed  
Areas: Room 1, Hallway at Room 1

HA No. 03: Boiler insulation jacket

Assessment: Removed  
Areas: Boiler room

HA No. 04: Condensation tank TSI

Assessment: Good condition with potential for damage  
Areas: Boiler room

HA No. 05: Exhaust duct TSI

Assessment: Removed  
Areas: Boiler room

## AHERA THREE YEAR REINSPECTION REPORT

Mason Consolidated School District  
Mason Junior High School - Page 2 of 2

HA No. 08: Vinyl floor tile

Assessment: Good condition  
Areas: Coach's office, Rooms 8-9 Ball storage (9" x 9"), Room 8, 10-11  
Computer lab (older 1' x 1')

Assessment: Carpeted  
Areas: Office

Assessment: Removed  
Areas: Room 1, Room 2, Room 3, Room 4, Room 5, Room 6, Room 13,  
Room 14, Room 15, Room 16, Custodial closet near Room 6

HA No. 13: Green chalk boards

Assessment: Good condition  
Areas: Room 1, Room 2, Room 3, Room 4, Room 5, Room 6, Room 13,  
Room 14, Room 15, Room 16

HA No. 14: Fire doors

Assessment: Damaged  
Areas: Boiler room  
**Recommendation: Spackle 4 holes outside and 1 large hole inside**

HA No. 15: Vent dampers


Assessment: Damaged  
Areas: Boiler room - torn  
**Recommendation: Replace**

HA No. 25: Transite sheeting


Assessment: Good condition  
Areas: Rooms 1 through 6 in hallway wall

NOTE: Round light fixtures should be assumed to be asbestos containing.

Inspector Signature: \_\_\_\_\_



Management Planner Signature: \_\_\_\_\_

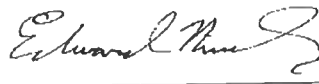

NOTE: The minimum response for each HA is to continue the Operations and Maintenance Program.



# AHERA THREE YEAR REINSPECTION REPORT

Mason Consolidated School District  
Mason Central Elementary School - Page 1 of 4

Date Performed: July 10, 2024

Performed By: Chad Thomas, DMD Environmental, Inc.

HA No. 01: Hard TSI lines

Assessment: Good condition with potential for damage  
Areas: Room 39, Girls restroom next to Room 38, Boys restroom next to Room 40, Room 40, Room 42

Assessment: Inaccessible  
Areas: Above ceilings

Assessment: Damaged with potential for damage  
Areas: Hall from Room 34 to 42 (above ceiling)

**Recommendation: Repair with rewettable cloth**

Assessment: Damaged with potential for damage  
Areas: Room 35

**Recommendation: Minor damage, 2 small repairs**

Assessment: Removed  
Areas: Hall between rooms 6 and 7, Hall between Room 16 and 17, Hallway at Room 37, Hallway at Room 39, Hallway at Room 41, Hallway at Room 42, Boiler room, Hallway at Room 36

HA No. 02: Mud packed joints on hard TSI

Assessment: Good condition with potential for damage  
Areas: Girls restroom next to Room 38, Boys restroom next to Room 40, Room 35

Assessment: Inaccessible  
Areas: Above ceilings

Assessment: Damaged with potential for damage  
Areas: Hall from Room 34 to 42 (above ceiling), Room 39

**Recommendation: Repair with rewettable cloth**

Assessment: Removed  
Areas: Hall between Rooms 6 and 7, Hall between Room 16 and 17, Hallway at Room 37, Hallway at Room 39, Hallway at Room 41, Hallway at Room 42, Boiler room, Hallway at Room 36

# AMERA THREE YEAR REINSPECTION REPORT

Mason Consolidated School District  
Mason Central Elementary School - Page 2 of 4

HA No. 03: Corrugated TSI

Assessment: Good condition with potential for damage  
Areas: Room 15, Room 25, Room 35

Assessment: Inaccessible  
Areas: Above ceilings

Assessment: Damaged with potential for damage  
Areas: Hall from Room 34 to 42 (above ceiling)  
**Recommendation: Repair with rewettable cloth**

Assessment: Removed  
Areas: Boiler room, Hall between Rooms 6 and 7, Hall between Room 16 and 17

HA No. 04: Mud packed joints on corrugated TSI

Assessment: Good condition with potential for damage  
Areas: Room 15, Room 25, Room 35

Assessment: Inaccessible  
Areas: Above ceilings

Assessment: Damaged with potential for damage  
Areas: Hall from Room 34 to 42 (above ceiling), Room 23 (above hatch)  
**Recommendation: Repair with rewettable cloth**

Assessment: Removed  
Areas: Boiler room, Hall between rooms 6 and 7, Hall between Room 16 and 17

HA No. 05: Boiler jacket insulation

Assessment: Removed  
Areas: Boiler room

HA No. 06: Condensation tank TSI

Assessment: Removed  
Areas: Boiler room

# AHERA THREE YEAR REINSPECTION REPORT

Mason Consolidated School District  
Mason Central Elementary School - Page 3 of 4

HA No. 07: Exhaust duct TSI

Assessment: Removed  
Areas: Boiler room

HA No. 09: Vinyl floor tile

Assessment: Good condition  
Areas: Room 4, Room 16 closet, Room 25

Assessment: Carpeted  
Areas: Room 1, Room 2, Room 11, Room 22, Room 24, Room 39

Assessment: Removed  
Areas: Room 17, Room 18, Room 19, Room 20, Room 21, Room 27, Room 26, Room 34, Hall between rooms 24 and 28, Room 6 closet, Room 7 closet, Room 8 closet, Room 9 closet, Room 23, Room 28, Room 29, Room 30, Room 31, Room 32, Room 33, Hallway between rooms 6 and 16, Hall between rooms 36 and 42, Room 36, Room 37, Room 38, Room 40, Room 41, Room 42, Cafeteria, Room 12, Room 13, Room 3, Room 5, Room 10

HA No. 16: Mud pack elbows on fiberglass line TSI

Assessment: Good condition with potential for damage  
Areas: Pipe chase in Room 39

Assessment: Inaccessible  
Areas: Above ceilings throughout new wing

HA No. 17: Mud pack joints on hard white TSI line

Assessment: Good condition with potential for damage  
Areas: Above ceilings throughout new wing

HA No. 19: Water tank TSI

Assessment: Removed  
Areas: Room 35

**AHERA THREE YEAR REINSPECTION REPORT**

Mason Consolidated School District  
Mason Central Elementary School - Page 4 of 4

HA No. 21: Vent dampers

Assessment: Good condition  
Areas: Room 25

Assessment: Removed  
Areas: Boiler room

HA No. 22: Sink insulation

Assessment: Good condition  
Areas: Room 6, Room 7, Room 8, Room 9, Room 11, Room 16, Room 17, Room 18, Room 19, Room 20, Room 21, Room 28, Room 29, Room 30, Room 31, Room 32, Room 33

HA No. 23: Green chalk boards

Assessment: Good condition  
Areas: Room 6, Room 7, Room 8, Room 9, Room 16, Room 17, Room 18, Room 19, Room 20, Room 21, Room 28, Room 29, Room 30, Room 31, Room 32, Room 33

NOTE: Round light fixtures in supply closets should be assumed to be asbestos containing.

Inspector Signature: 

Management Planner Signature: 

NOTE: The minimum response for each HA is to continue the Operations and Maintenance Program.

# REMAINING ASBESTOS CONTAINING BUILDING MATERIALS

Revised July 10, 2024

Mason Consolidated School District  
Mason High School - Page 1 of 2  
(Delete Previous Edition)

HIA No. 01: Hard TSI

Areas containing ACBM: Boiler room, Custodial in boiler room, Art room, Room 242, Room 119 closet, Stage, Receiving/maintenance room (mezzanine area), West tunnel, East tunnel, Pool filter room, Industrial arts (back storage)

HA No. 02: Mud packed elbows on hard TSI lines

Areas containing ACBM: Boiler room, Industrial arts, Art room, Stage, Room 242, Room 119 closet, Custodial in boiler room, Receiving/maintenance room (mezzanine area), Pool filter room, West tunnel, East tunnel

HA No. 03: Mud packed elbows on fiberglass lines

Areas containing ACBM: Receiving/maintenance, Gym, Room 309 - pipe chase, East tunnel, Pool filter room

HA No. 04: Exhaust duct TSI

Areas containing ACBM: Each functional area

HA No. 05: South condensation tank TSI

Areas containing ACBM: Boiler room

HA No. 08: Brown condensation insulation jacket

Areas containing ACBM: Boiler room

HA No. 09: Spray-on ceiling

Areas containing ACBM: Planetarium, Stage transition to cafeteria, Library (media center)

# REMAINING ASBESTOS CONTAINING BUILDING MATERIALS

Revised July 10, 2024

Mason Consolidated School District  
Mason High School - Page 2 of 2

(Delete Previous Edition)

HA No. 10: 1' x 1' ceiling tile with big and small holey pattern

Areas containing ACBM: Room 113, Room 216, Room 220, Room 237, Room 248, Room 249, Room 250, Room 252, Room 300, Room 303, Room 309, Room 402, Room 404, Room 405, Room 407, Room 408, Room 410, Room 411, Room 413, Room 415, Room 417, Room 420, Room 422, Library offices, Sup. offices, School office, Art room, Planetarium, Music room hall and storage/practice rooms, Room 301, Room 302, Room 304, Room 305, Room 306, Room 409, Room 104 - now 9C

HA No. 11: Vinyl floor tile

Areas containing ACBM: Room 216, Room 248, Room 250, Room 252, Drafting, Art room, Custodial room, Planetarium, Custodial in boiler room, Library offices, Sup. offices, School office, Printing room, Kitchen office, Receiving/maintenance, Coach's office, Room 410/404 prep area, Room 239, Library, Band storage/practice rooms, Room 101

HA No. 16: Hard gray TSI

Areas containing ACBM: Custodial in boiler room, Room 242

HA No. 22: Green chalk boards

Areas containing ACBM: Room 115, Room 117, Room 252

HA No. 23: Sink undercoating

Areas containing ACBM: Each functional area

HA No. 24: Vent vibrator damper

Areas containing ACBM: Room 242, Room 309, Kitchen storage room

HA No. 25: Transite

Areas containing ACBM: Room 107 welding

## REMAINING ASBESTOS CONTAINING BUILDING MATERIALS

Revised July 10, 2024

Mason Consolidated School District  
Mason Junior High School - Page 1 of 1  
(Delete Previous Edition)

- HA No. 01: Hard TSI lines  
Areas containing ACBM: Gym, Tunnel, Boiler room
- HA No. 02: Mudpack joints on hard TSI  
Areas containing ACBM: Gym, Tunnel, Boiler room
- HA No. 04: Condensation tank TSI  
Areas containing ACBM: Boiler room
- HA No. 08: Vinyl floor tile  
Areas containing ACBM: Coach's office, Rooms 8-9 Ball storage, Room 8, 10-11  
Computer lab, Office
- HA No. 13: Green chalk boards  
Areas containing ACBM: Room 1, Room 2, Room 3, Room 4, Room 5, Room 6, Room  
13, Room 14, Room 15, Room 16
- HA No. 14: Fire doors  
Areas containing ACBM: Boiler room
- HA No. 15: Vent dampers  
Areas containing ACBM: Boiler room
- HA No. 25: Transite sheeting  
Areas containing ACBM: Rooms 1 through 6 in hallway wall

Round light fixtures should be assumed to be asbestos containing.

## REMAINING ASBESTOS CONTAINING BUILDING MATERIALS

Revised July 10, 2024

Mason Consolidated School District  
Mason Central Elementary School - Page 1 of 2  
(Delete Previous Edition)

HA No. 01: Hard TSI lines

Areas containing ACBM: Room 39, Girls restroom next to Room 38, Boys restroom next to Room 40, Room 40, Room 42, Above ceilings - inaccessible, Hall from Room 34 to 42 (above ceiling), Room 35

HA No. 02: Mud packed joints on hard TSI

Areas containing ACBM: Girls restroom next to Room 38, Boys restroom next to Room 40, Room 35, Above ceilings - inaccessible, Hall from Room 34 to 42 (above ceiling), Room 39

HA No. 03: Corrugated TSI

Areas containing ACBM: Room 15, Room 25, Room 35, Above ceilings - inaccessible, Hall from Room 34 to 42 (above ceiling)

HA No. 04: Mud packed joints on corrugated TSI

Areas containing ACBM: Room 15, Room 25, Room 35, Above ceilings - inaccessible, Hall from Room 34 to 42 (above ceiling), Room 23 (above hatch)

HA No. 09: Vinyl floor tile

Areas containing ACBM: Room 4, Room 16 closet, Room 25, Room 1, Room 2, Room 11, Room 22, Room 24, Room 39

HA No. 16: Mud pack elbows on fiberglass line TSI

Areas containing ACBM: Pipe chase in Room 39, Above ceilings throughout new wing - inaccessible

HA No. 17: Mud pack joints on hard white TSI line

Areas containing ACBM: Above ceilings throughout new wing

HA No. 21: Vent dampers

Areas containing ACBM: Room 25



**REMAINING ASBESTOS CONTAINING BUILDING MATERIALS**

Revised July 10, 2024

Mason Consolidated School District  
Mason Central Elementary School - Page 2 of 2  
(Delete Previous Edition)

HA No. 22: Sink insulation

Areas containing ACBM: Room 6, Room 7, Room 8, Room 9, Room 11, Room 16,  
Room 17, Room 18, Room 19, Room 20, Room 21, Room 28,  
Room 29, Room 30, Room 31, Room 32, Room 33

HA No. 23: Green chalk boards

Areas containing ACBM: Room 6, Room 7, Room 8, Room 9, Room 16, Room 17,  
Room 18, Room 19, Room 20, Room 21, Room 28, Room 29,  
Room 30, Room 31, Room 32, Room 33

Round light fixtures in supply closets should be assumed to be asbestos containing.

# PERIODIC SURVEILLANCE

Mason Consolidated School District

Mason High School - Page 1 of 3

Date Performed: \_\_\_\_\_

Performed By: \_\_\_\_\_

HA No. 01: Hard TSI

Areas: Boiler room, Custodial in boiler room, Art room, Room 242, Room 119 closet, Stage, Receiving/maintenance room (mezzanine area), West tunnel, East tunnel, Pool filter room, Industrial arts (back storage)

HA No. 02: Mud packed elbows on hard TSI lines

Areas: Boiler room, Industrial arts, Art room, Stage, Room 242, Room 119 closet, Custodial in boiler room, Receiving/maintenance room (mezzanine area), Pool filter room, West tunnel, East tunnel

HA No. 03: Mud packed elbows on fiberglass lines

Areas: Receiving/maintenance, Gym, Room 309 - pipe chase, East tunnel, Pool filter room

HA No. 04: Exhaust duct TSI

Areas: Each functional area

HA No. 05: South condensation tank TSI

Areas: Boiler room

HA No. 08: Brown condensation insulation jacket

Areas: Boiler room

HA No. 09: Spray-on ceiling

Areas: Planetarium, Stage transition to cafeteria, Library (media center)

Are all above materials in good condition? \_\_\_\_\_

List any damage noted: \_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

# PERIODIC SURVEILLANCE

Mason Consolidated School District

Mason High School - Page 2 of 2

Date Performed: \_\_\_\_\_

Performed By: \_\_\_\_\_

HA No. 10: 1' x 1' ceiling tile with big and small holey pattern

Areas: Room 113, Room 216, Room 220, Room 237, Room 248, Room 249, Room 250, Room 252, Room 300, Room 303, Room 309, Room 402, Room 404, Room 405, Room 407, Room 408, Room 410, Room 411, Room 413, Room 415, Room 417, Room 420, Room 422, Library offices, Sup. offices, School office, Art room, Planetarium, Music room hall and storage/practice rooms, Room 301, Room 302, Room 304, Room 305, Room 306, Room 409, Room 104 - now 9C

HA No. 11: Vinyl floor tile

Areas: Room 216, Room 248, Room 250, Room 252, Drafting, Art room, Custodial room, Planetarium, Custodial in boiler room, Library offices, Sup. offices, School office, Printing room, Kitchen office, Receiving/maintenance, Coach's office, Room 410/404 prep area, Room 239, Library, Band storage/practice rooms, Room 101

HA No. 16: Hard gray TSI

Areas: Custodial in boiler room, Room 242

HA No. 22: Green chalk boards

Areas: Room 115, Room 117, Room 252

HA No. 23: Sink undercoating

Areas: Each functional area

HA No. 24: Vent vibrator damper

Areas: Room 242, Room 309, Kitchen storage room

HA No. 25: Transite

Areas: Room 107 welding

Are all above materials in good condition? \_\_\_\_\_

List any damage noted: \_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

# PERIODIC SURVEILLANCE

Mason Consolidated School District  
Mason Junior High School - Page 1 of 1

Date Performed: \_\_\_\_\_

Performed By: \_\_\_\_\_

HA No. 01: Hard TSI lines

Areas: Gym, Tunnel, Boiler room

HA No. 02: Mudpack joints on hard TSI

Areas: Gym, Tunnel, Boiler room

HA No. 04: Condensation tank TSI

Areas: Boiler room

HA No. 08: Vinyl floor tile

Areas: Coach's office, Rooms 8-9 Ball storage, Room 8, 10-11 Computer lab, Office

HA No. 13: Green chalk boards

Areas: Room 1, Room 2, Room 3, Room 4, Room 5, Room 6, Room 13, Room 14, Room 15, Room 16

HA No. 14: Fire doors

Areas: Boiler room

HA No. 15: Vent dampers

Areas: Boiler room

HA No. 25: Transite sheeting

Areas: Rooms 1 through 6 in hallway wall

Round light fixtures should be assumed to be asbestos containing.

Are all above materials in good condition? \_\_\_\_\_

List any damage noted: \_\_\_\_\_

\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

**PERIODIC SURVEILLANCE**  
Mason Consolidated School District  
Mason Central Elementary School - Page 1 of 2

Date Performed: \_\_\_\_\_

Performed By: \_\_\_\_\_

HA No. 01: Hard TSI lines

Areas: Room 39, Girls restroom next to Room 38, Boys restroom next to Room 40, Room 40, Room 42, Above ceilings - inaccessible, Hall from Room 34 to 42 (above ceiling), Room 35

HA No. 02: Mud packed joints on hard TSI

Areas: Girls restroom next to Room 38, Boys restroom next to Room 40, Room 35, Above ceilings - inaccessible, Hall from Room 34 to 42 (above ceiling), Room 39

HA No. 03: Corrugated TSI

Areas: Room 15, Room 25, Room 35, Above ceilings - inaccessible, Hall from Room 34 to 42 (above ceiling)

HA No. 04: Mud packed joints on corrugated TSI

Areas: Room 15, Room 25, Room 35, Above ceilings - inaccessible, Hall from Room 34 to 42 (above ceiling), Room 23 (above hatch)

HA No. 09: Vinyl floor tile

Areas: Room 4, Room 16 closet, Room 25, Room 1, Room 2, Room 11, Room 22, Room 24, Room 39

HA No. 16: Mud pack elbows on fiberglass line TSI

Areas: Pipe chase in Room 39, Above ceilings throughout new wing – inaccessible

HA No. 17: Mud pack joints on hard white TSI line

Areas: Above ceilings throughout new wing

Are all above materials in good condition? \_\_\_\_\_

List any damage noted: \_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

**PERIODIC SURVEILLANCE**  
Mason Consolidated School District  
Mason Central Elementary School - Page 2 of 2

Date Performed: \_\_\_\_\_

Performed By: \_\_\_\_\_

HA No. 21: Vent dampers

Areas: Room 25

HA No. 22: Sink insulation

Areas: Room 6, Room 7, Room 8, Room 9, Room 11, Room 16, Room 17, Room 18, Room 19, Room 20, Room 21, Room 28, Room 29, Room 30, Room 31, Room 32, Room 33

HA No. 23: Green chalk boards

Areas: Room 6, Room 7, Room 8, Room 9, Room 16, Room 17, Room 18, Room 19, Room 20, Room 21, Room 28, Room 29, Room 30, Room 31, Room 32, Room 33

Round light fixtures in supply closets should be assumed to be asbestos containing.

Are all above materials in good condition? \_\_\_\_\_

List any damage noted: \_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

*State of Michigan*  
Department of Labor and Economic Opportunity  
Michigan Occupational Safety & Health Administration - Asbestos Program

Asbestos Inspector

**Chad M. Thomas**  
7156 Jackman Road  
Temperance, MI 48182



**Accreditation Number**  
A33073

**Expiration Date**  
12/30/2024

**DOB: 09/04/1972**

This individual has satisfactorily met or exceeded the requirements of Michigan Public Act 440 of 1986, as amended, to be accredited as an Asbestos Inspector.

*State of Michigan*  
Department of Labor and Economic Opportunity  
Michigan Occupational Safety & Health Administration - Asbestos Program

Asbestos Contractor/Supervisor

**Chad M. Thomas**  
7156 Jackman Road  
Temperance, MI 48182



**Accreditation Number**  
A33073

**Expiration Date**  
12/30/2024

**DOB: 09/04/1972**

This individual has satisfactorily met or exceeded the requirements of Section 206 of the Toxic Substances Control Act to be accredited in the above discipline.

163942

**Edward A. Rinckey**  
3366 Jerome Street  
Temperance, MI 48182



Accreditation Number      Expiration Date

DOB: 01/02/1963

This individual has satisfactorily met or exceeded the requirements of Michigan Public Act 440 of 1938, as amended, to be accredited as an Asbestos Inspector.

**Edward A. Rinckey**  
3366 Jerome Street  
Temperance, MI 48182



Accreditation Number      Expiration Date

DOB: 01/02/1963

This individual has satisfactorily met or exceeded the requirements of Section 208 of the Toxic Substances Control Act to be accredited in the above discipline.

**Edward A. Rinckey**  
3366 Jerome Street  
Temperance, MI 48182



Accreditation Number      Expiration Date

DOB: 01/02/1963

This individual has satisfactorily met or exceeded the requirements of Section 208 of the Toxic Substances Control Act to be accredited in the above discipline.

*State of Michigan*

Department of Labor and Economic Opportunity  
Michigan Occupational Safety & Health Administration - Asbestos Program

**Asbestos Project Designer**

**Edward A. Rinckey**  
3366 Jerome Street  
Temperance, MI 48182



Accreditation Number      Expiration Date  
**A1231**                      **02/15/2025**

DOB: 01/02/1963

This individual has satisfactorily met or exceeded the requirements of Section 208 of the Toxic Substances Control Act to be accredited in the above discipline.

163933