

#### ALL STAR HOME INSPECTION SERVICES, LLC +1 (305) 849-4284 allstarhomeinspectionsfl@gmail.com https://allstarhomeinspect.com/



### CONDOMINIUM INSPECTION

#### 19655 E Country Club Dr 6204 Aventura, FL 33180

Ricardo Rojas JUNE 28, 2023



Inspector Nelson Figueroa

Nelson M Figueroa Certified Professional Inspector 305-849-4284 allstarhomeinspectionsfl@gmail.com



Agent Walter Meloni Beachfront Realty INC. 305-904-5971 waltermelonirealtor@gmail.com

## TABLE OF CONTENTS

| 1: INSPECTION DETAILS               | 4  |
|-------------------------------------|----|
| 2: ELEVATION PHOTOS                 | 6  |
| 3: BUILDFAX                         | 7  |
| 4: THERMAL IMAGING                  | 8  |
| 5: EXTERIOR                         | 11 |
| 6: ROOF                             | 14 |
| 7: ELECTRICAL                       | 16 |
| 8: HVAC                             | 18 |
| 9: WATER HEATER                     | 21 |
| 10: PLUMBING AND LAUNDRY            | 23 |
| 11: BATHROOMS                       | 25 |
| 12: INTERIOR ROOMS                  | 31 |
| 13: KITCHEN                         | 36 |
| 14: RECOMMENDATIONS AND DISCLAIMERS | 39 |
| Standard of Practice                | 42 |
|                                     |    |

## SUMMARY







| 5.2.1 EXTERIOR - LIMITATIONS: Townhouse or Condominium  |
|---|
| ⊖ 5.5.1 EXTERIOR - DOORS/ WINDOWS: Doors - Lock Sets Damaged or Incorrectly Installed           |
| 5.5.2 EXTERIOR - DOORS/ WINDOWS: Windows - Screens Damage Holes and/ or Tears                   |
| 6.2.1 ROOF - LIMITATIONS: Condominium/Townhouse   |
| ○ 8.2.1 HVAC - LIMITATIONS: No Access to Roof for A/C Condenser Inspection                      |
| 8.5.1 HVAC - DUCTS/ FILTERS: Filter - Maintain in Future  |
| ⊖9.5.1 WATER HEATER - WATER HEATER: Age - At 8-12 Years   |
| 9.6.1 WATER HEATER - WATER TEMPERATURE: Water Temperature                                       |
| \ominus 10.6.1 PLUMBING AND LAUNDRY - WASHER/ DRYER: Dryer - Exhaust Duct Plastic or Foil       |
| 11.2.1 BATHROOMS - BATHTUBS/ SHOWERS: Exhaust Fan - None with Shower                            |
| O 11.2.2 BATHROOMS - BATHTUBS/ SHOWERS: Faucet - Leaks When On                                  |
| O 11.3.1 BATHROOMS - TOILETS: Loose   |
| 11.3.2 BATHROOMS - TOILETS: Caulking Deteriorated   |
| 11.4.1 BATHROOMS - VANITIES/ SINKS: Countertops - Need Caulk at Backsplash                      |
| O 11.4.2 BATHROOMS - VANITIES/ SINKS: Cabinets - Deteriorated                                   |
| ○ 11.4.3 BATHROOMS - VANITIES/ SINKS: Plumbing - Leak in Drain Line                             |
| 11.5.1 BATHROOMS - ELECTRICAL: Lighting - Inoperable  |
| 11.6.1 BATHROOMS - CEILINGS/ FLOORS/ WALLS: Floor - Tiles - Damaged, Cracked, and/or Loose      |
| 12.1.1 INTERIOR ROOMS - LIMITATIONS: Some Areas Inaccessible or Obscured                        |
| O 12.4.1 INTERIOR ROOMS - ELECTRICAL: Cover Plates - Missing                                    |
| 12.5.1 INTERIOR ROOMS - CEILINGS/ FLOORS/ WALLS: Ceilings/Walls - Cracks - Minor/Moderate       |
| O 12.5.2 INTERIOR ROOMS - CEILINGS/ FLOORS/ WALLS: Ceilings/Walls - Damage - Moderate           |
| O 12.5.3 INTERIOR ROOMS - CEILINGS/ FLOORS/ WALLS: Floor - Vinyl/Laminate Flooring Deteriorated |
| 😑 13.4.1 KITCHEN - APPLIANCES: Garbage Disposal - Noisy   |
| O 13.5.1 KITCHEN - COUNTER TOPS AND CABINETS: Cabinets - Deteriorated                           |
|   |

### 1: INSPECTION DETAILS

#### Information

| GENERAL INFORMATION: 1. TYPE<br>OF BUILDING<br>Condominium                          | GENERAL INFORMATION: 2. YEAR<br>BUILT<br>Unknown  | GENERAL INFORMATION: 3.<br>FRONT OF STRUCTURE FACES<br>West        |
|---|---|--|
| GENERAL INFORMATION: 4. MAIN<br>ENTRYWAY FACES<br>West                              | GENERAL INFORMATION: 5.<br>OCCUPANCY STATUS AT TIME OF<br>INSPECTION<br>Furniture Present | GENERAL INFORMATION: 6. IN<br>ATTENDANCE<br>Client, Client's Agent |
| GENERAL INFORMATION: 7.<br>ACTUAL START TIME<br>2:45 PM<br>GENERAL INFORMATION: 10. | GENERAL INFORMATION: 8.<br>WEATHER CONDITIONS<br>Partly cloudy, Humid                     | GENERAL INFORMATION: 9.<br>CLIMATIC CONDITIONS<br>Hot              |

GROUND CONDITION

Dry

#### PLEASE READ: BACK UP PHOTOS AND VIDEOS

As you read this report, we have included backup photos/videos that are located in the "LIMITATIONS" tab of each section. This area shows items of interest, like the roof, attic, crawl space, systems operating, etc.

In order to keep the report clean, we've added these items under the tab labeled LIMITATIONS. These verifications are not actual LIMITATIONS, but we are unable to change the heading label at this time.

The goal of the backup photo/videos are intended to give the client/homebuyer more insight into the items inspected during the All Star Inspection of their new home. The photos and videos in these sections are intended to supplement and are not exhaustive, nor do they represent the full extent of the inspection.

#### **PLEASE READ: REPAIR COST ESTIMATES**

Repair cost estimates are provided as a courtesy 'ballpark' range only and are not meant as a replacement for actual contractor estimates. All Star Inspections is a generalist inspection company and not a licensed contractor, therefore cost estimates may not always align with current contractor estimates. Cost estimate ranges can include DIY/Handyman repair costs, all the way up to licensed contractor replacement costs. The estimates do not include any unforeseen damage that may be a result of other repairs. The range is an attempt to provide a min/max price range, but is not a hard limit on either end. The size, age or other factors of the home could cause the min/max values to be breached and should not be used to calculate worst-case scenarios.

All Star Inspections assumes no responsibility for the accuracy of the repair cost estimates and encourages every client to obtain several actual repair estimates, from qualified contractors, prior to inspection deadlines and/or closing.

#### PLEASE READ: RENOVATIONS - CONTRACTORS - TRADES

It's possible and perhaps even likely that you may have renovations or work performed by a licensed tradesperson or a contractor after the purchase of your new home. Sometimes, after the inspection, these trades and contractors like to say that inspectors missed many things. Inspectors, while human, usually did not, These trades and contractors are not familiar with what a home inspection is. The trades and contractors experience with inspections are based on their work, which are inspections performed by city and county code inspectors to ensure that their work is performed up to current building codes and standards. <u>A home inspection is not a code inspection</u>. Many homes purchased are older and built under different codes and rules. And that's ok. A house doesn't arbitrarily need to be brought up to any current code without cause, like new renovations or permits for new work. There is nothing about the transfer of ownership of a property that says anything about a house needing to be brought up to current building codes. Current building codes are for current building and renovations, not for the purchase of a home. Home inspector can actually be fined by local municipalities for talking about code requirements without being an actual code inspector for the municipality. The purpose of the home inspection is to ensure the client does not inherit problems that are currently present when making a home purchase.

If you plan on making renovations and/or having significant work performed after the purchase it would be smart to bring that specialized expert in to give some insight on the local municipality requirements you will be required to follow during your work and renovations since that is not the role of a home inspection

#### **DISCLAIMER:** LIMITATIONS = SYSTEMS VERIFICATION

As you read this report, we have included a SYSTEMS VERIFICATION with pertinent sections. This is a video or a picture that shows items of interest, like the roof, attic, crawl space, systems operating, etcln order to keep the report clean, weve added these items under the tab labeled LIMITATIONS. These VERIFICATIONS are not LIMITATIONS, but we are unable to change this heading label. The goal of the SYSTEMS VERIFICATIONS section are intended to give the client/homebuyer more insight into the items inspected during the All Star inspection of their new home. The photos and videos in these sections are intended to supplement and are not exhaustive, nor do they represent the full extent of the inspection.

#### **DISCLAIMER:** DISCLAIMER - REPAIR COST ESTIMATES

Repair cost estimates are provided as a courtesy 'ballpark' range only and are not meant as a replacement for actual contractor estimates. All Star Inspections is a generalist inspection company and not a licensed contractor, therefore cost estimates may not always align with current contractor estimates. Cost estimate ranges can include DIY/Handyman repair costs, all the way up to licensed contractor replacement costs. The estimates do not include any unforeseen damage that may be a result of other repairs. The range is an attempt to provide a min/max price range, but is not a hard limit on either end. The size, age or other factors of the home could cause the min/max values to be breached and should not be used to calculate worst-case scenarios. All Star Inspections assumes no responsibility for the accuracy of the repair cost estimates and encourages every client to obtain several actual repair estimates, from qualified contractors, prior to inspection deadlines and/or closing.

## 2: ELEVATION PHOTOS

#### Information

#### **ELEVATION PHOTOS:** photos





### 3: BUILDFAX

#### Information

#### **BUILDFAX: 1. What is BuildFax?**

BuildFax is a 3rd party information source for your home. Buildfax is a company that collects and organizes construction records on over 70 million properties across the United States. They collect data on new construction, major system repairs, additions, renovations, roofs, pools, demolitions, contractors and more. Think - Carfax, but for your house. While this information is considered accurate, it is possible that it may not be complete from time to time. Many cities have older property records that are not available online and only accessible by calling/visiting your local building dept. Consider this one of the potential resources to learn as much as possible about your future home.

#### **BUILDFAX: No Permit History Available**

This property does not have any historical permit information available online or through the BuildFax service. Some reasons this may occur are:The property is new and no records are available online yetThere have not been any permits issued for this property during the period in which the city/county provides information onlineIf this is a Condo there may be too many permits and the system cannot handle the volume.If this is a new build, which replaced another property with the same address, the permit history is irrelevant and intentionally omitted from this report.Some cities/counties will conduct a historical permit search for a fee. Client may wish to contact the city building department to see if this is an option.

## 4: THERMAL IMAGING

#### Information

78.2

#### **THERMAL:** 1. What is Thermal Imaging?


All objects emit infrared energy (heat) as a function of their temperature. The infrared energy emitted by an object is known as its heat signature. In general, the hotter an object is, the more radiation it emits. A thermal imager (also known as a thermal camera) is essentially a heat sensor that is capable of detecting tiny differences in temperature. The device collects the infrared radiation from objects in the scene and creates an electronic image based on information about the temperature differences. Because objects are rarely precisely the same temperature as other objects around them, a thermal camera can detect them and they will appear as distinct in a thermal image.


#### **THERMAL: 3. Interior Images**

The following thermal images were collected during the thermal image inspection of the indoors. No anomalies were identified in these images. Images with anomalies (if any) will be under the appropriate defect section of the report.



#### THERMAL: 4. Backup Thermal Images

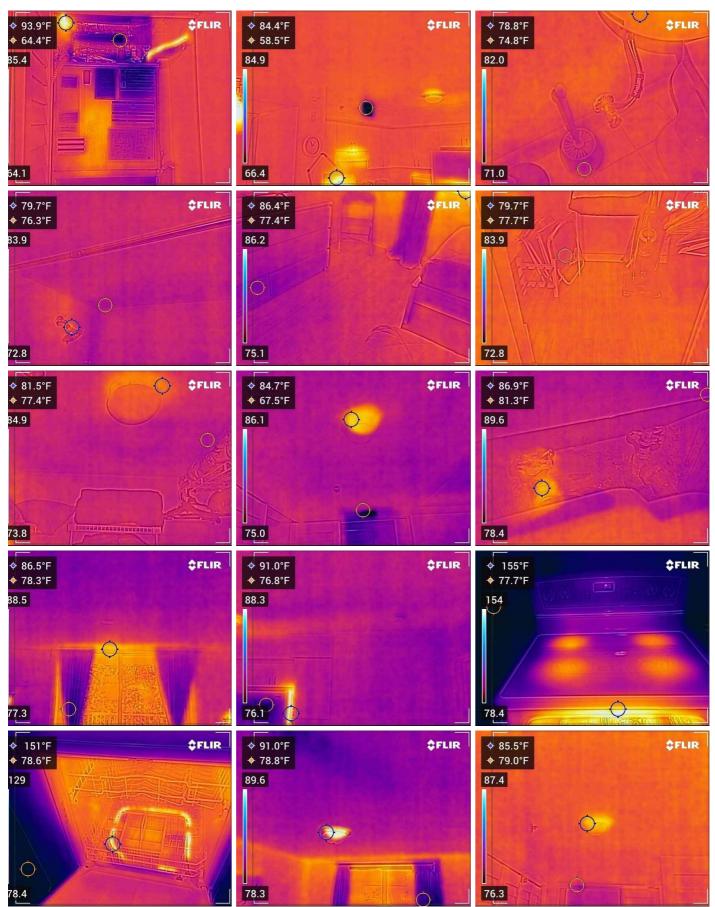

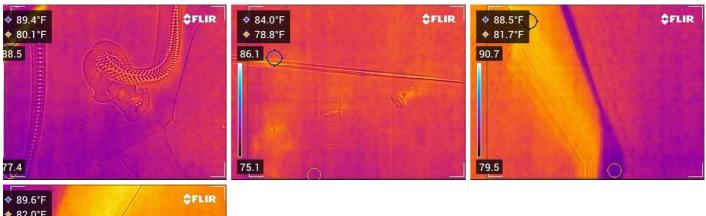



## **5: EXTERIOR**

#### Information

**GENERAL INFORMATION: 1.** FOUNDATION MATERIAL Poured in Place Concrete

**GENERAL INFORMATION: 2.** FOUNDATION Slab on Grade

**GENERAL INFORMATION: 4. WALL GENERAL INFORMATION: 5.** COVERING Stucco

**DRIVEWAY MATERIAL** Asphalt

**GENERAL INFORMATION: 3. APPARENT WALL STRUCTURE** Concrete Block

**GENERAL INFORMATION: 6. WALKWAYS** Concrete (Poured in Place)

**GENERAL INFORMATION: 7. FRONT ENTRYWAY TYPE** Solid Core Steel

#### Limitations

SYSTEM VERIFICATION **ENTRY DOOR** 



SYSTEM VERIFICATION **EXTERIOR** 



## SYSTEM VERIFICATION **ADDRESS**



#### SYSTEM VERIFICATION

#### WM OPENING PROTECTION RATING

X - One or more Glazed with No Protection

#### SYSTEM VERIFICATION

WM PHOTOS



#### **Observations**

#### 5.2.1 LIMITATIONS

#### **TOWNHOUSE OR CONDOMINIUM**

Because the property is a townhouse or condominium, some of the exterior building structure components are not evaluated by the inspector. The Condo Association or HOA is responsible for the maintenance and upkeep of the building structure. The building may be subject to periodic code inspections by the city and/or insurance company.

Maintenance Item

5.5.1 DOORS/ WINDOWS

WEST

#### 5.5.2 DOORS/ WINDOWS


#### WINDOWS - SCREENS DAMAGE HOLES AND/ OR TEARS

EAST

Screen(s) in windows are damaged, torn, or have holes in them. Screens should be replaced where necessary.

#### Recommendation

Contact a handyman or DIY project

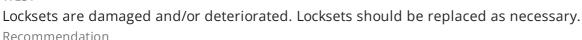


**DOORS - LOCK SETS DAMAGED OR INCORRECTLY INSTALLED** 

Recommendation Contact a handyman or DIY project Estimated Cost \$150 - \$200







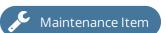

### 6: ROOF

#### Information

#### **GENERAL INFORMATION: 1.**

INSPECTION METHOD Not Inspected

# GENERAL INFORMATION: 2. ROOFGENERAL INFORMATION: 3. ROOFSTYLE/ TYPECOVERINGFlatFlat- Built Up or Rolled

GENERAL INFORMATION: 4. ESTIMATED YEAR OF INSTALLATION

2010

#### GENERAL INFORMATION: 5. GUTTER AND DOWNSPOUT MATERIAL Unable to Determine

#### **GENERAL INFORMATION: 7. WE ARE NOT ROOFING CONTRACTORS**

We are not licensed roofing contractors. Feel free to hire one prior to closing. We do our best to inspection the roof system within the time allotted. We inspect the roof covering, drainage system, the flashings, the skylights, and other installed accessories. We are not required to inspect antennae, interiors of flues or chimneys which are not readily accessible. This is not an exhaustive inspection of every installation detail of the roofing system according to manufacturers specification and local building codes.

#### Limitations

SYSTEM VERIFICATION

#### ROOF





#### **Observations**

## 6.2.1 LIMITATIONS CONDOMINIUM/TOWNHOUSE



Because the property is a condominium/townhouse, much of the roof structure components are not evaluated by the inspector. The Condo Association or HOA is responsible for the maintenance and upkeep of the roof structure. The building may also be subject to periodic code inspections by the city and/or insurance company. Recommend checking with Association to determine if funds are available for repairs, maintenance and/or replacement.

## 7: ELECTRICAL

#### Information

| GENERAL INFORMATION: 1.<br>LOCATION OF SERVICE PANEL<br>Condo Assoc. Locked Meter Room                     | GENERAL INFORMATION: 2.<br>SERVICE TYPE<br>Underground                          | <b>GENERAL INFORMATION: 3.</b><br><b>VOLTAGE</b><br>Unable to Confirm   |
|--|---|---|
| GENERAL INFORMATION: 4.<br>SERVICE PANEL AMPERAGE<br>(AMPS)<br>Unable to Determine                         | GENERAL INFORMATION: 5. MAIN<br>DISCONNECT RATING (AMPS)<br>Unable to Determine | <b>GENERAL INFORMATION: 6.</b><br><b>PROTECTION</b><br>Unable to Confirm  |
| GENERAL INFORMATION: 7.<br>LOCATION OF MAIN DISCONNECT<br>IN SERVICE PANEL<br>Unable to Determine          | <b>GENERAL INFORMATION: 8.</b><br><b>GROUNDING TYPE</b><br>Not Visible          | GENERAL INFORMATION: 9.<br>SERVICE ENTRANCE CONDUCTOR<br>MATERIAL (MAIN PANEL)<br>Not Visible/ Unable to Determine      |
| GENERAL INFORMATION: 10.<br>BRANCH CIRCUIT WIRING TYPE<br>(MAIN PANEL)<br>Not Visible/ Unable to Determine | GENERAL INFORMATION: 11.<br>LOCATION OF SUB-PANEL<br>Hallway                    | GENERAL INFORMATION: 12.<br>SERVICE ENTRANCE CONDUCTOR<br>MATERIAL (SUB-PANEL)<br>Aluminum Multi Strand (No<br>Problem) |
| GENERAL INFORMATION: 13.   |   |   |

BRANCH CIRCUIT WIRING TYPE (SUB-PANEL)


Copper

#### **GENERAL INFORMATION: ELECTRICAL CODES**

Like other sections of this home inspection, this is not an exhaustive electrical inspection, nor are we licensed electricians verifying that all areas of the house are up to the current building codes. Many houses are NOT up to current codes, and making changes or renovations may require extensive electrical work to bring an older system up to current standards. This inspection has the goal to find current problems, not future use problems. If you are interested to see what is inspected electrically during a home inspection, please see the STANDARDS section, or visit NACHI.org/sop, and view the electrical section. This inspection is looking for current electrical problems, it is not designed to determine future use or every eventuality such as renovations, additions, or other unforeseen electrical needs you may have in the future. This is also not an electrical code inspection, installation inspection... it is nothing more than the current status looking for current safety issues. If you are planning on making significant changes or renovations, All Star Inspections recommends that you hire a contractor or an electrician to determine additional electrical needs you may face.

#### Limitations

SYSTEM VERIFICATION ELECTRICAL PANEL

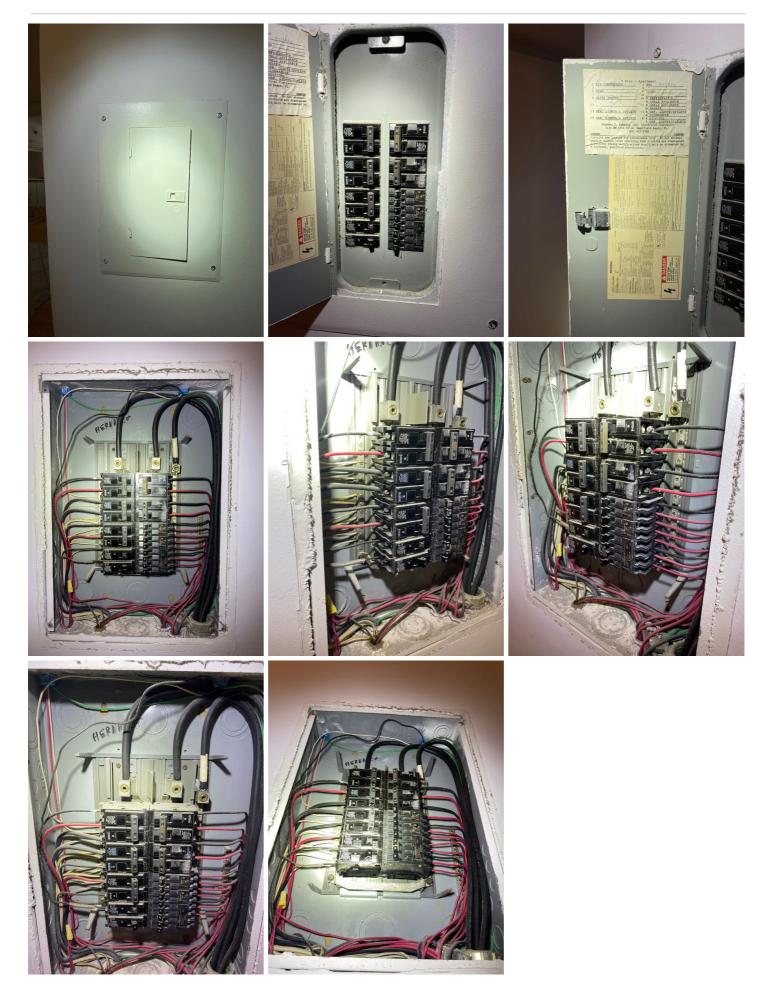

All Star Home Inspection Services, LLC

8: HVAC

#### Information

| GENERAL INFORMATION: 1.                         | GENERAL INFORMATION: 2.             | <b>GENERAL INFORMATION: 3. AC</b> |
|---|-------------------------------------|-----------------------------------|
| PRIMARY A/C ENERGY SOURCE                       | PRIMARY A/C TYPE                    | <b>MANUFACTURER</b>               |
| Electric  | Split System                        | Goodman                           |
| GENERAL INFORMATION: 4. A/C                     | GENERAL INFORMATION: 4. A/C         | GENERAL INFORMATION: 5.           |
| AIR HANDLER DATE OF                             | COMPRESSOR/ CONDENSER DATE          | PRIMARY HEATING SYSTEM            |
| MANUFACTURE                                     | OF MANUFACTURE                      | ENERGY SOURCE                     |
| 2015  | Not Inspected                       | Electric                          |
| GENERAL INFORMATION: 6.                         | <b>GENERAL INFORMATION: 9. AIR</b>  | GENERAL INFORMATION: 10.          |
| PRIMARY HEATING SYSTEM TYPE                     | <b>DISTRIBUTION SYSTEM MATERIAL</b> | LOCATION OF AIR FILTER            |
| Heat Pump                                       | Not Visible                         | In Duct Below the Unit            |
| GENERAL INFORMATION: 11.<br>THERMOSTAT LOCATION |                                     |                                   |

#### **GENERAL INFORMATION: 12. WE ARE NOT LICENSED HVAC CONTRACTORS**


We are not licensed HVAC or Steam & Boiler contractors. We recommend you hire one to further evaluate the internal components and building codes for the most recent installation, especially if there are concerns or if the system is older. We do our best to inspection the heating & cooling system within the time allotted. We are not required to inspect internal components which are not readily accessible. This is not an exhaustive inspection of every installation detail of the heating & cooling system according to manufacturers specification and local building codes.

#### Limitations

Main Hallway

#### SYSTEM VERIFICATION

#### A/C MANUFACTURE MODEL/ SERIAL NUMBER

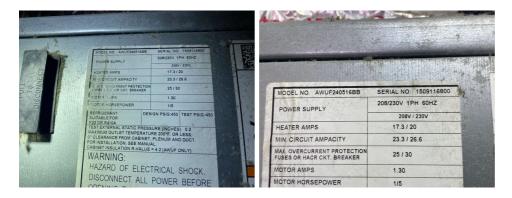

SYSTEM VERIFICATION



HEAT

## **TEMPERATURE VERIFICATION**











SYSTEM VERIFICATION **FILTER SIZE** 



#### **Observations**

#### 8.2.1 LIMITATIONS

#### NO ACCESS TO ROOF FOR A/C CONDENSER INSPECTION

At the time of inspection no roof access was available to inspect the Air Condenser, therefore the inspector was unable to verify the Condenser Age, Condition, etc. Recommend evaluation to determine the condition of the condenser. Condensers can be expensive to repair/replace and should be taken into consideration for overall costs/budgeting. If access can be granted by the HOA/Mgmt company, contact HERO (954-737-4376) to schedule a re-inspection.

Recommendation

Contact a qualified professional.

8.5.1 DUCTS/ FILTERS

#### **FILTER - MAINTAIN IN FUTURE**

Air handler filter(s) should be checked monthly in the future and replaced or washed as necessary. Recommendation Recommended DIY Project

Maintenance Item

### 9: WATER HEATER

#### Information

GENERAL INFORMATION: 1. TYPE<br/>OF WATER HEATER<br/>TankGENERAL INFORMATION: 2.<br/>ENERGY SOURCE<br/>ElectricityGENERAL INFORMATION: 4.GENERAL INFORMATION: 5.<br/>WATER HEATER MANUFACTURE<br/>General ElectricGeneral ElectricMANUFACTURE

GENERAL INFORMATION: 3. TANK CAPACITY (GALLONS) 38

#### Limitations

## SYSTEM VERIFICATION WATER HEATER MANUFACTURE MODEL/ SERIAL NUMBER

2012



#### SYSTEM VERIFICATION

WATER HEATER





#### **Observations**

#### 9.5.1 WATER HEATER

AGE - AT 8-12 YEARS

The estimated useful life for most water heaters is 8 to 12 years. This water heater appears to be at this age and may need replacing at any time. Recommend budgeting for a replacement in the near future.

Recommendation

Recommend monitoring. Estimated Cost \$800 - \$2,000



9.6.1 WATER TEMPERATURE WATER TEMPERATURE KITCHEN Recommendation Contact a gualified professional. 🗲 Maintenance Item



## 10: PLUMBING AND LAUNDRY

#### Information

GENERAL INFORMATION: 1. MAINGENERAL INFORMATION: 2. MAINGENERAL INFORMATION: 3.FUEL SHUT OFF LOCATIONWATER SUPPLY SHUT OFFWATER SERVICE TYPE

FUEL SHUT OFF LOCATION N/A

LOCATION HVAC Closet

GENERAL INFORMATION: 4. SERVICE PIPE MATERIAL Copper

GENERAL INFORMATION: 7. DRAIN PIPE MATERIAL Plastic GENERAL INFORMATION: 5. SUPPLY PIPE MATERIAL Copper

**GENERAL INFORMATION: 8. WASTE PIPE MATERIAL** Not visible WATER SERVICE TYPE Public

GENERAL INFORMATION: 6. VENT PIPE MATERIAL Not Visible

#### Limitations

#### SYSTEM VERIFICATION APPLIANCES - WASHER / DRYER



SYSTEM VERIFICATION **PLUMBING** 



## SYSTEM VERIFICATION SHUTOFF - WATER



#### **Observations**

#### 10.6.1 WASHER/ DRYER

#### **DRYER - EXHAUST DUCT PLASTIC OR FOIL**



LAUNDRY

The clothes dryer is equipped with a vinyl or foil, accordion-type, flexible exhaust duct. The U.S. Consumer Product Safety Commission considers these types of ducts to be unsafe, and a fire hazard. These types of ducts can trap lint and are susceptible to kinks or crushing, which can greatly reduce the air flow. This duct should be replaced with a rigid or corrugated semi-rigid metal duct, and by a qualified contractor if necessary. Most clothes dryer manufacturers specify the use of a rigid or corrugated semi-rigid metal duct. For more information, visit:http://www.cpsc.gov/CPSCPUB/PUBS/5022.html

Recommendation

Contact a handyman or DIY project Estimated Cost \$10 - \$50



## 11: BATHROOMS

#### Limitations

#### SYSTEM VERIFICATION MASTER BATHROOM (S)









#### Page 26 of 42

### Observations



SYSTEM VERIFICATION **PLUMBING** 





#### SYSTEM VERIFICATION GUEST BATHROOM (S)

### EXHAUST FAN - NONE WITH SHOWER

**GUEST, MASTER** 

This bathroom does not have an exhaust fan installed. While not required, per-say, as long as there is a window, it is still a smart idea to prevent the buildup of moisture which can lead to excess moisture and even mold, potentially. Consider installing an exhaust fan that exhausts all the way to the exterior.

Recommendation Contact a qualified handyman.

#### 11.2.2 BATHTUBS/ SHOWERS

#### **FAUCET - LEAKS WHEN ON**

**GUEST BATHROOM** 

The shower head or tub spout leaks by handle(s) or at their base when turned on. A gualified plumber should evaluate and repair as necessary.

Maintenance Item

Recommendation

Contact a qualified plumbing contractor. Estimated Cost \$150 - \$200



#### LOOSE

MASTER

The toilet is loose. A gualified contractor should remove the toilet for further evaluation and repair if necessary. A new wax ring should be installed and toilet should be securely anchored to the floor to prevent movement and leaking.

Recommendation

Contact a qualified plumbing contractor. Estimated Cost \$10 - \$300

11.3.2 TOILETS **CAULKING DETERIORATED GUEST** 

Recommendation

















## The caulking around the base of the toilet is deteriorated and/or missing. Recommend replacing caulking where needed.

Recommendation

Contact a handyman or DIY project



#### 11.4.1 VANITIES/ SINKS

#### **COUNTERTOPS - NEED CAULK AT BACKSPLASH**

#### GUEST

Caulk and/or grout is missing and/or deteriorated where countertops meet backsplashes in wet areas, such as around sinks. Caulk & grout should be replaced where deteriorated and/or applied where missing to prevent water damage. For more information on caulking, visit:The Ins and Outs of Caulking.

#### Recommendation

Contact a handyman or DIY project



#### 11.4.2 VANITIES/ SINKS

#### **CABINETS - DETERIORATED**



The cabinets and/or drawers are damaged and/or deteriorated. A qualified contractor should evaluate and repair or replace cabinets and/or components as necessary.

Recommendation Contact a handyman or DIY project Estimated Cost \$250 - \$350



Maintenance Item



#### 11.4.3 VANITIES/ SINKS

#### **PLUMBING - LEAK IN DRAIN LINE**

Recommendation

GUEST, MASTER

Sink drains have an active leak. For example, at pipe fittings and/or junctions between pipe and sink. A qualified plumber should evaluate and repair as necessary.

Recommendation

Contact a qualified plumbing contractor. Estimated Cost \$100 - \$300



#### 11.5.1 ELECTRICAL

### LIGHTING - INOPERABLE

MASTER

The light fixtures appear to be fully or partially inoperable. Recommend further evaluation by replacing bulb(s) and/or consulting with the property owner(s). Repairs or replacement of the light fixture by a qualified electrician may be necessary.

Recommendation

Contact a handyman or DIY project

#### 11.6.1 CEILINGS/ FLOORS/ WALLS

### FLOOR - TILES - DAMAGED, CRACKED, AND/OR LOOSE



GUEST

Deteriorated and/or Loose floor tiles were present at the time of inspection. Recommend having a qualified contractor evaluate, re-install, and seal.

Maintenance Item

Recommendation

Contact a qualified handyman.






## 12: INTERIOR ROOMS

#### Limitations

## SYSTEM VERIFICATION MAIN LEVEL

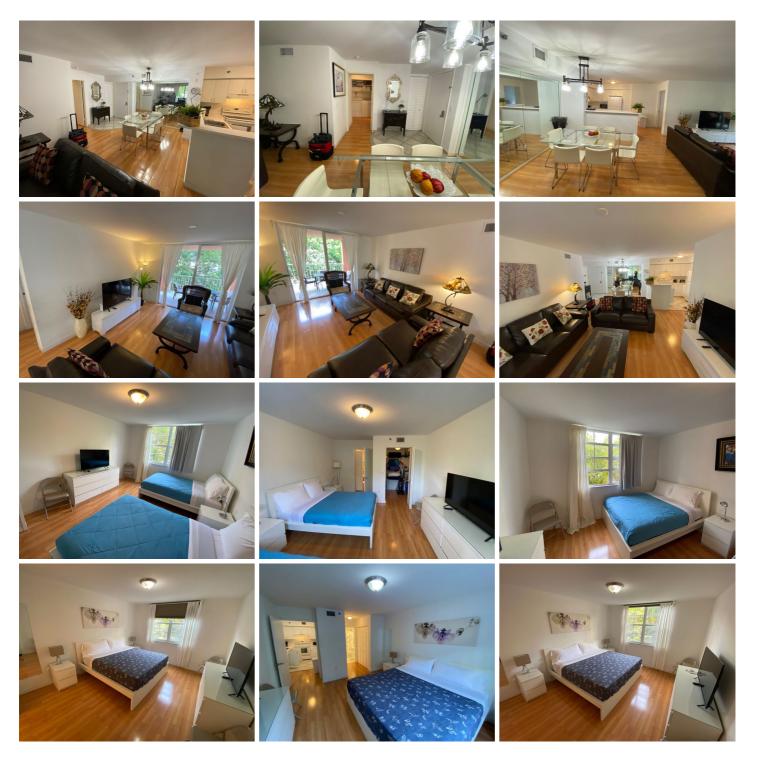

## SYSTEM VERIFICATION SMOKE ALARMS




#### **Observations**

#### 12.1.1 LIMITATIONS

#### SOME AREAS INACCESSIBLE OR OBSCURED

Some areas were inaccessible due to stored items. These areas are excluded from this inspection. Recommendation

Contact a qualified professional.

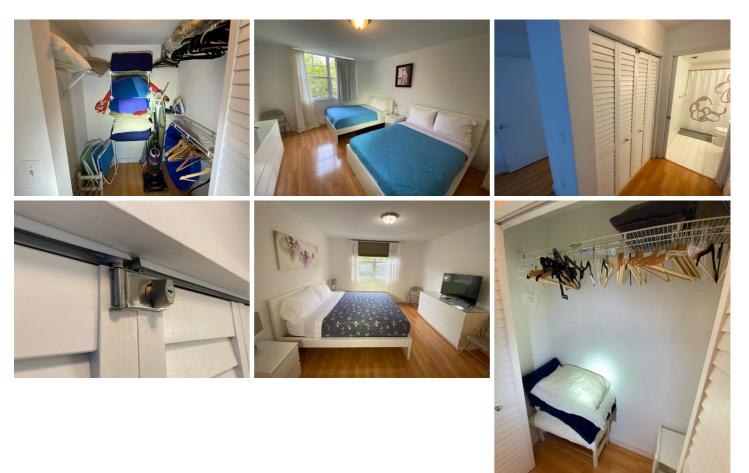





#### 12.4.1 ELECTRICAL

#### **COVER PLATES - MISSING**

LIVING ROOM

Cover plate(s) are missing from electric boxes, such as for receptacles, switches and/or junction boxes. They are intended to contain fire and prevent electric shock from exposed wires. This is a safety hazard due to the risk of fire and shock. Cover plates should be installed where missing.

Recommendation

Contact a handyman or DIY project Estimated Cost \$10 - \$50



12.5.1 CEILINGS/ FLOORS/ WALLS

#### CEILINGS/WALLS - CRACKS - MINOR/MODERATE

DINING ROOM

Minor to moderate cracks were found in ceilings or walls. They do not appear to be a structural concern, but the client(s) may wish to have evaluated by a structural engineer or repair for aesthetic reasons. Recommendation

Contact a qualified professional.









#### 12.5.2 CEILINGS/ FLOORS/ WALLS

#### **CEILINGS/WALLS - DAMAGE - MODERATE**



DINING ROOM

Moderate damage was found on ceilings or walls. Recommend a qualified contractor evaluate and repair damaged areas.

Recommendation

Contact a handyman or DIY project Estimated Cost \$100 - \$150



#### 12.5.3 CEILINGS/ FLOORS/ WALLS FLOOR - VINYL/LAMINATE FLOORING DETERIORATED




LIVING ROOM

Vinyl or Laminate flooring is damaged and/or deteriorated. A qualified contractor should replace or repair the damaged flooring.

Recommendation

Contact a qualified flooring contractor

Estimated Cost \$1,500 - \$1,700

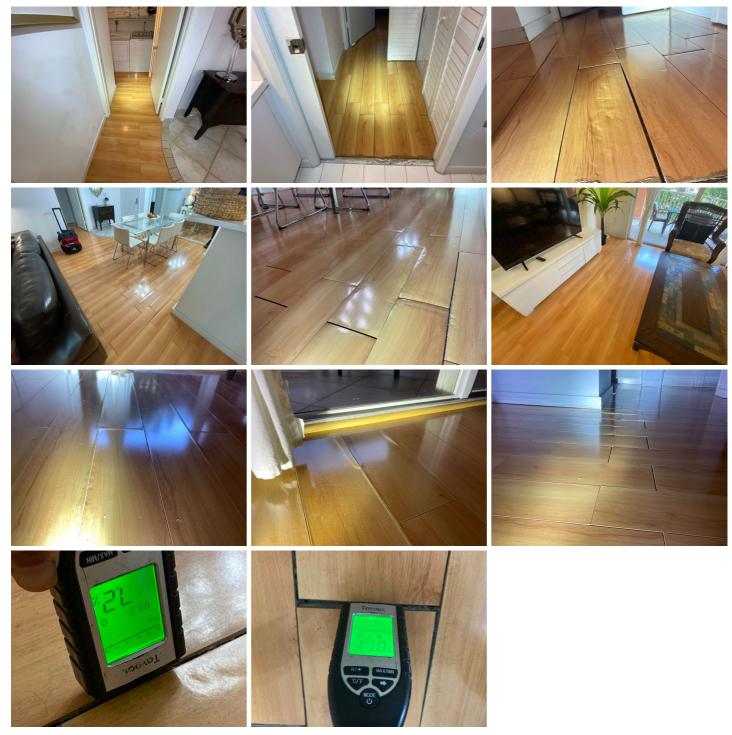

## 13: KITCHEN

#### Limitations

## SYSTEM VERIFICATION APPLIANCES



SYSTEM VERIFICATION **KITCHEN** 

## SYSTEM VERIFICATION **PLUMBING**



#### **Observations**

#### 13.4.1 APPLIANCES

#### **GARBAGE DISPOSAL - NOISY**


The under-sink food disposal is noisy. A qualified plumber or contractor should evaluate and repair or replace the food disposal as necessary.

Recommendation

Contact a qualified appliance repair professional. Estimated Cost \$0 - \$175





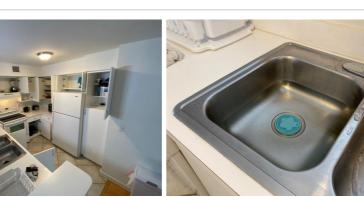



#### 13.5.1 COUNTER TOPS AND CABINETS

- Recommendation

#### **CABINETS - DETERIORATED**

The cabinets and/or drawers are damaged and/or deteriorated. A qualified contractor should evaluate and repair or replace cabinets and/or components as necessary.

Recommendation

Contact a handyman or DIY project Estimated Cost \$200 - \$600



## 14: RECOMMENDATIONS AND DISCLAIMERS

#### Information

EXCLUSIONS: The Following Items (if applicable) are Excluded from this Inspection:

Fire Suppression



#### NOTIFICATIONS/ WARNINGS: RENOVATIONS - CONTRACTORS - TRADES.

It's possible and perhaps even likely that you may have renovations or work performed by a licensed tradesperson or a contractor after the purchase of your new home. Sometimes, after the inspection, these trades and contractors like to say that inspectors missed many things. Inspectors, while human, usually did not, These trades and contractors are not familiar with what a home inspection is. The trades and contractors experience with inspections are based on their work, which are inspections performed by city and county code inspectors to ensure that their work is performed up to current building codes and standards. A home inspection is not a code inspection. Many homes purchased are older and built under different codes and rules. And that's ok. A house doesn't arbitrarily need to be brought up to any current code without cause, like new renovations or permits for new work. There is nothing about the transfer of ownership of a property that says anything about a house needing to be brought up to current building codes. Current building codes are for current building and renovations, not for the purchase of a home. Home inspectors can actually be fined by local municipalities for talking about code requirements without being an actual code inspector for the municipality. The purpose of the home inspection is to ensure the client does not inherit problems that are currently present when making a home purchase. If you plan on making renovations and/or having significant work performed after the purchase it would be smart to bring that specialized expert in to give some insight on the local municipality requirements you will be required to follow during your work and renovations since that is not the role of a home inspection.

#### **NOTIFICATIONS/ WARNINGS: ASBESTOS NOTIFICATION - ALL STRUCTURES**

ASBESTOSAsbestos is still sold in stores. This comes as a surprise to many people. It is still used in several current building materials. Asbestos, when disturbed, can be inhaled and cause significant lung damage decades after the exposure. Because of this, there are strict rules during renovation processes to protect the general population from exposure. An asbestos inspector (we would be happy to recommend one if needed) would need to take a piece of material in to be analyzed by an accredited laboratory so you can determine if that sample is considered Asbestos Containing Material (ACM). Some sellers will not allow this type of "destructive" testing due to potential damage to their property or because of disclosure requirements if the testing is positive. Only a licensed firm, with an EPA licensed building inspector, can conduct this evaluation for you. This above testing does not allow you to begin renovations or demolition. It is for information seeking purposes only. It DOES NOT prove that asbestos is not present.

#### **NOTIFICATIONS/ WARNINGS: EXTENSIVE REPAIRS REQUIRED**

This home has the need for extensive repairs. Much of the material is deteriorated and/or damaged.

#### **NOTIFICATIONS/ WARNINGS: RENOVATIONS WITHOUT PERMITS**

Many older homes have previous renovations, repairs or upgrades that may not have been permitted by the city. Common non-permitted items are (this is not an inclusive list): - Florida/Sunroom conversions- Carport/Garage conversions- Major Appliance Replacement (A/C, Water Heater, etc.)- Electrical Panel/Wiring replacement- Plumbing replacement (Cast Iron, Polybutylene, Galvanized, etc.)- Roof replacementThere may have been updates that would normally require a city inspection that were not inspected. All Star Inspections pulled all available online permits (located under section 3 titled "BuildFax") for your convenience. The inspector is not required to research the history of the property, or report on its potential for alteration, modification, extendibility or suitability for a specific or proposed use for occupancy. Recommend checking with the seller and/or the city building permits department. \*Non-permitted alterations could also cause a problem during future resale.

#### **RECOMMENDATIONS AND DISCLAIMERS: 1. Thermal Imaging Recommendation**

All Star Inspections always recommends the thermal imaging of the interior and exterior of your prospective residence. We use a heat sensitive camera to detect anomalies in your new home: electrical issues, water leaks, roof leaks, appliances not working correctly, energy issues, missing insulation, etc. The thermal camera can detect very small variances and is very useful helping to detect items not visible to the naked eye.

#### **RECOMMENDATIONS AND DISCLAIMERS: 4. Final Walk-Through Prior to Closing**

\*\*\* IMPORTANT: CONDITIONS AT THE HOME CAN CHANGE BETWEEN THE TIME OF THE HOME INSPECTION AND THE TIME OF CLOSING. FOR THIS REASON, THE CLIENT SHOULD, IN EVERY CASE, ALWAYS PERFORM A FINAL WALK-THROUGH PRIOR TO FINALIZING THE PURCHASE IN ORDER TO ASSESS THE FINAL CONDITION OF THE HOME.\*\*\*The final walk-through prior to closing is the final opportunity for the client to assess the final condition of the home prior to officially purchasing the home. All Star Inspections can perform a final walk-through with the client at the time of closing to evaluate conditions that might have changed following the home inspection. To schedule an Inspector to be present during the final walk through, please contact us at 305-849-4284. Additional Notes on the Final Walk Through:Some defects/problems existing at the home may not have been observable by the Inspector at the time of the home inspection due to obstructions/restrictions preventing full evaluation in one or more areas. This situation is especially common if the residence was occupied at the time of the inspection due to the presence of furnishings, storage apparatus, etc. Such defects/problems concealed at the time of the home inspection may present themselves at the time of walk-through. The client should be thorough during the walk through. Because All Star performed your home inspection, it is recommended that we be contacted to also be present during the final walk-through since we are already familiar with the home. Depending on the terms of your contract, any defect/problem discovered during the final walkthrough may still be be able to be negotiated with the owner/seller of the property prior to closing.Purchasing the property with a known defect/problem releases the seller of all responsibility. The client assumes responsibility for all known defects after settlement. Should you choose to conduct the final walk through without the assistance of a home inspector, the following is recommended at a minimum: Check all components of the Heating Ventilation and Air Conditioning System. For example, turn the thermostat to the lowest position and be sure the air is blowing cold within a few minutes of the adjustment. Test the heat if the outside air temperature is below 75 degrees Fahrenheit. Try turning the thermostat off completely, wait 20 minutes and repeat these tests. Also confirm that the condenser is operating. Operate all appliances. Run water at all fixtures and flush toilets. Look for plumbing leaks or plumbing back ups. Operate all exterior doors, windows, and locks. Test smoke and carbon monoxide detectors.Ask for all remote controls to any garage door openers, fans, gas fireplaces, etc.Inspect areas that may have been restricted at the time of the inspection, but are no longer restricted.

#### **RECOMMENDATIONS AND DISCLAIMERS: 5.** Scope of Your Home Inspection and Standards of Practice

Home Inspections performed by All Star Inspections are performed in accordance with the Standards of Practice issued by our governing body, the International Association of Certified Home Inspectors (InterNACHI). Every reasonable effort was made to conduct a visual, non-invasive evaluation of the entire residence according to the Standards of Practice for Home Inspections, however, it is possible that one or more areas of the residence could not be fully evaluated due to obstructions present such as furnishings, storage equipment, etc.The InterNACHI Standards of Practice, which also detail the Scope of the Home Inspection: Were provided to the client via email prior to the inspection;Were outlined in the Inspection Agreement signed by the client prior to the inspection being performed; can be found in the STANDARD tab of each section; and can be reviewed at the following location: InterNACHI Standards of Practice. CODE OF ETHICS: All Star Inspection follows the Code of Ethics issued by InterNACHI. For a complete list of InterNACHI's Code of Ethics, please visit: InterNACHICode of Ethics. This document is simply a report that provides an assessment of the general condition of the residence at a given point in time. As a homeowner, you should expect potential problems to occur. Roofs will leak, stucco will wear and systems may fail without warning. We cannot predict future events. For these reasons, you should always keep a comprehensive insurance policy for the residence current.You are advised to seek two professional opinions and acquire estimates of repair for any and all defects, comments, improvements or recommendations mentioned in this report by gualified contractors. We recommend that any professional performing repairs at the residence inspects the property further, in order to discover and repair related problems that may not have been identified in this report. We recommend that all repairs, corrections and cost estimates be completed and documented prior to closing or purchasing the property. Feel free to hire other professionals to inspect the property prior to closing, including, HVAC, electricians, engineers and roofers, especially if you are concerned about all previous work being done up to current building and safety codes.

#### **RECOMMENDATIONS AND DISCLAIMERS: STORM PROTECTION - LIMITED EVALUATION**

Storm Protection (I.e., accordion shutters, storm panels, clamshell shutters, etc.), if they exist, are not fully evaluated during the home inspection. The inspector may attempt to operate 1 or 2 shutters and will note any noticeable damage, but will not attempt to operate/inspect all shutters or install & match panels to windows. The client may wish to perform a self evaluation or hire a storm protection company to perform a full operational evaluation.

## STANDARDS OF PRACTICE