

CONTACT REPAIR HOTLINE

HOME **SEARCH FIXES** SERVICE MANUALS MAINTENANCE ESTIMATING HOTLINE MY SHOP BOOKMARKS

Search Information Available Can't Find Service Manual Info? New Vehicle Payment Settings Referral Logout

**Post Fix**

**2008 Pontiac G8 GT 6.0L, V8, VIN Y, Des L76, 16V, OHV, USA/Canada**

Chris Lentz - Shadetree Automotive

Hotline Archive *With Service Manual d* << **Bookmark** **Print Preview** Print

**Number:** 576811

**Vehicle Application:** 2008 Silverado 1500 4.3 2008 Silverado 1500 6.0  
 2008 Silverado 1500 4.8 2008 Sierra 1500 4.8  
 2008 Silverado 1500 5.3 2008 Sierra 1500 5.3

**Customer Concern:** No start, no crank. Theft Deterrent Module (TDM) code: B3060.

**Average Reported Mileage:** 169913


**Tests/Procedures:**

1. Try the customer's other key.
2. If the vehicle now starts, replace the original key with a new one and perform key learn.
3. If the customer's second key does not allow crank, check scan data in the TDM, check that the module recognizes the key.

**Author:** [Rolf Ward](#)

**Related Document(s):** [Silverado Immobilizer Description and Operation](#)  
[Silverado TDM Location](#)  
[Silverado TDM Schematic](#)  
[Silverado TDM Replacement](#)

**Diagnostic Codes** [B3060](#)





**Potential Causes**  *With Service Manual diagrams, components, TSBs, and R&R procedures*  
[Ignition Key](#)  
[Theft Deterrent Module \(TDM\)](#)

**Confirmed Fix Summary**  *With Service Manual diagrams, components, TSBs, and R&R procedures*

**Confirmed Fix**

- [19 - Performed/Relearned 30-Minute Relearn Procedure](#)
- [3 - Replaced Ignition Key\(s\)](#)
- [2 - Relearned Theft Deterrent Module \(TDM\)](#)
- [1 - Removed Add-On Remote Start System](#) and [Programmed Ignition Key\(s\)](#)
- [1 - Performed 30-Minute Relearn Procedure](#) and [Replaced Ignition Key\(s\)](#)
- [1 - Performed 30-Minute Relearn Procedure](#) and [Replaced Theft Deterrent Module \(TDM\)](#)
- [1 - Removed Add-On Remote Start System](#)
- [1 - Replaced Ignition Switch](#)
- [1 - Replaced Starter](#)

**Confirmed Fix Details**

	<b>Tech</b>	<b>Reported Fix Details</b>	<b>Confirmed Fix</b>
1	Anthony Bischoff June 20, 2018	 2008 Chevrolet Express 2500, 4.8L, V8, Gas, Asp N, VIN C, 16V, USA * 30-Minute Relearn Procedure - <i>Relearned ignition key to van (10 minute procedure with snapon verus)</i>	Performed 30-Minute Relearn Procedure
2	Edward Youkhana October 23, 2019	 2008 Chevrolet Silverado 1500, LT 4.8L, V8, Gas, VIN C, 16V, USA * 30-Minute Relearn Procedure - <i>Had to use 10 minute key learn with factory scanner</i>	Performed 30-Minute Relearn Procedure
3	Technician September 22, 2016	 2008 Chevrolet Express 1500, 4.3L, V6, Gas, VIN X, Des LU3, 12V, USA * 30-Minute Relearn Procedure - <i>Replaced ignition key and perform key relearn</i>	Performed 30-Minute Relearn Procedure
4	Harleys3 October 20, 2021	 2008 GMC Sierra 1500, Wt 4.3L, V6, Gas, VIN X, Des LU3, 12V, USA * 30-Minute Relearn Procedure	Performed 30-Minute Relearn Procedure

Training Toolbox

	Tech	Reported Fix Details	Confirmed Fix
5	Rankin Ramsey April 23, 2021	2008 Chevrolet Silverado 1500, LT 5.3L, V8, Flex, VIN 3, Des LC9, 16V, USA * 30-Minute Relearn Procedure	Performed 30-Minute Relearn Procedure
6	Sandor Kovacs February 21, 2020	2009 GMC Sierra 1500, Wt 4.3L, V6, Gas, VIN X, Des LU3, 12V, USA * 30-Minute Relearn Procedure	Performed 30-Minute Relearn Procedure
7	Robert Lopez November 7, 2019	2007 Chevrolet Tahoe, LT 5.3L, V8, Flex, VIN 0, Des LMG, USA * 30-Minute Relearn Procedure	Performed 30-Minute Relearn Procedure
8	Ronald Page August 2, 2019	2009 Chevrolet Silverado 1500, LT 5.3L, V8, Flex, VIN 0, Des LMG, 16V, USA * 30-Minute Relearn Procedure	Performed 30-Minute Relearn Procedure
9	Robert Barnes July 19, 2019	2010 GMC Sierra 1500, SLT 5.3L, V8, Flex, VIN 3, Des LC9, 16V, USA * 30-Minute Relearn Procedure	Performed 30-Minute Relearn Procedure
10	BARGAINBT2 March 14, 2019	2007 Chevrolet Silverado 1500, LT 5.3L, V8, Flex, VIN 3, Des LC9, 16V, USA * 30-Minute Relearn Procedure	Performed 30-Minute Relearn Procedure
<b>(+) 11-19</b>			
1	Brian Brown October 22, 2018	2008 Chevrolet Express 1500, 4.3L, V6, Gas, VIN X, Des LU3, 12V, USA * Ignition Key(s)	Replaced Ignition Key(s)
2	SAFETOWMD1 May 14, 2018	2010 Chevrolet Tahoe, LS 5.3L, V8, Flex, VIN 0, Des LMG, USA * Ignition Key(s)	Replaced Ignition Key(s)
3	ACTIONAUTOSC1 March 29, 2018	2009 Chevrolet Express 3500, 4.8L, V8, Gas, Asp N, VIN C, 16V, USA * Ignition Key(s)	Replaced Ignition Key(s)
1	Patricia Ziegler September 2, 2020	2007 Chevrolet Avalanche, LS 5.3L, V8, Flex, VIN 3, Des LC9, USA * Theft Deterrent Module (TDM) - REPLACED DLIS FUSE AND RELEARNED TDM	Relearned Theft Deterrent Module (TDM)
2	Al Simmer February 23, 2017	2007 Chevrolet Avalanche, LT 5.3L, V8, Flex, VIN 0, Des LMG, USA * Theft Deterrent Module (TDM)	Relearned Theft Deterrent Module (TDM)
1	DONERIGHTAUTO1 July 12, 2019	2008 GMC Sierra 1500, SLE 5.3L, V8, Flex, VIN 3, Des LC9, 16V, USA * 30-Minute Relearn Procedure Ignition Key(s) - REPLACED KEY AND RELEARN PROCEDURE	Performed 30-Minute Relearn Procedure and Replaced Ignition Key(s)
1	Charlie Payne February 3, 2022	2008 Chevrolet Silverado 1500, Wt 4.3L, V6, Gas, VIN X, Des LU3, 12V, USA * 30-Minute Relearn Procedure Theft Deterrent Module (TDM)	Performed 30-Minute Relearn Procedure and Replaced Theft Deterrent Module (TDM)
1	Orindamotors May 13, 2018	2008 Chevrolet Suburban 1500, LT 6.0L, V8, Gas, VIN Y, Des L76, USA * Add-On Remote Start System	Removed Add-On Remote Start System
1	Bob Gooch March 2, 2021	2008 Chevrolet Silverado 1500, LT 4.8L, V8, Gas, VIN C, 16V, USA * Add-On Remote Start System Ignition Key(s) - also reprogrammed 2 new keys	Removed Add-On Remote Start System and Programmed Ignition Key(s)
1	Dawn Hudson March 7, 2017	2007 Chevrolet Silverado 1500, LT 4.8L, V8, Gas, VIN C, 16V, USA * Ignition Switch	Replaced Ignition Switch
1	CA 9778 November 2, 2016	2009 Chevrolet Express 1500, 4.3L, V6, Gas, VIN X, Des LU3, 12V, USA * Starter	Replaced Starter

🔍 - Confirmed Fix - Exact Vehicle Match

🔍 - Confirmed Fix - Similar Vehicle Match

\* - Indicates a Similar Vehicle - Not an exact match to the vehicle selected

Training Toolbox

**What Fixed It ?**

Please describe what was done to fix the vehicle you were working on.

Example 1: **Replaced fuel pump**

Example 2: **Cleaned Throttle Body**

If the problem you were fixing is **NOT** the same as the problem described in the "Customer Concern" please use the [Post Fix](#) link to share your fix.

Still need help? Click here to access the [Hotline Call Request Form](#) to schedule a call from one of our Carline Specialists.

300 characters left

[Posting Guidelines](#)

**Comments may be posted publicly with your username.**

Submit

[New Vehicle](#) [Referral](#) [Help](#) [Logout](#) [FAQ](#) [Contact Us](#) [Privacy Notice](#) [Español](#) [Français](#)  
Copyright 2001 - 2022 Identifix, Inc. All rights reserved. Use of this online service is subject to [Terms of Use](#)