



## Plant Service Record



|  |     |  |          |
|--|-----|--|----------|
| Date: 12.02.2020   |     | Fitter's name: Philip Clements   |          |
| Plant Item: Dando 2000   |     | Plant no: CT52   |          |
| Hour reading:  | N/A | Last Service   | Jan 2020 |
| Description of work carried out  |     | Time taken (hours)   | Initials |
| Re-secured Pillar bearings   |     |  |          |
| Removed chain cover, cleaned, adjusted and lubricated chain.   |     |  |          |
| Changed oil in gearbox   |     |  |          |
| Secured Locking ring on sliding member   |     |  |          |
| Cut down proud bolts on inner winch cheek plate  |     |  |          |
| Clutch Pivot bolts re-tightened  |     |  |          |
| Replaced and secured wiring to E-Stop  |     |  |          |
| Adjusted throttle to ensure full range   |     |  |          |
| Repaired guard on set up winch cover   |     |  |          |
| Added soft brace to battery clamp  |     |  |          |
| N/S Mudguard seized on- released.  |     |  |          |
| Travel Pin brackets re-welded and pins attached  |     |  |          |
| N/S Tyre Split- Replaced all 3 with new  |     |  |          |
| Monitored line pull on set up winch during RIG erection.   |     |  |          |
| Fabricated a spare wheel mount and installed on Rig  |     |  |          |
| Parts/materials used   |     | Quantity   |          |
| G90 Tyres and tubes  |     | 3  |          |
| <p><b>**Fitter's comments:**</b></p> <p><i>Set up winch wire replaced with new. Distinguishing mark- HV33802/1</i></p> |     |  |          |
| Fitter's Signature (work complete)   |     |  |          |
| Managers signature (uploaded)  |     |  |          |