



SOCOTEC

Plant Service Record

REPAIR / MODIFICATION in PAR

Date: 13 / III / 2024		Fitter's name: DOM	
Plant Item:		Plant no.: CT-34	
Hour reading:			
Description of work carried out		Time taken (hours)	Initials
MODIFY RING AND REPLACE RING ON WINCH SHAFT			LD
ADJUST CLUTCH			LD
Parts/materials used		Quantity	
RING		1	
Fitter's comments:			
<p>AFTER REPLACE CLUTCH WITH BRAND NEW CLUTCH ASSEMBLY DRILLERS FOUND THAT CLUTCH IS NOT POSSIBLE TO ADJUST PROPERLY (BINDING WHEN HOT) PROBLEM OCCURED WHEN CLUTCH BECAME HOT PROBABLY FRICTION MATERIAL EXPANDING TOO FAR / MUCH WHEN IT'S IN OPERATION.</p> <p>I MODIFY RESISTANCE RING TO ALLOW MORE TRAVEL FOR SLIDING MEMBER AND MOR TRAVEL FOR CLUTCH</p>			
Fitter's Signature (work complete)		13 ÷ 14 / III / 2024 <i>LD</i>	