

### **SUMMARY** 1234 Demo Ln NW, Dreamy, GA John Doe May 19, 2023



### 2.1.1 Coverings


### CRACKED AND DAMAGED ROOF COVERING



I observed areas of cracked/splitting and damaged roof-covering materials. I recommend that a qualified roofing contractor to further evaluate and make repairs to the roof system,.

Recommendation

Contact a qualified roofing professional.

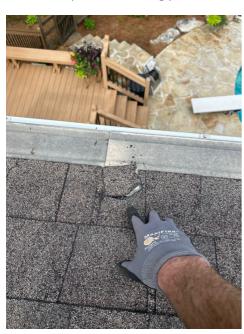



Fasteners are sealed, but this is incorrect



### 2.1.2 Coverings **SECURE COVERING**

Recommendation Contact a qualified professional.





Hartwell Management Page 1 of 23

### MISSING DRIP EDGE FLASHING



Observation/Maintenance

No "drip edge" flashing was visible at roof eaves (lower edges) or rakes (gable end edges). Drip edge helps prevent water from soaking into the edges of the roof sheathing material (typically plywood or oriented strand board). This reduces the chance of fungal rot or deterioration from water damage in the roof sheathing. This standard building practices in GA for installations from 2014.




### 2.3.1 Gutters & Downspouts

#### **DEBRIS IN GUTTERS**


I observed debris in the gutter. Cleaning and maintenance is recommended.

Recommendation
Contact a qualified gutter contractor

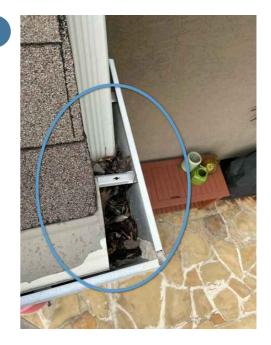

#### 2.3.2 Gutters & Downspouts

### **GUTTERS MISSING**

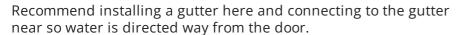

Recommendation
Contact a qualified gutter contractor



2.3.3 Gutters & Downspouts


### DOWNSPOUTS DRAIN NEAR HOUSE



Hartwell Management Page 2 of 23

One or more downspouts drain too close to the home's foundation. This can result in excessive moisture in the soil at the foundation, which can lead to foundation/structural movement. Recommend downspout extensions to drain at least 6 feet from the foundation. A handy homeowner should be able to do this project.



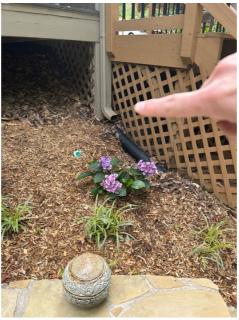

Several Around Home

# 2.3.4 Gutters & Downspouts **GUTTER GUARD**



Gutter guards need minor adjustments



3.2.1 Eaves, Soffits & Fascia SOFFIT HAS SOME DETERIORATION
BACK NEAR CHIMNEY





Hartwell Management Page 3 of 23

# 3.3.1 Siding, Flashing & Trim INADEQUATE GROUND CLEARANCE



Recommend better clearance from ground cover and base of home. This will help reduce the risk of deterioration and help with pest



3.3.2 Siding, Flashing & Trim **SEAL OPENING** 









3.3.3 Siding, Flashing & Trim **PREVIOUS REPAIR NOTED** 



Hartwell Management Page 4 of 23



3.4.1 Exterior Doors
THRESHOLD IS DAMAGED



RIGHT SIDE OF HOME.

Recommend sealing this opening in the threshold.

Recommendation Contact a qualified professional.




# 3.6.1 Decks, Balconies, & Porches IMPROPER DECK CONSTRUCTION PRACTICES



Deck joist not supported correctly over the post. Sagging is visible. Pic 1  $\&\,2$  Recommend correction at some point.

Hartwell Management Page 5 of 23

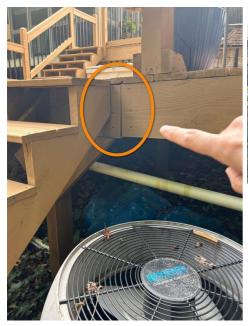



### 3.6.2 Decks, Balconies, & Porches

### **DECK POST**



Deck feels solid. However, there are items that will need to be addressed. The post that have some rot can be addressed later. The post that is leaning, I feel needs correction sooner than later. Recommend mulch be pulled back away from each post to extend their life and reduce rot.

Recommendation Contact a qualified professional.



No Footer, Some Rot, Back Right Deck



Important: Correct Support Post. Leaning. Back Left Deck



No Visible Footer, Some Rot, Back Left Deck.

### 3.7.1 Stairs, Steps, Stoops, Stairways & Ramps

### **DECK STAIRS**

Stairs Secured with Nails Only

Recommend each staircase be secured with braces or screws. Notice the separation.

Hartwell Management Page 6 of 23





### 3.7.2 Stairs, Steps, Stoops, Stairways & Ramps

### STAIRWAY ILLUMINATION



All stairs should have adequate lighting to see where you're stepping. There should be lighting for the stairway, steps, treads, and landings. For the exterior stairs, there should be a light at the top landing.

Recommendation

Contact a qualified professional.

### 3.8.1 Railings, Guards & Handrails

### MISSING HANDRAIL

I observed a missing handrail.

There is more than one step here, and I recommend installing a handrail for safety.

Recommendation

Contact a qualified professional.







Safety Hazard

Safety Hazard

Hartwell Management Page 7 of 23

### 3.8.2 Railings, Guards & Handrails

### LOOSE RAILING COMPONENT



I observed one or more loose railing components. Railing should be able to support 200 lbs in any direction. Correction and further evaluation is recommended.

Recommendation Contact a qualified handyman.



### 3.8.3 Railings, Guards & Handrails



Current standards are to have railing at least 36" high.

Recommendation Contact a qualified professional.



### 3.9.1 Walkways, Patios & Driveways **DRIVEWAY CRACKING - MINOR**



Several minor cosmetic cracks observed, which may indicate movement in the soil. Recommend monitor and/or have driveway contractor patch/seal.



3.9.2 Walkways, Patios & Driveways **WALKWAY CRACKING - MINOR** 



Hartwell Management Page 8 of 23 Minor cosmetic cracks observed. Recommend monitor and/or patch/seal.

Here is a DIY article on repairing cracked sidewalks.



3.10.1 Vegetation, Grading, Drainage & Retaining Walls



### **DEPRESSION IN LAWN**

I recommend asking the owner if there was a tree previously here. Maybe that is why it's sunken in.



# 4.1.1 Foundation FOUNDATION CRACK - MINOR



GARAGE UTILITY ROOM

I observed indications of a minor crack at the foundation. The crack is hairline with no major displacement or movement.

Recommendation Recommend monitoring.

Hartwell Management Page 9 of 23



### 5.6.1 Lighting Fixtures, Switches & Receptacles **SWITCH UNABLE TO IDENTIFY**



Unable to identify what one or more switches operate. There were a few on the exterior. Owner said they worked.



5.6.2 Lighting Fixtures, Switches & Receptacles



### LIGHT INOPERABLE

**KITCHEN** 

One or more lights are not operating. New light bulb possibly needed. This was for the light above the sink.

Page 10 of 23 Hartwell Management



5.6.3 Lighting Fixtures, Switches & Receptacles



### **COVER PLATES DAMAGED**

One or more receptacles have a damaged cover plate. Recommend replacement.



### 5.6.4 Lighting Fixtures, Switches & Receptacles **OUTDOOR LIGHTING**



Seal around exterior lights to prevent water intrusion. Secure outdoor electrical outlet, it's exposed to the elements and water intrusion.

Hartwell Management Page 11 of 23





Recommend sealing all exterior lights

Right of Front Door

# 5.6.5 Lighting Fixtures, Switches & Receptacles COVER PLATE LOOSE



One or more outlet covers are loose and need tightening. This cover for the light fixture needs to be secured.





Several In Home

Upstairs Mst. Closet

5.6.6 Lighting Fixtures, Switches & Receptacles



#### LIGHT OPENING

MASTER BATHROOM

It's cosmetic, but visible gap between light a fixture.

Hartwell Management Page 12 of 23



Mst. Bathroom

### 5.7.1 AFCIs MISSING AFCI



Living Room, Bedroom(s), Other Usable Space

No arc fault circuit interrupter (AFCI) breakers were installed for the identified locations. These are relatively new devices, and reduce the risk of fire by protecting against overheated or arcing receptacles (outlets) or light fixtures. Consult with a qualified electrician about upgrading circuits to AFCI protection per standard building practices.

\*NOTE\* A listed combination AFCI breaker is now required for all 15A or 20A, 120V branch circuits in dwelling units supplying outlets or devices in kitchens, family rooms, dining rooms, living rooms, parlors, libraries, dens, bedrooms, sunrooms, recreation rooms, closets, hallways, laundry areas, or similar rooms or areas.

#### 5.8.1 GFCIs

#### MISSING GFCI



Kitchen, Laundry Room, Garage, Bathroom(s), Porch/Patio, Deck

One or more electric receptacles at the laundry area and/or crawl space had no visible ground fault circuit interrupter (GFCI) protection, or it was unable to be determined if GFCI protection was present. If not GFCI-protected, receptacles in wet areas pose a shock hazard. Recommend that a qualified electrician evaluate and install GFCI protection if necessary and per standard building practices. General guidelines for GFCI-protected receptacles include the following locations:

Outdoors (since 1973) Bathrooms (since 1975) Garages (since 1978) Kitchens (since 1987)

Crawl spaces and unfinished basements (since 1990) Wet bar sinks (since 1993)

Laundry and utility sinks (since 2005)

Hartwell Management Page 13 of 23



There is one GFCI outlet in the kitchen. However, the other outlets are not connected to this so they maintain power even when the GFCI is tripped. Meaning, the other outlets are not GFCI protected.



#### 5.9.1 Presence of Smoke and CO Detectors

### OLD DETECTORS, NEW DETECTORS RECOMMENDED



I observed indications of old smoke detectors in the house. Detectors should be replaced every 5-10 years. The should be hard-wired with electricity and have a battery backup feature in case the electricity turns off. New smoke detectors are recommended.

Recommendation Contact a qualified professional.

### 5.9.2 Presence of Smoke and CO Detectors

### IMPROPER LOCATION OF SMOKE DETECTOR PER CURRENT STANDARD



Page 14 of 23

I observed indications of improper location of the smoke detector. Current standard is to have one in each bedroom. Only located two. 1. on main in hallway. 2. upstairs in hallway.

Smoke detectors should be installed on the ceiling, or installed on the wall no more than 12 inches from the ceiling.



7.1.1 Equipment
SEDIMENT TRAP MISSING ON FURNACE



ATTIC UNIT

Hartwell Management

No sediment trap was installed in the gas supply line at the furnace or the trap was improperly installed. Sediment traps prevent damage to

gas-fired appliances by trapping oil, scale, water condensation and/or debris. Recommend that a qualified contractor install a sediment trap per standard building practice.

Recommendation Contact a qualified professional.



Attic

# 7.1.2 Equipment **DUCT DEFECT**

GARAGE UTILITY ROOM UNIT

Need a cover for the filter insert.

Recommendation Contact a qualified professional.





Garage Utility Room

### 8.1.1 Cooling Equipment

# NEEDS MORE CLEARANCE FROM GROUND COVER



Remove access pinestraw from around units.

Hartwell Management Page 15 of 23



### 9.4.1 Water Supply, Distribution Systems & Fixtures



### POLYBUTYLENE SUPPLY PIPES

Water supply pipes were made from polybutylene material. This material can be prone to fail without warning, causing damage to the home structure. Recommend a qualified plumber replace pipes and fittings with an approved material like PEX.

You can read more about polybutylene piping here and here.







**Upstairs Guest** 

**Upstairs Guest & Mst Toilets** 

Mst. Upstairs

Hartwell Management Page 16 of 23





Mst. Upstairs

Toilet in 1/2 Bath Downstairs

#### 11.3.1 Ventilation in Attic

### **BATHROOM VENTS TO ATTIC**

ATTIC

Current Standard in GA is for exhaust fans to vent directly to the exterior of the home. The two upstairs units exhaust into the attic. Recommend having them directed to the exterior.

Recommendation Contact a qualified professional.






### 12.2.1 Sinks, Tubs & Showers

### LOOSE FIXTURE

I observed one or more fixtures are loose and need to be tightened.



Hartwell Management Page 17 of 23

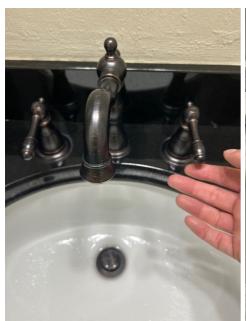



# 12.2.2 Sinks, Tubs & Showers NO RUNNING WATER AT FIXTURE




MST. UPSTAIRS SHOWER

I observed that there was no running water at the fixture.

Recommendation

Contact a qualified plumbing contractor.

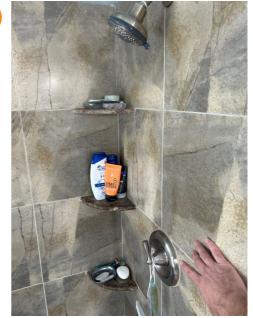

### 12.2.3 Sinks, Tubs & Showers

### **SHOWER SEALANT**

Recommend resealing/sealing these areas to help prevent water intrusion.



Hartwell Management Page 18 of 23






Mst. Upstairs Shower

**Upstairs Guest** 

# 12.2.4 Sinks, Tubs & Showers **JACUZZI TUB**

MST. UPSTAIRS BATHROOM

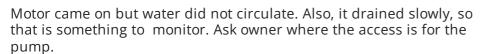

Recommendation Contact a qualified professional.



#### 12.3.1 Bathroom Exhaust Fan

### **MISSING FAN**



I observed that the full bathroom on the main and Mst. Upstairs bathroom do not have a mechanical exhaust fan installed at or near the showers.

Regardless of what kind of ventilation system may be installed for the rest of the house, exhaust fans are recommended in the bathrooms to remove excess moisture, cleaning chemical fumes, etc. The fan should be ducted to exhaust outside of the home.

Recommendation

Contact a qualified general contractor.

Hartwell Management Page 19 of 23





Mst. Upstairs Bathroom

Main full bathroom

12.4.1 Cabinetry, Ceiling, Walls & Floor MINOR DEFECT



MAIN FULL BATHROOM

I observed a minor repair in the bathroom floor.



Main full bathroom

#### 13.1.1 Doors

### POOR WEATHER-STRIPPING



At the time of the inspection, weather-stripping at an interior door was generally damaged or deteriorated. The Inspector recommends replacement/installation of effective weather-stripping components as necessary.

Hartwell Management Page 20 of 23



# 13.2.1 Windows WINDOW FILM



Appears the window film is starting to deteriorate, or the window could just be dirty.



# 13.3.1 Floors **CARPET STAINS**



Carpet had areas of staining or discoloration. Recommend a thorough steam clean by a qualified carpet cleaning company

Hartwell Management Page 21 of 23



Upstairs/office, guest

### 13.3.2 Floors **TILE BROKEN**

KITCHEN/DINING Recommendation Contact a qualified professional.






WALL PAPER NEEDS RESECURED Observation/Maintenance **DINING ROOM** 



Minor repair needed to wallpaper.

Hartwell Management Page 22 of 23

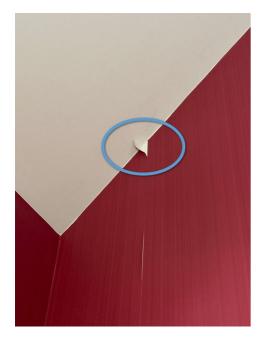

# 14.1.1 Clothes Washer MISSING CATCH PAN



I observed a missing water catch pan that should be installed under the clothes washer.

Recommendation Recommended DIY Project

Hartwell Management Page 23 of 23