

GOVERNMENT OF INDIA MINISTRY OF SKILL DEVELOPMENT & ENTREPRENEURSHIP DIRECTORATE GENERAL OF TRAINING

COMPETENCY BASED CURRICULUM

WELDER

(Duration: One Year)

CRAFTSMEN TRAINING SCHEME (CTS) NSQF LEVEL- 4



SECTOR – CAPITAL GOODS AND MANUFACTURING





(Engineering Trade)

(Revised in 2019)

Version: 1.2

CRAFTSMEN TRAINING SCHEME (CTS)

NSQF LEVEL - 4

Developed By

Ministry of Skill Development and Entrepreneurship

Directorate General of Training

CENTRAL STAFF TRAINING AND RESEARCH INSTITUTE

EN-81, Sector-V, Salt Lake City, Kolkata – 700 091 www.cstaricalcutta.gov.in

CONTENTS

S No.	Topics	Page No.
1.	Course Information	1
2.	Training System	3
3.	Job Role	7
4.	General Information	10
5.	Learning Outcome	12
6.	Assessment Criteria	14
7.	Trade Syllabus	19
	Annexure I (List of Trade Tools & Equipment)	33
	Annexure II (List of Trade experts)	37





During the one year duration a candidate is trained on subjects Professional Skill, Professional Knowledge, Engineering Drawing, Workshop Science & Calculation and Employability Skills related to job role. In addition to this a candidate is entrusted to undertake project work and extracurricular activities to build up confidence. The broad components covered under Professional Skill subject are as below:

The practical skills are imparted in simple to complex manner & simultaneously theory subject is taught in the same fashion to apply cognitive knowledge while executing task. The safety aspects covers components like OSH & E, PPE, Fire extinguisher, First Aid and in addition 5S being taught. The practical part starts with edge preparation by hacksawing, filing and fitting followed by Oxy Acetylene Welding & Brazing, Oxy Acetylene Cutting, Shielded Metal Arc Welding, Gas Metal Arc Welding, Gas Tungsten Arc Welding and Spot Welding, Plasma Cutting and Arc Gouging. These processes are widely used in Industries.

During the practice on Welding / Brazing process, the trainees will learn to read the job drawing, select the required base metal and filler metals, cut the metals by appropriate process, carry out edge preparation, setup the plant and do welding/Brazing on M.S, SS, Aluminium and Copper in different positions. On completion of each job the trainees will also evaluate their jobs by visual inspection, and identify the defects for further correction/improvement. They learn to adapt precautionary measures such as preheating; maintaining inter-pass temperature and post weld heat treatment for Welding Alloy steel, Cast Iron etc. The Work Shop calculation taught will help them to plan and cut the required jobs economically without wasting the material and also used in estimating the Electrodes, filler metals etc. The Workshop Science taught will help them to understand the materials and properties, effect of alloying elements etc. Engineering Drawing taught will be applied while reading the job drawings and will be useful in understanding the location, type and size of weld to be carried out.

The professional knowledge taught will be useful in understanding the principles of Welding, Brazing and Cutting process, use of jigs and Fixtures, distortion and methods of control, selection of consumables and to take precautionary measures for storage and handling and apply the same for executing the Cutting, Welding and Brazing.

The knowledge and practice imparted on Destructive and Non-destructive testing will be use in understanding the standard quality of welds and to carry out shop floor Inspection and test in laboratories.



One project need to be completed by the candidates in a group. In addition to above components the core skills components viz., Workshop calculation & science, Engineering drawing, employability skills are also covered. These core skills are essential skills which are necessary to perform the job in any given situation.



2.1 GENERAL

The Directorate General of Training (DGT) under Ministry of Skill Development & Entrepreneurship offers a range of vocational training courses catering to the need of different sectors of economy/ Labour market. The vocational training programmes are delivered under the aegis of Directorate General of Training (DGT). Craftsman Training Scheme (CTS) with variants and Apprenticeship Training Scheme (ATS) are two pioneer schemes of DGT for strengthening vocational training.

Welder trade under CTS is one of the most popular courses delivered nationwide through a network of ITIs. The course is of one-year duration. It mainly consists of Domain area and Core area. In the Domain area (Trade Theory & Practical) imparts professional skills and knowledge, while the core area (Workshop calculation & Science, Engg. Drawing and Employability Skill) imparts requisite core skills, knowledge, and life skills. After passing out the training program, the trainee is awarded National Trade Certificate (NTC) by DGT which is recognized worldwide.

Trainee broadly needs to demonstrate that they are able to:

- Read & interpret technical parameters/documentation, plan and organize work processes, identify necessary materials and tools;
- Perform tasks with due consideration to safety rules, accident prevention regulations and environmental protection stipulations;
- Apply professional knowledge, core skills & employability skills while performing the job, and repair & maintenance work.
- Check the job/ assembly as per drawing for functioning identify and rectify errors in job/ assembly.
- Document the technical parameters in tabulation sheet related to the task undertaken.

2.2 PROGRESSION PATHWAYS

- Can join industry as Technician and will progress further as Senior Technician, Supervisor and can rise up to the level of Manager.
- Can become Entrepreneur in the related field.
- Can join Apprenticeship programme in different types of industries leading to National Apprenticeship certificate (NAC).
- Can join Crafts Instructor Training Scheme (CITS) in the trade for becoming instructor in ITIs.



• Can join Advanced Diploma (Vocational) courses under DGT as applicable.

2.3 COURSE STRUCTURE:

Table below depicts the distribution of training hours across various course elements during a period of one year: -

S No.	Course Element	Notional Training Hours
1	Professional Skill (Trade Practical)	1000
2	Professional Knowledge (Trade Theory)	280
3	Workshop Calculation & Science	80
4	Engineering Drawing	80
5	Employability Skills	160
	Total	1600

2.4 ASSESSMENT & CERTIFICATION

The trainee will be tested for his skill, knowledge and attitude during the period of course through formative assessment and at the end of the training programme through summative assessment as notified by the DGT from time to time.

- a) The **Continuous Assessment** (Internal) during the period of training will be done by **Formative assessment method** by testing for assessment criteria listed against learning outcomes. The training institute have to maintain individual *trainee portfolio* as detailed in assessment guideline. The marks of internal assessment will be as per the formative assessment template provided on www.bharatskills.gov.in
- b) The final assessment will be in the form of summative assessment. The All India Trade Test for awarding NTC will be conducted by Controller of examinations, DGT as per the guidelines. The pattern and marking structure is being notified by DGT from time to time. The learning outcome and assessment criteria will be basis for setting question papers for final assessment. The examiner during final examination will also check individual trainee's profile as detailed in assessment guideline before giving marks for practical examination.

2.4.1 PASS REGULATION

For the purposes of determining the overall result, weightage of 100% is applied for six months and one year duration courses and 50% weightage is applied to each examination for



two years courses. The minimum pass percent for Trade Practical and Formative assessment is 60% & for all other subjects is 33%. There will be no Grace marks.

2.4.2 ASSESSMENT GUIDELINE

Appropriate arrangements should be made to ensure that there will be no artificial barriers to assessment. The nature of special needs should be taken into account while undertaking assessment. Due consideration should be given while assessing for team work, avoidance/reduction of scrap/wastage and disposal of scarp/wastage as per procedure, behavioral attitude, sensitivity to environment and regularity in training. The sensitivity towards OSHE and self-learning attitude are to be considered while assessing competency.

Assessment will be evidence based comprising the following:

- Job carried out in labs/workshop
- Record book/ daily diary
- Answer sheet of assessment
- Viva-voce
- Progress chart
- Attendance and punctuality
- Assignment
- Project work

Evidences and records of internal (Formative) assessments are to be preserved until forthcoming examination for audit and verification by examination body. The following marking pattern to be adopted while assessing:



Performance Level	Evidence			
(a) Weightage in the range of 60 -75% to be all	otted during assessment			
For performance in this grade, the candidate should produce work which demonstrates attainment of an acceptable standard of craftsmanship with occasional guidance, and due regard for safety procedures and practices.	 Demonstration of good skill in the use of hand tools, machine tools and workshop equipment 60-70% accuracy achieved while undertaking different work with those demanded by the component/job/set standards. A fairly good level of neatness and consistency in the finish Occasional support in completing the project/job. 			
(b)Weightage in the range of above 75% - 90% to be allotted during assessment				
For this grade, a candidate should produce work which demonstrates attainment of a reasonable standard of craftsmanship, with little guidance, and regard for safety procedures and practices.	 Good skill levels in the use of hand tools, machine tools and workshop equipment 70-80% accuracy achieved while undertaking different work with those demanded by the component/job. A good level of neatness and consistency in the finish Little support in completing the project/job 			
(c) Weightage in the range of above 90% to be	allotted during assessment			
For performance in this grade, the candidate, with minimal or no support in organization and execution and with due regard for safety procedures and practices, has produced work which demonstrates attainment of a high standard of craftsmanship.	 High skill levels in the use of hand tools, machine tools and workshop equipment Above 80% accuracy achieved while undertaking different work with those demanded by the component/job/set standards. A high level of neatness and consistency in the finish. Minimal or no support in completing the project. 			



Welder, Gas; fuses metal parts together using welding rod and oxygen acetylene flame. Examines parts to be welded, cleans portion to be joined, holds them together by some suitable device and if necessary, makes narrow groove to direct flow of molten metal to strengthen joint. Selects correct type and size of welding rod, nozzle etc. and tests welding, torch. Wears dark glasses and other protective devices while welding. Releases and regulates valves of oxygen and acetylene cylinders to control their flow into torch. Ignites torch and regulates flame gradually. Guides flame along joint and heat it to melting point, simultaneously melting welding rod and spreading molten metal along joint shape, size etc. and rectifies defects if any.

Welder, Electric; fuses metals using arc-welding power source and electrodes. Examines parts to be welded, cleans them and sets joints together with clamps or any other suitable device. Starts welding power source and regulates current according to material and thickness of welding. Connect one lead to part to be welded, selects required type of electrode and clamps other lead to electrode holder. May join parts first at various points for holding at specified angles, shape, form and dimension by tack welding. Establish arc between electrode and joint and maintain it throughout the length of the joint.

Welder, Resistance; sets up and operates resistance welding machine to join metal parts, according to blueprints, work orders, or oral instructions. Turns machine dials to set air and hydraulic pressure, amperage, and joining time, according to specified type of metal, weld, and assembly. May select, install, and adjust electrodes. Aligns work pieces, using square and rule. May hold pieces together manually, fasten into jigs, or secure with clamps to align in specified assembly position. Holds part between electrodes or positions on machine worktable. Depresses pedal or pulls trigger to close electrodes and form weld at point of contact. Releases pedal or trigger after specified welding time. Cleans electrodes, using file, tip dresser, emery cloth. May operate machine which automatically releases electrodes from metal after welding cycle. May devise and build fixtures to hold pieces. May inspect finished work. May operate machine equipped with two or more electrodes which weld at several points simultaneously. Important variations include types of joints welded (seam, spot, butt) and types of materials welded (aluminium, steel).

Gas Cutting; cuts metal to require shape and size by gas flame either manually or by machine. Examines material to be cut and marks it according to instruction of specification. Makes necessary connections and fits required size of nozzle in welding torch. Releases and regulates flow of gas in nozzle, ignites and adjusts flame. Guides flame by hand or machine along cutting line at required speed and cuts metal to required size.



Brazer; joints metal parts by heating using flux and filler rods. Cleans and fastens parts to be joined face to face by wire brush. Apply flux on the joint and heats by torch to melt filler rods into joint. Allows it to cool down. Clean and examines the joint.

Tungsten Inert Gas (TIG) welder; reads fabrication drawing, examines parts to be welded, cleans them and sets joints with clamps or any other suitable device. Selects suitable tungsten electrode, grinds the edges and fit in to the GTA welding torch. Selects gas nozzle and fit in to the GTA welding torch. Selects suitable filler rods and cleans them. Connects work piece with earth cable, Connects the machine with Inert gas Cylinder, regulator and flow meter. Starts the Constant current GTA welding machine, sets suitable welding current & polarity and inert gas flow. Establish arc through across a column of highly ionized inert gas between work piece and Tungsten electrode. Melts the metal and deposit weld beads on metal surfaces by passing the suitable filler rod in to the weld puddle. Joins metal pieces such as Steel, Stainless steel and Aluminium metals.

Gas Metal Arc Welder/ Metal Inert Gas/ Metal Active Gas/ Gas Metal Welder (MIG/MAG/GMAW); reads fabrication drawing, examines parts to be welded, cleans them and sets joints with clamps or any other suitable device. Connects work piece with earth cable. Connects the machine with suitable gas Cylinder, regulator and flow meter. Connects pre-heater when CO₂ is used as shielding gas. Selects suitable wire electrode, feed it to welding GMA Welding torch through wire feeder. Selects contact tip gas nozzle and fit in to the GMA welding torch. Preheats joints as required. Starts the Constant Voltage GMA welding machine, sets suitable welding voltage & wire feed speed and shielding gas flow, produces arc between work piece and continuously fed wire electrode. Melts the metal and deposit weld beads on the surface of metals or joins metal pieces such as Steel, and Stainless-steel metals.

Iron and Steel Plasma Cutter- Manual; cuts different materials (mild carbon steel, stainless steel, aluminium, high tensile and special steels, and other materials) in various profiles. This involve setting-up and preparing operations interpreting the right information from the specification documents, obtaining the right consumables and other materials, etc.

Plan and organize assigned work and detect & resolve issues during execution in his own work area within defined limit. Demonstrate possible solutions and agree tasks within the team. Communicate with required clarity and understand technical English. Sensitive to environment, self-learning and productivity.

Reference NCO 2015:

- (i) 7212.0100 Welder, Gas
- (ii) 7212.0200 Welder, Electric
- (iii) 7212.0700 Welder, Resistance



- (iv) 7212.0400 Gas Cutter
- (v) 7212.0500 Brazer
- (vi) 7212.0105 Tungsten Inert Gas Welder
- (vii) 7212.0303 Gas Metal Arc Welder/ Metal Inert Gas/ Metal Active Gas/ Gas
- (viii) Metal Welder (MIG/MAG/GMAW)
- (ix) 7212.0111- Repair Welder
- (x) 7212.0402- Plasma Cutter Manual



4. GENERAL INFORMATION

Name of the Trade	Welder				
Trade Code	DGT/1004				
NCO - 2015	7212.0100, 7212.0200, 7212.0700,7212.0400, 7212.0500, 7212.0105, 7212.0303, 7212.0111, 7212.0402				
NSQF Level	Level – 4				
Duration of Craftsmen Training	One year (1600 Hours)				
Entry Qualification	Passed 8 th class examination				
Minimum Age	14 years as on first day of academic session.				
Eligibility for PwD	LD, LC, DW, AA, DEAF, HH				
Unit Strength (No. Of Student)	20 (There is no separate provision of supernumerary seats)				
Space Norms	80 Sq. m				
Power Norms	16 KW				
Instructors Qualification					
1. Welder Trade	B.Voc/Degree in Mechanical/ Metallurgy/ Production Engineering/ Mechatronics from AICTE /UGC recognized university/ college with one year experience in relevant field. OR 03 years Diploma in Mechanical and allied from AICTE/ recognized technical board of education or relevant Advanced Diploma (Vocational) from DGT with two years experience in relevant field. OR NTC/NAC passed in the Trade of "Welder" with three years' experience in the relevant field. Essential Qualification: Relevant National Craft Instructor Certificate (NCIC) in any of the variants under DGT. Note: Out of two Instructors required for the unit of 2(1+1), one must have Degree/Diploma and other must have NTC/NAC qualifications. However, both of them must possess NCIC in any of its variants.				
2. Workshop	B.Voc/Degree in Engineering from AICTE/UGC recognized				
Calculation & Science	Engineering College/ university with one-year experience in the relevant field.				
	OR O3 years Diploma in Engineering from AICTE/ recognized hoard of				
	03 years Diploma in Engineering from AICTE/ recognized board of				



				·	(Vocational) from			
		DGT with two years' experience in the relevant field.						
		OR NTC/ NAC in any one of the engineering trades with three years' experience.						
		•	Essential Qualification:					
		National Craft Instructor Certificate (NCIC) in relevant trade.						
				OR ,				
		NCIC in RoDA or any of its variants under DGT.						
3. Engineeri Drawing	ng		in Engineering ege/ university	from AICTE/L with one-year ex	•			
		OR						
		03 years Diploma in Engineering from AICTE/ recognized board of technical education or relevant Advanced Diploma (Vocational) from DGT with two years' experience in the relevant field.						
		OR						
		NTC/ NAC in any one of the Engineering trades with three years						
		experience.						
		Essential Qualification:						
		National Craft Ins	structor Certificat	e (NCIC) in releva	nt trade			
			_	OR "				
		· · · · · · · · · · · · · · · · · · ·		l) or any of its vari				
4. Employat	oility Skill			oloma in any dise	-			
				1 101 Course in Er	nployability Skills			
		from DGT institutes. (Must have studied English/ Communication Skills and Basic						
		(Must have studied English/ Communication Skills and Basic Computer at 12th / Diploma level and above) OR						
		Existing Social Studies Instructors in ITIs with short term ToT Course						
		in Employability Skills from DGT institutes.						
5. Minimum Age for		21 Years						
Instructor								
List of Tools a Equipment		As per Annexure – I						
		on Hourly basis: (I	1		_ , ,			
Total Hrs /week	Trade Practica	Trade I Theory	Workshop Cal. & Sc.	Engg. Drawing	Employability Skills			
40 Hours	25 Hours		2 Hours	2 Hours	4 Hours			
40 110013	25 Hours	7 110013	2 110013	2110013	4110013			



Learning outcomes are a reflection of total competencies of a trainee and assessment will be carried out as per the assessment criteria.

5.1 LEARNING OUTCOMES (TRADE SPECIFIC)

- 1. Set the gas welding plant and join MS sheet in different position following safety precautions. [Different position: 1F, 2F, 3F, 1G, 2G, 3G.]
- 2. Set the SMAW machine and perform different type of joints on MS in different position observing standard procedure. [different types of joints- Fillet (T-joint, lap & Corner), Butt (Square & V); different position 1F, 2F, 3F,4F, 1G, 2G, 3G, 4G]
- 3. Set the oxy- acetylene cutting plant and perform different cutting operations on MS plate. [Different cutting operation Straight, Bevel, circular]
- 4. Perform welding in different types of MS pipe joints by Gas welding (OAW). [Different types of MS pipe joints Butt, Elbow, T-joint, angle (45°) joint, flange joint]
- 5. Set the SMAW machine and perform welding in different types of MS pipe joints by SMAW. [Different types of MS pipe joints Butt, Elbow, T-joint, angle (45°) joint, flange joint]
- 6. Choose appropriate welding process and perform joining of different types of metals and check its correctness. [appropriate welding process OAW, SMAW; Different metal SS, CI, Brass, Aluminium]
- 7. Demonstrate arc gouging operation to rectify the weld joints.
- 8. Test welded joints by different methods of testing. [different methods of testing- Dye penetration test, Magnetic particle test, Nick break test, Free band test, Fillet fracture test]
- 9. Set GMAW machine and perform welding in different types of joints on MS sheet/plate by GMAW in various positions by dip mode of metal transfer. [different types of joints-Fillet (T-joint, lap, Corner), Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G]
- 10. Set the GTAW machine and perform welding by GTAW in different types of joints on different metals in different position and check correctness of the weld. [different types of joints- Fillet (T-joint, lap, Corner), Butt (Square & V); different metals- Aluminium, Stainless Steel; different position- 1F & 1G]
- 11. Perform Aluminium & MS pipe joint by GTAW in flat position.
- 12. Set the Plasma Arc cutting machine and cut ferrous & non-ferrous metals.
- 13. Set the resistance spot welding machine and join MS& SS sheet.
- 14. Perform joining of different similar and dissimilar metals by brazing operation as per standard procedure. [different similar and dissimilar metals- Copper, MS, SS]



- 15. Repair Cast Iron machine parts by selecting appropriate welding process. [Appropriate welding process- OAW, SMAW]
- 16. Hard facing of alloy steel components/ MS rod by using hard facing electrode.



	LEARNING OUTCOMES	ASSESSMENT CRITERIA			
1.	Set the gas welding plant and join MS sheet in different position following safety precautions. [Different position: - 1F, 2F, 3F, 1G, 2G, 3G.]	Plan and select the nozzle size, working pressure, type of flame, filler rod as per requirement. Prepare, set and tack the pieces as per drawing. Set up the tacked joint in specific position. Deposit the weld following proper welding technique and safety aspect. Carry out visual inspection to ascertain quality weld joint.			
2.	Set the SMAW machine and perform different type of joints on MS in different position observing standard procedure. [different types of joints- Fillet (T-joint, lap & Corner), Butt (Square & V); different position - 1F, 2F, 3F,4F, 1G, 2G, 3G, 4G]	Plan and select the type & size of electrode, welding current. Prepare edge as per requirement Prepare, set SMAW machine and tack the pieces as per drawing. Set up the tacked pieces in specific position. Deposit the weld maintaining appropriate arc length, electrode angle, welding speed, weaving technique and safety aspects. Clean the welded joint thoroughly. Carry out visual inspection for appropriate weld joint & check by gauges.			
3.	Set the oxy- acetylene cutting plant and perform different cutting operations on MS plate. [Different cutting operation – Straight, Bevel, circular]	Plan and mark on MS plate surface for straight/bevel/circular cutting. Select the nozzle size and working pressure of gases as per requirement. Set the marked plate properly on cutting table. Set the cutting plant & perform the cutting operation maintaining proper techniques and all safety aspects. Clean the cutting burrs and inspect the cut surface for soundness of cutting.			
4.	Perform welding in different types of MS pipe joints by Gas welding (OAW).	pipe joint.			



	[Different types of MS pipe	Select the size of filler rod, size of nozzle, working		
	joints – Butt, Elbow, T-joint,	pressure etc.		
	angle (45°) joint, flange	Set and tack the pieces as per drawing.		
	joint]	Deposit the weld bead maintaining proper technique and		
		safety aspects.		
		Inspect the welded joint visually for poor penetration,		
		uniformity of bead and surface defects.		
5.	Set the SMAW machine and	Plan and prepare the development for a specific type of		
	perform welding in different	pipe joint.		
	types of MS pipe joints by	Mark and cut the MS pipe as per development.		
	SMAW. [Different types of	Select the electrode size and welding current for welding.		
	MS pipe joints – Butt,	Set and tack the pieces as per drawing.		
	Elbow, T-joint, angle (45°)	Deposit the weld bead maintaining proper technique and		
	joint, flange joint]	safety aspects.		
		Insect the welded joint visually for root penetration,		
		uniformity of bead and surface defects.		
6.	Choose appropriate welding	Plan and prepare the pieces for welding.		
	process and perform joining	Select the type and size of filler rod and flux/electrode,		
	of different types of metals	size of nozzle and gas pressure/welding current,		
	and check its correctness.	preheating method and temperature as per requirement.		
	[appropriate welding	Set and tack metals as per drawing.		
	process – OAW, SMAW; Different metal – SS, CI,	Deposit the weld maintaining appropriate technique and		
Brass, Aluminium]		safety aspects.		
	Diass, Alaminianij	Cool the welded joint by observing appropriate cooling		
		method. Use post heating, peening etc. as per		
		requirement.		
		Clean the joint and inspect the weld for its uniformity and		
		one and post and make an arrange and arrange a		
		different types of surface defects.		
		,		
7.	Demonstrate arc gouging	,		
7.	operation to rectify the	different types of surface defects.		
7.	0 0 0	different types of surface defects. Plan and select the size of electrode for Arc gouging.		
7.	operation to rectify the	Plan and select the size of electrode for Arc gouging. Select the polarity and current as per requirement.		
7.	operation to rectify the	Plan and select the size of electrode for Arc gouging. Select the polarity and current as per requirement. Perform gouging adapting proper gouging technique.		



resting. [different methods of testing- Dye penetration test, Magnetic particle test, Nick break test, Free band test, Fillet fracture test] 9. Set GMAW machine and perform welding in different types of joints on MS sheet/plate by GMAW in various positions by dip mode of metal transfer. [different types of joints-Fillet (T-joint, lap, Corner), Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G] Perform testing of welded joints adapting standard operating procedure. Record the test result & compare with standard parameter/ result value. Accept/reject the job based on test result. Select size of electrode wire, welding voltage, gas flow rate, wire feed rate as per requirement. Prepare, set (machine & Job) and tack the pieces as per drawing and type of joints. Set up the tacked joint in specific position. Deposit the weld adapting proper welding technique and safety aspects. Carry out visual inspection to ensure quality of welded joint. Inspect the weld using Dye-penetration Test (DPT)/Magnetic particle Test (MPT).
rest, Magnetic particle test, Nick break test, Free band test, Fillet fracture test] 9. Set GMAW machine and perform welding in different types of joints on MS sheet/plate by GMAW in various positions by dip mode of metal transfer. [different types of joints-Fillet (T-joint, lap, Corner), Butt (Square & V); various positions - 1F, 2F, 3F,4F, 1G, 2G, 3G] Record the test result & compare with standard parameter/ result value. Record the test result & compare with standard parameter/ result value. Record the test result & compare with standard parameter/ result value. Record the test result & compare with standard parameter/ result value. Record the test result & compare with standard parameter/ result value. Record the test result & compare with standard parameter/ result value. Record the test result & compare with standard parameter/ result value. Record the test result & compare with standard parameter/ result value. Record the test result & compare with standard parameter/ result value. Record the test result & compare with standard parameter/ result value. Record the test result & compare with standard parameter/ result value. Record the test result & compare with standard parameter/ result value. Record the test result & compare with standard parameter/ result value. Record the test result & compare with standard parameter/ result value. Record the test result & compare with standard parameter/ result value. Record the test result & compared to parameter/ result value. Record the test result & compared to parameter/ result value. Record the test result & compared to parameter/ result value. Record the test result alles.
Nick break test, Free band test, Fillet fracture test] 9. Set GMAW machine and perform welding in different types of joints on MS sheet/plate by GMAW in various positions by dip mode of metal transfer. [different types of joints-Fillet (T-joint, lap, Corner), Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G] Set GMAW machine and perform welding in different types of joints on MS sheet/plate by GMAW in various positions by dip mode of metal transfer. [different types of joints-Fillet (T-joint, lap, Corner), Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G] To Set the GTAW machine and Select power source as per material, size and type of samples with standard parameter/ result value. Accept/reject the job based on test result. Select size of electrode wire, welding voltage, gas flow rate, wire feed rate as per requirement. Prepare, set (machine & Job) and tack the pieces as per drawing and type of joints. Set up the tacked joint in specific position. Deposit the weld adapting proper welding technique and safety aspects. Carry out visual inspection to ensure quality of welded joint. Inspect the job based on test result.
Set GMAW machine and perform welding in different types of joints on MS sheet/plate by GMAW in various positions by dip mode of metal transfer. [different types of joints-Fillet (T-joint, lap, Corner), Butt (Square & V); various positions - 1F, 2F, 3F,4F, 1G, 2G, 3G] Set GMAW machine and Select size of electrode wire, welding voltage, gas flow rate, wire feed rate as per requirement. Prepare, set (machine & Job) and tack the pieces as per drawing and type of joints. Set up the tacked joint in specific position. Deposit the weld adapting proper welding technique and safety aspects. Carry out visual inspection to ensure quality of welded joint. Inspect the weld using Dye-penetration Test (DPT)/Magnetic particle Test (MPT).
9. Set GMAW machine and perform welding in different types of joints on MS sheet/plate by GMAW in various positions by dip mode of metal transfer. [different types of joints-Fillet (T-joint, lap, Corner), Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G] Select size of electrode wire, welding voltage, gas flow rate, wire feed rate as per requirement. Prepare, set (machine & Job) and tack the pieces as per drawing and type of joints. Set up the tacked joint in specific position. Deposit the weld adapting proper welding technique and safety aspects. Carry out visual inspection to ensure quality of welded joint. Inspect the weld using Dye-penetration Test (DPT)/Magnetic particle Test (MPT).
perform welding in different types of joints on MS sheet/plate by GMAW in various positions by dip mode of metal transfer. [different types of joints-Fillet (T-joint, lap, Corner), Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G] Tate, wire feed rate as per requirement. Prepare, set (machine & Job) and tack the pieces as per drawing and type of joints. Set up the tacked joint in specific position. Deposit the weld adapting proper welding technique and safety aspects. Carry out visual inspection to ensure quality of welded joint. Inspect the weld using Dye-penetration Test (DPT)/Magnetic particle Test (MPT).
perform welding in different types of joints on MS sheet/plate by GMAW in various positions by dip mode of metal transfer. [different types of joints-Fillet (T-joint, lap, Corner), Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G] Tate, wire feed rate as per requirement. Prepare, set (machine & Job) and tack the pieces as per drawing and type of joints. Set up the tacked joint in specific position. Deposit the weld adapting proper welding technique and safety aspects. Carry out visual inspection to ensure quality of welded joint. Inspect the weld using Dye-penetration Test (DPT)/Magnetic particle Test (MPT).
types of joints on MS sheet/plate by GMAW in various positions by dip mode of metal transfer. [different types of joints-Fillet (T-joint, lap, Corner), Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G] The prepare, set (machine & Job) and tack the pieces as per drawing and type of joints. Set up the tacked joint in specific position. Deposit the weld adapting proper welding technique and safety aspects. Carry out visual inspection to ensure quality of welded joint. Inspect the weld using Dye-penetration Test (DPT)/Magnetic particle Test (MPT).
sheet/plate by GMAW in various positions by dip mode of metal transfer. [different types of joints-Fillet (T-joint, lap, Corner), Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G] To Set the GTAW machine and Select power source as per material, size and type of joints. Set up the tacked joint in specific position. Deposit the weld adapting proper welding technique and safety aspects. Carry out visual inspection to ensure quality of welded joint. Inspect the weld using Dye-penetration Test (DPT)/Magnetic particle Test (MPT).
various positions by dip mode of metal transfer. [different types of joints-Fillet (T-joint, lap, Corner), Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G] 10. Set the GTAW machine and Select power source as per material, size and type of
mode of metal transfer. [different types of joints- Fillet (T-joint, lap, Corner), Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G] To Set the GTAW machine and Select power source as per material, size and type of
[different types of joints-Fillet (T-joint, lap, Corner), Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G] [Deposit the Weld adapting proper welding technique and safety aspects. Carry out visual inspection to ensure quality of welded joint. Inspect the weld using Dye-penetration Test (DPT)/Magnetic particle Test (MPT).
Fillet (T-joint, lap, Corner), Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G] Inspect the weld using Dye-penetration Test (DPT)/Magnetic particle Test (MPT).
Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G] Carry out visual inspection to ensure quality of welded joint. Inspect the weld using Dye-penetration Test (DPT)/Magnetic particle Test (MPT). 10. Set the GTAW machine and Select power source as per material, size and type of
positions- 1F, 2F, 3F,4F, 1G, 2G, 3G] Inspect the weld using Dye-penetration Test (DPT)/Magnetic particle Test (MPT). 10. Set the GTAW machine and Select power source as per material, size and type of
2G, 3G] Inspect the weld using Dye-penetration Test (DPT)/Magnetic particle Test (MPT). 10. Set the GTAW machine and Select power source as per material, size and type of
(DPT)/Magnetic particle Test (MPT). 10. Set the GTAW machine and Select power source as per material, size and type of
porform wolding by CTAM T and a destroit and the account and the contract of
perform welding by GTAW Tungsten electrode, welding current, gas nozzle size, gas
in different types of joints flow rate and filler rod size as per requirement.
on different metals in Prepare, set (machine & Job) and tack the pieces as per
different position and check drawing and type of joints.
correctness of the weld. Set up the tacked joint in specific position.
[different types of joints- Fillet (T-joint, lap, Corner), Deposit the weld by adapting proper welding technique
Butt (Square & V); different and safety aspects.
metals- Aluminium, Carry out visual inspection to ensure quality of welded
Stainless Steel; different joint.
position- 1F & 1G] Inspect the weld using Dye-penetration Test
(DPT)/Magnetic particle Test (MPT).
11. Perform Aluminium & MS Plan and prepare development or edge preparation for
pipe joint by GTAW in flat specific type of pipe joint.
position. Mark and cut the MS pipe as per development.
Select the type of welding current, size and type of
tungsten electrode, size of nozzle, gas flow rate and



	welding current as per requirement.		
	Set and tack the piece as per drawing.		
	Deposit the weld bead maintaining proper technique and		
	safety aspects.		
	Inspect the welded joint visually for root penetration,		
	bead uniformity and surface defects.		
	ı ·		
12. Set the Plasma Arc cutting	Plan and mark on Ferrous/Non ferrous metal plates		
machine and cut ferrous	surface for plasma cutting.		
&non-ferrous metals.	Select the torch/nozzle size, current and working pressure		
	of gas as per requirement.		
	Set the marked plate properly on cutting table.		
	Set the plasma cutting machine and perform the cutting		
	operation by adapting proper techniques and safety		
	aspects.		
	Clean and inspect the cut surface for quality of cutting.		
	clean and inspect the cut surface for quanty or cutting.		
13. Set the resistance spot	Plan and select the material and clean the surface		
welding machine and join	thoroughly.		
MS & SS sheet.	Set the spot welding parameters on machine.		
	·		
	Spot weld the joint adapting appropriate techniques and safety.		
	Inspect the joint for soundness of weld.		
	inspect the joint for soundness of weld.		
14. Perform joining of different	Plan and select the nozzle size, working pressure type of		
similar and dissimilar metals	flame, filler rod and flux as per requirement.		
by brazing operation as per	· · ·		
standard procedure.	Prepare, set and tack the pieces as per drawing.		
[different similar and	Braze the joint adapting proper brazing technique and		
dissimilar metals- Copper,	safety aspect.		
MS, SS]	Carry out visual inspection to ascertain quality weld joint.		
15. Repair Cast Iron machine	Plan and prepare the job as per requirement.		
parts by selecting	Select the type & size of electrode, power source, polarity,		
appropriate welding	welding current as per requirement.		
process. [Appropriate	Set the part properly.		
welding process- OAW,	Deposit the weld adapting appropriate welding technique		
	and safety aspects.		
	<i>i</i> 1		



SMAW]	Clean the welded joint thoroughly.
	Carry out visual inspection to ascertain quality of weld
	joint.
16. Hard facing of alloy steel	Plan and prepare the component by cleaning the surface
components / MS rod by	thoroughly.
using hard facing electrode.	Select the type & size of electrode, power source, welding
	current as per requirement.
	Deposit the weld observing standard practice and safety.
	Clean the welded surface thoroughly.
	Carryout visual inspection to ascertain quality of weld.



SYLLABUS - WELDER

	ЭΛТІ			VEAD
DUI	NAH	IUIV: 1	JINE	YEAR

		DURAT	ION	: ONE YEAR	
Duration	Reference Learning Outcome	Process code		Professional Skills (Trade Practical) With Indicative Hrs.	Professional Knowledge (Trade Theory)
Professional	Set the gas welding		1.	Demonstration of	- Importance of trade
Skill 50 Hrs;	plant and join MS			Machinery used in the	
Professional	sheet in different			trade. (6 hrs.)	- General discipline in the
Knowledge	position following		2.	Identification to safety	
14 Hrs	safety precautions.			equipment and their	•
	[Different position: -			use etc. (4 hrs.)	- Importance of Welding in
	1F, 2F, 3F, 1G, 2G,		3.	Hack sawing, filing	•
	3G.]			square to dimensions.	
	Cot the CMANN		,	(7 hrs.)	Shielded Metal Arc
	Set the SMAW machine and perform		4.	Marking out on MS plate and punching. (8	,
	different type of joints			hrs.)	Acetylene Welding and Cutting.
	on MS in different			1113.)	(07 hrs)
	position observing		5.	Setting of oxy-acetylene	- Introduction and definition
	standard procedure.	OAW-01		welding equipment,	
	[different types of				- Arc and Gas Welding
	joints- Fillet (T-joint,			flame. (5 hrs.)	Equipments, tools and
	lap & Corner), Butt		6.	Perform fusion run	accessories.
	(Square & V); different	SMAW-01		without filler rod on MS	- Various Welding Processes
	position - 1F, 2F,			sheet 2mm thick in flat	and its applications.
	3F,4F, 1G, 2G, 3G, 4G]			position. (5 hrs.)	- Arc and Gas Welding terms
			7.	Setting up of Arc	
				welding machine &	(07 hrs)
				accessories and striking	
				an arc. (5 hrs.)	
			8.	Deposit straight line	
				bead on MS plate in flat	
				position. (10 hrs.)	



Professional Skill 25 Hrs; Professional Knowledge 07 Hrs	Set the gas welding plant and join MS sheet in different position following safety precautions. [Different position: -1F, 2F, 3F, 1G, 2G, 3G.]	OAW-02	 Depositing bead with filler rod on M.S. sheet mm thick in flat position. (10 hrs.) Edge joint on MS sheet mm thick in flat position without filler rod. (15 hrs.) 	 Different process of metal joining methods: Bolting, riveting, soldering, brazing, seaming etc. Types of welding joints and its applications. Edge preparation and fit up for different thickness. Surface Cleaning (07 hrs)
Professional	Set the SMAW	SMAW-02	11. Straight line beads on	- Basic electricity applicable
Skill 25 Hrs; Professional Knowledge 07 Hrs	machine and perform different type of joints on MS in different position observing standard procedure. [different types of joints- Fillet (T-joint, lap & Corner), Butt (Square & V); different position - 1F, 2F,	SMAW-03	M.S. plate 10 mm thick in flat position. (10 hrs.) 12. Weaved bead on M. S plate 10mm thick in flat position. (15 hrs.)	to arc welding and related electrical terms &definitions. - Heat and temperature and its terms related to welding - Principle of arc welding. And characteristics of arc. (07 hrs)
Professional	3F,4F, 1G, 2G, 3G, 4G] Set the oxy- acetylene	OAGC-01	13. Setting up of oxy-	- Common gases used for
Skill 25 Hrs; Professional Knowledge 07 Hrs	cutting plant and perform different cutting operations on MS plate. [Different cutting operation –	OAGC-02	acetylene and make straight cuts (freehand) (2 hrs.) 14. Perform marking and straight line cutting of	welding & cutting, flame temperatures and uses Chemistry of oxy-acetylene flame.
	Straight, Bevel,		MS plate 10 mm thick	flames and uses.



	circular]		by gas. Accuracy within	- Oxy-Acetylene Cuttin	ıg
			±2mm. (4 hrs.)	Equipment principle	e,
		OAGC-03	15. Beveling of MS plates	parameters an	ıd
			10 mm thick, cutting	application.	
			regular geometrical	(07 hrs)	
			shapes and irregular		
			shapes, cutting		
			chamfers by gas cutting.		
			(7 hrs.)		
		OAGC-04	16. Circular gas cutting on		
			MS plate 10 mm thick		
			by <i>profile</i> cutting		
			machine.(7 hrs.)		
		OAGC-05	17. Marking and perform		
			radial cuts, cutting out		
			holes using oxy-		
			acetylene gas cutting.(3		
			hrs.)		
		OAGC-06	18. Identify cutting defects		
			viz., distortion, grooved,		
			fluted or ragged cuts;		
			poor draglines; rounded		
			edges; tightly adhering		
			slag.(2 hrs.)		
Professional	Set the gas welding	OAW-04	19. Square butt joint on	- Arc welding power	∍r
Skill 150 Hrs;	plant and join MS		M.S. sheet 2 mm thick	sources: Transforme	r,
Drofossional	sheet in different		in flat Position. (1G) (9	Motor Generator se	t,
Professional	position following		hrs.)	Rectifier and Inverter typ	e
Knowledge	safety precautions.		20. Fillet "T" joint on M.S.	welding machines and it	ts
42 Hrs	[Different position: -	SMAW-04	Plate 10 mm thick in flat	care & maintenance	
	1F, 2F, 3F, 1G, 2G,		position. (1F) (7 hrs.)	- Advantages an	ıd
	3G.]		21. Open corner joint on	disadvantages of A.C. an	ıd
		OAW-05	MS sheet 2 mm thick in	D.C. welding machines	
	Set the SMAW		flat Position (1F)(9 hrs.)	(06 hrs)	
	machine and perform	SMAW-05	22. Fillet lap joint on M.S.	- Welding positions as pe	∍r
	different type of joints		plate 10 mm thick in flat	EN &ASME: flat, horizonta	ıl,
	on MS in different		position. (1F) (7 hrs.)	vertical and over hea	d
	position observing	OAW-06	23. Fillet "T" joint on MS	position.	



standard procedure.		sheet 2 mm thick in flat	- Weld slope and rotation.
[different types of		position. (1F) (7 hrs.)	- Welding symbols as per BIS
joints- Fillet (T-joint,	SMAW-06	24. Open Corner joint on	& AWS. (06 hrs)
lap & Corner), Butt		MS plate 10 mm thick in	
(Square & V); different		flat position. (1F)(8 hrs.)	
position - 1F, 2F,	OAW-07	25. Fillet Lap joint on MS	- Arc length – types – effects
3F,4F, 1G, 2G, 3G, 4G]		sheet 2 mm thick in flat	of arc length.
		position . (1F) (08 hrs.)	- Polarity: Types and
	SMAW-07	26. Single "V" Butt joint on	applications.
		MS plate 12 mm thick in	- Weld quality inspection,
		flat position (1G). (11	common welding mistakes
		hrs.)	and appearance of good
	I&T-01	27. Testing of weld joints by	and defective welds
		visual inspection. (1 hr.)	- Weld gauges & its uses.
		28. Inspection of welds by	(06 hrs)
		using weld gauges. (1	
		hr.)	
	OAW-08	29. Square Butt joint on	- Calcium carbide properties
		M.S. sheet. 2 mm thick	and uses.
		in Horizontal position.	- Acetylene gas properties
		(2G) (8 hrs.)	and generating methods.
	SMAW-08	30. Straight line beads and	- Acetylene gas Purifier,
		multi layer practice on	Hydraulic back pressure
		M.S. Plate 10 mm thick	valve and Flash back
		in Horizontal position.	arrestor.
		(4 hrs.)	(06hrs)
	SMAW-09	31. Fillet "T" joint on M.S.	
		plate 10 mm thick in	
		Horizontal position.	
		(2F) (7 hrs.)	
	OAW-09	32. Fillet Lap joint on M.S.	- Oxygen gas and its
		sheet 2 mm thick in	properties
		horizontal position	, ,
		(2F) (10 hrs.)	Air liquefaction.
		33. Fillet Lap joint on M.S.	- Charging process of oxygen
	SMAW-10	plate 10 mm thick in	and acetylene gases
		horizontal position. (11	- Oxygen and Dissolved
		hrs.) (2F)	Acetylene gas cylinders



				and Color coding for different gas cylinders.Gas regulators, types and uses.(06 hrs)
		OAW-10	34. Fusion run with filler rod in vertical position on 2mm thick M.S sheet. (7 hrs.)	- Oxy acetylene gas welding Systems (Low pressure and High pressure). Difference between gas
		OAW-11	35. Square Butt joint on M.S. sheet. 2 mm thick in vertical position	welding blow pipe(LP &HP) and gas cutting blow pipe - Gas welding techniques.
		SMAW-11	M.S. plate 12 mm thick in horizontal position	Rightward and Leftward techniques. (06 hrs)
		SMAW- 12	(2G). (8hrs.) 37. Weaved bead on M.S	- Arc blow – causes and
		OAW-12	Plate 10mm in vertical position.(7 hrs.) 38. Fillet "T" joint on M.S sheet 2 mm thick in	
		SMAW-13	vertical position. (3F)(7 hrs.) 39. Fillet "T" joint on M.S. plate 10 mm thick in vertical position. (3F)(8 hrs.)	distortion - Arc Welding defects, causes and Remedies. (06 hrs)
Professional	Set the SMAW	OAW-13	40. Structural pipe welding	- Specification of pipes,
Skill 100 Hrs;	machine and perform		butt joint on MS pipe Ø	various types of pipe
Professional Knowledge	different type of joints on MS in different	CNANALAA	50 and 3mm WT in 1G position. (15 hrs.)	joints, pipe welding all positions, and procedure.
28 Hrs	position observing standard procedure. [different types of joints- Fillet (T-joint,	SMAW-14	41. Fillet Lap joint on M.S. Plate 10 mm in vertical position. (3G) (10 hrs.)	- Difference between pipe welding and plate welding. (07 hrs)
	lap & Corner), Butt (Square & V); different	SMAW-15	42. Open Corner joint on MS plate 10 mm thick in	- Pipe development for Elbow joint, "T" joint, Y



	position - 1F, 2F,		vertical position. (2F)(10	joint and branch joint
	3F,4F, 1G, 2G, 3G, 4G]		hrs.)	- Manifold system
		OAW-14	43. Pipe welding - Elbow	(07 hrs)
			joint on MS pipe Ø 50	
	Perform welding in		and 3mm WT. (1G) (15	
	different types of MS		hrs.)	
	pipe joints by Gas welding (OAW). [Different types of MS pipe joints – Butt,	OAW-15	44. Pipe welding "T" joint on MS pipe Ø 50 and 3mm WT. (1G) (10 hrs.)	 Gas welding filler rods, specifications and sizes. Gas welding fluxes – types and functions.
	Elbow, T-joint, angle (45°) joint, flange joint]	SMAW-16	45. Single "V" Butt joint on MS plate12 mm thick in vertical position (3G). (15 hrs.)	
		OAW-16	46. Pipe welding 45° angle joint on MS pipe Ø 50 and 3mm WT. (1G) (15 hrs.)	 Electrode: types, functions of flux, coating factor, sizes of electrode Coding of electrode as per BIS, AWS, Effects of moisture pick up.
		SMAW-17	47. Straight line beads on M.S. plate 10mm thick in over head position. (10 hrs.)	Storage and baking of electrodes.Special purpose electrodes and their applications.(07 hrs)
Professional Skill 75 Hrs; Professional Knowledge 21 Hrs	Set the SMAW machine and perform different type of joints on MS in different position observing standard procedure. [different types of	SMAW-18 SMAW-19	48. Pipe Flange joint on M.S plate with MS pipe Ø 50 mm X 3mm WT (1F)(15 hrs.) 49. Fillet "T" joint on M.S. plate 10 mm thick in	 Weldability of metals, importance of pre heating, post heating and maintenance of inter pass temperature. (07 hrs)
	joints- Fillet (T-joint, lap & Corner), Butt	CNANAL 22	over head position. (4F)(10 hrs.)	Classification of stand
	(Square & V); different position - 1F, 2F,	SMAW-20	50. Pipe welding butt joint on MS pipe Ø 50 and 5 mm WT. in 1G position.	Classification of steel.Welding of low, medium and high carbon steel and



	3F,4F, 1G, 2G, 3G, 4G]		(15 hrs.)	alloy steels.
		SMAW-21	51. Fillet Lap joint on M.S.	, (07 hrs)
			plate 10 mm thick in	,
	Set the SMAW		over head position.	
	machine and perform		(4G). (10 hrs.)	
	welding in different	SMAW-22	52. Single "V" Butt joint on	- Effects of alloying
	types of MS pipe		MS plate 10mm thick in	elements on steel
	joints by SMAW.		over head position(4G)	- Stainless steel types- weld
	[Different types of MS		(15 hrs.)	decay and weldability.
	pipe joints – Butt,	SMAW-23	53. Pipe butt joint on M. S.	(07 hrs)
	Elbow, T-joint, angle		pipe Ø 50mm WT 6mm	
	(45°) joint, flange		(1G Rolled).(10 hrs.)	
	joint]			
Professional	Choose appropriate	OAW-17	54. Square Butt joint on	- Brass – types – properties
Skill 25 Hrs;	welding process and		S.S. sheet. 2 mm thick	and welding methods.
Professional	perform joining of		in flat position. (1G) (8	- Copper – types –
Knowledge	different types of		hrs.)	properties and welding
07 Hrs	metals and check its	SMAW -24	55. Square Butt joint on S.S.	methods.
071113	correctness.		Sheet 2 mm thick in flat	(07 hrs)
	[appropriate welding		position. (1G) (8 hrs.)	
	process – OAW,	OAW-18	56. Square Butt joint on	
	SMAW; Different		Brass sheet 2 mm thick	
	metal — SS, CI, Brass,		in flat position. (1G) (9	
	Aluminium]		hrs.)	
Professional	Choose appropriate	OAW-19	' '	- Aluminium and its alloys,
Skill 25 Hrs;	welding process and		on M.S. sheet 2 mm	_ ' '
Professional	perform joining of	CB 4 A \ 4 \ 2 =	thick by brazing in flat	Welding methods
Knowledge	different types of	SMAW-25	position. (11 hrs.)	- Arc cutting & gouging,
07 Hrs	metals and check its		58. Single "V" butt joint C.I.	(07 hrs)
	correctness.	A C 04	plate 6mm thick in flat	
	[appropriate welding	AG-01	position. (1G)(11 hrs.)	
	process – OAW,		59. Arc gouging on MS plate	
	SMAW; Different		10 mm thick. (3 hrs.)	
	metal – SS, CI, Brass,			
	Aluminium]			
	Demonstrate arc			
	gauging operation to			



	rectify the weld joints.		
Professional Skill 25 Hrs; Professional Knowledge 07 Hrs	Choose appropriate welding process and perform joining of different types of metals and check its correctness. [appropriate welding process – OAW, SMAW; Different metal – SS, CI, Brass, Aluminium]	OAW-20	60. Square Butt joint on Aluminium sheet. 3 mm thick in flat position. (12 hrs.) 61. Bronze welding of cast iron (Single "V" butt joint) 6mm thick plate (1G).(13 hrs.)
Professional Skill 25 Hrs; Professional Knowledge 07 Hrs	Test welded joints by different methods of testing. [different methods of testing-Dye penetration test, Magnetic particle test, Nick break test, Free band test, Fillet fracture test]	I&T-02 I&T-03 I&T-04 I&T-05 I&T-06	62. Dye penetrant test. (5 - Types of Inspection hrs.) methods 63. Magnetic particle test. (5 chrs.) classification of destructive and NDT methods hrs.) - Welding economics and Cost estimation. (07 hrs.) chrs.)
Professional Skill 200 Hrs; Professional Knowledge 56 Hrs	Set GMAW machine and perform welding in different types of joints on MS sheet/plate by GMAW in various positions by dip mode of metal transfer. [different types of joints- Fillet (T-joint, lap, Corner), Butt (Square & V); various positions- 1F, 2F, 3F,4F, 1G, 2G, 3G]		 67. Introduction to safety equipment and their use etc. (2 hrs.) 68. Setting up of GMAW welding machine & accessories and striking an arc. (4 hrs.) 69. Depositing straight line beads on M.S Plate. (10 hrs.) 70. Fillet weld – "T" joint on M.S plate 10mm thick in flat position by 67. Metal Arc Welding and Gas Tungsten Arc welding. 68. Arc Welding and Gas Tungsten Arc welding. 69. Introduction to GMAW - equipment – accessories. 69. Various other names of the process. (MIG/MAG/CO₂ welding.) 60. Wetal Arc Welding and Gas Tungsten Arc welding. 61. Of MAW - equipment – accessories. 62. Various other names of the process. (MIG/MAG/CO₂ welding.) 69. Depositing straight on M.S plate 10mm thick in flat position by



		Dip transfer. (1F) (4	
		hrs.)	
GMAW -03	71.	Fillet weld – Lap joint	- Advantages of GMAW
		on M.S. sheet 3mm	welding over SMAW ,
		thick in flat position by	limitations and
		Dip transfer. (1F) (5	applications
		hrs.)	- Process variables of
GMAW -04	72.	Fillet weld – "T" joint	GMAW.
		on M.S. sheet 3mm	- Modes of metal transfer –
		thick in flat position by	dip or short circuiting
		Dip transfer. (1F)	transfer, spray transfer
		(5hrs.)	(free flight transfer) and
GMAW -05	73.	Fillet weld – corner	globular transfer
		joint on M.S. sheet	(intermittent transfer) and
		3mm thick in flat	Pulsed metal transfer.
		position by Dip	(05 hrs)
		transfer. (1F)(5 hrs.)	
GMAW -06	74.	Butt weld – Square	- Wire feed system – types –
		butt joint on M.S	care and maintenance.
		sheet 3mm thick in	- Welding wires used in
		flat position (1G) (07	GMAW, standard
		hrs.)	diameter and codification
GMAW -07	75.	Butt weld – Single "V"	as per AWS.
		butt joint on M.S plate	(05 hrs)
		10 mm thick by Dip	
		transfer in flat	
		position. (1G) (8	
		hrs.)	
GMAW -08	76.	Fillet weld – "T" joint	- Types of shielding gases
		on M.S plate 10mm	and gas mixtures used in
		thick in Horizontal	GMAW and its
		position by Dip	applications.
		transfer. (2F) (10	- Flux cored arc welding –
		hrs.)	description, advantage,
GMAW -09	77.	Fillet weld – corner	welding wires, coding as
		joint on M.S plate	per AWS.
		10mm thick in	(06 hrs)
		Horizontal position by	



		Dip transfer. (2F) (15	
GMAW -10	78.	hrs.) Fillet weld – "T" joint on M.S. sheet 3mm thick in Horizontal position by Dip transfer. (2F) (10 hrs.) Fillet weld – corner joint on M.S. sheet 3mm thick in Horizontal position by Dip transfer. (2F) (15 hrs.)	 Edge preparation of various thicknesses of metals for GMAW. GMAW defects, causes and remedies (07 hrs)
GMAW -12		Fillet weld – "T" joint on M.S plate 10mm thick in vertical position by Dip transfer. (3F) (10 hrs.) Fillet weld – corner joint on M.S plate 10mm thick in vertical position by dip	 Heat input and techniques of controlling heat input during welding. Heat distribution and effect of faster cooling (07 hrs)
GMAW -14		transfer. (3F) (15 hrs.) Fillet weld – Lap joint on M.S. sheet 3mm thick in vertical position by Dip transfer. (3F) (10 hrs.) Fillet weld – corner joint on M.S. sheet 3mm thick in vertical position by Dip transfer. (3F) (15 hrs.)	- Pre heating & Post Weld Heat Treatment - Use of temperature indicating crayons. (07 hrs)



		GMAW -16	84.	Fillet weld – Lap and	- Submerged arc welding
				"T" joint on M.S sheet	process –principles,
				3mm thick inover	equipment, advantages
				head position by Dip	and limitations
				transfer. (4F) (15	- Electro slag and Electro gas
		GMAW -17		hrs.)	welding processes-
			85.	Tee Joints on MS Pipe	principles, equipments,
				Ø 60 mm OD x 3 mm	advantages and
				WT 1G position – Arc	limitations.
				constant (Rolling) (10	(07 hrs)
				hrs.)	
		GMAW -18	86.	Depositing bead on	- Thermit welding process-
				S.S sheet in flat	types, principles,
				position. (10 hrs.)	equipments, Thermit
		GMAW -19	87.	Butt joint on Stainless	mixture types and
				steel 2 mm thick sheet	applications.
				in flat position by Dip	- Use of backing strips and
				transfer. (15 hrs.)	backing bars
					(07 hrs)
Professional	Set the GTAW	GTAW -01	88.	Depositing bead on	- GTAW process - brief
Skill 100 Hrs;	machine and perform			Aluminium sheet 2	description. Difference
Professional	welding by GTAW in			mm thick in flat	between AC and DC
Knowledge	different types of			position. (10 hrs.)	welding, equipments,
28 Hrs	joints on different	GTAW -02	89.	Square butt joint on	• • • • • • • • • • • • • • • • • • • •
201113	metals in different			Aluminium sheet	- Various other names of
	position and check			1.6mm thick in flat	the process (TIG, Argonarc)
	correctness of the			position. (15 hrs.)	- Power sources for GTAW -
	weld. [different types				AC &DC
	of joints- Fillet (T-				(07 hrs)
	joint, lap, Corner),	GTAW -03	90.	Fillet weld – "T" joint	- Tungsten electrodes –
	Butt (Square & V);			on Aluminium sheet	types & uses, sizes and
	different metals-			1.6 mm thick in flat	preparation
	Aluminium, Stainless			position. (1F) (10 hrs.)	- GTAW Torches- types,
	Steel; different	GTAW -04	91.	Fillet weld – Outside	parts and their functions
	position- 1F & 1G]			corner joint on	- GTAW filler rods and
				Aluminium sheet 2	selection criteria.
				mm thick in flat	(07 hrs)
				position. (1F) (15 hrs.)	



		GTAW -05	92.	Butt weld - Square butt joint on Stainless steel sheet 1.6 mm thick in flat position with purging gas (1G) (25 hrs.)	'
		GTAW -06	93.	Fillet weld – "T" joint on Stainless steel sheet 1.6 mm thick in flat position. (1F) (25 hrs.)	- Argon / Helium gas
Professional Skill 25 Hrs; Professional Knowledge 07 Hrs	Perform Aluminium & MS pipe joint by GTAW in flat position.	GTAW -07	94.	Pipe butt joint on Aluminium pipe Ø 50 mm x 3 mm WT in Flat position. (1G) (25 hrs.)	equipment and application
Professional Skill 25 Hrs; Professional Knowledge 07 Hrs	Perform Aluminium & MS pipe joint by GTAW in flat position. Set the Plasma Arc cutting machine and cut ferrous & nonferrous metals.	GTAW -08	95. 96.	"T" Joints on MS Pipe Ø 50 mm OD x 3 mm WT, position — Flat (1F) (15 hrs.) Straight cutting on ferrous and non ferrous (10 hrs.)	_ , ,
Professional Skill 25 Hrs; Professional Knowledge 07 Hrs	Set the resistance spot welding machine and join MS & SS sheet.	RW-01	97.	Lap joint on Stainless steel sheet by Resistance Spot welding. (10 hrs.) MS sheets joining by Resistance Spot welding (15 hrs.)	 Resistance welding process -types, principles, power sources and welding parameters. Applications and limitations. (07 hrs)
Professional	Perform joining of different similar and	OAW-01	99.	Square butt joint on Copper sheet 2mm	- Metalizing – types of metalizing principles,



Skill 50 Hrs;	dissimilar metals by		t	thick in flat position.	equipments, advantages
·	brazing operation as			(1G) (15 hrs.)	and applications
Professional	per standard	OAW-02			- Manual Oxy – acetylene
Knowledge	procedure. [different			MS sheet	powder coating process-
14 Hrs	similar and dissimilar		2	2mm thick in flat	principles of operation and
	metals- Copper, MS,		ı	position by	applications
	SS]			Brazing (1F) (10 hrs.)	
	-	OAW-03		Silver brazing on S.S	
				Sheet with copper	standards
			9	sheet "T" joint. (10	- Reading of assembly
			ŀ	hrs.)	drawing
		OAW-04	102. 9	Silver brazing on	- Welding Procedure
			(copper tube to tube.	Specification (WPS) and
			((15 hrs.)	Procedure Qualification
					Record (PQR)
					(07 hrs)
Professional	Repair Cast Iron	OAW - 05	103. I	Repair welding of	- Hard facing/ surfacing
Skill 25 Hrs;	machine parts by		ŀ	broken C.I. machine	necessity, surface
Professional	selecting appropriate		ı	parts by oxy-acetylene	preparation, various hard
Knowledge	welding process.		١	welding with C.I and	facing alloys and
07 Hrs	[Appropriate welding		ŀ	bronze filler rod. (10	advantages of hard facing.
07 HIS	process- OAW,		ŀ	hrs.)	(06 hrs)
	SMAW]	SMAW-01		Repair welding of	
				broken C.I machine	
	Hard facing of alloy		-	parts by C.I. electrode.	
	steel components /			(8 hrs.)	
	MS rod by using hard	SMAW-02	105. I	J	
	facing electrode.		-	practice on M.S round	
				rod Ø 25 mm by using	
				Hard facing electrode	
_	og / Droject work		i	in flat position. (7 hrs.)	

In-plant training / Project work

Broad area:

- a) Universal welding manipulator
- b) Metal rack
- c) Cylinder trolley with chain provision for locking
- d) Welding fixture for TIG- butt/ corner joint with purging facility



SYLLABUS FOR CORE SKILLS

- 1. Workshop Calculation & Science (Common for one year trades) (80 hrs)
- 2. Engineering Drawing (80 hrs)
- 3. Employability Skills (Common for all CTS trades) (160 hrs)

Learning outcomes, assessment criteria, syllabus and Tool List of Core Skills subjects which is common for a group of trades, provided separately in www.bharatskills.gov.in.



LIST OF TOOLS AND EQUIPMENT			
	WELDER (For batch of 20 Candidates)		
S No.	Name of the Tools& Equipment	Specification	Quantity
A. TRA	INEES TOOL KIT (For each additional u	nit trainees tool kit Sl. 1-15 is	required
additio	onally)		
1.	Welding helmet fiber		20+1 Nos.
2.	Welding hand shield fiber		20+1 Nos.
3.	Chipping hammer	with metal handle 250 Grams	20+1 Nos.
4.	Chisel cold	flat 19 mm x 150 mm	20+1 Nos.
5.	Centre punch	9 mm x 127 mm	20+1 Nos.
6.	Dividers	200 mm	20+1 Nos.
7.	Stainless steel rule	300mm	20+1 Nos.
8.	Scriber	150 mm double point	20+1 Nos.
9.	Flat Tongs	350mm long	20+1 Nos.
10.	Hack saw frame	fixed 300 mm	20+1 Nos.
11.	File half round	bastard 300 mm	20+1 Nos.
12.	File flat	350 mm bastard	20+1 Nos.
13.	Hammer ball pane	1 kg with handle	20+1 Nos.
14.	Tip Cleaner		20+1 Nos.
15.	Try square	6"	20+1 Nos.
B. INST	TRUMENTS AND GENERAL SHOP OUTF	IT - For 2 (1+1) units no additi	onal items are
require	ed		
TOOLS	& EQUIPMENT		
16.	Spindle key		4 Nos.
17.	Screw Driver	300mm blade and 250 mm blade	1 each
18.	Number punch	6 mm	2 set
19.	Letter punch	6 mm	2 set
20.	. Magnifying glass	100 mm dia.	2 Nos.
21.	Universal Weld measuring gauge		2 Nos.
22.	Earth clamp	600A	6 Nos.
23.	Spanner D.E.	6 mm to 32mm	2 sets
24.	C-Clamps	10 cm and 15 cm	2 each
25.	Hammer sledge	double faced 4 kg	1 No.
26.	S.S tape	5 meters flexible in case	1 No.
27.	Electrode holder	600 amps	6 Nos.
28.	H.P. Welding torch	with 5 nozzles	2 sets



29.	Oxygen Gas Pressure	regulator double stage	2 Nos.
30.	Acetylene Gas Pressure	regulator double stage	2 Nos.
31.	CO ₂ Gas pressure regulator	with flow meter	2 set
32.	Argon Gas pressure regulator	with flow meter	2 set
33.	Metal rack	182 cm x 152 cm x 45 cm	1 No.
34.	First Aid box		1 No.
35.	Steel lockers	with 8 Pigeon holes	2 Nos.
36.	Steel almirah / cupboard	J	2 Nos.
37.	Black board and easel with stand		1 No.
38.	Flash back arrester (torch mounted)		4 pairs
39.	Flash back arrester (cylinder mounted)		4 pairs
GENER	RAL SHOP OUTFIT		
		with all accessories	1 set
40.	Welding Transformer	(400A, OCV 60-100 V,	
		60% duty cycle)	
	Wolding Transformer (or) Invertor	with all accessories	1 set
41.	Welding Transformer (or) Inverter based welding machine	(300A, OCV 60 – 100 V,	
	based welding machine	60% duty cycle)	
42.	D.C Arc welding rectifiers set with all	(400 A. OCV 60 – 100 V,	1 sets
72.	accessories	60% duty cycle)	
		400A capacity with air	1 set
43.	GMAW welding machine	cooled torch, Regulator,	
		Gas pre-heater, Gas hose	
		and Standard accessories	
		with water cooled torch	1 set
4.4	AC/DC GTAW welding machine	300 A, Argon regulator,	
44.		Gas hose, water	
		circulating system and standard accessories.	
		with all accessories,	 1 set
45.	Air Plasma cutting equipment	capacity to cut 12 mm	T 2C!
45.	All Flashia cutting equipment	clear cut	
	Air compressor suitable for above air	olear cat	1 No.
46.	plasma cutting system.		1.101
47.	Auto Darkening Welding Helmet		2 Nos.
40	Spot welding machine	15 KVA with all	1 set
48.		accessories	
		capable of cutting Straight	1 set
49.	Portable gas cutting machine	& Circular with all	
		accessories	
50.	Pedestal grinder fitted with coarse	300 mm dia.	1 No.
50.	reacstar Brilliaci littea with coarse	500 mm dia.	I NO.



	and medium grain size grinding		
	wheels Bench grinder fitted with fine grain		1 No.
51.	size silicon carbide green grinding wheel	150 mm dia.	I NO.
52.	AG 4 Grinder		2 Nos.
53.	Suitable gas welding table	with fire bricks	2 Nos.
54.	Suitable Arc welding table	with positioner	6 Nos.
55.	Trolley for cylinder (H.P. Unit)		2 Nos.
56.	Hand shearing machine capacity	cut 6 mm sheets and flats	1 No.
57.	Power saw machine	14"	1 No.
58.	Portable drilling machine	(Cap. 6 mm)	1 No.
59.	Oven, electrode drying	0 to 350°C, 10 kg capacity	1 No.
		340x120x75 cm with 4	
60.	Work bench	bench vices of 150 mm	4 sets
		jaw opening	
61.	Oxy Acetylene Gas cutting blow pipe		2 sets
62.	Oxygen, Acetylene Cylinders **		2 each
63.	CO ₂ cylinder **		2 Nos.
64.	Argon gas cylinder **		2 Nos.
65.	Anvil 12 sq. inches working area with stand		1 No.
66.	Swage block		1 No.
67.	Die penetrant testing kit		1 set
68.	Magnetic particle testing Kit #		1 set
69.	Fire extinguishers (foam type and CO ₂		1. No.
	type)		
70.	Fire buckets with stand		4 Nos.
71.	Portable abrasive cut-off machine		1 No.
72.	Suitable Gas cutting table		1 No.
73.	Welding Simulators for		1 each
C. CON	SMAW/GTAW/GMAW ISUMABLE		(Optional)
74.	Leather Hand Gloves	14"	20 pairs
75.	Cotton hand Gloves	8"	20 pairs
76.	Leather Apron leather		20 Nos.
77.	S.S Wire brush	5 rows and 3 rows	20 Nos. each
78.	Leather hand sleeves	16"	20 pairs
79.	Safety boots for welders		20 pairs
80.	Leg guards leather		20 pairs
81.	Rubber hose clips	1/2"	20 Nos.



82.	Rubber hose oxygen	8 mm dia X 10 Mtr. long	2 Nos.
02.		as per BIS	
83.	Rubber hose acetylene	8 mm dia X 10 Mtr. long	2 Nos.
65.		as per BIS	
84.	Arc welding cables multi cored	400/ 600 amp as per BIS	45 mts. each
64.	copper		
85.	Arc welding single coloured glasses	108 mm x 82 mm x 3 mm.	34 Nos.
65.		DIN 11A &12 A	
86.	Arc welding plain glass	108 mm x 82 mm x 3 mm.	68 Nos.
87.	Gas welding Goggles	with Colour glass 3 or 4A	34 Nos.
67.		DIN	
88.	Safety goggles plain		34 Nos.
89.	Spark lighter		6 Nos.
90.	AG 4 Grinding wheels		10 Nos.
D. CLA	SS ROOM FURNITURE FOR TRADE THEO	RY	
91.	Instructor's table and Chair (Steel)		1 set
92.	Students chairs with writing pads		20 Nos.
93.	White board	size 1200mm X 900 mm	1 No.
	Instructor's laptop with latest		
94.	configuration pre-loaded with		1 No.
	operating system and MS Office		I NO.
	package.		_
95.	LCD projector with screen.		1 No.
96.	Welding Process, Inspection & codes	_	1 set each
96.	DVD/ CDs.		(optional)

Note:

- 1. ** Optionally Gas cylinders can also be hired as and when required.
- 2. # One machine per institute irrespective of number of units of welding trade is necessary.



The DGT sincerely acknowledges contributions of the Industries, State Directorates, Trade Experts, Domain Experts, trainers of ITIs, NSTIs, faculties from universities and all others who contributed in revising the curriculum. Special acknowledgement is extended by DGT to the following expert members who had contributed immensely in this curriculum.

	List of Expert members contributed/ participated for finalizing the course curriculum of Welder trade held on 12.01.17 at CSTARI, Kolkata		
S No.	Name & Designation Shri/Mr./Ms.	Organization	Remarks
1.	DEEPANKAR MALLICK,DDG (Trg.)	DGT, MSDE, New Delhi	Chairman
2.	H. V. SAMVATSAR,Director	CSTARI, Kolkata	Secretary (Trade Committee)
3.	NIRMALYA NATH, Asst. Director of Trg.	CSTARI, Kolkata	Member cum Co-coordinator
4.	RAJENDRA PRASAD, Director	DTE, Uttar Pradesh	Member
5.	R. N. BANDYOPADHAYA, OSD	Paschim Banga Society For Skill Development, Kolkata	Member
6.	SUMANTA MODAK, General Manager (Works)	EVEREADY Industries Pvt. Ltd. (Representative of <i>CII</i>)	Member
7.	S. D. SATISH CHANDRA, Manager (HR), Trg.	HAL – Koraput Division, Koraput, Odisha	Member
8.	SUMANTA CHATTERJEE, Addl. General Manager	BHEL, Power Sector ER	Member
9.	P. C. BHANDARI, Technical Advisor	J K Cement Ltd., Kanpur	Member
10.	SANJIT BHOWMICK, Asst. General Manager	Hindalco Industries Ltd., Belur Math, Howrah	Member
11.	DEBASHIS BHATTACHARYYA, JWM,/FTI	Rifle Factory, Ishapore, Ministry of Defence, Govt. India, WB	Member
12.	SATYABADI SATAPATHY, Training Officer	HAL – Koraput Division, Koraput, Odisha	Member
13.	PRABHAT SAMIR PAL, Jr. Manager	GRSE Ltd., Kolkata	Member
14.	JOYDEEP PAL MAJUMDER Asst. Work Manager	Rifle Factory, Ishapore, Ministry of Defence, Govt. India, WB	Member
15.	BHABANI PROSAD MONDAL CM/FTI	Rifle Factory, Ishapore, Ministry of Defence, Govt. India, WB	Member
16.	SUNIRMAL BASU, Asst. Inspecting Officer	Railway Workshop, Kanchrapara	Member



17.	K. L. KULI, Joint Director of Trg.	CSTARI, Kolkata	Member
18.	M. THAMIZHARASAN,	CSTARI, Kolkata	Member
	Joint Director of Trg.		
19.	SANJAY KUMAR, Joint Director of	CSTARI, Kolkata	Member
	Trg.		
20.	L. K. MUKHERJEE, Dy. Director of	CSTARI, Kolkata	Member
	Trg.		
21.	U. K. MALLICK, Dy. Director	DTE&T, Odisha	Member
22.	N. R. PATTANAIK, Principal	Govt. ITI Balasore, Odisha	Member
23.	DEEPAK KUMAR,SSE/Drg./C&W	Railway Workshop,	Member
		Kanchrapara	
24.	D. W. PATNE, Secretary	Association of Non Govt. ITI,	Member
		Maharastra	
25.	VIVEK CHAUDHARI, Principal	Ujjwal ITI Nashirabad, Dist-	Member
		Jalgoan, Maharastra	
26.	Fr. JOSE PADAMATTAM, Principal	Don Bosco Technical	Member
		Institute, Park Circus	
27.	SWAMI GUNINDRANANDA,	R. K. Mission Shilpayatan	Member
	Superintendent	Belurmath, Howrah	
28.	TAPAS SENGUPTA, Instructor	ITI Howrah Homes	Member
29.	DEBIPROSHAD SARKAR, Instructor	ITI Howrah Homes	Member
30.	G. B. KOLAPATE, Instructor	Govt. ITI Andhari, Mumbai,	Member
		Maharastra	
31.	H. B. KOSHTI, Craft Instructor	Govt. ITI Byculla, Mumbai -	Member
		400011	
32.	N. B. NARKAR, Craft Instructor	ITI Ambernath, Thane,	Member
		Maharastra	
33.	PARTHA SARKAR, Jr.	Railway Workshop,	Member
	Engineer/Drawing (Mech.)	Kanchrapara	
34.	S. K. BHATTACHARYA,	STC/KPA, Eastern Railways,	Member
	Instructor	Kanchrapara	
35.	BIKASH CHAUDHURI, Instructor	Ramakrishna Mission	Member
		Shilpayatan, Belur, Howah	
36.	SACHIN M. LAMSE, Instructor	ITI Aundh, Pune, Maharastra	Member
37.	SOMNATH B. SAPKAL, Instructor	ITI Anudh, Pune, Maharastra	Member
38.	K. K. PANIGRAHI, Instructor	Gun Shell Factory, Cossipore	Member
39.	TARAKNATH GARAI, Instructor	ITI Howrah Homes	Member
40.	SUDHANGSHU MUKHERJEE,	Eastern Railway,	Member
	Sr. Tech./Dy. CEE/KPN	Kanchrapara	
41.	S. N. TAMBATKAR,	Govt. ITI, Adheri, Mumbai	Member
	Craft Instructor		



SI. No.	Name & Designation Sh/Mr./Ms.	Organization	Mentor Council Designation
Memb	Members of Sector Mentor council		
1.	Dr. G. Buvanashekaran	AGM, WRI, Trichy - Chairman	Chairman
2.	Dr. K. Ashok kumar	AGM, BHEL, Trichy	Member
3.	Prof. Jyothi Mukhopadhya	IIT, Ahmedabad	Member
4.	B. Pattabhiraman	MD, GB Engineering, Tricgy	Member
5.	Dr. Rajeev Kumar	IIT, Mandi	Member
6.	Dr. Vishalchauhan	IIT, Mandi	Member
7.	D.K. Singh	IIT, Kanpur	Member
8.	Navneet Arora	IIT, Roorkee	Member
9.	R. K. Sharma	Head, SDC, JBM Group, Faridabad	Member
10.	Puneet Sinha	Deputy Director, MSME, New Delhi	Member
Mento	or		
11.	Deepankar Mallick	Director of Training, DGE&T Hq,	Mentor
Memb	pers of Core Group	114,	
12.	M Thamizharasan	JDT, CSTARI, Kolkata	Member
13.	M Kumaravel	DDT, FTI , Bangalore	Team Leader
14.	Sushil Kumar	DDT, DGE&T Hq,	Member
15.	S.P. Khatokar	T.O. ATI, Mumbai	Member
16.	V.L. Ponmozhi	TO, CTI, Chennai	Member
17.	D. Pani	TO, ATI, Howrah	Member
18.	Amar Singh	TO, ATI, Ludhiana	Member
19.	Gopalakrishnan	TO, NIMI, Chennai	Member
20.	Manjunatha B.S	JTO, GITI, K.G.F. Karnataka	Member
21.	Venugopal PC	ITI Chalakudi, Kerala	Member



ABBREVIATIONS

CTS	Craftsmen Training Scheme
ATS	Apprenticeship Training Scheme
CITS	Craft Instructor Training Scheme
DGT	Directorate General of Training
MSDE	Ministry of Skill Development and Entrepreneurship
NTC	National Trade Certificate
NAC	National Apprentice Certificate
NCIC	National Craft Instructor Certificate
LD	Locomotor Disability
СР	Cerebral Palsy
MD	Multiple Disabilities
LV	Low Vision
НН	Hard of Hearing
ID	Intellectual Disabilities
LC	Leprosy Cured
SLD	Specific Learning Disabilities
DW	Dwarfism
MI	Mental Illness
AA	Acid Attack
PwD	Person with disabilities
SMAW	Shielded Metal Arc Welding
OAW	Oxy-Acetylene Gas Welding
OAG C	Oxy-Acetylene Gas Cutting
GMAW	Gas Metal Arc Welding
GTAW	Gas Tungsten Arc Welding
PAC	Plasma Arc Cutting
RW	Resistance Welding
OAW	Oxy-Acetylene Gas Welding
OAG C	Oxy-Acetylene Gas Cutting
I&T	Inspection & Testing
WT	Wall Thickness.



