Inspection Report

Provided by:



Interior Exterior Home Inspection, Inc.

Inspector:Seth Larman Lic# 70002235 PO Box 639 Choctaw, OK 73020 Phone: (405) 534-7366 Email: seth@inexhomeinspection.com

> Property Address Sample Report



Table Of Contents:

Section name:

Page number:

Report Information	.3
Report Summary Page	. 5
Grounds	.7
Roofing	.7
Exterior	10
Foundation - Crawl Space	13
Heating - Air1	14
Electrical	16
Plumbing1	18
_iving Room	20
Hallways	21
Rear Entrance Room	23
Kitchen	24
_aundry Room	25
Hallway Bathroom	26
Master Bathroom	28
	30
	32
Southeast Bedroom	33

Report Information

South.

Client Information

Client Name	Sample Report
Client Agent	Sample Report
Property Information	
Approximate Year Built	1927
Approximate Square Footage	1656
Number of Bedroom	3
Number of Bath	2

Direction House Faces

Inspection Information

Inspection Date	10/1/2020
Inspection Time	3:00 PM
Weather Conditions	Dry.
Outside Temperature	56
Personal Present at Inspection	Agent Buyer Seller

OBJECTIVE EVALUATION

A general home inspection is an objective evaluation performed by a licensed home inspector regarding readily accessible systems and components of the home as they exist at the time of this inspection. The inspector is limited by time constraints and limited disclosure, if any, of previous concerns or defects which may or may not be known by the seller. The inspector also cannot predict the failure of aging systems or components. While every attempt is made by the inspector to access and visually inspect all items and systems required by the Oklahoma State Statures regarding home inspector performance, not all defects will be detected and as such may not be reported as part of the general home inspection. The buyer is advised to budget for possible future repairs and maintenance which would typically be associated with homeownership.

MOLD EXCLUSION

Interior Exterior Home Inspection is not responsible for discovering or reporting on the presence of mold or mildew. Furthermore, we are not responsible for any damages that arise from mold or mildew. Per the Home Inspectors act c 70 "The inspector is not required to determine the presence of potentially hazardous plants or animals including, but not limited to wood destroying organisms, mold, mildew, fungi or diseases harmful to humans"

ENVIRONMENTAL CONCERNS

Environmental issues include but are not limited to radon, fungi/mold, asbestos, lead paint, lead contamination, toxic waste, formaldehyde, electromagnetic radiation, buried fuel oil tanks, groundwater contamination, and soil contamination. We are not trained or licensed to recognize or discuss any of these materials. We may make reference to one or more of these materials in this report when we recognize one of the common forms of these substances. If further study or analysis seems prudent, the advice and services of the appropriate specialists are advised.

Throughout the report, you'll find special symbols at certain comments. Below are the symbols and their meanings.

IN = Inspected: Visually observed the item, component, or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

R = Repair: The item was at or near the end of its useful lifespan. A certified professional should be contacted for further evaluation and repair.

S = Safety Issue: The item is considered a safety hazard and can cause harm to people or property. These items need to be repaired as soon as possible.

NI = Not Inspected: The item was not inspected during the inspection.

Report Summary Page

This is a summary review of the inspector's findings during this inspection. However, it does not contain every detailed observation. This is provided as an additional service to our client and is presented in the form of a listing of the items which, in the opinion of your inspector, merit further attention, investigation, or improvement. Some of these conditions are of such a nature as to require repair or modification by a skilled craftsman, technician, or specialist. Others can be easily handled by a homeowner such as yourself. Often, following the inspector's advice will result in improved performance and/or extended life of the component(s) in question. In listing these items, your inspector is not offering any opinion as to who, among the parties to this transaction, should take responsibility for addressing any of these concerns. As with most of the facets of your transaction, we recommend consultation with your Real Estate Professional for further advice with regards to the following items:

we recommend consultation	on with your Rea	I Estate Professional for further advice with regards to the following items:
Section	Condition#	Comment
		Roofing
Attic Conditions	2.7	Attic access has no door/panel to close the attic from the bedroom. Recommend correction.
		Exterior
Exterior Wall	3.3	 An open hole on the exterior siding was observed. Recommend sealing the hole
Conditions		to prevent water and bugs from entering the home.
		 Recommend adding a flexible sealant to the expansion gap on the west side of
		the home.
Exterior Door Conditions	3.8	Front and rear exterior door contacts the floor when closing. This will cause the floor to wear out in these areas. Recommend adjusting the doors.
		Foundation - Crawl Space
Foundation Conditions	s 4.1	The area under the hallway bathroom had moisture and organic growth. A leaking pipe was observed in this area. It is suggested that a "Licensed Plumbing Contractor be contacted for further evaluation and repair.
		Electrical
Electrical Panel Conditions	6.3	The inspector was unable to determine the amperage due to no main breaker present. Today's standards require main breakers.
		Plumbing
Water Heater	7.4	• T P R (temperature pressure relief) valve overflow pipe was missing at the time
Conditions		of the inspection. Recommend the installation of an extension pipe for increased
		safety.
		• The water heater was operable at the time of inspection. This does not howeve
		guarantee future performance, operation, or condition. The hot water tank MFG
		date is 2014. The average lifespan of an electric water heater is 10-12 years.
		Hallways
Floor Conditions	9.3	No transition installed between the carpet and tile floors. This could allow for the tile to chip prematurely. Recommend installing a transition to this area.
		Master Bathroom

Report Summary Page			
Sink Conditions	14.10	There was no cold water supply in bathroom. Inspector was unable to test or inspect. It is suggested that a "Licensed Plumbing Contractor" be contacted for further evaluation and repair.	
Master Bedroom			
Floor Condition	15.3	No transition installed between the carpet and tile floors. This could allow for the tile to chip prematurely. Recommend installing a transition to this area.	
Door Condition	15.4	The door sticks at the doorframe in the master bedroom. Repairs and/or adjustments are recommended.	

1 Grounds Grading The site is flat. **Grading Slope** 1.1) Grading Conditions IN Grading of the soil near the foundation appears to be in serviceable condition. Driveways - Sidewalks - Walkways **Driveway Material** Concrete. 1.2) Driveway Conditions IN The driveway appeared to be in serviceable condition at the time of the inspection. 2 Roofing **Roof Covering** The roof was inspected by walking the safe and accessible areas. Method of Inspection **Roof Style** Gable. Architectural Asphalt Shingles **Roof Covering Material** One. Number of Layers 2.1) Roof Covering Condition

• Tree damage was observed on the roof. This is minor damage and isn't causing a leak. Recommend monitoring this area.

• Tree branches/leaves were in contact with the roof surface. Recommend trimming branches back to prevent potential roof damage.

• Debris was in the valley of the roof. Normal cleaning in the area is recommended to prevent organic growth from occurring.

• Moss covering was observed on the roof. While mostly cosmetic and not immediately harmful, this condition can indicate a moisture-related condition. This is a low lying area. Recommend correction to the area for proper water mitigation.



Minor tree damage to shingles



Trees contacting roof



Debris in valley

2.2) Flashing Conditions



IN

The exposed flashings appeared to be in serviceable condition at the time of inspection.

2.3) Roof Penetrations

The roof penetrations appear to be in serviceable condition during the inspection.

2.4) Gutter & Downspout Conditions

NI

The property has a no gutter system installed. Recommend adding gutters and downspouts where needed. Water seepage into crawl spaces is primarily caused by inadequate removal of rainwater from the perimeter of the house.

Mildew present

No.



Low lying area on roof



Low lying area on the roof

Eases, Soffits, and Fascias

2.5) Eases, Soffits, and Fascias

IN

The Eases, Soffits, and Fascias appeared to be in serviceable condition at the time of the inspection.

Attic Area

Attic Access

Southeast Bedroom Closet



Method of Inspection

IN

Roof Frame Type

Entered attic area.

The roof framing is constructed with rafter framing.

Roof Sheathing Material

Plywood

2.6) Roof Sheathing Condition

The visible and accessible portions of the attic appeared to be in serviceable condition at the time of the inspection.

2.7) Attic Conditions



Attic access has no door/panel to close the attic from the bedroom. Recommend correction.

Attic Ventilation Type	Turbines.
2.8) Attic Ventilation Conditions	IN
The attic ventilation appeared to be in service	ceable condition at the time of the inspection.
Attic Insulation Type	Loose fill.
2.9) Attic Insulation Conditions	IN
The approximate depth of the insulation is 6	+/- inches. Additional insulation should be considered at some point.
Signs of pest in Attic	No.
	3 Exterior
Front - Back Entrance	
Front Entrance Type	Covered Porch.
3.1) Front Entrance Conditions	IN
The visible and accessible areas of the porc	ch appeared to be in serviceable condition at the time of the inspection.
Back Entrance Type	Porch.
3.2) Back Entrance Conditions	IN
The visible and accessible areas of the porc	ch appeared to be in serviceable condition at the time of the inspection.

Exterior Walls

Structure Type

Concrete Block.

Exterior Wall Covering

The visible and accessible areas of the exterior siding material are brick and stone.

3.3) Exterior Wall Conditions

• An open hole on the exterior siding was observed. Recommend sealing the hole to prevent water and bugs from entering the home.

• Recommend adding a flexible sealant to the expansion gap on the west side of the home.

R





Open hole

3.4) Flashing and Trim

IN

IN

The flashing and trim appeared to be in serviceable condition at the time of the inspection.

3.5) Exterior Lighting

The exterior lighting appeared in serviceable condition at the time of inspection.

3.6) Exterior Outlets



- The exterior outlets appeared to be in serviceable condition at the time of the inspection.
- An exposed electrical wire was observed. Recommend adding a cover to the area.



Missing Cover

Exterior Windows - Doors

Window Type	Single Hung		
Window Material	Vinyl.		
3.7) Window Conditions	IN		
The windows appeared to be in serviceable condition at the time of the inspection.			


Exterior Door Material

Wood

R

3.8) Exterior Door Conditions

Front and rear exterior door contacts the floor when closing. This will cause the floor to wear out in these areas. Recommend adjusting the doors.

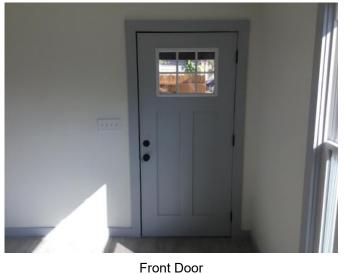



Exterior Water Faucet(s)

Faucet Location

East and west side of home.

3.9) Faucet Conditions

The hose faucets appeared to be in serviceable condition at the time of the inspection. These should be drained prior to freezing temperatures.

4 Foundation - Crawl Space

Foundation

Foundation Type

Foundation Material

Block.

Crawl Space.

IN

4.1) Foundation Conditions

The area under the hallway bathroom had moisture and organic growth. A leaking pipe was observed in this area. It is suggested that a "Licensed Plumbing Contractor" be contacted for further evaluation and repair.



Organic Growth

Method used to observe



Leaking Pipe

Flooring Structure

Flooring Support Type

The support framing was constructed of 2 X 10 beams.

4.2) Flooring Support Conditions

The visible and accessible areas of the wood framing system appeared to be in serviceable condition at the time of the inspection.

Crawled.

Floor System Insulation

There was no insulation installed under the floor in the crawl space. Recommend adding insulation to improve the energy efficiency of the home. No insulation will cause the heated/cooled air to be lost through the floor.

5 Heating - Air

Heating

Location of Unit

Attic.

Heating Type

Forced Air.

Natural Gas.

Energy Source

5.1) Unit Conditions

NI

At the time of inspection, the fuel was off. Inspection of appliances that are shut down is not performed, therefore our review is very limited in scope. We suggest that the client obtain a full and complete inspection prior to close.



Distribution Type

The visible areas of the heat distribution system is ductwork with registers.

5.2) Distribution Conditions

IN

The visible and accessible areas of the distribution system appeared to be in serviceable condition at the time of inspection.

5.3) Ventilation Conditions



IN

The visible and accessible portion of the venting flue appeared to be in serviceable condition at the time of the inspection.

5.4) Thermostat Condition and Location

The thermostat is located in the living room.

The normal operating controls appeared to be serviceable at the time of the inspection.



Filter Type



Hallway Filter

Disposable. Recommend changing filters every 30 days.



Master Bedroom Filter

Air Condition - Cooling

Type of Cooling System

AC Unit Power

Central Air Conditioning

5.5) AC Unit Conditions

NI

240V.

The outside air temperature was below 65 degrees within 48 hours of the inspection. Operating the system at this temperature could damage the system, therefore the inspector was unable to operate and test the system at the time of inspection. We suggest that the client obtain a full and complete inspection prior to close.



Number of AC only Units

1

6 Electrical

Service Drop - Weatherhead

Electrical Service Type	The electrical service is overhead.			
Electrical Service Material	Copper.			
Number of Conductors	Two.			
6.1) Electrical Service Conditions	IN			
The main service entry appeared to be in serviceable condition at the time of inspection.				
Main Electrical Panel				

Main Disconnect LocationAt Main Panel.Electric Panel LocationThe main electric panel is located at the exterior.



Panel Amperage Rating

Circuit Protection Type

Breakers.


The electrical capacity of main breaker was unlisted.



6.2) Wiring Methods



The main power cable is copper. The branch cables are copper.

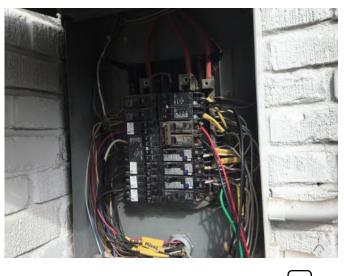

6.3) Electrical Panel Conditions

The inspector was unable to determine the amperage due to no main breaker present. Today's standards require main breakers.

7 Plumbing

Water Main Line

Water Source

Main Shutoff Location

Public At meter

R



Main Line Material

Copper.

IN

7.1) Main Line & Valve Conditions

The visible portion of the main pipe and valve appeared to be in serviceable condition at the time of the inspection.

Water Supply Lines

 Supply Line Material
 The visible material used for the supply lines is copper and PEX.

7.2) Supply Line Conditions

Active leaks were observed in the crawlspace under the hallway bathroom. Recommend further evaluation and repair by a licensed plumber. See section 4.1

Drain - Waste Lines

Drain Line Material

PVC

IN

7.3) Drain Line Conditions

The visible portions of the waste lines appeared to be in serviceable condition at the time of inspection. All of the waste lines were not fully visible or accessible at the time of the inspection.



Drain Cleanout


Water Heater(s)

Water Heater Type	Electric.
Water Heater Location	Laundry Room.
Water Heater Capacity	50 Gallon.
7.4) Water Heater Conditions	R

• T P R (temperature pressure relief) valve overflow pipe was missing at the time of the inspection. Recommend the installation of an extension pipe for increased safety.

• The water heater was operable at the time of inspection. This does not however guarantee future performance, operation, or condition. The hot water tank MFG date is 2014. The average lifespan of an electric water heater is 10-12 years.

IN = Inspected | R = Repair | S = Safety | NI = Not Inspected

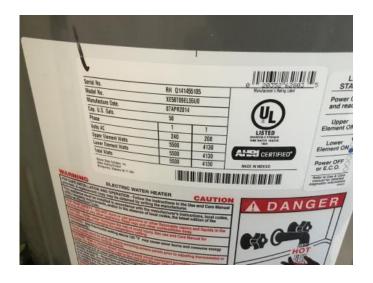



No TPR overflow pipe



Hot water measured at 118 degrees.

8 Living Room

Walls - Ceilings - Floors

8.1) Wall Conditions




IN

IN

The general condition of the walls appeared to be in serviceable condition at the time of the inspection.

8.2) Ceiling Conditions

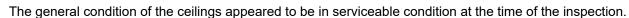

8.3) Floor Conditions

Uneven floors were observed. From the visible and accessible areas, no immediate concern was observed. This may not however, be an indication of future conditions.



Uneven floor

8.4) Heat Source Conditions

Appeared serviceable at the time of inspection.

Windows - Doors

8.5) Interior Window Conditions

The window(s) appeared to be in serviceable condition at the time of the inspection.

IN

IN

IN

8.6) Interior Door Conditions

See Exterior Doors. Section 3.8

Electrical Conditions

8.7) Electrical Conditions

The electrical appeared to be in serviceable condition at the time of the inspection.

8.8) Lighting Conditions

IN

IN

IN

IN

The lighting appeared to be in serviceable condition at the time of the inspection.

8.9) Ceiling Fan Conditions

The ceiling fan was operational at the time of the inspection.

8.10) Smoke Detector Conditions

Appeared serviceable at the time of inspection.

9 Hallways

Walls - Ceilings - Floors

9.1) Wall Conditions

The general condition of the walls appeared to be in serviceable condition at the time of the inspection.

IN

IN

9.2) Ceiling Conditions

The general condition of the ceilings appeared to be in serviceable condition at the time of the inspection.

9.3) Floor Conditions

R

No transition installed between the carpet and tile floors. This could allow for the tile to chip prematurely. Recommend installing a transition to this area.



9.4) Heat Source Conditions

IN

Appeared serviceable at the time of inspection.

Doors

9.5) Interior Door Conditions



The interior doors appeared to be in serviceable condition at the time of the inspection.

Electrical Conditions

9.6) Electrical Conditions

IN

IN

IN

The electrical appeared to be in serviceable condition at the time of the inspection.

9.7) Lighting Conditions

The lighting appeared to be in serviceable condition at the time of the inspection.

9.8) Smoke Detector Conditions

Appeared serviceable at the time of inspection.



10 Rear Entrance Room

Walls - Ceilings - Floors

10.1) Wall Conditions

The general condition of the walls appeared to be in serviceable condition at the time of the inspection.

IN

10.2) Ceiling Conditions

IN

There was a common crack on the ceiling. Although these conditions are common in most homes, client is advised to monitor cracks for future movement.



10.3) Floor Conditions

IN

IN

IN

IN

IN

The general condition of the visible and accessible portions of the floors appeared to be in serviceable condition at the time of the inspection.

10.4) Heat Source Conditions

Appeared serviceable at the time of inspection.

Windows - Doors

10.5) Interior Door Conditions

See Exterior Doors. Section 3.8

Electrical Conditions

10.6) Electrical Conditions

The electrical appeared to be in serviceable condition at the time of the inspection.

10.7) Lighting Conditions

The lighting appeared to be in serviceable condition at the time of the inspection.

11 Kitchen

Walls - Ceilings - Floors

11.1) Wall Conditions

IN

The general condition of the walls appeared to be in serviceable condition at the time of the inspection.

11.2) Ceiling Conditions

IN

IN

IN

The general condition of the ceilings appeared to be in serviceable condition at the time of the inspection.

11.3) Floor Conditions

The general condition of the visible and accessible portions of the floors appeared to be in serviceable condition at the time of the inspection.

11.4) Heat Source Conditions

Appeared serviceable at the time of inspection.

Windows

11.5) Kitchen Window Conditions



IN

IN

IN

IN

The window(s) appeared to be in serviceable condition at the time of the inspection.

Electrical Conditions

11.6) Electrical Outlets

The electrical appeared to be in serviceable condition at the time of the inspection.

11.7) Lighting Conditions

The lighting appeared to be in serviceable condition at the time of the inspection.

Kitchen Sink - Counter tops - Cabinets

11.8) Counter Conditions

The visible portion kitchen counters appeared to be in serviceable condition at the time of the inspection.

11.9) Cabinet Conditions

The kitchen cabinets appeared to be in serviceable condition at the time of inspection.

11.10) Sink Plumbing Conditions

Accordion drain under the sink. An accordion pipe is no longer permitted due to the fact that mildew and debris can catch in the folds of the pipe. Recommend replacement of pipe with smooth UL listed plumbing parts.

11.11) Garbage Disposal Condition

The sink disposal was operable at the time of the inspection. Client should consult a licensed plumber, manufacturer, or disposal supply company for information on proper usage and safety related concerns.

Appliances

Stove - Range Type

The range and oven are gas.

11.12) Stove - Range Condition

The gas was turned off. The range/oven could not be inspected. We suggest that the client obtain a full and complete inspection prior to close.

11.13) Hood Fan Conditions

No exhaust fan was observed. Today's construction would require installation of a fan/hood.

NI

NI

IN

11.14) Dishwasher Conditions

The dishwasher appeared to be in serviceable condition at the time of the inspection. This does not however guarantee future performance or conditions.

11.15) Built in Mircowave



The built in microwave appeared to be in serviceable condition at the time of the inspection. This does not however guarantee future performance or conditions.

12 Laundry Room

Laundry Room

Location

The laundry facilities are located in the laundry room.

12.1) Laundry Room Conditions

IN

The visible and accessible portions of the laundry plumbing components appeared to be in serviceable condition at the time of inspection.

Dry Power Source

220 Electric.

Dry Vent Material

PVC Rigid

IN

IN

12.2) Dryer Vent Condition

Appeared serviceable at the time of inspection.

12.3) Electrical Conditions

The electrical appeared to be in serviceable condition at the time of the inspection.

12.4) Lighting Conditions

IN

The lighting appeared to be in serviceable condition at the time of the inspection.

12.5) Wall Conditions

The interior walls were damaged. Recommend repairs as needed.



13 Hallway Bathroom

Walls - Ceilings - Floors

13.1) Wall Conditions

The general condition of the walls appeared to be in serviceable condition at the time of the inspection.

13.2) Ceiling Conditions

(١
I	I	N	I
			L

IN

IN

IN

The general condition of the ceilings appeared to be in serviceable condition at the time of the inspection.

13.3) Floor Conditions

The general condition of the visible and accessible portions of the floors appeared to be in serviceable condition at the time of the inspection.

13.4) Heat Source Conditions

Appeared serviceable at the time of inspection.

Windows - Doors

13.5) Bathroom Window Conditions

IN

IN

The window(s) appeared to be in serviceable condition at the time of the inspection.

13.6) Bathroom Door Conditions

The interior doors appeared to be in serviceable condition at the time of the inspection.

IN

IN

IN

Electrical Conditions

13.7) Electrical Outlets

The electrical appeared to be in serviceable condition at the time of the inspection.

13.8) Lighting Conditions

The lighting appeared to be in serviceable condition at the time of the inspection.

13.9) Vent Fan Conditions

Appeared serviceable at the time of inspection.

Bathroom Sink

13.10) Counter - Cabinet Conditions

IN

The counters and cabinets appeared to be in serviceable condition at the time of the inspection.

IN

13.11) Sink Conditions


The sink appeared to be in serviceable condition at the time of inspection in bath.

Shower - Tub - Toilet

13.12) Shower - Tub Conditions

R

Shower head was leaking during the inspection. Recommend correction.

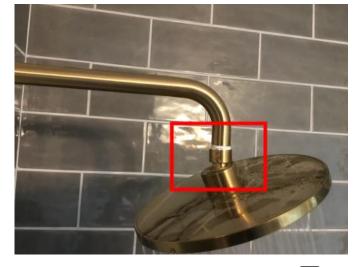

13.13) Toilet Conditions

IN

The toilet appeared to be in serviceable condition at the time of inspection.

Plumbing System

13.14) Plumbing Drain System

Accordion drain under the sink. An accordion pipe is no longer permitted due to the fact that mildew and debris can catch in the folds of the pipe. Recommend replacement of pipe with smooth UL listed plumbing parts.

IN



13.15) Plumbing Water Supply and Distribution Systems

IN

The water supply appeared to be in serviceable condition at the time of inspection.

14 Master Bathroom

Walls - Ceilings - Floors

14.1) Wall Conditions

IN

The general condition of the walls appeared to be in serviceable condition at the time of the inspection.

14.2) Ceiling Conditions

The general condition of the ceilings appeared to be in serviceable condition at the time of the inspection.

14.3) Floor Conditions

	L	N
	1	1.1
L		

IN

The general condition of the visible and accessible portions of the floors appeared to be in serviceable condition at the time of the inspection.

14.4) Heat Source Conditions

Appeared serviceable at the time of inspection.

Doors

14.5) Bathroom Door Conditions



IN

The interior doors appeared to be in serviceable condition at the time of the inspection.

Electrical Conditions

14.6) Electrical Outlets

The electrical appeared to be in serviceable condition at the time of the inspection.

14.7) Lighting Conditions

IN

IN

The lighting appeared to be in serviceable condition at the time of the inspection.

14.8) Vent Fan Conditions

Appeared serviceable at the time of inspection.

Bathroom Sink

14.9) Counter - Cabinet Conditions

IN

The counters and cabinets appeared to be in serviceable condition at the time of the inspection.

14.10) Sink Conditions

There was no cold water supply in bathroom. Inspector was unable to test or inspect. It is suggested that a "Licensed Plumbing Contractor" be contacted for further evaluation and repair.



Shower - Toilet

14.11) Shower Conditions

The shower, faucet, and drains appeared to be in serviceable condition.

14.12) Toilet Conditions

IN

The toilet appeared to be in serviceable condition at the time of inspection.

Plumbing System

14.13) Plumbing Drain System

Accordion drain under the sink. An accordion pipe is no longer permitted due to the fact that mildew and debris can catch in the folds of the pipe. Recommend replacement of pipe with smooth UL listed plumbing parts.

IN





14.14) Plumbing Water Supply and Distribution Systems



The water supply appeared to be in serviceable condition at the time of inspection.

15 Master Bedroom

Ceiling

15.1) Ceiling Condition



The general condition of the ceilings appeared to be in serviceable condition at the time of the inspection.

Walls

15.2) Wall Condition



The general condition of the walls appeared to be in serviceable condition at the time of the inspection.


Floors

15.3) Floor Condition



No transition installed between the carpet and tile floors. This could allow for the tile to chip prematurely. Recommend installing a transition to this area.



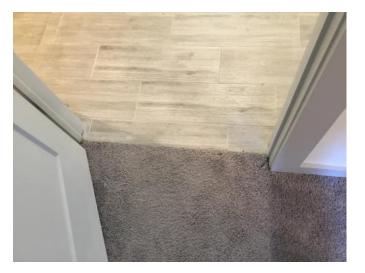

Interior Door

15.4) Door Condition



The door sticks at the doorframe in the master bedroom. Repairs and/or adjustments are recommended.



Window

15.5) Window Condition



The window(s) appeared to be in serviceable condition at the time of the inspection.

Electrical Conditions

15.6) Electrical Outlets

The electrical appeared to be in serviceable condition at the time of the inspection.

15.7) Lighting Conditions



IN

The lighting appeared to be in serviceable condition at the time of the inspection.

15.8) Ceiling Fan Conditions

The ceiling fan was operational at the time of the inspection.

15.9) Smoke Detector Conditions

Appeared serviceable at the time of inspection.

16 Northeast Bedroom

Ceiling

16.1) Ceiling Condition

The general condition of the ceilings appeared to be in serviceable condition at the time of the inspection.

Walls

16.2) Wall Condition



IN

IN

IN

The general condition of the walls appeared to be in serviceable condition at the time of the inspection.

Floors

16.3) Floor Condition

The general condition of the visible and accessible portions of the floors appeared to be in serviceable condition at the time of the inspection.

Interior Door

16.4) Door Condition



The interior doors appeared to be in serviceable condition at the time of the inspection.

Window

16.5) Window Condition



IN

IN

The window(s) appeared to be in serviceable condition at the time of the inspection.

Electrical Conditions

16.6) Electrical Conditions

The electrical appeared to be in serviceable condition at the time of the inspection.

16.7) Lighting Conditions

The lighting appeared to be in serviceable condition at the time of the inspection.

16.8) Ceiling Fan Conditions

The ceiling fan was operational at the time of the inspection.

16.9) Smoke Detector Conditions

Appeared serviceable at the time of inspection.

17 Southeast Bedroom

Ceiling

17.1) Ceiling Condition

The general condition of the ceilings appeared to be in serviceable condition at the time of the inspection.

Walls

17.2) Wall Condition



IN

IN

IN

The general condition of the walls appeared to be in serviceable condition at the time of the inspection.

Floors

17.3) Floor Condition

The general condition of the visible and accessible portions of the floors appeared to be in serviceable condition at the time of the inspection.

Interior Door

17.4) Door Condition



The interior doors appeared to be in serviceable condition at the time of the inspection.

Window

17.5) Window Condition



IN

IN

The window(s) appeared to be in serviceable condition at the time of the inspection.

Electrical Conditions

17.6) Electrical Conditions

The electrical appeared to be in serviceable condition at the time of the inspection.

17.7) Lighting Conditions

The lighting appeared to be in serviceable condition at the time of the inspection.

17.8) Ceiling Fan Conditions

The ceiling fan was operational at the time of the inspection.

17.9) Smoke Detector Conditions



IN

Appeared serviceable at the time of inspection.