

Inspection Report Linda Sample

Property Address: 123 Any Street Scottsdale AZ 85255



Inspected by Bob Nau #65789 11445 E Via Linda Suite 2 #460 Scottsdale, AZ 85259 480-226-7915

123 Any Street Page 2 of 70

Table of Contents

<u>1</u>
3
4
5
8
13
23
30
34
36
39
40
42
45
53
66
67

123 Any Street Page 3 of 70

Date: 5/15/2021	Time: 08:00:00 AM	Report ID: 051521BN9
Property: 123 Any Street Scottsdale AZ 85255	Customer: Linda Sample	Real Estate Professional:

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

<u>Inspected (IN)</u> = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI)= I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

Style of Home: SINGLE FAMILY DETACHED, ONE STORY	Year Built: 2001	Building Faces: South
Client Is Present: No	Weather: Clear	Temperature: Over 85
Rain in last 3 days:		

123 Any Street Page 4 of 70

1. STRUCTURAL COMPONENTS

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

Styles & Materials

FOUNDATION TYPE (6):

FLOOR SYSTEM TYPE (7):

WALL TYPE (8):

REINFORCED CONCRETE

CONCRETE SLAB ON GRADE

WOOD FRAMED

ROOF/CEILING TYPE (10):

COLUMNS TYPE AND LOCATION (9):

ENGINEERED TRUSS

WOOD FRAMED WITH STUCCO - REAR PORCH

ORIENTED STRAND BOARD DECKING. (OSB)

Items

1.0 FOUNDATION CONDITION (6)

Comments: Inspected

The visible portions of the foundation are in satisfactory condition.

1.1 FLOOR CONDITION (7)

Comments: Inspected

The visible portions of the floor at each level of the structure are in satisfactory condition.

1.2 WALL CONDITION (8)

Comments: Inspected

The visible portions of the exterior structural walls are in satisfactory condition.

1.3 COLUMNS CONDITION (9)

Comments: Inspected

The visible portions of the posts/columns are in satisfactory condition.



1.3 Item 1(Picture)

1.4 ROOF/CEILING CONDITION (10)

Comments: Inspected

123 Any Street Page 5 of 70

The visible portions of the roof and ceiling structure are in satisfactory condition.



123 Any Street Page 6 of 70



123 Any Street Page 7 of 70





1.4 Item 13(Picture)

1.4 Item 14(Picture)

1.5 OBSERVATION METHOD FOR ATTIC AND CRAWL SPACE (12)

Comments: Inspected

The attic was viewed from the attic access opening in the kitchen pantry. Some areas of the attic are not visible from the attic access openings. There is no crawl space.

1.6 UNDERFLOOR CRAWL SPACE CONDITION (11)

Comments: Not Present None present, slab on grade.

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

2. EXTERIOR

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

Styles & Materials

SIDING MATERIAL TYPE (13):

STUCCO TYPE FINISH


Items

2.0 WALL CLADDING CONDITION (13)


Comments: Inspected

123 Any Street Page 8 of 70

- (1) Overall, the visible portions of the exterior wall cladding is in satisfactory condition. Stucco has or will develop typical hairline cracks, seal all exterior penetrations as needed to prevent water intrusion.
- (2) Seal all exterior cracks and penetrations to prevent water and pest intrusion.

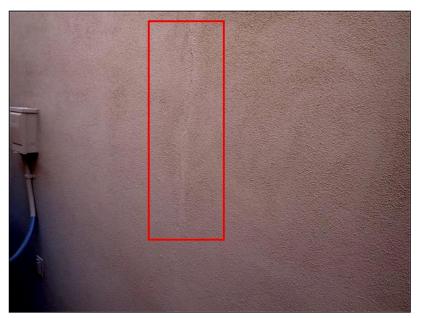


2.0 Item 1(Picture)

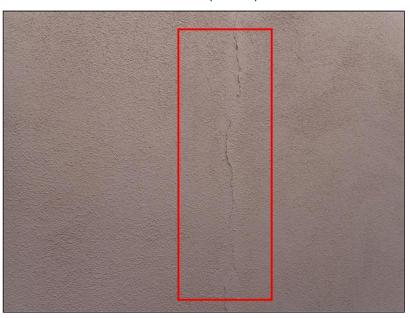

2.0 Item 2(Picture)

123 Any Street Page 9 of 70

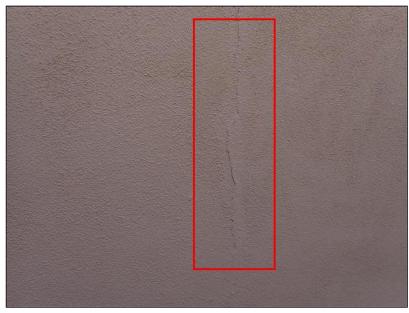

2.0 Item 3(Picture)

2.1 FLASHING AND TRIM CONDITION (14)

Comments: Inspected

The visible portions of the flashing and trim are in satisfactory condition.

2.2 ENTRYWAY DOORS CONDITION AND OPERATION (15)


Comments: Inspected

The exterior doors are in satisfactory condition and operational.

2.3 WINDOWS CONDITION AND OPERATION (16/75)

Comments: Inspected

- (1) A representative number of windows were operated and found to be in satisfactory condition and operational.
- (2) The front courtyard left bedroom window does not lock. Repair as necessary.

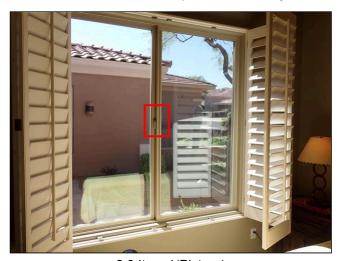

2.3 Item 1(Picture)

2.4 GARAGE DOOR OPENER CONDITION AND OPERATION (17)

Comments: Inspected

The garage doors and openers are in satisfactory condition and operational, including the safety reverse features.

2.5 DECKS, BALCONIES and STEPS CONDITION (18)

Comments: Not Present

None present.

2.6 PORCH, AREAWAY, RAILINGS CONDITION (19)

123 Any Street Page 10 of 70

Comments: Not Present

None present.

2.7 EAVES, SOFFITS AND FASCIA CONDITION (20)

Comments: Inspected


The visible portions of the eaves, soffits and fascia are in satisfactory condition.

2.8 VEGETATION, ADVERSE IMPACT ON STRUCTURE (21)

Comments: Repair or Replace

Tree limbs/vegetation in contact with the exterior and roof can cause damage and provide access for rodents. Trim as necessary to prevent damage.



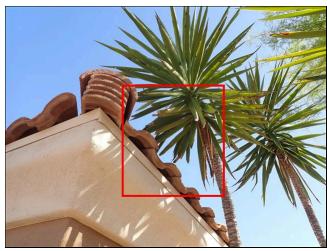

2.8 Item 1(Picture)

2.8 Item 2(Picture)



2.8 Item 3(Picture)

2.9 GRADING, DRAINAGE, CONDITION AND ANY ADVERSE IMPACT ON STRUCTURE (22)

Comments: Inspected

123 Any Street Page 11 of 70

- (1) Overall, the grading and drainage is in satisfactory condition and has no adverse impact on the structure.
- (2) The stucco runs to grade on the framed walls in several locations. This is conducive to water damage and termite activity. Keep the soil in the affected areas as dry as possible to prevent damage. Adjust the grade to direct surface water away from the walls.



123 Any Street Page 12 of 70

2.10 PATIOS, WALKS AND DRIVEWAYS, CONDITION AND ANY ADVERSE IMPACT ON STRUCTURE (23)

Comments: Inspected

The patios, walks and driveway are in satisfactory condition and have no adverse impact on the structure.

2.11 RETAINING WALLS, CONDITION AND ANY ADVERSE IMPACT ON STRUCTURE (24)

Comments: Inspected

None present.

2.12 GENERAL

Comments: Inspected

The exterior natural gas BBQ is operational and in satisfactory condition.





2.12 Item 1(Picture)

2.12 Item 2(Picture) Gas valve turned off after inspecting

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

3. ROOFING

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

Styles & Materials

ROOF COVERING TYPE (25):

CONCRETE TILE


Items

3.0 ROOF COVERINGS CONDITION (25)

Comments: Inspected

123 Any Street Page 13 of 70


(1) Overall, the visible portions of the roof coverings are in satisfactory condition.

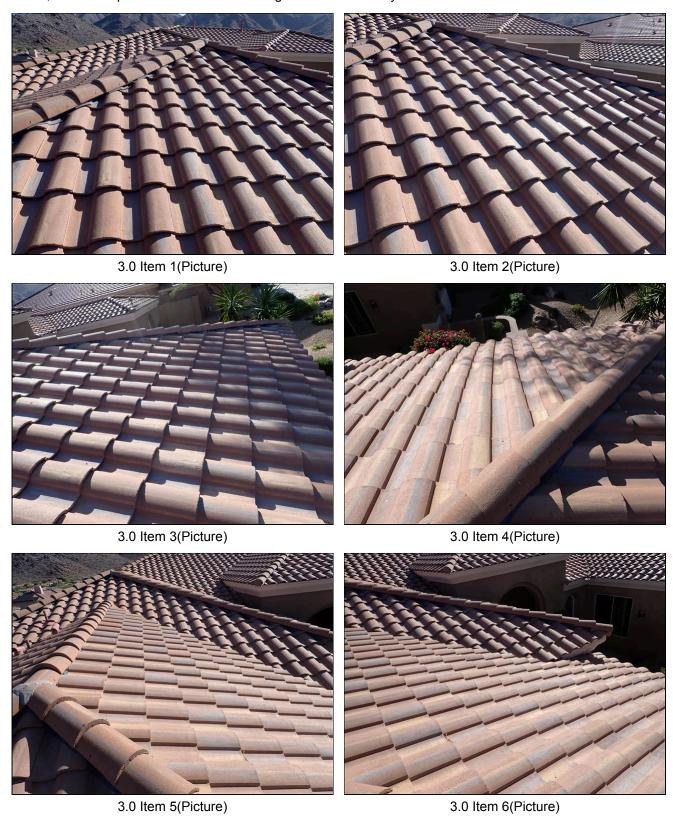

123 Any Street Page 14 of 70



123 Any Street Page 15 of 70

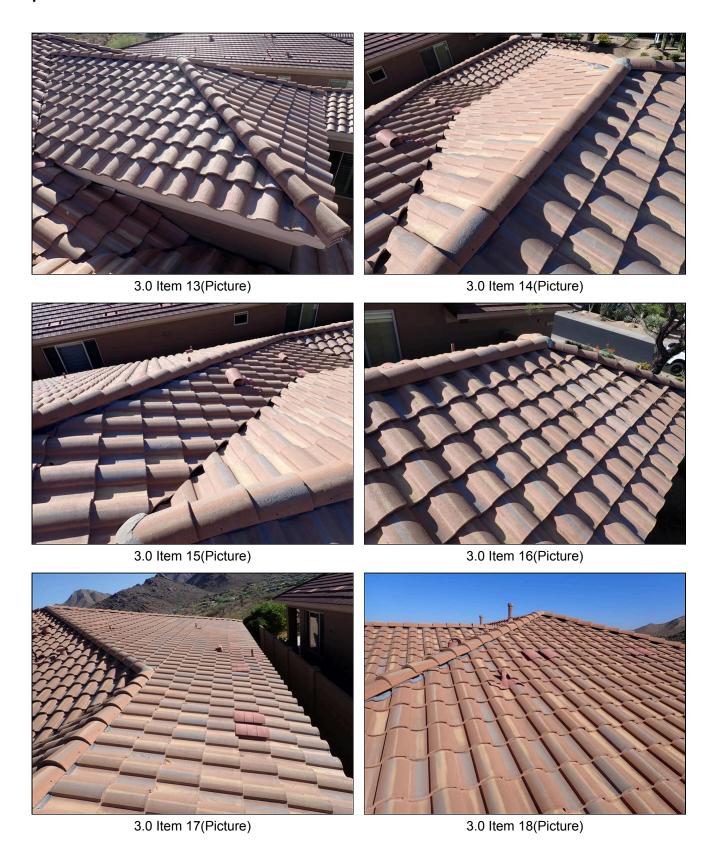

123 Any Street Page 16 of 70



123 Any Street Page 17 of 70




123 Any Street Page 18 of 70



3.0 Item 31(Picture)

(2) Underlayment photos.

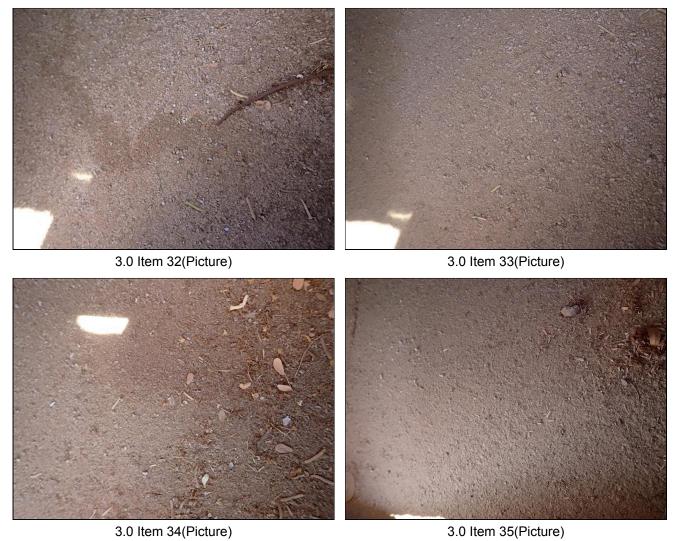

123 Any Street Page 19 of 70



3.0 Item 36(Picture)

(3) Routine maintenance required to repair cracked tiles, secure slipped tiles and repair cracked mudballs. I recommend professional repair by a licensed roofer.




3.0 Item 37(Picture)

123 Any Street Page 20 of 70



3.0 Item 38(Picture)

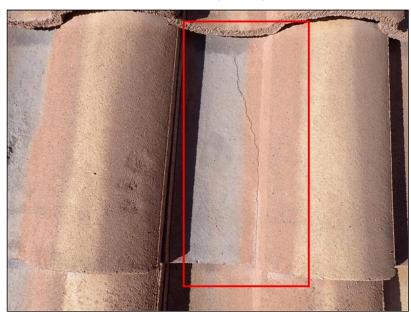

3.0 Item 39(Picture)

123 Any Street Page 21 of 70



3.0 Item 40(Picture)

3.1 DRAINAGE SYSTEMS CONDITION (26)

Comments: Inspected

- (1) Overall, the roof drainage system is in satisfactory condition.
- (2) Remove the leaf litter to improve water flow off the roof.



3.1 Item 1(Picture)

123 Any Street Page 22 of 70



3.1 Item 2(Picture)

3.2 FLASHINGS AT ROOF PENETRATIONS, SKYLIGHTS AND CHIMNEYS CONDITION (27)

Comments: Inspected

The flashings at the roof penetrations, the skylights (if present) and chimney (if present) are in satisfactory condition.

3.3 EVIDENCE OF LEAKING (28)

Comments: Inspected

There are no signs of leakage or abnormal condensation.

3.4 METHOD USED TO OBSERVE ROOF (29)

Comments: Inspected

Walked roof.

3.5 General

Comments: Repair or Replace

For all of your roofing needs, I recommend Bryce with Acclaimed Roofing. 480-454-7033.

admin@acclaimedroofing.com. No referral fee is paid to Nau Inspections LLC.

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

4. PLUMBING SYSTEM

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.

Styles & Materials

INTERIOR SUPPLY/DISTRIBUTION PIPING TYPE (30):

VISIBLE PORTIONS ARE COPPER

WASTE AND VENT PIPING SYSTEM TYPE (36):

VISIBLE PORTIONS ARE ABS

WATER HEATER TYPE (39):

NATURAL GAS

123 Any Street Page 23 of 70

Items

4.0 INTERIOR SUPPLY/DISTRIBUTION PIPING CONDITION (30)

Comments: Inspected

The visible portions of the interior supply and distribution system are in satisfactory condition.





4.0 Item 1(Picture) Copper pipe

4.0 Item 2(Picture) Copper pipe

4.1 FIRE SPRINKLER SUPPLY/DISTRIBUTION MATERIAL

Comments: Inspected

CPVC Pipe



4.1 Item 1(Picture) CPVC pipe

123 Any Street Page 24 of 70

4.2 SUPPORTS AND INSULATION CONDITION (31)

Comments: Inspected

The visible supports and insulation, where required, are in satisfactory condition.

4.3 FIXTURES AND FAUCETS CONDITION (32)

Comments: Inspected

The fixtures and faucets are in satisfactory condition and operational.

4.4 FUNCTIONAL FLOW (33)

Comments: Inspected

Functional flow is defined as a reasonable flow at the highest fixture in a dwelling when another fixture in the home is operated simultaneously. The supply system provides functional flow.

4.5 WATER SUPPLY LEAKS (34)

Comments: Inspected

There is no evidence of supply side leaks.

4.6 CROSS CONNECTIONS. (35)

Comments: Inspected

There were no potential cross connections observed.

4.7 WASTE AND VENT PIPING SYSTEM CONDITION (36)

Comments: Inspected

The visible portions of the waste and vent system are in satisfactory condition.



4.7 Item 1(Picture) ABS pipe

4.8 DRAIN LEAKS (37)

Comments: Inspected

There is no evidence of leakage in the waste system piping.

4.9 SINK AND TUB OVERFLOWS

Comments: Inspected

The sink and tub overflow drains (if present) are in satisfactory condition and operational.

4.10 FUNCTIONAL DRAINAGE (38)

Comments: Inspected

A drain is considered functional when it empties in a reasonable amount of time and does not overflow when another fixture is drained simultaneously. The waste system provides functional drainage.


4.11 WATER HEATER CONDITION (39)

Comments: Inspected

123 Any Street Page 25 of 70

Water heaters typically last 8-12 years in Arizona. This water heater is a 2013 model and near the end of its service life. Budget for replacement soon. I highly recommend the purchase of a home warranty to help defer owner expense in the event of water heater failure.



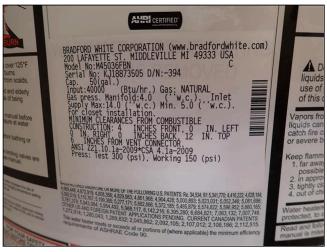

4.11 Item 1(Picture) 2013 Model 50 Gallon natural gas

4.11 Item 2(Picture)

4.12 AUTOMATIC SAFETY CONTROLS (40)


Comments: Inspected

A TPR valve and thermocouple/limit switch are present in each water heater, the visible portions are in satisfactory condition.

4.13 FLUES AND COMBUSTION AIR VENTS (41)

Comments: Inspected

(1) The combustion air vents are present and in satisfactory condition.

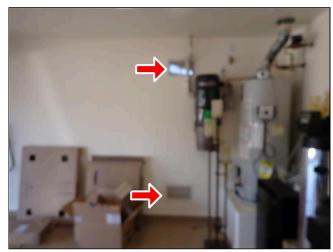

4.13 Item 1(Picture)

123 Any Street Page 26 of 70

(2) Secure the draft collar to the ceiling to prevent fire drafting into the attic.



4.13 Item 2(Picture)

4.14 FUEL DISTRIBUTION SYSTEM AND SUPPORTS (42)

Comments: Repair or Replace

There is no sediment trap installed on the gas supply for the water heater. I recommend professional evaluation with repair as necessary to prevent hazard/damage.



4.14 Item 1(Picture)

4.15 WATER PRESSURE BETWEEN 40 AND 80 PSI

Comments: Inspected

123 Any Street Page 27 of 70

Water pressure is between 40-80psi.



4.15 Item 1(Picture)

4.16 MAIN WATER SHUT OFF VALVE LOCATION. If the main valve is a gate valve we recommend replacement with a ball valve.

Comments: Inspected

The main water shut off valve is located on the left side of the house.



4.16 Item 1(Picture)



4.16 Item 2(Picture) Main water shut off valve.

123 Any Street Page 28 of 70



4.16 Item 3(Picture) Water pressure reducing valve.

4.17 SUMP PUMP

Comments: Not Present

None present.

4.18 GAS SUPPLY

Comments: Inspected

Located on the left side of the house.



4.18 Item 1(Picture)

4.19 GAS APPLIANCE VALVES LOCATED.

Comments: Inspected

All gas appliance valves were located.

4.20 WATER TREATMENT SYSTEM

Comments: Not Inspected

123 Any Street Page 29 of 70

The performance characteristics of the water treatment system were not evaluated. If the performance of this system is a material factor of your purchase, I recommend professional evaluation during your inspection period, with service and repair as necessary.





4.20 Item 1(Picture)

4.20 Item 2(Picture)

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

5. ELECTRICAL SYSTEMS

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

Styles & Materials

UNDERGROUND

SERVICE TYPE (43): SERVICE CONDUCTOR TYPE (44):

OVERCURRENT PROTECTION DEVICES TYPE

(46):

BREAKERS

SERVICE AMPERAGE/VOLTAGE BRANCH CIRCUIT CONDUCTORS TYPE 15/

ALUMINUM BARS

(48): 20AMP:

120/240 VOLT COPPER

200 AMP

100 AMP

Items

5.0 MAIN AND DISTRIBUTION PANELS, LOCATIONS AND CONDITION (47)

Comments: Inspected

123 Any Street Page 30 of 70

The main disconnect and distribution panels are located on the left side of the house.

The main and distribution panels are in satisfactory condition.






5.0 Item 1(Picture)

5.0 Item 2(Picture)

5.1 SERVICE CONDUCTOR AND MAIN OVERCURRENT PROTECTION DEVICE CONDITION (44)

Comments: Inspected

The visible portion of the electric service conductor and main overcurrent protection device are in satisfactory condition.

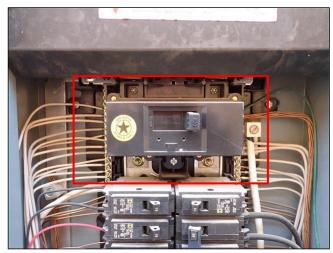


5.1 Item 1(Picture)

5.2 OVERCURRENT PROTECTION DEVICES CONDITION (46) AND BRANCH CIRCUIT CONDUCTORS CONDITION (49)

Comments: Inspected

123 Any Street Page 31 of 70

The visible portions of the over current protection devices (breakers/fuses) and branch circuit conductors (wires) are in satisfactory condition.

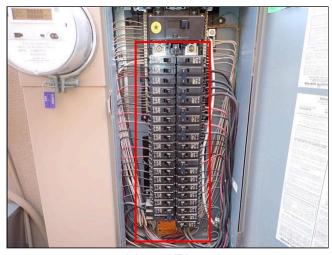




5.2 Item 1(Picture)

5.2 Item 2(Picture)


5.3 PRESENCE OF ALUMINUM BRANCH CIRCUIT WIRING ON 15/20 AMP CIRCUITS (50)


Comments: Inspected

There is no aluminum branch circuit wiring visible on the 15/20 AMP circuits.

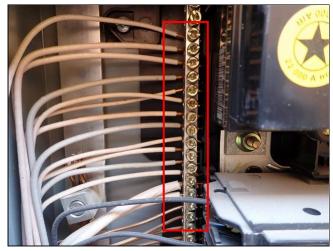

5.3 Item 1(Picture) Copper 15/20 amp branch circuits. 5.3 Item 2(Picture) Copper 15/20 amp branch circuits.

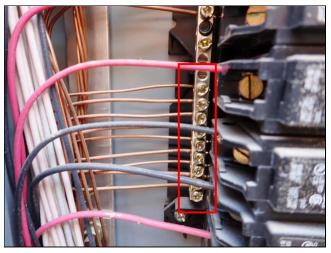

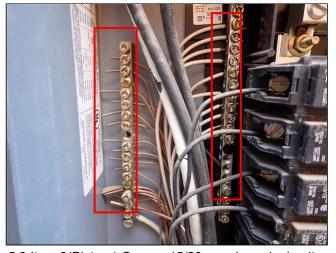

5.3 Item 3(Picture) Copper 15/20 amp branch circuits.

5.4 SERVICE GROUNDING EQUIPMENT CONDITION (45)

123 Any Street Page 32 of 70

Comments: Inspected

The visible portions of the grounding equipment are in satisfactory condition.

5.5 COMPATIBILITY (51)

Comments: Inspected

The breakers are compatible (not oversized) with the conductor size.

5.6 LIGHTS, SWITCHES CONDITION (52)

Comments: Inspected

A representative number of lights/switches were tested and are in satisfactory condition and operational.

5.7 RECEPTACLES, CONDITION, POLARITY, GROUND (53)

Comments: Inspected

A representative number of receptacles were tested for polarity and ground and found to be operational and in satisfactory condition.

5.8 GROUND FAULT CIRCUIT INTERRUPTERS CONDITION (54)

Comments: Inspected

All existing GFCI protected outlets function as intended.

5.9 SMOKE DETECTORS and CARBON MONOXIDE MONITORS PRESENCE (smoke detectors over ten years old should be replaced)

Comments: Inspected

(1) There are two types of smoke detectors installed in homes today, lonization and Photoelectric. lonization type detectors are installed in about 90% of homes and are more sensitive to the flaming stage of a fire. Open (fast flame) fires account for the majority of house fires and injuries but only 15% of fatalities. lonization type detectors respond slower to smoldering fires and fail completely 20-25% of the time.

Photoelectric type detectors are more sensitive to the smoldering stages of fires which account for 12% of fires but 50% of fire fatalities and 30% of injuries. The majority of fire related deaths occur during smoldering fires while occupants of the home are sleeping.

We strongly recommend the replacement of all lonization type smoke detectors with Photoelectric type detectors. All smoke detectors should be replaced after ten years due to loss of sensitivity.

Note - This is not a seller defect. This is our safety recommendation to you, the buyer.

(2) Smoke detectors are present in the hallway but not in the bedrooms. I recommend the installation of new smoke detectors for each bedroom.



5.9 Item 1(Picture)

123 Any Street Page 33 of 70

(3) There are carbon monoxide monitors present.



5.9 Item 2(Picture)

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

6. HEATING

The home inspector shall observe permanently installed heating systems including: Heating equipment; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.

ENERGY SOURCE (56):

NATURAL GAS

SOLID FUEL HEATING DEVICES TYPE (60):

SWITCH OPERATED GAS FIREPLACE

Styles & Materials

HEATING EQUIPMENT TYPE (55):

FORCED AIR GAS FURNACE/S

DISTRIBUTION SYSTEM TYPE (61):

MECHANICAL FAN/BLOWER

INSULATED DUCTS WITH REGISTERS

Items

6.0 HEATING EQUIPMENT CONDITION (55)

Comments: Inspected

123 Any Street Page 34 of 70

The heating equipment is in satisfactory condition and operational.





6.0 Item 1(Picture)

6.0 Item 2(Picture)

6.1 AUTOMATIC SAFETY CONTROLS CONDITION (58)

Comments: Inspected

The automatic safety controls are present and in good condition.

Automatic safety controls include limit switches/thermocouples on gas furnaces and overcurrent protection on electric systems.

6.2 CHIMNEYS, FLUES AND VENTS CONDITION (59)

Comments: Inspected

The flues, vents and combustion air vents are present and in good condition.

6.3 SOLID FUEL HEATING DEVICES (fireplace) CONDITION (60) HEARTH EXTENSION

Comments: Inspected

The switch operated gas fireplace is in satisfactory condition and operational.



6.3 Item 1(Picture)

6.4 HEAT DISTRIBUTION SYSTEM CONDITION (61)

Comments: Inspected

The visible portions of the heat distribution system is in satisfactory condition.

6.5 AIR FILTERS CONDITION (62)

Comments: Inspected

The filter/s is/are in replacement condition. Install fresh filter/s as necessary.

6.6 HEAT SOURCE (63)

123 Any Street Page 35 of 70

Comments: Inspected

There is a source of heat in each habitable room.

6.7 GENERAL

Comments: Inspected

I recommend professional cleaning and service as necessary.

The heating system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

7. CENTRAL AIR CONDITIONING

The home inspector shall observe: Central air conditioning and permanently installed cooling systems including: Cooling and air handling equipment; and Normal operating controls. Distribution systems including: Fans, pumps, ducts and piping, with associated supports, dampers, insulation, air filters, registers, fan-coil units; and The presence of an installed cooling source in each room. The home inspector shall describe: Energy sources; and Cooling equipment type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance The home inspector is not required to: Observe window air conditioners or operate cooling systems when weather conditions or other circumstances may cause equipment damage; Observe non-central air conditioners; or Observe the uniformity or adequacy of cool-air supply to the various rooms.

Styles & Materials

COOLING EQUIPMENT TYPE (64):

ENERGY SOURCE TYPE (65): DISTRIBUTION SYSTEM TYPE (67):

SPLIT SYSTEM STRAIGHT COOL AIR CONDITIONING

ELECTRICITY

MECHANICAL FAN/BLOWER
INSULATED DUCTS AND REGISTERS

Items

7.0 COOLING EQUIPMENT CONDITION (64)

Comments: Inspected

The visible portions of the cooling equipment are in satisfactory condition and operational.



7.0 Item 1(Picture) 2018 Model 5 Ton



7.0 Item 2(Picture)

123 Any Street Page 36 of 70





7.0 Item 3(Picture) 2018 Model 3 Ton

7.0 Item 4(Picture)

7.1 TEMPERATURE DIFFERENTIAL (temp.in-temp.out=differential) 18-24 degrees is normal.

Comments: Inspected


The temperature differentials are in the normal range.

7.2 OPERATING CONTROLS (THERMOSTAT) CONDITION (66)

Comments: Inspected

The thermostats are in satisfactory condition.







7.2 Item 2(Picture)

7.3 DISTRIBUTION SYSTEM CONDITION (67)

Comments: Inspected

The visible portions of the distribution system are in satisfactory condition.

7.4 UNDERGROUND RETURN AIR DUCTS

Comments: Not Present

None present.

7.5 COOLING SOURCE (69)

Comments: Inspected

There is a source of cool air in each habitable room.

7.6 RETURN AIR LOCATION (not allowed from kitchen, bath, garage, closet or mechanical room)

Comments: Inspected In approved location.

7.7 EVAPORATIVE COOLING SYSTEM

Comments: Not Present

123 Any Street Page 37 of 70

None present.

7.8 PRIMARY AND SECONDARY CONDENSATE DRAIN LOCATIONS

Comments: Inspected

The primary and secondary drains are visible.





7.8 Item 1(Picture)

7.8 Item 2(Picture)

7.9 GENERAL

Comments: Inspected

I recommend professional cleaning and service as needed.

I recommend Scott Casseday AIREPROS at 623-547-5992.

Note: Home Warranty companies will DENY repair claims if THEY determine your air conditioning system/s have/has not been properly maintained. I recommend you have the system/s serviced now and semiannually to obtain maximum performance and service life. Keep your service records as proof of maintenance. No referral fee is paid to Nau Inspections LLC.



7.9 Item 1(Picture)

The cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed HVAC contractor would discover (Heating, Ventilation, and Air Conditioning). Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

123 Any Street Page 38 of 70

8. INTERIORS

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

Items

8.0 WALLS, CEILINGS, FLOORS CONDITION (70)

Comments: Inspected

The visible portions of the walls, ceilings and floors are in satisfactory condition except for normal wear/age.

8.1 STEPS, STAIRWAYS CONDITION (71)

Comments: Not Present

None present.

8.2 BALCONIES, RAILINGS CONDITION (72)

Comments: Not Present

None present.

8.3 COUNTERS, CABINETRY CONDITION (73)

Comments: Inspected

The visible portions of the counters and cabinetry are in satisfactory condition.

8.4 DOORS CONDITION (74)

Comments: Inspected

A representative number of doors were tested and found to be operational and in satisfactory condition.

8.5 FIRE SEPARATION WALLS AND CEILINGS CONDITION (76)

Comments: Inspected

The visible portions of the fire separation walls between the dwelling unit and an attached garage or another dwelling unit are in satisfactory condition.

8.6 FIRE SEPARATION DOORS CONDITION (77)

Comments: Inspected

The fire separation door between the garage and house is in satisfactory condition and operational.

8.7 GENERAL

Comments: Inspected

The central vacuum system is operational and in satisfactory condition.







8.7 Item 2(Picture)

123 Any Street Page 39 of 70



8.7 Item 3(Picture)

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

9. INSULATION AND VENTILATION

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

Styles & Materials

INSULATION TYPE:

BLOWN CELLULOSE

VENTILATION TYPE:

OHAGEN VENTS

Items

9.0 INSULATION CONDITION (78)

Comments: Inspected

The visible insulation is in satisfactory condition. Attic visibility is limited, portions of the attic are not visible from the attic access.



9.0 Item 1(Picture) Blown cellulose insulation.



9.0 Item 2(Picture) Blown cellulose insulation.

9.1 VAPOR RETARDER CONDITION (79)

123 Any Street Page 40 of 70

Comments: Not Present

Vapor retarder is regional requirement for colder climates. Most homes in the Phoenix area do not require vapor retarder.

9.2 ATTIC VENTILATION CONDITION (80)

Comments: Inspected

The visible portions of the attic ventilation are in satisfactory condition.



9.2 Item 1(Picture) Ohagen vents.

9.3 UNDER FLOOR CRAWL SPACE VENTILATION CONDITION (81)

Comments: Not Present None present, slab on grade.

9.4 KITCHEN VENTILATION CONDITION (82)

Comments: Inspected

(1) Overall the stove vent is in satisfactory condition.



9.4 Item 1(Picture)

123 Any Street Page 41 of 70

(2) The kitchen vent exterior flapper is loud when windy. Remedy as necessary.





9.4 Item 2(Picture)

9.4 Item 3(Picture)

9.5 BATHROOM VENTILATION CONDITION (83)

Comments: Inspected

The bathroom ventilation fans/windows are operational and in satisfactory condition.

9.6 LAUNDRY VENTILATION, DRYER VENT CONDITION (84)

Comments: Inspected

The visible sections from the clothes dryer to the exterior of the building are in satisfactory condition.

I recommend professional cleaning before use.

9.7 LAUNDRY VENTILATION, ROOM VENT CONDITION (84)

Comments: Inspected

The visible portions of the laundry room ventilation fan or operable window are in satisfactory condition.

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

10. BUILT-IN KITCHEN APPLIANCES

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

Items

10.0 DISHWASHER

Comments: Inspected

123 Any Street Page 42 of 70

The dishwasher is in satisfactory condition and operational.



10.0 Item 1(Picture)

10.1 RANGES/OVENS/COOKTOPS

Comments: Inspected

The range, ovens and cooktops are in satisfactory condition and operational.



10.1 Item 1(Picture)

10.2 FOOD WASTE DISPOSAL

Comments: Inspected

123 Any Street Page 43 of 70

The disposal is in satisfactory condition and operational.



10.2 Item 1(Picture)

10.3 MICROWAVE COOKING EQUIPMENT

Comments: Inspected

The microwave oven is in satisfactory condition and operational.



10.3 Item 1(Picture)

10.4 TRASH COMPACTOR

Comments: Not Present

None present.

10.5 BUILT IN REFRIGERATOR

Comments: Inspected

123 Any Street Page 44 of 70

The built in refrigerator is in satisfactory condition and operational.





10.5 Item 1(Picture)

10.5 Item 2(Picture)

10.6 INSTANT HOT/COLD WATER SYSTEM

Comments: Inspected

The instant cold water system is in satisfactory condition and operational.

10.7 WARMING DRAWER

Comments: Not Present

Not present.

10.8 GENERAL

Comments: Inspected

(1) The wine cooler is in satisfactory condition and operational.



10.8 Item 1(Picture)

(2) The reverse osmosis system is inoperable. Repair as needed.

Reverse osmosis systems are prone to leakage and cause water damage to sink base cabinets. Monitor for leakage and repair as necessary.

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

11. SWIMMING POOLS AND EQUIPMENT

123 Any Street Page 45 of 70

Items

11.0 Type of Pool and/or Spa.

Comments: Inspected

In ground.



11.0 Item 1(Picture)



11.0 Item 2(Picture)

11.1 Interior Finish Materials. Type and condition.

Comments: Inspected

Epoxied Stone.

The interior finish is in satisfactory condition.

11.2 Deck, coping and steps. Condition of the pool and/or spa deck, internal steps and seats, external stairs and ladders, coping, perimeter tile trim, grout seam between the coping and pool structure.

Comments: Inspected

The deck, coping and steps are in satisfactory condition.

11.3 Filters. Type and condition.

123 Any Street Page 46 of 70

Comments: Inspected

Sand.

The filter is in satisfactory condition.



11.3 Item 1(Picture)

11.4 Cross connections.

Comments: Inspected

There is a vacuum breaker or anti-siphon device installed on the self levelling automatic filling water supply.



11.4 Item 1(Picture)

11.5 Equipment. Condition of pumps. motors, blowers, skimmers, drains, gauges, visible piping and valves.

Comments: Inspected


123 Any Street Page 47 of 70

(1) Overall the pool equipment is in satisfactory condition.



11.5 Item 1(Picture)

(2) The aerator valve handle is broken, I recommend replacement.

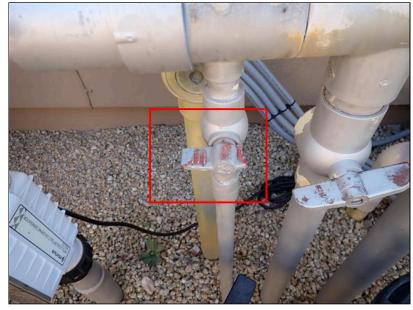

11.5 Item 2(Picture)

11.6 Electrical Components. Condition of underwater lighting, GFCIs, conduit, components and timer assemblies. Presence and condition of external bonding of pump motors, blowers and heaters. Deck mounted controls are not tested. If the pool or spa is equipped with deck mounted controls I recommend professional evaluation and service/repair.

Comments: Inspected

123 Any Street Page 48 of 70

(1) Overall the electrical components are in satisfactory condition.

The GFCI is present and operational.

The electrical conduit is in satisfactory condition.


The timer assembly is in satisfactory condition.



11.6 Item 1(Picture)




11.6 Item 2(Picture)

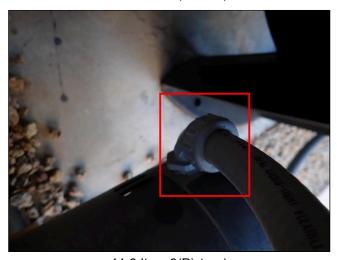

11.6 Item 3(Picture)



11.6 Item 4(Picture)

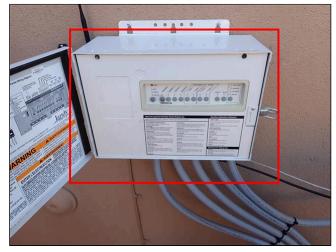


11.6 Item 5(Picture)



11.6 Item 6(Picture)

123 Any Street Page 49 of 70

(2) The bonding conductor is not attached, secure the bonding conductor as needed to prevent electrical hazard.

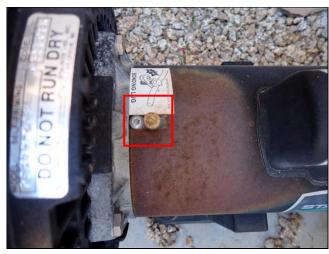

11.6 Item 7(Picture)

11.7 Heater. Type and condition.

Comments: Inspected

Natural gas.

The pool heater is in satisfactory condition and operational.




11.7 Item 1(Picture)

11.8 Cleaning systems. Type only. No representation is made regarding the operation or effectiveness of cleaning systems.

Comments: Inspected

123 Any Street Page 50 of 70

In floor pop-ups.

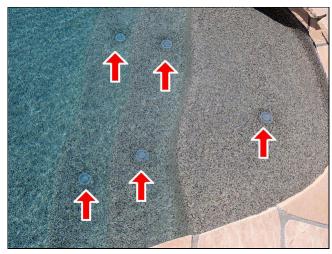

11.8 Item 1(Picture)

11.9 Handrails and Ladders. Condition.

Comments: Repair or Replace

Consider the addition of hand rails for the stairs.



11.9 Item 1(Picture)

11.10 Child Safety Barriers. Type and condition.

Comments: Repair or Replace

I recommend the installation of child protective barriers.


I recommend the addition of automatic closing devices on doors and gates that provide access to the pool area.

11.11 Entrapment Prevention Components.

Comments: Inspected

123 Any Street Page 51 of 70

There are anti-vortex covers on the drains.

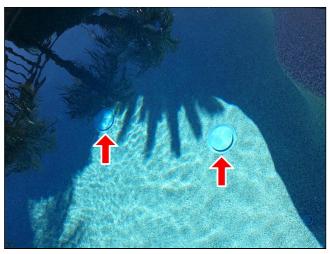

11.11 Item 1(Picture)

11.12 Salt system/Ozone generator.

Comments: Inspected Satisfactory condition.





11.12 Item 1(Picture)

11.12 Item 2(Picture)

11.13 GENERAL

Comments: Repair or Replace

For all of your pool service and repair needs I recommend, CTB Pool Service, Cliff Brummett 602-319-3429

No referral fee is paid to Nau Inspections LLC for any referral.

123 Any Street Page 52 of 70

General Summary



Nau Inspections

11445 E Via Linda Suite 2 #460 Scottsdale, AZ 85259 480-226-7915

> **Customer** Linda Sample

Address 123 Any Street

Scottsdale AZ 85255

The following items or discoveries indicate that these systems or components do not function as intended or adversely affects the habitability of the dwelling; or appear to warrant further investigation by a specialist, or requires subsequent observation. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function, efficiency, or safety of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.


2. EXTERIOR

2.0 WALL CLADDING CONDITION (13)


Inspected

(2) Seal all exterior cracks and penetrations to prevent water and pest intrusion.

123 Any Street Page 53 of 70

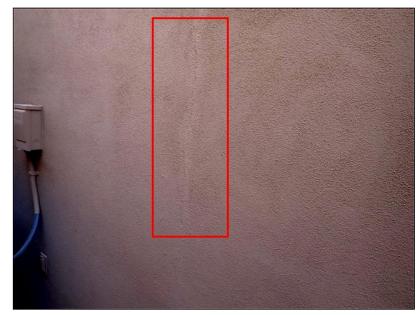


2.0 Item 1(Picture)

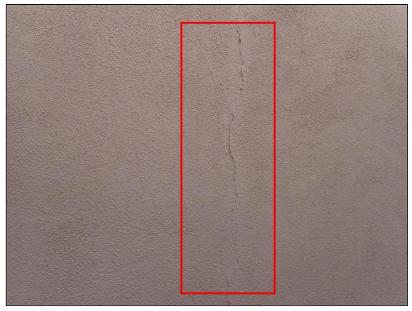

2.0 Item 2(Picture)

123 Any Street Page 54 of 70

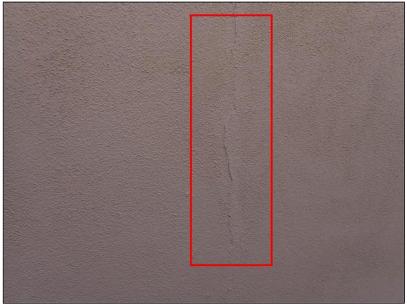


2.0 Item 3(Picture)

2.3 WINDOWS CONDITION AND OPERATION (16/75)

Inspected

(2) The front courtyard left bedroom window does not lock. Repair as necessary.

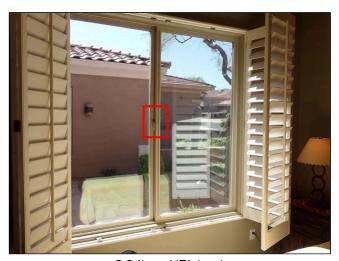

2.3 Item 1(Picture)


2.8 VEGETATION, ADVERSE IMPACT ON STRUCTURE (21)

Repair or Replace

Tree limbs/vegetation in contact with the exterior and roof can cause damage and provide access for rodents. Trim as necessary to prevent damage.

123 Any Street Page 55 of 70



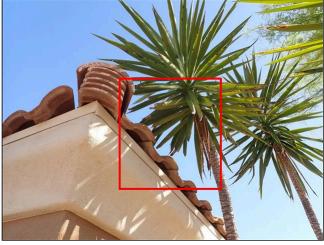

2.8 Item 1(Picture)

2.8 Item 2(Picture)




2.8 Item 3(Picture)

2.9 GRADING, DRAINAGE, CONDITION AND ANY ADVERSE IMPACT ON STRUCTURE (22)

Inspected

(2) The stucco runs to grade on the framed walls in several locations. This is conducive to water damage and termite activity. Keep the soil in the affected areas as dry as possible to prevent damage. Adjust the grade to direct surface water away from the walls.







2.9 Item 2(Picture)

123 Any Street Page 56 of 70




3. ROOFING

3.0 ROOF COVERINGS CONDITION (25)

Inspected

(3) Routine maintenance required to repair cracked tiles, secure slipped tiles and repair cracked mudballs. I recommend professional repair by a licensed roofer.

123 Any Street Page 57 of 70

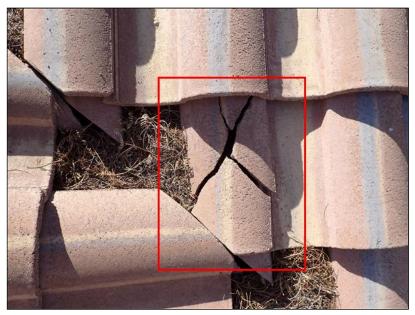


3.0 Item 37(Picture)



3.0 Item 38(Picture)

123 Any Street Page 58 of 70

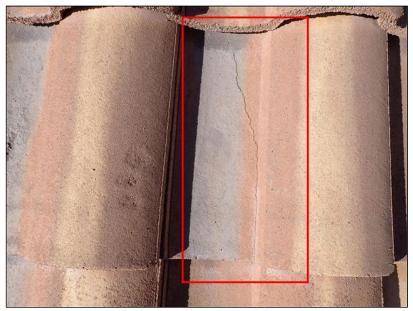

3.0 Item 39(Picture)



3.0 Item 40(Picture)

3.1 DRAINAGE SYSTEMS CONDITION (26)

Inspected

(2) Remove the leaf litter to improve water flow off the roof.

123 Any Street Page 59 of 70



3.1 Item 1(Picture)



3.1 Item 2(Picture)

3.5 General

Repair or Replace

For all of your roofing needs, I recommend Bryce with Acclaimed Roofing. 480-454-7033. admin@acclaimedroofing.com. No referral fee is paid to Nau Inspections LLC.


4. PLUMBING SYSTEM


4.11 WATER HEATER CONDITION (39)

Inspected

Water heaters typically last 8-12 years in Arizona. This water heater is a 2013 model and near the end of its service life. Budget for replacement soon. I highly recommend the purchase of a home warranty to help defer owner expense in the event of water heater failure.

123 Any Street Page 60 of 70

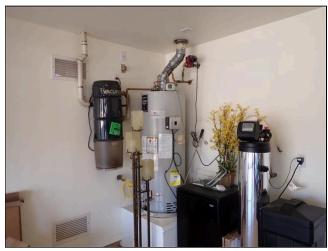

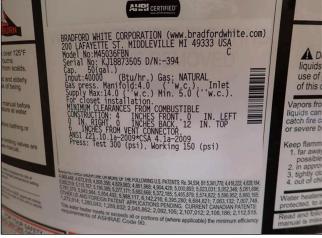

4.11 Item 1(Picture) 2013 Model 50 Gallon natural gas

4.11 Item 2(Picture)

4.13 FLUES AND COMBUSTION AIR VENTS (41)

Inspected

(2) Secure the draft collar to the ceiling to prevent fire drafting into the attic.



4.13 Item 2(Picture)

4.14 FUEL DISTRIBUTION SYSTEM AND SUPPORTS (42)

Repair or Replace

There is no sediment trap installed on the gas supply for the water heater. I recommend professional evaluation with repair as necessary to prevent hazard/damage.

123 Any Street Page 61 of 70



4.14 Item 1(Picture)

5. ELECTRICAL SYSTEMS

5.9 SMOKE DETECTORS and CARBON MONOXIDE MONITORS PRESENCE (smoke detectors over ten years old should be replaced)

Inspected

(1) There are two types of smoke detectors installed in homes today, lonization and Photoelectric. lonization type detectors are installed in about 90% of homes and are more sensitive to the flaming stage of a fire.

Open (fast flame) fires account for the majority of house fires and injuries but only 15% of fatalities.

lonization type detectors respond slower to smoldering fires and fail completely 20-25% of the time.

Photoelectric type detectors are more sensitive to the smoldering stages of fires which account for 12% of fires but 50% of fire fatalities and 30% of injuries. The majority of fire related deaths occur during smoldering fires while occupants of the home are sleeping.

We strongly recommend the replacement of all lonization type smoke detectors with Photoelectric type detectors. All smoke detectors should be replaced after ten years due to loss of sensitivity.

Note - This is not a seller defect. This is our safety recommendation to you, the buyer.

(2) Smoke detectors are present in the hallway but not in the bedrooms. I recommend the installation of new smoke detectors for each bedroom.



5.9 Item 1(Picture)

123 Any Street Page 62 of 70

9. INSULATION AND VENTILATION

9.4 KITCHEN VENTILATION CONDITION (82)

Inspected

(2) The kitchen vent exterior flapper is loud when windy. Remedy as necessary.






9.4 Item 2(Picture)

9.4 Item 3(Picture)

11. SWIMMING POOLS AND EQUIPMENT

11.5 Equipment. Condition of pumps. motors, blowers, skimmers, drains, gauges, visible piping and valves. Inspected

(2) The aerator valve handle is broken, I recommend replacement.

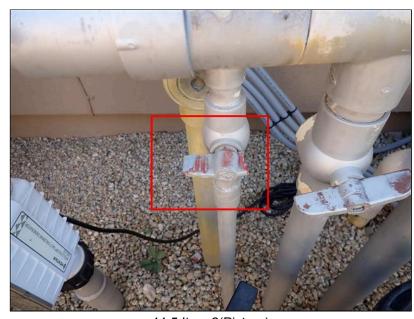


11.5 Item 2(Picture)

11.6 Electrical Components. Condition of underwater lighting, GFCIs, conduit, components and timer assemblies. Presence and condition of external bonding of pump motors, blowers and heaters. Deck mounted controls are not tested. If the pool or spa is equipped with deck mounted controls I recommend professional evaluation and service/repair.

Inspected

123 Any Street Page 63 of 70

(2) The bonding conductor is not attached, secure the bonding conductor as needed to prevent electrical hazard.

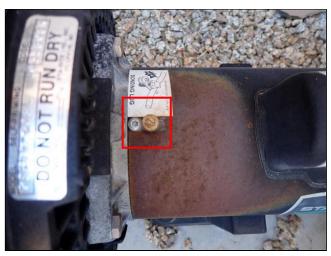

11.6 Item 7(Picture)

11.9 Handrails and Ladders. Condition.

Repair or Replace

Consider the addition of hand rails for the stairs.



11.9 Item 1(Picture)

11.10 Child Safety Barriers. Type and condition.

Repair or Replace

I recommend the installation of child protective barriers.

I recommend the addition of automatic closing devices on doors and gates that provide access to the pool area.

11.13 GENERAL

Repair or Replace

For all of your pool service and repair needs I recommend, CTB Pool Service, Cliff Brummett 602-319-3429

No referral fee is paid to Nau Inspections LLC for any referral.

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of

123 Any Street Page 64 of 70

the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge http://www.HomeGauge.com : Licensed To Inspected by Bob Nau

123 Any Street Page 65 of 70



INVOICE

Inspection Date: 5/15/2021 Report ID: 051521BN9

Nau Inspections 11445 E Via Linda Suite 2 #460 Scottsdale, AZ 85259 480-226-7915

Inspected By: Inspected by Bob Nau

Customer Info:	Inspection Property:	
Linda Sample	123 Any Street Scottsdale AZ 85255	
Customer's Real Estate Professional:		

Inspection Fee:

Service	Price	Amount	Sub-Total
Inspection Fee	450.00	1	450.00
Pool / Spa Inspection Fee	50.00	1	50.00
Termite Inspection	55.00	1	55.00

Tax \$0.00

Total Price \$555.00

Payment Method: Credit Card

Payment Status: Paid At Time Of Inspection

Note: Thank You!

123 Any Street Page 66 of 70

Account #: 051521BN9

Home Inspection Authorization and Agreement

Nau Inspections 11445 E Via Linda Suite 2 #460 Scottsdale, AZ 85259 480-226-7915

Customer(s)

Linda Sample

Inspection Site Property

123 Any Street, Scottsdale, AZ 85255

- 1. The Customer(s) hereby authorizes and contracts for Nau Inspections to conduct a home inspection on the subject named inspection site property. Legal access to the entire property will be provided to Nau Inspections for the purposes of conducting a limited visual inspection in accordance with the terms and conditions of this contract.
- 2. The inspection report and its contents are intended for the exclusive use of, and are the non-transferable property of Nau Inspections and the Customer(s).
- 3. The customer's signature below acknowledges that he/she has read, understands, and accepts the terms, conditions, and limitations as outlined in this Nau Inspections
 Home Inspection Authorization and Agreement and the Scope, Purpose, Limitations and Exclusions of this inspection. Any acceptance or use of this Inspection Report
 shall constitute acceptance of all of the terms and conditions as listed below. reserves the right to supplement any report with an addendum within (3) three business days of
 the inspection date.
- 4. The Customer(s) agrees to pay Nau Inspections the fee specified below at the time of the inspection. Nau Inspections reserves the right to "not" release its Inspection Report without payment in full.

THE TOTAL FEE FOR THIS INSPECTION IS: \$ 555.0	00
(Linda Sample Signature) (Date)	
(Robert Nau Signature) (Date)	_

123 Any Street Page 67 of 70

Scope and Purpose / Limitations and Exclusions

- 1. The Scope and Purpose of this inspection is to visually examine the safely and readily accessible portions, as set forth in the State of Arizona Standards of Professional Practice, of the structural, heating, cooling, plumbing, roofing, electrical and permanently attached kitchen appliance systems and components of the subject named inspection property specified in this Home Inspection Authorization and Agreement and the inspection report for conditions which are adversely affecting their normally intended function or operation within the limits set forth in this Home Inspection Authorization and Agreement and the inspection report. Only the visible and safely and readily accessible portions of the items and components specified in the inspection report shall be inspected. No other systems, items or appliances, are included in this inspection. The inspection performed by Nau Inspections is supplemental to any real estate transfer or seller's disclose statement and shall not be used as a substitute for such disclosure statements.
- 2. Excluded in any inspection of any systems or items not included in the inspection report including but not limited to the following: any systems that are shut down or inactive, any information pertaining to manufacturers recalls of any component or "class action" litigation or settlements against contractors or manufactures, detached buildings or equipment, the presence/damage caused by insects or other pests, low-voltage systems, pools, spas, hot tub systems, saunas, electrostatic precipitators or electronic air cleaners or filters, septic systems, any component or system which is underground, private water systems or equipment, wells and well pumps, cisterns, ponds, fountains, water quality or volume, water conditioning systems, elevators, lifts, dumbwaiters, audio and video systems, central vacuum systems, fencing, automatic gates, landscaping, irrigations systems, playground equipment, active and passive solar systems, soils, security systems, smoke or fire detection or suppression systems, windows, window and door screening, retaining walls, any detached buildings or structures (other than garage or carport) and any inspection or testing of any toxic or dangerous substances including asbestos, lead or gasses including radon and formaldehyde, other than gases typically used as fuel for home heating systems, or any system or item not included in or which is excepted for the inspection report. The inspection will not include any area that has access or clearance less than thirty inches in any direction, or is not safely accessible from a twelve foot ladder. In the event that the Inspection Report supplies information about any of the forgoing, this information shall be deemed to be informational only and supplied as a courtesy to the Customer(s), and shall not be deemed to be an amendment to or waiver of the forgoing exclusions.
- 3. This inspection is not technically exhaustive. This is not an engineering inspection or analysis and no engineering tests will be made. No examination will be made to determine compliance with any governmental ordinance, regulation, or code (notwithstanding any reference in the inspection report to any code provision). The inspection report is not to be considered an implied or express warranty or insurance on the subject inspected property or its components concerning future use, operability, habitability, or suitability. The sole purpose of the inspection is for the Customer(s) to be informed of as many conditions as possible within the brief period of time allotted for the inspection and the limited access to the subject named property which is made available by the current owner. The Customer(s) has no expectation of being notified of all conditions, and waives any claim to conditions which are not reported. is not responsible for any condition affecting any system or component which occurs subsequent to the inspection or is intermittent and/or otherwise not detectable for any reason during the inspection. If Nau Inspections refers the Customer(s) to a third party for evaluation of a condition, intends for the Customer(s) to pursue this evaluation **PRIOR TO CLOSING** on the purchase of or taking or other action with respect to the subject named property. This inspection will be performed in accordance with the State of Arizona Standards of Professional Practice unless otherwise noted and where conditions permit.
- 4. The Customer(s) acknowledges that Nau Inspections warrants that its inspection services will be performed in accordance with the Scope and Purpose of this Home Inspection Authorization and Agreement and the inspection report only. This is a limited and non-transferable warranty and is the only warranty that is given or made by Nau Inspections and the Customer(s) receives no other warranty, express or implied. All other warranties including warranties of merchantability and fitness for particular purpose are expressly excluded. This stated express warranty is in lieu of all liabilities or obligations of Nau Inspections for damages arising out of or in connection with the performance of the inspection and delivery and use of and reliance on the inspection report. Nau Inspections does not guarantee that the structure inspected will be free from faults or defects. The Customer(s) waives any claim for consequential, exemplary, or incidental damages, even if the Customer(s) has been advised of the possibility of such damages. The Customer(s) expressly intends for Nau Inspections to have no obligations or duty except as expressly set forth in this Home Inspection Authorization and Agreement.
- 5. In the event of a breach or a failure of the foregoing warranty, misrepresentation or negligent inspection by Nau Inspections (Excluding willful misconduct), the Customer(s) agrees that the liability of Nau Inspections, and for its agents, employees and Inspectors, for claims or damages, cost of defense and suit, attorney's fees or expenses and payments arising out of or in any way connected with errors or omissions in the inspection or the Inspection report shall be limited to liquidated damages in an amount equal to all amounts paid for the Inspection to Nau Inspections by the Customer(s). The Customer(s) acknowledges the liquidated damages are not intended as a penalty but are intended to: (1) reflect the fact that actual damages may be difficult and impractical to ascertain; (2) to allocate risk among Nau Inspections and the Customer(s); and (3) to enable Nau Inspections to perform the inspection at the stated inspection fee. In the event of the tender by Nau Inspections of a refund of the inspection fee, such refund shall be full and final settlement of all present and future claims and causes of action and Nau Inspections shall be thereupon generally and fully

123 Any Street Page 68 of 70

released

- 6. Except as expressly provided herein, The Customer(s) agrees to indemnify and hold Nau Inspections and its Inspector(s) harmless (Including costs of defense and attorney's fees) from and against all liabilities, claims, causes of action, damages and actions, including Nau Inspections breach of contract, misrepresentation and negligence, and including costs and attorneys fees related to or arising from the conduct of the inspection or the delivery of the inspection report which are the subject of this Home Inspection Authorization and Agreement (excluding only willful misconduct).
- 7. The Customer(s) hereby expressly waives and releases any claims and cause of action against the inspector personally, excluding solely willful misconduct, and agrees to look solely at Nau Inspections for any and all liability related to the inspection including the negligence of the inspector. The Customer(s) hereby agrees to indemnify the inspector personally for any and all causes of action, including costs of defense and attorneys' fees, related to or arising from any claim brought by the Customer(s) against the Inspector(s).
- 8. It is the responsibility of the customer(s) to make the Subject named property and its components accessible for this inspection. Nau Inspections are not authorized to turn on gas mains or valves, water mains or valves, activate electrical power or pilot lights, nor move items in order to gain access to an area or component. Except for the removal of electrical service panels (where possible without damage to property), furnace and water heater inspection panels, inspectors will not remove panels, or disassemble any item for access to a component which is contained by fasteners that require tools for entry. Areas containing standing water or mud are considered inaccessible. Decisions relating to safety are as at the inspector's discretion, but they are specifically prohibited from climbing on roofs during high winds, roofs that are slippery or high pitched or entering areas in which potentially dangerous pets are contained. Inspectors are not required or expected to move or remove personal property from or at the subject named property in order to conduct the inspection.
- 9. Additional trips for re-inspection, or to perform or complete an inspection, for reasons beyond the control of Nau Inspections, (e.g. inaccessibility of the items normal to the inspection, inactive utilities, or an inability to gain access to the Subject named property), will be performed at an additional fee plus an applicable trip charge.
- 10. In the event the Customer(s) has a claim of a breach or failure of warranty, misrepresentation or negligent inspection of any component or item in the inspection, the Customer(s) shall provide Nau Inspections with three (3) working days to re-inspect the component or item before the Customer(s) repairs or replaces the component or item. This right of re-inspection is to protect Nau Inspections and the Customer(s) from the business practices of some contractors who base their recommendations to repair or replace components of false or misleading information. If the Customer(s) fails to allow Nau Inspectionsto re-inspect, the Customer(s) waives any claim against Nau Inspections with respect to the component or item.
- 11. In the event any dispute, controversy, or claim arises regarding this Authorization and Agreement or the contents of the Inspection Report it is agreed that all parties shall attempt, in good faith, to settle such disputes between themselves. In the event such attempts fail to resolve such disputes, controversy, or claim prior to filing any legal action by the Customer(s), the Customer(s) shall submit to Nau Inspections written notification of the dispute and the Customer(s) intent to file a legal action, and Nau Inspections shall have thirty (30) days to submit to binding and final arbitration under the Expedited Arbitration Rules of the American Arbitration Association. The parties submitting the dispute, controversy, or claim shall appoint an arbitrator by mutual agreement arbitrator and this arbitrator should have knowledge of the home inspection profession and industry with at least five years of home inspection experience and who will follow substantive rules of law. Each party further agrees to pay its own arbitration costs. Any decision of the arbitrator appointed there under shall be final and binding and judgment of the award may be entered into any court of competent jurisdiction.
- 12. No action, whether in contract or tort, shall be brought against Nau Inspections in arbitration or a court of law beyond the earlier of one year following the date of the Inspection Report or 120 days after discovery by the Customer(s) of the condition that forms the basis of the action.
- 13. If a claim is made against Nau Inspections for any alleged error omission or other act arising out of the performance of this inspection, whether in court or in arbitration, and if Customer(s) fails to prove such claim, the Customer(s) agrees to pay all costs and attorney's fees incurred by Nau Inspections and its employees, agents, inspectors, directors, shareholders, successors and assigns.
- 14. This Inspection Report is not intended for use by anyone other than the Customer(s). No third party shall have any right arising from this Authorization and Agreement or the Inspection Report. In consideration of the furnishing of the Inspection Report, the Customer(s) agrees to indemnify and hold harmless Nau Inspections, its agents, employees, inspectors, directors, officers, shareholders, successors and assigns, for all costs, expenses, legal fees, awards, settlements, judgments, and any other payments of any kind whatsoever incurred and arising out of a law suit, cross-complaint, counter suit, arbitration, administrative proceeding, or any other legal proceeding brought by any third party who claims that he/she relied on representations made in such Inspection Report and was damaged thereby. Customer's request that Nau Inspections release copies of the Inspection Report shall be at the Customer's own risk with respect to the contents of this paragraph.

123 Any Street Page 69 of 70

15. The presence of Customer(s) has been requested during the inspection. If Customer(s) is not present at the time of the inspection or for any other reason is unable to sign this Contract at the time of inspection, acceptance of the Inspection Report shall constitute acceptance of the terms and conditions of the Contract as if signed by Customer(s).

16. Nau Inspections will not return to any property which it has previously inspected for the purpose of re-inspection to verify that any conditions documented in the course of the original inspection have been modified or corrected or that any remedial measures have been performed. For this reason, recommends that all repairs, corrective measures, or new work undertaken on any component or system be performed only by qualified and competent individuals, licensed when applicable and that only new, appropriate or specified materials be used. Further, that all work be performed in a workmanlike manner and in accordance with all appropriate applicable industry standards and governmental codes, ordinances and regulations. Subsequent to completion, it is recommended that all such work be documented by work orders, invoices or receipts from the individuals or companies which performed the work.

123 Any Street Page 70 of 70