Confidential Inspection Report 528 Locust Avenue Manteca, California 95337



**Prepared for: Irma Conteras** 

This report is the exclusive property of the inspection company and the client whose name appears herewith and its use by any unauthorized persons is prohibited.

## **Report Table of Contents**

GENERAL INFORMATION	5
GROUNDS	7
EXTERIOR - FOUNDATION	9
ROOF SYSTEM	11
ELECTRICAL SYSTEM	13
HEATING - AIR CONDITIONING	17
PLUMBING SYSTEM	20
KITCHEN - APPLIANCES	23
BATHROOMS	25
INTERIOR ROOMS	27
LAUNDRY AREA	33
GARAGE - CARPORT	35

RE: 528 Locust Avenue Manteca, California 95337



#### Dear : Irma Conteras

At your request, a visual inspection of the above referenced property was conducted on . An earnest effort was made on your behalf to discover all visible defects, however, in the event of an oversight, maximum liability must be limited to the fee paid. The following is an opinion report, reflecting the the visual conditions of the property at the time of the inspection only. Hidden or concealed defects cannot be included in this report. No warranty is either expressed or implied. This report is not an insurance policy, nor a warranty service.

#### SUMMARY OF AREAS REQUIRING FURTHER EVALUATION

**IMPORTANT:** The Summary is not the entire report. The complete report may include additional information of concern to the client. It is recommended that the client read the complete report. The entire Inspection Report, including the Standards of Practice, limitations and scope of Inspection, and Pre-Inspection Agreement must be carefully read to fully assess the findings of the inspection. This list is not intended to determine which items may need to be addressed per the contractual requirements of the sale of the property. Any areas of uncertainty regarding the contract should be clarified by consulting an attorney or real estate agent.

It is strongly recommended that you have appropriate licensed contractors evaluate each concern further and the entire system for additional concerns that may be outside our area of expertise or the scope of our inspection BEFORE the close of escrow. Please call our office for any clarifications or further questions.

Here is a list of major defects that need further evaluation or repair by appropriately Licensed Contractors.

#### BATHROOMS

<u>Tub/Shower Fixtures:</u> Hall Bath: Minor leakage is noted at faucet handles.

#### **INTERIOR ROOMS**

<u>Smoke / Fire Detector:</u> *Entry / Foyer / Hall:* There is no smoke detector installed in this room. For safety considerations, you should consider installation of a battery operated or hardwired smoke detector.

#### Master Bedroom:

There is no smoke detector installed in this room. For safety considerations, you should consider installation of a battery operated or hardwired smoke detector.

#### Bedroom #2:

There is no smoke detector installed in this room. For safety considerations, you should consider installation of a battery operated or hardwired smoke detector.

#### **GARAGE - CARPORT**

Garage Door: Service Doors: Hardware operational, Door or its hardware needs repair or replacement. At least one of the door hinges needs to be replaced with a self-closingng, all fire doors need to be self closing, There is no fire rated door separating the garage from the living areas of the house.

Other minor items are also noted in the entire inspection report and should receive eventual attention, but do not affect the habitability of the house and the majority are the result of normal wear and tear.

Thank you for selecting our firm to do your pre-purchase home inspection. If you have any questions regarding the inspection report or the home, please feel free to call us.

Sincerely, Damon Stevenson Damon's Home Inspection Services

# **GENERAL INFORMATION**

## **Client & Site Information:**



	A ( 10.0000						
Inspection Date:	August 12,2022.						
Client:	Irma.						
Inspection Site:	528 Locust Avenue Manteca, California 95337.						
House Occupied?	Yes.						
People Present:	Homeowner.						
Building Characteristics:							
Main Entry Faces:	North.						
Estimated Age:	Built in 1950.						
Building Type:	1 family.						
Stories:	1						
Space Below Grade:	Ground floor living area.						
Climatic Conditions:							
Weather:	Clear.						
Soil Conditions:	Dry.						
Outside Temperature (f)	<i>:</i> 70-80.						
	Utility Services:						
Water Source:	Public.						
Sewage Disposal:	Public.						

Utilities Status:	All utilities on.					
Payment Information:						
Total Fee:	\$250.					
Paid By:	Cash.					

### **About Rated Items:**

Items not found in this report are beyond the scope of this inspection and should not be considered inspected at this time. Please read the entire report for important details. Inspected items may be generally rated as follows:

**OK = "Serviceable" =** Item is functional and we did not observe conditions that would lead us to believe problems existed with this system or component. Some serviceable items may show wear and tear. Other conditions may be noted in the body of the report.

**MM = "Marginal/Maintenance" =** Item warrants attention or monitoring, or has a limited remaining useful life expectancy and may require replacement in the not too distant future. Further evaluation or servicing may be needed by a qualified licensed contractor or specialty tradesman dealing with that item or system.

**RR = "Repair or Replace" =** Item, component, or unit is not functioning as intended and needs repair or replacement. Further evaluation is needed by a qualified licensed contractor or specialty tradesman dealing with that item or system.

SAF = "Safety Concern" = Poses a risk of Injury or death.

**NI = "Not Inspected" =** Item was not visible, not accessible, or not able to be operated at the time of inspection, due to safety concerns or the possibility of damage.

### **REPORT LIMITATIONS**

This report is intended only as a general guide to help the client make his own evaluation of the overall condition of the home, and is not intended to reflect the value of the premises, nor make any representation as to the advisability of purchase. The report expresses the personal opinions of the inspector, based upon his visual impressions of the conditions that existed at the time of the inspection only. The inspection and report are not intended to be technically exhaustive, or to imply that every component was inspected, or that every possible defect was discovered. No disassembly of equipment, opening of walls, moving of furniture, appliances or stored items, or excavation was performed. All components and conditions which by the nature of their location are concealed, camouflaged or difficult to inspect are excluded from the report. The inspection is performed in compliance with generally accepted standard of practice, a copy of which is available upon request.

Systems and conditions which are not within the scope of the inspection include, but are not limited to: formaldehyde, lead paint, asbestos, toxic or flammable materials, and other environmental hazards; pest infestation, playground equipment, efficiency measurement of insulation or heating and cooling equipment,

internal or underground drainage or plumbing, any systems which are shut down or otherwise secured; water wells (water quality and quantity) zoning ordinances; intercoms; security systems; heat sensors; cosmetics or building code conformity. Any general comments about these systems and conditions are informational only and do not represent an inspection.

The inspection report should not be construed as a compliance inspection of any governmental or non governmental codes or regulations. The report is not intended to be a warranty or guarantee of the present or future adequacy or performance of the structure, its systems, or their component parts. This report does not constitute any express or implied warranty of merchantability or fitness for use regarding the condition of the property and it should not be relied upon as such. Any opinions expressed regarding adequacy, capacity, or expected life of components are general estimates based on information about similar components and occasional wide variations are to be expected between such estimates and actual experience.

We certify that our inspectors have no interest, present or contemplated, in this property or its improvement and no involvement with tradespeople or benefits derived from any sales or improvements. To the best of our knowledge and belief, all statements and information in this report are true and correct.

Should any disagreement or dispute arise as a result of this inspection or report, it shall be decided by arbitration and shall be submitted for binding, non-appealable arbitration to the American Arbitration Association in accordance with its Construction Industry Arbitration Rules then obtaining, unless the parties mutually agree otherwise. In the event of a claim, the Client will allow the Inspection Company to inspect the claim prior to any repairs or waive the right to make the claim. Client agrees not to disturb or repair or have repaired anything which may constitute evidence relating to the complaint, except in the case of an emergency.

# GROUNDS

This inspection is not intended to address or include any geological conditions or site stability information. We do not comment on coatings or cosmetic deficiencies and the wear and tear associated with the passage of time, which would be apparent to the average person. However, cracks in hard surfaces can imply the presence of expansive soils that can result in continuous movement, but this can only be confirmed by a geological evaluation of the soil. Any reference to grade is limited to only areas around the exterior of the exposed areas of foundation or exterior walls. We cannot determine drainage performance of the site or the condition of any underground piping, including subterranean drainage systems and municipal water and sewer service piping or septic systems. Decks and porches are often built close to the ground, where no viewing or access is possible. Any areas too low to enter or not accessible are excluded from the inspection. We do not evaluate any detached structures such as storage sheds and stables, nor mechanical or remotely controlled components such as driveway gates. We do not evaluate or move landscape components such as trees, shrubs, fountains, ponds, statuary, pottery, fire pits, patio fans, heat lamps, and decorative or low-voltage lighting. Any such mention of these items is informational only and not to be construed as inspected.

## **Paving Conditions:**

OK MM RR  $\mathbf{\Lambda}$ 

Driveway:

 $\Box$ Cracks noted are typical.



OK MM RR

Walks:

- Sidewalk type: Concrete, Surface raised/settled, Tripping hazards.
- □ ☑ □ Sidewalk type: Concrete, Cracks noted are typical, Cracks noted are major.



Exterior Steps / Stoops: 🗹 🛛 🖓

## Patio / Porch:

Type: Open design.

Slab:



 $\mathbf{\nabla}$ 

Structure:

☑ □ □ Patio type: Concrete. Cracks noted - typical.

Fences & Gates:							
	OK	MM	RR				
Condition:	V			Type: Wood.			
				Grading:			
Site:	V			Flat site, Grade at foundation appears serviceable.			
				Landscaping:			
Condition:	V						
E	KT	ER	RIC	R - FOUNDATION			
All structures are dependent on the soil beneath them for support, but soils are not uniform. Some that appear to be firm and solid can become unstable during seismic activity or may expand with the influx of water, moving structures with relative easy and fracturing slabs and other hard surfaces. In accordance with our standards of practice, we identify foundation types and look for any evidence of structural deficiencies. However, minor cracks or deteriorated surfaces are common in many foundations and most do not represent a structural problem. If major cracks are present along with bowing, we routinely recommend further evaluation be made by a qualified structural engineer. All exterior grades should allow for surface and roof water to flow away from the foundation. All concrete floor slabs experience some degree of cracking due to shrinkage in the curing process. In most instances floor coverings prevent recognition of cracks or settlement in all but the most severe cases. Where carpeting and other floor coverings are installed, the materials and condition of the flooring underneath cannot be determined. Areas hidden from view by finished walls or stored items cannot be judged and are not a part of this inspection. We will certainly alert you to any suspicious cracks if they are clearly visible. However, we are not specialists, and in the absence of any major defects, we may not recommend that you consult with a foundation contractor, a structural engineer, or a geologist, but this should not deter you from seeking the opinion of any such expert. We also routinely recommend that inquiry be made with the seller about knowledge of any prior foundation or structural repairs.							
			E	Exterior Walls:			
Materials & Condition:	$\checkmark$			Walls are constructed with: Stucco.			
Flashing & Trim:	$\checkmark$			Wood materials.			
Chimney:							
Please Note:	there meta meta foun Our gene	e are al one al one id in re inspe eralist	three s tha s sho eside ction and	de variety of chimneys and interrelated components. However, basic types, single-walled metal, masonry, and pre-fabricated t are commonly referred to as factory-built ones. Single-walled buld not be confused with factory-built metal ones, and are rarely ntial use, but masonry and factory-built ones are commonplace. of them conforms to industry standards, and is that of a not a specialist. However, significant areas of chimney flues quately viewed during a field inspection. Therefore, because our			

inspection of chimneys is limited to areas easily viewed and does not include the use of specialized equipment, we will not guarantee their integrity or drafting ability and recommend that they be more thoroughly evaluated before the close



	OK	MM	RR	
Chimney Exterior:	$\checkmark$			Brick materials.
Flue:				The fireplace flue was not checked from the top side. The inspector did not climb on to the roof or could not get to the chimney top.
Flashing:				Satisfactory - The installed flashing around the chimney stack appears to be functional.
Chimney Cap:				There is no chimney cap installed. Installation of a chimney cap is highly recommended to prevent water from entering the masonry stack or entering the wood chase causing deterioration. Top of chimney is covered in plastic no viewing of a rain hat.
	A.S.			
Height & Clearance:	V			The chimney installation appears to meet clearance requirements.
				Foundation:
Materials & Condition:				Poured in place slab concrete, 8 inches or more thick. Slab is not visible due to carpet and/or floor covering - no readily visible problem are noted. The exterior view of the foundation is limited to the portions visible above grade. Satisfactory - The exposed portions of the perimeter foundation walls appear to be adequate.
Recent Movement:	The	re is r	no evi	dence of any recent movement.

# **ROOF SYSTEM**

Although not required to, we generally attempt to evaluate various roof types by walking on their surfaces. If we are unable or unwilling to do this for any reason, we will indicate the method used to evaluate them. Every roof will wear differently relative to its age, number of layers, quality of material, method of application, exposure to weather conditions, and the regularity of its maintenance. We can only offer an opinion of the general quality and condition of the roofing material.

The inspector cannot and does not offer an opinion or warranty as to whether the roof leaks or may be subject to future leakage. The waterproof membrane beneath roofing materials is generally concealed and cannot be examined without removing the roof material. Although roof condition can be evaluated, it is virtually impossible for anyone to detect a leak except as it is occurring or by specific water tests, which are beyond the scope of our service. Even water stains on ceilings or on framing within attics will not necessarily confirm an active leak without some corroborative evidence, and such evidence can be deliberately concealed. We evaluate every roof conscientiously, and even attempt to approximate its age, but we will not predict its remaining life expectancy, or guarantee that it will not leak. Naturally, the sellers or the occupants of a residence will generally have the most intimate knowledge of the roof and of its history. Therefore, we recommend that you ask the sellers about it, and that you either include comprehensive roof coverage in your home insurance policy, or that you obtain a roof certification from an established local roofing company. We do not inspect attached accessories including by not limited to solar systems, antennae, and lightning arrestors.

				Roof:	
Style:	Gab	le.			
Roof Access:	View OK		•	ound with binoculars.	
Roof Covering:	$\mathbf{V}$			Composition shingles.	
Flashings:					
	V				
				Valleys:	
	V			Satisfactory - The valleys appear to be in satisfactory condition.	
Eaves - Soffits - Fascias:					
	V				
Gutters & Downspouts:					

 $\square$   $\square$  Full centered no carriage return.

In accordance with our standards, we do not attempt to enter attics that have less than thirty-six inches of headroom, are restricted by ducts, or in which the insulation obscures the joists and thereby makes mobility hazardous, in which case we would inspect them as best we can from the access point. In regard to evaluating the type and amount of insulation on the attic floor, we use only generic terms and approximate measurements, and do not sample or test the material for specific identification. Also, we do not disturb or move any portion of it, and it may well obscure water pipes, electrical conduits, junction boxes, exhaust fans,

and other components.

## Attic & Insulation:

Access: Attic is full size, Accessible.

 $\mathbf{\nabla}$ 

 $\checkmark$ 

 $\mathbf{\Lambda}$ 

OK MM RR

Structure:

A rafter system is installed in the attic cavity to support the roof decking. The rafters or truss system appears to be in satisfactory condition.



Ventilation:

Satisfactory - There appears to be adequate ventilation installed. Vents are located both in the ridge area and low in the eaves area. There are ridge vents installed.



### Insulation:

□ □ Mineral wool.



### Depth & R-factor:

5-6 inches.

# ELECTRICAL SYSTEM

We are not electricians and in accordance with the standards of practice we only test a representative number of switches and outlets and do not perform load-calculations to determine if the supply meets the demand. However, every electrical deficiency or recommended upgrade should be regarded as a latent hazard that should be serviced as soon as possible, along with evaluation and certification of the entire system as safe by a licensed contractor. Therefore, it is essential that any recommendations that we may make for service or upgrades should be completed before the close of escrow, because an electrician could reveal additional deficiencies or recommend additional upgrades for which we disclaim any responsibility. Any electrical repairs or upgrades should be made by a licensed electrician. Aluminum wiring requires periodic inspection and maintenance by a licensed electrician. Smoke Alarms should be installed within 15 feet of all bedroom doors, and tested regularly.

Operation of time clock motors is not verified. Inoperative light fixtures often lack bulbs or have dead bulbs installed. The inspector is not required to insert any tool, probe, or testing device inside the panels, test or operate any over-current device except for ground fault interrupters, nor dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels. Any ancillary wiring or system that is not part of the primary electrical distribution system is not part of this inspection but may be mentioned for informational purposes only, including but not limited to low voltage systems, security system devices, heat detectors, carbon monoxide detectors, telephone, security, cable TV, intercoms, and built in vacuum equipment.



	EL	o otri o	al Distribution Danala
		MM RR	al Distribution Panels:
Main Panel Location:			Exterior of house, Appears serviceable.
Main Panel Observations:	Circui	it and wir	e sizing correct so far as visible, Grounding system is present.
Subpanel #1:			Located in the Exterior, Circuit and wire sizing correct so far as visible, Grounding system is present.
			Conductors:
Entrance Cables:			Copper.
Branch Wiring:			Copper, Appears serviceable.
		Sw	itches & Fixtures:
General:			A representative sampling of switches was tested. As a whole, switches throughout the house are in serviceable condition.
Kitchen Interior:			ve sampling of switches and fixtures was tested. As a whole, vitches throughout the room are in serviceable condition.
Hall Bath:	Switcl	hes and t	fixtures are functional.
Entry / Foyer / Hall:			ve sampling of switches and fixtures was tested. As a whole, vitches throughout the room are in serviceable condition.
Living Room			ve sampling of switches and fixtures was tested. As a whole, vitches throughout the room are in serviceable condition.

Dining Room:	A representative sampling of switches and fixtures was tested. As a whole, fixtures and switches throughout the room are in serviceable condition.						
Master Bedroom:	A representative sampling of switches and fixtures was tested. As a whole, fixtures and switches throughout the room are in serviceable condition.						
Bedroom #2:	A representative sampling of switches and fixtures was tested. As a whole, fixtures and switches throughout the room are in serviceable condition.						
Laundry:	Switches and fixtures are functional. A representative sampling of switches was tested. As a whole, switches and fixtures throughout the room are in serviceable condition.						
Garage Walls:	Found no damages to the Switches and fixture at the time of Inspection.						
	Electrical Outlets:						
General:	A representative sampling of outlets was tested. As a whole, outlets throughout the house are in serviceable condition.						
Kitchen Interior:	A representative sampling of switches and outlets was tested. As a whole, outlets and switches throughout the room are in serviceable condition.						
Hall Bath:	A representative sampling of switches and outlets was tested. As a whole, outlets and switches throughout the room are in serviceable condition.						
Entry / Foyer / Hall:	A representative sampling of switches and outlets was tested. As a whole, outlets and switches throughout the room are in serviceable condition.						
Living Room	A representative sampling of switches and outlets was tested. As a whole, outlets and switches throughout the room are in serviceable condition.						
Dining Room:	A representative sampling of switches and outlets was tested. As a whole, outlets and switches throughout the room are in serviceable condition.						
Master Bedroom:	A representative sampling of switches and outlets was tested. As a whole, outlets and switches throughout the room are in serviceable condition.						
Bedroom #2:	A representative sampling of switches and outlets was tested. As a whole, outlets and switches throughout the room are in serviceable condition.						
Laundry:	Electrical outlet is grounded.						
Garage Walls:	A representative sampling of switches and outlets was tested. As a whole, outlets and switches throughout the house are in serviceable condition.						
	Ceiling Fans:						
Entry / Foyer / Hall:	Satisfactory - There is a ceiling fan installed in this room. It appears to be functional.						



### Living Room

Satisfactory - There is a ceiling fan installed in this room. It appears to be functional.



### Dining Room:

Satisfactory - There is a ceiling fan installed in this room. It appears to be functional.



### Master Bedroom:

Satisfactory - There is a ceiling fan installed in this room. It appears to be functional.



Bedroom #2:

Satisfactory - There is a ceiling fan installed in this room. It appears to be functional.



# **HEATING - AIR CONDITIONING**

The inspector can only readily open access panels provided by the manufacturer or installer for routine homeowner maintenance, and will not operate components when weather conditions or other circumstances apply that may cause equipment damage. The inspector does not light pilot lights or ignite or extinguish solid fuel fires, nor are safety devices tested by the inspector. The inspector is not equipped to inspect furnace heat exchangers for evidence of cracks or holes, or inspect concealed portions of evaporator and condensing coils, heat exchanger or firebox, electronic air filters, humidifiers and de-humidifiers, ducts and in-line duct motors or dampers, as this can only be done by dismantling the unit. This is beyond the scope of this inspection. Thermostats are not checked for calibration or timed functions. Adequacy, efficiency or the even distribution of air throughout a building cannot be addressed by a visual inspection. Have these systems evaluated by a qualified individual. The inspector does not perform pressure tests on coolant systems, therefore no representation is made regarding coolant charge or line integrity. We perform a conscientious evaluation of the system, but we are not specialists.

Please note that even modern heating systems can produce carbon monoxide, which in a poorly ventilated room can result in sickness and even death. Therefore, it is essential that any recommendations we make for service or further evaluation be scheduled before the close of escrow, because a specialist could reveal additional defects or recommend further upgrades that could affect your evaluation of the property, and our service does not include any form or warranty or guarantee. Normal service and maintenance is recommended on a yearly basis. Determining the presence of asbestos materials commonly used in heating systems can ONLY be preformed by laboratory testing and is beyond the scope of this inspection. Determining the condition of oil tanks, whether exposed or buried, is beyond the scope of this inspection.

Leaking oil tanks represent an environmental hazard which is sometimes costly to remedy.

## Heating Equipment:

Type & Location:

Forced Air, The furnace is a newer high efficiency type with a fan installed in the vent pipe to push the burnt flue gases up and out the flue. Location: located in, Exterior of house.



### Fuel Source:

Natural Gas.



MM PP

**NK** 

	UK	IVIIVI	ΠΠ
General Operation & Cabinet:	V		
Burners / Heat Exchangers:	Ø		
Pump / Blower Fan:	$\checkmark$		
Combustion Air:	$\square$		
Air Filters:	V		

Satisfactory - The filter is clean and correctly installed. It is recommended that the filter(s) be changed or cleaned every 30 to 45 days for best performance..

### Normal Controls:

 $\Box$  Thermostat is located in the hallway.



 $\mathbf{\Lambda}$ 

 $\mathbf{\nabla}$ 

 $\Box$ 

### **Fireplaces / Solid Fuel Heating:** OK MM RR

Living Room

□ Wood - The fireplace is designed to burn wood. Mortar joints are intact, There is a set of glass doors installed. Used correctly, these will help minimize heat loss when the fireplace is not in use. They also eliminate burning embers from flying into the room during a fire and reduce the volume of room air sucked up the chimney.



## Air Conditioning:

Primary Type:	Cer	ntral, I	Packa	age Unit-	
Fuel Source:	220 Volt, Electrical disconnect preser				
Return Air Temp:	78.				
Supply Air Temp:	65.				
Air Temp Drop:	13.				
System Condition:	V				
Condensate Line:	V			Condensate line installed.	
Normal Controls:	$\checkmark$				



**Ductwork / Distribution:** 

OK MM RR

Ducts / Air Supply: □ □

*Kitchen Interior:* There is a heat source to this room. There is no comment as to the amount of air or temperature coming from the supply vent. There is no return air vent located in this room.

*Entry / Foyer / Hall:* There is a heat source to this room. There is no comment as to the amount of air or temperature coming from the supply vent. There is no return air vent located in this room.

- *Living Room* There is a heat source to this room. There is no comment as to the amount of air or temperature coming from the supply vent. There is no return air vent located in this room.
- **Dining Room:** There is a heat source to this room. There is no comment as to the amount of air or temperature coming from the supply vent. There is no return air vent located in this room.
- *Master Bedroom:* There is a heat source to this room. There is no comment as to the amount of air or temperature coming from the supply vent. There is no return air vent located in this room.

**Bedroom #2:** There is a heat source to this room. There is no comment as to the amount of air or temperature coming from the supply vent. There is no return air vent located in this room.

# **PLUMBING SYSTEM**

Water quality or hazardous materials (lead) testing is available from local testing labs, and not included in this inspection. All underground piping related to water supply, waste, or sprinkler use are excluded from this inspection. Leakage or corrosion in underground piping cannot be detected by a visual inspection, nor can the presence of mineral build-up that may gradually restrict their inner diameter and reduce water volume. Plumbing components such as gas pipes, potable water pipes, drain and vent pipes, and shut-off valves are not generally tested if not in daily use. The inspector cannot state the effectiveness or operation of any anti-siphon devices, automatic safety controls, water conditioning equipment, fire and lawn sprinkler systems, on-site water quality and quantity, on-site waste disposal systems, foundation irrigation systems, spa and swimming pool equipment, solar water heating equipment, or observe the system for proper sizing, design, or use of materials.

The water pressure within pipes is commonly confused with water volume, but whereas high water volume is good high water pressure is not. Therefore a regulator is recommended whenever street pressure exceeds

80 psi. However, regardless of pressure, leaks will occur in any system, and particularly in one with older galvanized pipes, or one in which the regulator fails and high pressure begins to stress washers and diaphragms within various components.

Waste and drainpipes pipe condition is usually directly related to their age. Older ones are subject to damage through decay and root movement, whereas the more modern ABS ones are virtually impervious to damage, although some rare batches have been alleged to be defective. Older homes with galvanized or cast iron supply or waste lines can be obstructed and barely working during an inspection but later fail under heavy use. If the water is turned off or not used for periods of time (such as a vacant house waiting for closing), rust or deposits within the piping can further clog the piping system. However, inasmuch as significant portions of drainpipes are concealed, we can only infer their condition by observing the draw at drains at the time of inspection. Nonetheless, blockages will still occur in the life of any system.

## Main Line:

Shut Off:

Unable to locate meter at the time of inspection.

**Pressure:** Water pressure was checked at an exterior hose bib. Water pressure from 40 to 80 pounds per square inch is considered within normal/acceptable range. Water pressure appears adequate.




## Supply Lines:

Material:	Unable to fully determine. OK MM RR						
Condition:	$\Box$ $\Box$ No leakage is noted, but monitor in the future.						
Waste Lines:							
Material:	Cast Iron.						
Condition:	Image: Plumbing vents appear serviceable.						
Hose Bibs / Hookups:							
General:	Image: Sample operated, appeared serviceable.						

The temperature pressure relief valve at the upper portion of the water heater is a required safety valve which should be connected to a drain line of proper size terminating just above floor elevation. If no drain is located in the floor a catch pan should be installed with a drain extending to a safe location. The steam caused by a blow-off can cause scalding. Improper installations should be corrected.

## Water Heater:

**Power Source:** 

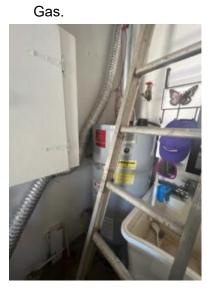

 Capacity:
 40 Gallons.

 Location:
 Garage.

 OK
 MM
 RR

 Condition:
 ☑
 □
 □

Appears serviceable, Pressure relief valve noted, not tested, Flue vent intact, A water shutoff valve is installed, Water heater is seismically secured.

See Bathrooms section of report for information about plumbing and fixtures in those areas.

## Fixtures & Drain

Kitchen Sink:

D Porcelain, Faucet is serviceable, Hand sprayer is serviceable.



 $\mathbf{\Lambda}$ 

 $\Box$ 

## Water Purifier:

Other Built-ins:

 $\Box$   $\Box$  Water purifier is installed, but is not a part of this inspection.


## Hose Bibs / Hookups/Sink Faucets:

#### *Laundry:* $\square$ $\square$ Plumbing appears serviceable.



## Waste Lines/Sink Drains:

#### Laundry:

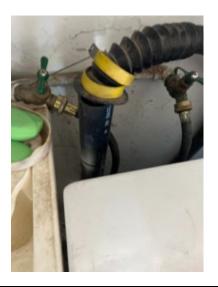

## **KITCHEN - APPLIANCES**

We may test kitchen appliances for basic functionality, but cannot evaluate them for their performance nor for the variety of their settings or cycles. Appliances older than ten years may exhibit decreased efficiency. Even if general comments are made, these items are not inspected: free-standing appliances, refrigerators, freezers, ice makers, trash-compactors, built-in toasters, coffee-makers, can-openers, blenders, instant hot-water dispensers, water-purifiers, barbecues, grills, or rotisseries, timers, clocks, thermostats, the self-cleaning and cooking capability of ovens, and concealed or countertop lighting, which is convenient but often installed after the initial construction and not wired to national electrical standards. These items should be considered outside the scope of the inspection. Appliances are not moved during the inspection. Portable dishwashers are not inspected, as they require connection to facilitate testing.


	Range/ C	ooktop / Oven:	
OK	MM RR		

Type & Condition:

Electric, Free-standing, Appears serviceable.

 $\mathbf{\nabla}$ 



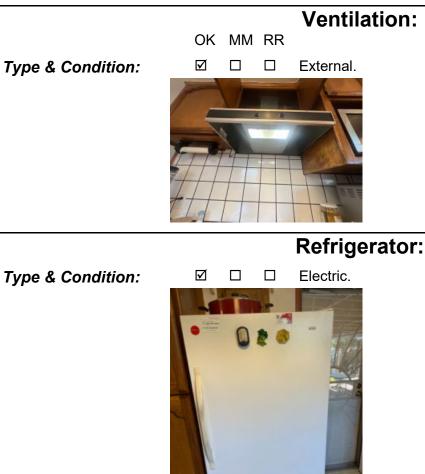

## **Dishwasher:**

Condition:





# BATHROOMS

In accordance with industry standards of practice, we do not comment on common cosmetic deficiencies, and do not evaluate window treatments, steam showers, and saunas. More importantly, we do we leak-test shower pans, which is usually the responsibility of a termite inspector. However, because of the possibility of water damage, most termite inspectors will not leak-test second floor shower pans without the written consent of the owners or occupants.

Our inspection of interior areas includes the visually accessible areas of walls, floors, cabinets and closets, and a representative number of windows and doors, switches and outlets. We do not evaluate window treatments, nor move furniture, lift carpets or rugs, empty closets or cabinets, and we do not comment on common cosmetic deficiencies.

# Sink & Cabinetry: OK MM RR Hall Bath: $\mathbf{\nabla}$ Counters/cabinets appear serviceable, Cabinetry and faucet (s) are good condition, faucet (s) drain properly with no leaks detected at this time. Toilet: $\checkmark$ Hall Bath: **Tub/Shower Fixtures:** $\checkmark$ Hall Bath: Minor leakage is noted at faucet handles. Tub/Shower And Walls:

Hall Bath:	V			Shower walls appear serviceable, Enclosure appears serviceable.	
			В	ath Ventilation:	
	OK	MM	RR		
Hall Bath:	V				
		IN <sup>-</sup>	ΓE	RIOR ROOMS	
Our increation of living anone includes the viewelly accessible areas of wells floars, achieves, and elecate an					

Our inspection of living space includes the visually accessible areas of walls, floors, cabinets and closets, and the testing of a representative number of windows and doors, switches and outlets. We do not evaluate window treatments, move furnishings or possessions, lift carpets or rugs, empty closets or cabinets, nor comment on cosmetic deficiencies. We may not comment on cracks that appear around windows and doors, along lines of framing members or along seams of drywall and plasterboard. These are typically caused by minor movement, such as wood shrinkage, common settling, and seismic activity, and will often reappear if they are not correctly repaired. Such cracks can become the subject of disputes, and are therefore best evaluated by a specialist. Floor covering damage or stains may be hidden by furniture, and the condition of floors underlying floor coverings is not inspected. Determining the condition of insulated glass windows is not always possible due to temperature, weather and lighting conditions. Check with owners for further information. All fireplaces should be cleaned and inspected on a regular basis to make sure that no cracks have developed. Large fires in the firebox can overheat the firebox and flue liners, sometimes resulting in internal damage. Testing, identifying, or identifying the source of environmental pollutants or odors (including but not limited to lead, mold, allergens, odors from household pets and cigarette smoke) is beyond the scope of our service, but can become equally contentious or difficult to eradicate. We recommend you carefully determine and schedule whatever remedial services may be deemed advisable or necessary before the close of escrow.

				Doors:
Main Entry Door:	$\checkmark$			Hardware operational.
Other Exterior Doors:	$\checkmark$			Sliding glass, Hardware operational.
Overall Interior Door Condition:	V			
Kitchen Interior:	Har	dware	e opei	rational.
Hall Bath:	Har	dware	e opei	rational.
Entry / Foyer / Hall:	Har	dware	e opei	rational.
			*	

### Living Room



### Dining Room:

Hardware operational.



### Master Bedroom:

Hardware operational.



### Bedroom #2:

Hardware operational.



Laundry:	Hardware operational.					
Windows:						
	OK MM RR					
General Type & Condition:	☑ □ □ Insulated glass.					
Kitchen Interior:	Window(s) are in good working condition.					
Hall Bath:	Windows and treatments are in working condition.					
Entry / Foyer / Hall:	Window(s) are in good working condition.					
Living Room	Window(s) are in good working condition.					
Dining Room:	Window(s) are in good working condition.					
Master Bedroom:	Window(s) are in good working condition.					
Bedroom #2:	Window(s) are in good working condition.					
Laundry:	There is no window in this room. This is a safety hazard because all bedrooms should have a second means of egress in an emergency.					
Walls:						
General Material & Condition:	☑ □ □ Drywall, General condition appears serviceable.					
Kitchen Interior:	Found no damages to the walls at the time of Inspection.					
Hall Bath:	Found no damages to walls.					
Entry / Foyer / Hall:	Found no damages to the walls at the time of Inspection.					
Living Room	Found no damages to the walls at the time of Inspection.					
Dining Room:	Found no damages to the walls at the time of Inspection.					
Master Bedroom:	Found no damages to the walls at the time of Inspection.					
Bedroom #2:	Found no damages to the walls at the time of Inspection.					
Laundry:	Found no damages to the walls at the time of Inspection.					
	Ceilings:					
General Type & Condition:	☑ □ □ Drywall, General condition appears serviceable.					
Kitchen Interior:	Found no damages to ceiling at the time of Inspection.					
Hall Bath:	Found no damages in ceiling.					

	Floors:
Laundry:	Found no damages to the ceiling at the time of Inspection.
Bedroom #2:	Found no damages to ceiling at the time of Inspection.
Master Bedroom:	Found no damages to ceiling at the time of Inspection.
Dining Room:	Found no damages to ceiling at the time of Inspection.
Living Room	Found no damages to ceiling at the time of Inspection.
Entry / Foyer / Hall:	Found no damages to ceiling at the time of Inspection.

OK MM RR 

 $\mathbf{\Lambda}$ 

General:

Hall Bath:

Stored items or furnishings prevent full inspection, Rugs and floor coverings prevent viewing of primary floor materials.

Kitchen Interior:

The floor covering material is vinyl.



The floor covering material is vinyl. Good - The floor covering is newer, and it should provide years of service.




Entry / Foyer / Hall:

The floor covering material is, Laminate Flooring.



### Living Room

The floor covering material is carpet. carpet has humps.

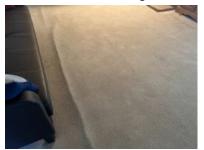

**Dining Room:** The floor covering material is vinyl. Good - The floor covering is newer, and it should provide years of service.

Master Bedroom:

The floor covering material is carpet. Good - The floor covering is newer, and it should provide years of service.



### Bedroom #2:

The floor covering material is carpet. Good - The floor covering is newer, and it should provide years of service.



Laundry:



## **Closets:**

	OK MM RR			
General:	$\square$ $\square$ Closet doors and hardware are all operational.			
Hall Bath:	All wall fixtures are present and intact.			
Master Bedroom:	The doors and hardware in this room are all in working condition.			
Bedroom #2:	The doors and hardware in this room are all in working condition.			
Smoke / Fire Detector:				
General:	We suggest additional smoke detectors be installed in appropriate locations.			
Entry / Foyer / Hall:	There is no smoke detector installed in this room. For safety considerations, you should consider installation of a battery operated or hardwired smoke detector.			
Dining Room:	There is a smoke detector installed in this room. It was undetermined if the unit is hardwired or is battery operated, batteries should be change once a year.			



*Master Bedroom:* There is no smoke detector installed in this room. For safety considerations, you should consider installation of a battery operated or hardwired smoke detector.

**Bedroom #2:** There is no smoke detector installed in this room. For safety considerations, you should consider installation of a battery operated or hardwired smoke detector.

# LAUNDRY AREA

Laundry appliances are not tested or moved during the inspection and the condition of any walls or flooring hidden by them cannot be judged. Drain lines and water supply valves serving washing machines are not operated. Water supply valves may be subject to leaking if turned. See Plumbing and Electrical pages for more details about those types of system components.

## Laundry:

Location:

Washer and Dryer hook-ups are located in the garage.



OK MM RR

 $\Box$ 

 $\mathbf{\nabla}$ 

 $\mathbf{\nabla}$ 

Fuel System: Clothes Washer: □ □ Gas service pipe is provided.

□ Appears serviceable.





 $\square$   $\square$  Appears serviceable.

**Clothes Dryer:** 



### Dryer Vent:

A dryer vent is provided, and in good visual condition. No tears were noted.



## **GARAGE - CARPORT**

Determining the heat resistance rating of firewalls is beyond the scope of this inspection. Flammable materials should not be stored within closed garage areas. Garage door openings are not standard, so you may wish to measure the opening to ensure that there is sufficient clearance to accommodate your vehicles. It is not uncommon for moisture to penetrate garages, particularly with slabs on-grade construction, and this may be apparent in the form of efflorescence or salt crystal formations on the concrete. You may want to have any living space above the garage evaluated further by a structural engineer, as it may be seismically vulnerable.

				Туре:	
	Atta	ched,	One	car.	
			ł		
				Roof:	
	OK	MM	RR		
Condition:	$\checkmark$				
				Ceilings:	
Condition:	$\checkmark$				
Garage Door:					
Material - Condition:	V				
Door Operator:	V				
Service Doors:		Ø		Hardware operational, Door or its hardware needs repair or replacement. At least one of the door hinges needs to be replaced with a self-closingng, all fire doors need to be self closing, There is no fire rated door separating the garage from the living areas of the house.	
Windows:					
Condition:				None.	

				Garage Walls:	
	OK	MM		•	
Type & Condition:				Drywall, There appears to be a fire rated separation between the garage ceiling and the living areas above.	
Floor:					
Condition:		Ø		Typical cracks noted.	