


Peace of Mind Automotive Inspection Report.

Joe Trejo Jr.
210-557-0686

Peace of Mind Automotive Inspection Report.
Joe Trejo Jr.
210-557-0686

Complete

Score	3 / 4 (75%)	Flagged items	1	Actions	0
Site conducted					Unanswered
Customer name					Lmj auto motor sales
Date / Time					May 19th
Payment method					Invoice
Inspection cost					199
Vehicle Year / Make / Model / Color					2019 ford expedition max
VIN					22443 last 5
					
Photo 1					
license plate					Dealer
Mileage					137422
Color					White

Flagged items

1 flagged

Interior Electrical Functions

Air conditioning below 60*

No

Air-conditioning system is not cooling correctly

Interior Electrical Functions	1 flagged, 1 / 2 (50%)
Horn function	Function correct
Interior lighting function	Function correct
Power lock function	Function correct
Power window function	Function correct
Power seat function	Function correct
Power Doors / lift gate function Rear power cargo door is not opening or closing automatically	Issue present
Air conditioning below 60* Air-conditioning system is not cooling correctly	No
Heater above 90*	Yes
Climate controls function	Function correct
Radio / display screen function	Function correct
Speakers performing correctly	Function correct
GPS function	Function correct
Satellite radio function	Function correct
12V power supply function	Function correct
Wireless charging function	Function correct
Cooled seat function Cooling seats are functioning however, the air is not as cold as it should be due to the air-conditioning not working correctly	Function correct
Heated seat function	Function correct
Remote entry function	Function correct

ADDITIONAL NOTES

Aside from the air-conditioning system, the vehicle interior electrical functionality is correct

Interior Condition	0 / 0 (0%)
Seat belt function	Function correct
Front seat condition	Normal wear
Rear seat condition	Normal wear
Carpeting condition	Normal wear
Headliner condition	Normal wear
Door panel condition	Normal wear
Dashboard condition	Normal wear
Headliner condition	Normal wear
Center console condition	Normal wear
Glove compartment condition	Normal wear
Sun visor condition	Normal wear
Trunk / Cargo area condition	Normal wear
Trim pieces condition	Normal wear

ADDITIONAL NOTES

Normal wear to the interior as expected for the age and mileage on the vehicle. No water damage to the carpet or carpet installation. No rust on the bottom side of the dash. No evidence of flood damage present. No evidence of the vehicle being smoked inside. no severely damaged or missing panels. See all interior photos for evidence of current condition.



Photo 2



Photo 3



Photo 4



Photo 5



Photo 6



Photo 7



Photo 8



Photo 9



Photo 10



Photo 11



Photo 12



Photo 13



Photo 14



Photo 15



Photo 16



Photo 17



Photo 18



Photo 19



Photo 20



Photo 21



Photo 22



Photo 23



Photo 24



Photo 25



Photo 26



Photo 27



Photo 28



Photo 29



Photo 30



Photo 31



Photo 32



Photo 33



Photo 34



Photo 35



Photo 36



Photo 37



Photo 38



Photo 39



Photo 40



Photo 41



Photo 42



Photo 43



Photo 44



Photo 45



Photo 46



Photo 47



Photo 48



Photo 49



Photo 50



Photo 51



Photo 52



Photo 53



Photo 54

Exterior Body / Structural Condition

0 / 0 (0%)

Paint depth on metal body panels

Factory, matching paint depth on all exterior metal body panels. All exterior metal body panels are original to the vehicle. No structural damage presents nor any structural damage repair work done. No accident damage presents nor any accident damage repair work done . All window glass is original to the vehicle. Normal wear to the exterior as expected for the age and mileage including chips, scrapes, scratches and dings. Overall vehicle exterior is well-kept. See all exterior photos for evidence of current condition.



Photo 55



Photo 56



Photo 57



Photo 58



Photo 59



Photo 60



Photo 61



Photo 62



Photo 63

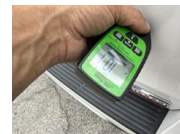


Photo 64



Photo 65



Photo 66



Photo 67



Photo 68



Photo 69



Photo 70



Photo 71



Photo 72



Photo 73



Photo 74



Photo 75



Photo 76



Photo 77



Photo 78



Photo 79



Photo 80



Photo 81



Photo 82



Photo 83



Photo 84



Photo 85



Photo 86



Photo 87



Photo 88



Photo 89



Photo 90



Photo 91



Photo 92



Photo 93



Photo 94



Photo 95



Photo 96



Photo 97



Photo 98



Photo 99



Photo 100



Photo 101



Photo 102



Photo 103



Photo 104



Photo 105



Photo 106



Photo 107



Photo 108



Photo 109



Photo 110



Photo 111



Photo 112



Photo 113



Photo 114

Front bumper condition	Normal wear
Rear bumper condition	Normal wear
Hood panel condition	Normal wear
Driver side fender condition	Normal wear
Passenger side fender condition	Normal wear
Roof panel condition	Normal wear
Front driver side door Condition	Normal wear
Rear driver side door condition	Normal wear
Front passenger side door condition	Normal wear
Rear passenger side door condition	Normal wear
Driver side quarter panel condition	Normal wear
Passenger side quarter panel condition	Normal wear
Trunk panel condition	Normal wear
Truck Bed condition	N/A
Tail gate condition	N/A
Chassis / Frame condition	Normal wear
Frame rail condition	Normal wear
Subframe condition	Normal wear
Engine cradle condition	Normal wear

Skid / Dust cover condition	Normal wear
Collapse beam condition	Normal wear
Window trim condition	Normal wear
Weather stripping condition	Normal wear
Front windshield condition	Abnormal wear
<p>Large crack on the upper passenger side of the front windshield, windshield will need to be replaced. There's also a large chip right in the center.</p>	
Other window glass condition	Normal wear
Wheel / Hubcap condition	Normal wear

ADDITIONAL NOTES

Tire condition

0 / 0 (0%)

Front driver side tire

50-75% remaining

All four tires are matching, all four tires are in healthy condition. Tires are evenly worn with right around 70% tread life remaining.



Photo 115



Photo 116



Photo 117

Front passenger side tire

50-75% remaining



Photo 118



Photo 119



Photo 120

Rear driver side tire

50-75% remaining

Rear passenger side tire

50-75% remaining



Photo 121



Photo 122



Photo 123



Photo 124

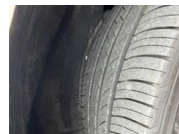


Photo 125

Spare tire and equipment

Spare and tools present

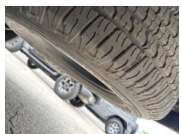


Photo 126

Battery / charging system

0 / 0 (0%)

Battery date

12/24

Standing voltage

12.8

Loaded voltage

14.2

Battery is accepting the charge from the alternator and the alternator charge output is correct



Photo 127

Engine Testing / Condition

2 / 2 (100%)

Internal engine inspection w/ borescope camera

Engine clean internally, no gunk or sludge presents. Proper signs of maintenance present. Block test passed, no internal combustion leak out. Coolant mixture correct and cooling system functionality is healthy. All external engine accessories in good working. No leaks or seepage from anywhere on the engine. External drive belts in decent condition. Currently no concern in mechanical issues present in relation to the engine or related accessories.



Photo 128



Photo 129



Photo 130

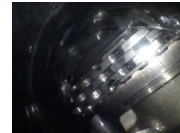


Photo 131



Photo 132



Photo 133



Photo 134



Photo 135



Photo 136



Photo 137



Photo 138



Photo 139



Photo 140

Engine block test

Pass



Photo 141



Photo 142



Photo 143



Photo 144

Coolant mixture test

Pass

Air filter condition

Normal wear

Engine oil condition

Normal wear

Engine oil level

Healthy

Engine oil leaks

None

Coolant level

Healthy

Coolant hoses

Healthy

Radiator condition / function

Healthy










Engine operating temperature

Healthy

Cooling fan function

Healthy

Drive belt condition	Healthy
Abnormal engine knock	None
Abnormal valve train rattle	None
Abnormal bearing noises	None
Engine gunk / sludge	None
Fuel tank	Healthy
Fuel injectors / lines	Healthy
Valve cover gaskets	Healthy
Intake manifold gasket	Healthy
Cylinder head gasket	Healthy
Oil pan gasket	Healthy
Timing cover gasket	Healthy
Rear main seal	Healthy
Timing belt / components	Healthy
Exhaust manifold	Healthy
External engine accessories	Healthy

Transmission / Differentials	0 / 0 (0%)
Transmission fluid level	Healthy
Transmission fluid condition	Healthy
Transmission fluid leaks	None
<p>No transmission fluid leaks from the transmission casing or the transmission pan area. The tail shaft seal is free of any fluid leaks. The driveshaft is in healthy condition. Shift transitions out on the road are correct across the board. No fluid leak out from the rear differential.</p>	
<div style="display: flex; justify-content: space-around;"> <div style="text-align: center;">  <p>Photo 145</p> </div> <div style="text-align: center;">  <p>Photo 146</p> </div> <div style="text-align: center;">  <p>Photo 147</p> </div> <div style="text-align: center;">  <p>Photo 148</p> </div> <div style="text-align: center;">  <p>Photo 149</p> </div> <div style="text-align: center;">  <p>Photo 150</p> </div> </div>	
Transmission cooler / lines	Healthy
Front differential condition	N/A
Center differential condition	N/A
Rear differential condition	Healthy
<div style="display: flex; justify-content: space-around;"> <div style="text-align: center;">  <p>Photo 151</p> </div> <div style="text-align: center;">  <p>Photo 152</p> </div> <div style="text-align: center;">  <p>Photo 153</p> </div> </div>	
Differential leaks	None
4x4 function / engagement	N/A
Clutch engagement	Healthy
Gear engagement	Healthy
Shift transitions	Healthy
Drive shaft condition	Healthy

Suspension condition 0 / 0 (0%)

Front shocks / struts Healthy

Normal fatigue notice to the suspension components. All of the suspension components seem to be original. None of the suspension components are blown out and due form the replacement. The No excessive surface rust on the exposed metal. No abnormal noise or feedback from the suspension while out on the road. All of the rubber in relation to the mounts, joints and bushings has decent texture.



Photo 154



Photo 155



Photo 156



Photo 157



Photo 158



Photo 159



Photo 160



Photo 161

Rear shocks / struts Healthy

Small amount of leak out notice from the rear driver, side strut, no immediate attention is needed however, eventually the strut may need to be replaced



Photo 162



Photo 163



Photo 164



Photo 165



Photo 166



Photo 167



Photo 168



Photo 169









Photo 170

Control arms upper	Healthy
Control arms lower	Healthy
Ball joints	Healthy
Bushings	Healthy
Torsion bars	Healthy
Coilover function	Healthy
Air ride function	N/A
Airbag condition	N/A
Abnormal rust / corrosion to metals	None

Deterioration of rubbers

None

Braking system condition	0 / 0 (0%)
Brake fluid condition	Healthy
Brake fluid level	Healthy
Brake fluid leaks	None
Moisture content in brake fluid	None
Brake lines	Healthy
Brake calipers front	Healthy
Brake calipers rear	Healthy
Brake drums rear	N/A
Brake rotors front	Healthy
Brake rotors rear	Healthy
Front brake pad life remaining	25-50% remaining
<p>Only around 35% brake pad life remaining</p> <div style="display: flex; justify-content: space-around;"> <div style="text-align: center;">  <p>Photo 171</p> </div> <div style="text-align: center;">  <p>Photo 172</p> </div> <div style="text-align: center;">  <p>Photo 173</p> </div> </div>	
Rear brake pad life remaining	50-75% remaining
<p>Write about 55% brake pad life remaining</p> <div style="display: flex; justify-content: space-around;"> <div style="text-align: center;">  <p>Photo 174</p> </div> <div style="text-align: center;">  <p>Photo 175</p> </div> <div style="text-align: center;">  <p>Photo 176</p> </div> </div>	
E-brake function	Healthy

Steering system condition	0 / 0 (0%)
Steering wheel	Healthy
Steering column	Healthy
Steering knuckle / shaft	Healthy
Steering box	N/A
Rack and pinion condition	Healthy
Inner tie rods	Healthy
outer tie rods	Healthy
Rack boots	Healthy
Power steering pump	N/A
power steering lines	N/A
Power steering leaks	N/A
Power steering fluid level	N/A
Electric steering motor	Healthy
Abnormal play / slack in steering	None
Steering alignment on road	Healthy

Computer diagnostic scan 0 / 0 (0%)

Engine control module Healthy

At the time of the inspection, there were no active warning lights presents. All of the live feed diagnostic testing was successfully passed. All of the live feed emission testing was successfully passed.



Photo 177 Photo 178 Photo 179

Transmission control module	Healthy
Anti lock brake (ABS) module	Healthy
SRS module	Healthy
hybrid control module	N/A
Suspension control module	N/A

Vehicle road test

0 / 0 (0%)

Vehicle road test comments / concerns

Normal drive characteristics present as expected for the age and mileage on this specific vehicle. No major/concerning drive abnormalities or issues.

Value of vehicle / Diminished value due to repairs or current damage

0 / 0 (0%)

No diminished value due to no structural damage presence or any structural damage repair work done



Photo 7



Photo 8



Photo 9



Photo 10



Photo 11



Photo 12



Photo 13



Photo 14



Photo 15



Photo 16



Photo 17



Photo 18



Photo 19



Photo 20



Photo 21



Photo 22



Photo 23



Photo 24



Photo 25



Photo 26



Photo 27



Photo 28



Photo 29



Photo 30



Photo 31



Photo 32



Photo 33



Photo 34



Photo 35



Photo 36



Photo 37



Photo 38



Photo 39



Photo 40



Photo 41



Photo 42



Photo 43



Photo 44



Photo 45



Photo 46



Photo 47



Photo 48



Photo 49



Photo 50



Photo 51



Photo 52



Photo 53



Photo 54



Photo 55



Photo 56



Photo 57



Photo 58



Photo 59



Photo 60



Photo 61



Photo 62



Photo 63



Photo 64



Photo 65



Photo 66



Photo 67



Photo 68



Photo 69



Photo 70



Photo 71



Photo 72



Photo 73



Photo 74



Photo 75



Photo 76



Photo 77



Photo 78



Photo 79



Photo 80



Photo 81



Photo 82



Photo 83



Photo 84



Photo 85



Photo 86



Photo 87



Photo 88



Photo 89



Photo 90



Photo 91



Photo 92



Photo 93



Photo 94



Photo 95



Photo 96



Photo 97



Photo 98



Photo 99



Photo 100



Photo 101



Photo 102



Photo 103



Photo 104



Photo 105



Photo 106



Photo 107



Photo 108



Photo 109



Photo 110



Photo 111



Photo 112



Photo 113



Photo 114



Photo 115



Photo 116



Photo 117



Photo 118



Photo 119



Photo 120



Photo 121



Photo 122



Photo 123



Photo 124



Photo 125



Photo 126



Photo 127



Photo 128



Photo 129



Photo 130



Photo 131



Photo 132



Photo 133



Photo 134



Photo 135



Photo 136



Photo 137



Photo 138



Photo 139



Photo 140



Photo 141



Photo 142



Photo 143



Photo 144



Photo 145



Photo 146



Photo 147



Photo 148



Photo 149



Photo 150



Photo 151



Photo 152



Photo 153



Photo 154



Photo 155



Photo 156



Photo 157



Photo 158



Photo 159



Photo 160



Photo 161



Photo 162



Photo 163



Photo 164



Photo 165



Photo 166



Photo 167



Photo 168



Photo 169



Photo 170



Photo 171



Photo 172



Photo 173



Photo 174



Photo 175



Photo 176

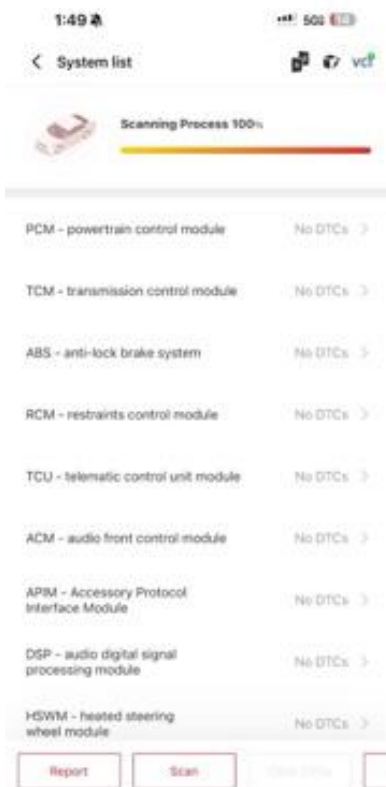


Photo 177



Photo 178

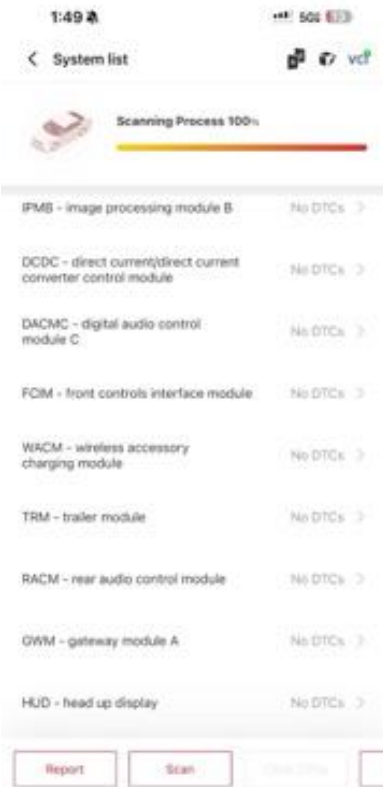


Photo 179