


F59 MY20 & newer Steering Wheel & Connectors

Horn Pad Removal

Using a screwdriver, release both sides of the retaining spring and position the horn pad assembly out

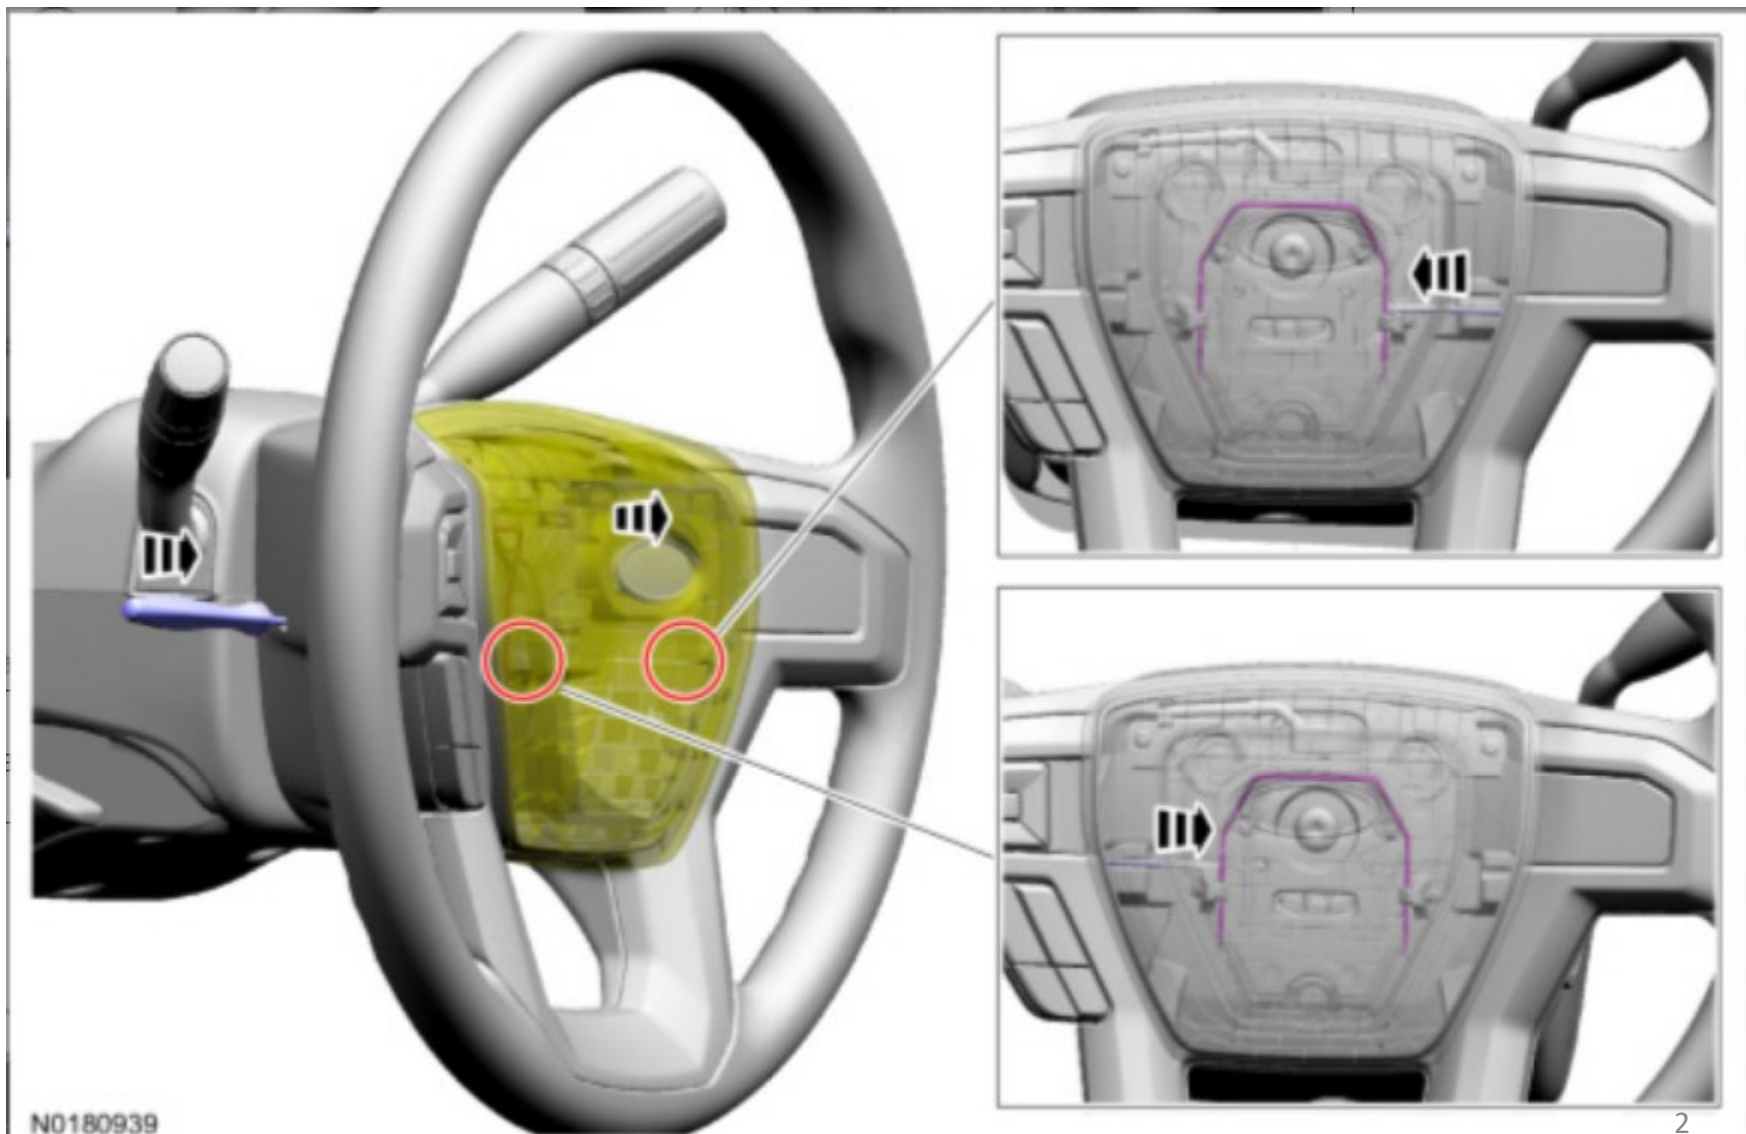

Steering wheel part



Back of horn pad




Steering wheel with pad removed

The wiring harness inside the wheel is not available as a service part. The repair pigtail connectors are to be used instead.

Steering Wheel menu button connector (C2998), repair pigtail connector WPT-1686

Steering Column Control Module Connector (C218B), repair pigtail connector WPT-1582.

Horn Switch Connector (C217), repair pigtail connector WPT-967

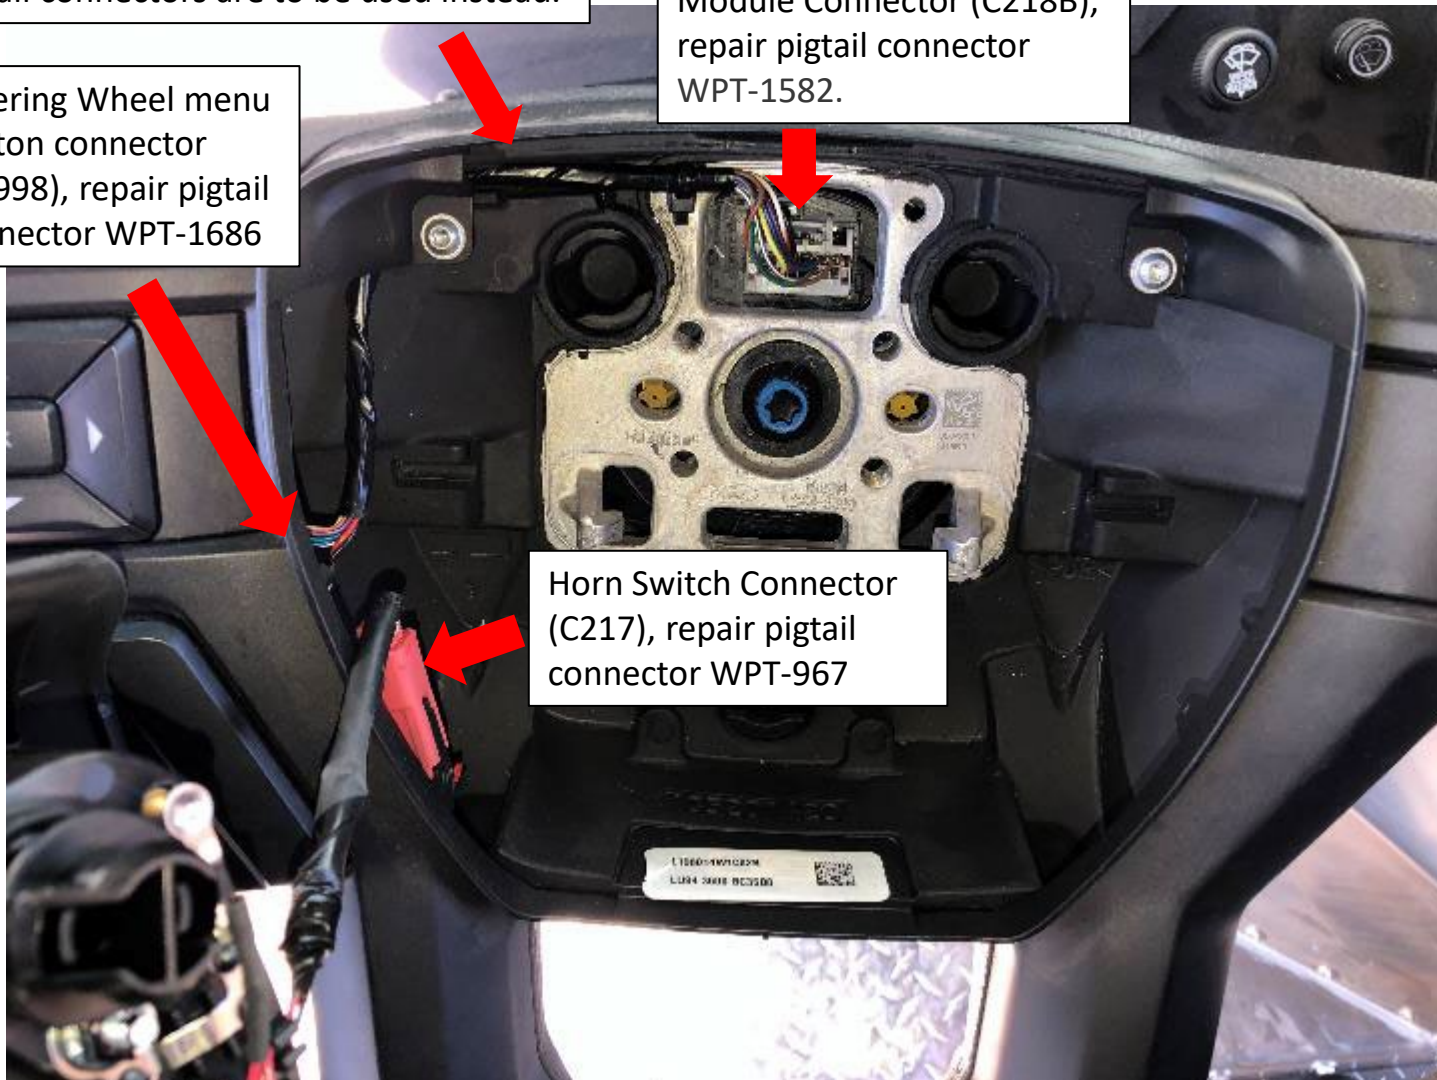

Horn connection



Steering Wheel Menu Button Connector

