

832-206-9949 www.texasedgeinspect.com matt@texasedgeinspect.com



INSPECTED FOR

Todd & Debbie Malone Sample Spring, TX 777386

January 16, 2020

832-206-9949

matt@texasedgeinspect.com

PROPERTY INSPECTION REPORT

Prepared For:	Todd & Debbie Malone	
•	(Name of Client)	
Concerning:	Sample, Spring, TX 777386 (Address or Other Identification of Inspected Property)	
By:	Matthew Brading, Lic #TREC # 22654 (Name and License Number of Inspector)	01/16/2020 (Date)
	(Name, License Number of Sponsoring Inspector)	

PURPOSE, LIMITATIONS AND INSPECTOR / CLIENT RESPONSIBILITIES

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions. If any item or comment is unclear, you should ask the inspector to clarify the findings. It is important that you carefully read ALL of this information.

This inspection is subject to the rules ("Rules") of the Texas Real Estate Commission ("TREC"), which can be found at www.trec.texas.gov.

The TREC Standards of Practice (Sections 535.227-535.233 of the Rules) are the minimum standards for inspections by TREC-licensed inspectors. An inspection addresses only those components and conditions that are present, visible, and accessible at the time of the inspection. While there may be other parts, components or systems present, only those items specifically noted as being inspected were inspected. The inspector is NOT required to turn on decommissioned equipment, systems, utility services or apply an open flame or light a pilot to operate any appliance. The inspector is NOT required to climb over obstacles, move furnishings or stored items. The inspection report may address issues that are code-based or may refer to a particular code; however, THIS IS NOT A CODE COMPLIANCE INSPECTION and does NOT verify compliance with manufacturer's installation instructions. THE INSPECTION DOES NOT IMPLY INSURABILITY OR WARRANTABILITY OF THE STRUCTURE OR ITS COMPONENTS. Although some safety issues may be addressed in this report, THIS REPORT IS NOT A SAFETY / CODE INSPECTION, and the inspector is NOT required to identify all potential hazards.

In this report, the inspector shall indicate, by checking the appropriate boxes on the form, whether each item was inspected, not inspected, not present or deficient and explain the findings in the corresponding section in the body of the report form. The inspector must check the Deficient (D) box if a condition exists that adversely and materially affects the performance of a system or component or constitutes a hazard to life, limb or property as specified by the TREC Standards of Practice. General deficiencies include inoperability, material distress, water penetration, damage, deterioration, missing components, and unsuitable installation. Comments may be provided by the inspector whether or not an item is deemed deficient. The inspector is not required to prioritize or emphasize the importance of one deficiency over another.

Some items reported may be considered life-safety upgrades to the property. For more information, refer to Texas Real Estate Consumer Notice Concerning Recognized Hazards or Deficiencies below.

THIS PROPERTY INSPECTION IS NOT A TECHNICALLY EXHAUSTIVE INSPECTION OF THE STRUCTURE, SYSTEMS OR COMPONENTS. THE INSPECTION MAY NOT REVEAL ALL DEFICIENCIES. A REAL ESTATE INSPECTION HELPS TO REDUCE SOME OF THE RISK INVOLVED IN PURCHASING A HOME, BUT IT CANNOT ELIMINATE THESE RISKS, NOR CAN THE INSPECTION ANTICIPATE FUTURE EVENTS OR CHANGES IN PERFORMANCE DUE TO CHANGES IN USE OR OCCUPANCY. It is recommended that you obtain as much information as is available about this property, including any seller's disclosures, previous inspection reports, engineering reports, building/remodeling permits, and reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should also attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have taken place at this property. It is not the inspector's responsibility to confirm that information obtained from these sources is complete or accurate or that this inspection is consistent with the opinions

Promulgated by the Texas Real Estate Commission (TREC), P.O. Box 12188, Austin, TX 78711-2188 (512) 936-3000 (http://www.trec.texas.gov).

Page 1 of 46

expressed in previous or future reports.

ITEMS IDENTIFIED IN THE REPORT DO NOT OBLIGATE ANY PARTY TO MAKE REPAIRS OR TAKE OTHER ACTIONS, NOR IS THE PURCHASER REQUIRED TO REQUEST THAT THE SELLER TAKE ANY ACTION. When a deficiency is reported, it is the client's responsibility to obtain further evaluations and/or cost estimates from qualified service professionals. Any such follow-up should take place prior to the expiration of any time limitations such as option periods. Evaluations by qualified tradesmen may lead to the discovery of additional deficiencies which may involve additional repair costs. Failure to address deficiencies or comments noted in this report may lead to further damage of the structure or systems and add to the original repair costs. The inspector is not required to provide follow-up services to verify that proper repairs have been made.

Property conditions change with time and use. For example, mechanical devices can fail at any time, plumbing gaskets and seals may crack if the appliance or plumbing fixture is not used often, roof leaks can occur at any time regardless of the apparent condition of the roof, and the performance of the structure and the systems may change due to changes in use or occupancy, effects of weather, etc. These changes or repairs made to the structure after the inspection may render information contained herein obsolete or invalid. This report is provided for the specific benefit of the client named above and is based on observations at the time of the inspection. If you did not hire the inspector yourself, reliance on this report may provide incomplete or outdated information. Repairs, professional opinions or additional inspection reports may affect the meaning of the information in this report. It is recommended that you hire a licensed inspector to perform an inspection to meet your specific needs and to provide you with current information concerning this property.

TEXAS REAL ESTATE CONSUMER NOTICE CONCERNING HAZARDS OR DEFICIENCIES

Each year, Texans sustain property damage and are injured by accidents in the home. While some accidents may not be avoidable, many other accidents, injuries, and deaths may be avoided through the identification and repair of certain hazardous conditions. Examples of such hazards include:

- malfunctioning, improperly installed or missing ground fault circuit protection (GFCI) devices for electrical receptacles in garages, bathroom, kitchens, and exterior areas;
- malfunctioning arc fault protection (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- the lack of fire safety features, such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

To ensure that consumers are informed of hazards such as these, the Texas Real Estate Commission (TREC) has adopted Standards of Practice requiring licensed inspectors to report these conditions as "Deficient" when performing an inspection for a buyer or seller, if they can be reasonably determined.

These conditions may not have violated building codes or common practices at the time of the construction of the home, or they may have been "grandfathered" because they were present prior to the adoption of codes prohibiting such conditions. While the TREC Standards of Practice do not require inspectors to perform a code compliance inspection, TREC considers the potential for injury or property loss from the hazards addressed in the Standards of Practice to be significant enough to warrant this notice.

Contract forms developed by TREC for use by its real estate licensees also inform the buyer of the right to have the home inspected and can provide an option clause permitting the buyer to terminate the contract within a specified time. Neither the Standards of Practice nor the TREC contract forms requires a seller to remedy conditions revealed by an inspection. The decision to correct a hazard or any deficiency identified in an inspection report is left to the parties to the contract for the sale or purchase of the home.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

Inspection Time In: 9 am Time Out: 1 pm Property was: Vacant, BUT staged with furniture.

Building Orientation (For Purpose Of This Report Front Faces): South/East

Weather Conditions During Inspection: Sunny

Outside temperature during inspection: 60 ° to 70 ° Degrees Parties present at inspection: Buyer, Builders Representative

THIS REPORT IS PAID AND PREPARED FOR THE EXCLUSIVE USE BY Todd & Debbie Malone. THIS COPYRIGHTED REPORT IS NOT VALID WITHOUT THE SIGNED INSPECTION AGREEMENT.

THIS REPORT IS NOT TRANSFERABLE FROM CLIENT NAMED ABOVE.

SCOPE OF INSPECTION

These standards of practice define the minimum levels of inspection required for substantially completed residential improvements to real property up to four dwelling units. A real estate inspection is a non-technically exhaustive, limited visual survey and basic performance evaluation of the systems and components of a building using normal controls and does not require the use of specialized equipment or procedures. The purpose of the inspection is to provide the client with information regarding the general condition of the residence at the time of inspection. The inspector may provide a higher level of inspection performance than required by these standards of practice and may inspect components and systems in addition to those described by the standards of practice.

GENERAL LIMITATIONS

The inspector is not required to:

(A) inspect:

- (i) items other than those listed within these standards of practice;
- (ii) elevators;
- (iii) detached buildings, decks, docks, fences, or waterfront structures or equipment;
- (iv) anything buried, hidden, latent, or concealed;
- (v) sub-surface drainage systems;
- (vi) automated or programmable control systems, automatic shut-off, photoelectric sensors, timers, clocks, metering devices, signal lights, lightning arrestor system, remote controls, security or data distribution systems, solar panels, outdoor kitchens, gas grills (built-in or free standing), refrigerators (built-in or free standing), wine coolers, ice makers or smart home automation components; or refrigerators (built-in or free standing), wine coolers, ice makers or smart home automation components; or
- (vii) concrete flatwork such as; driveways, sidewalks, walkways, paving stones or patios;

- (i) past repairs that appear to be effective and workmanlike except as specifically required by these standards;
- (ii) cosmetic or aesthetic conditions; or
- (iii) wear and tear from ordinary use;

(C) determine:

- (i) insurability, warrantability, suitability, adequacy, compatibility, capacity, reliability, marketability, operating costs, recalls, counterfeit products, product lawsuits, life expectancy, age, energy efficiency, vapor barriers, thermostatic performance, compliance with any code, listing, testing or protocol authority, utility sources, or manufacturer or regulatory requirements except as specifically required by these standards;
- (ii) the presence or absence of pests, termites, or other wood-destroying insects or organisms;
- (iii) the presence, absence, or risk of asbestos, lead-based paint, MOLD, mildew, corrosive or contaminated drywall "Chinese Drywall" or any other environmental hazard, environmental pathogen, carcinogen, toxin, mycotoxin, pollutant, fungal presence or activity, or poison;
- (iv) types of wood or preservative treatment and fastener compatibility; or
- (v) the cause or source of a conditions;

(D) anticipate future events or conditions, including but not limited to:

- (i) decay, deterioration, or damage that may occur after the inspection;
- (ii) deficiencies from abuse, misuse or lack of use;
- (iii) changes in performance of any component or system due to changes in use or occupancy;
- (iv) the consequences of the inspection or its effects on current or future buyers and sellers;
- (v) common household accidents, personal injury, or death;
- (vi) the presence of water penetrations; or
- (vii) future performance of any item;
- (E) operate shut-off, safety, stop, pressure or pressure-regulating valves or items requiring the use of codes, keys, combinations, or similar devices;
- (F) designate conditions as safe;
- (G) recommend or provide engineering, architectural, appraisal, mitigation, physical surveying, realty, or other specialist services;
- (H) review historical records, installation instructions, repair plans, cost estimates, disclosure documents, or other reports;
- (I) verify sizing, efficiency, or adequacy of the ground surface drainage system;
- (J) verify sizing, efficiency, or adequacy of the gutter and downspout system;
- (K) operate recirculation or sump pumps;
- (L) remedy conditions preventing inspection of any item;
- (M) apply open flame or light a pilot to operate any appliance;
- (N) turn on decommissioned equipment, systems or utility services; or
- (O) provide repair cost estimates, recommendations, or re-inspection services.

THE CLIENT, BY ACCEPTING THIS PROPERTY INSPECTION REPORT OR RELYING UPON IT IN ANY WAY, EXPRESSLY AGREES TO THE <u>SCOPE OF INSPECTION</u>, <u>GENERAL LIMITATIONS</u> AND <u>INSPECTION AGREEMENT</u> INCLUDED IN THIS INSPECTION REPORT.

This inspection report is made for the sole purpose of assisting the purchaser to determine his and/or her own opinion of feasibility of purchasing the inspected property and does not warrant or guarantee all defects to be found. If you have any questions or are unclear regarding our findings, please call our office prior to the expiration of any time limitations such as option periods.

This report contains technical information. If you were not present during this inspection, please call the office to arrange for a consultation with your inspector. If you choose not to consult with the inspector, this inspection company cannot be held liable for your understanding or misunderstanding of the reports content.

The contents of this report are for the sole use of the client named above and no other person or party may rely on this report for any reason or purpose whatsoever without the prior written consent of the inspector who authored the report. Any person or party who chooses to rely on this report for any reason or purpose whatsoever without the express written consent of the inspector does so at their own risk and by doing so without the prior written consent of the inspector waives any claim of error or deficiency in this report.

This report is not intended to be used for determining insurability or warrantability of the structure and may not conform to the Texas Department of Insurance guidelines for property insurability. *This report is not to be used by or for any property and/or home warranty company.*

The digital pictures within this report are a representative sample of inaccessible areas, deficiencies or damages in place and should not be considered to show all of the inaccessible areas, deficiencies or damages observed. There will be inaccessible areas, deficiencies or damages not represented with digital imaging.

Report Identification: Sample, Spring, TX 777386

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D

I. STRUCTURAL SYSTEMS

A. Foundations

Type of Foundation(s): Slab on Ground

Comments:

Foundation Is Performing Adequately

In my opinion, the foundation appears to be providing adequate support for the structure at the time of this inspection. I did not observe any apparent evidence that would indicate the presence of adverse performance or significant deficiencies in the foundation. The interior and exterior stress indicators showed little affects of adverse performance and I perceived the foundation to contain no significant unlevelness after walking the 1st level floors.

Notice: This inspection is one of first impression and the inspector was not provided with any historical information pertaining to the structural integrity of the inspected real property. This is a limited cursory and visual survey of the accessible general conditions and circumstances present at the time of this inspection. Opinions are based on general observations made without the use of specialized tools or procedures. Therefore, the opinions expressed are one of apparent conditions and not of absolute fact and are only good for the date and time of this inspection.

The inspection of the foundation may show it to be providing adequate support for the structure or having movement typical to this region, at the time of the inspection. This does not guarantee the future life or failure of the foundation. *The Inspector is not a structural engineer. This inspection is not an engineering report or evaluation and should not be considered one, either expressed or implied.* If any cause of concern is noted on this report, or if you want further evaluation, you should consider an evaluation by an engineer of your choice.

Report Identification: Sample, Spring, TX 777386

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D

B. Grading and Drainage

Comments:

Grading & Drainage

All components were found to be performing and in satisfactory condition on the day of the inspection.

Gutter & Downspout System

I=Inspected NI=Not Inspected NP=Not Present D=Deficient


I NI NP D

 \square \square \square \square \square \square \square C. Roof Covering Materials

Type(s) of Roof Covering: Composition *Viewed From*: Walked on roof

Comments:

General Photos of Roof

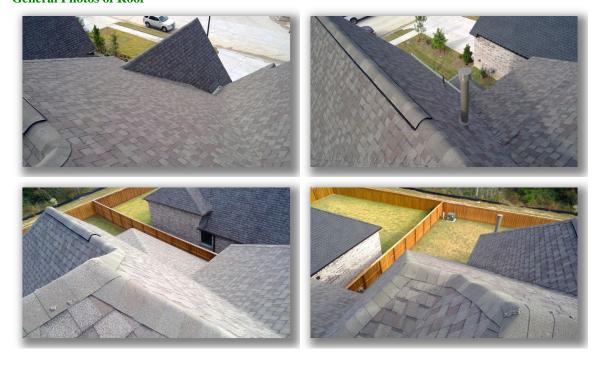

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

Roof Covering

• There is a lot of foot traffic bruising and/or damage to the roofing material on the southeast of the roof structure.





• Damaged shingles were observed on the southeast of the roof structure.



Flashing Details

All components were found to be performing and in satisfactory condition on the day of the inspection.

Notice: Life expectancy of the roofing material is not covered by this property inspection report. If any concerns exist about the roof covering life expectancy or potential for future problems, a roofing specialist should be consulted. The Inspector cannot offer an opinion or warranty as to whether the roof has leaked in the past, leaks now, or may be subject to future leaks, either expressed or implied.

The inspection of this roof may show it to be functioning as intended or in need of minor repairs. This inspection does not determine the insurability of the roof. You are strongly encouraged to have your Insurance Company physically inspect the roof, prior to the expiration of any time limitations such as option or warranty periods, to fully evaluate the insurability of the roof.

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D

\square \square \square \square D. Roof Structures and Attics

Viewed From: From Interior of Attic

Approximate Average Depth of Insulation: 13+"

(Note: Generally recommended depth of attic floor insulation is approximately 10+ inches to achieve a

R30 rating.)

Insulation Type: Loose Filled

Description of Roof Structure: Rafter Assembly

Attic Accessibility: Partial

Comments:

General Photos of Rafter Assembly



teport ruenumentom <u>Gampio, Opinig</u>

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

I=Inspected

Roof Structure

All components were found to be performing and in satisfactory condition on the day of the inspection.

Attic Ventilation

All components were found to be performing and in satisfactory condition on the day of the inspection.

Attic Insulation



Service Control Contro


I=Inspected NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

Bedroom Hallway Attic Ladder

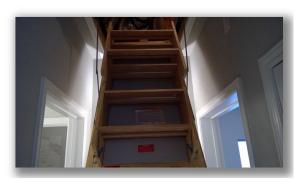

• Some of the attic ladder nuts and bolts were observed to be loose and/or missing. Minor improvements to the attic ladder are recommended for reasons of safety. ***Pull down bolt***



• Garage attic hatch is in a poor location under the garage door opener.



I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient	
I NI NP D				

☑ □ □ ☑ E. Walls (Interior and Exterior)

Comments:

Description of Exterior Cladding: Brick Veneer, Fiber Cement Board

Interior Walls & Surfaces

All components were found to be performing and in satisfactory condition on the day of the inspection.

Exterior Walls & Surfaces

• The wall expansion joint(s) need to be properly sealed on the various locations of the structure. It is recommended to use an elastomeric caulking.



I=Inspected NI=Not Inspected NP=Not Present D=Deficient

NI NP D

• The area between the exterior cladding / veneer and all of the wall penetrations / openings need to be properly sealed. Areas such as utility connections, downspouts, hose bibbs, lighting fixtures, receptacles etc. It is recommended to use an elastomeric caulking / sealant.



• Mortar improvements are recommended for the exterior masonry veneer on the right side of the structure.





I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient
I NI NP D			

✓ □ □ □ F. Ceilings and Floors

Comments:

Ceilings

All components were found to be performing and in satisfactory condition on the day of the inspection.

Floors

All components were found to be performing and in satisfactory condition on the day of the inspection.

• Note: Some cracking of the garage concrete floor finish was observed.

G. Doors (Interior and Exterior)

Comments:

Interior Doors

• The door spring latch(es) are damaged and/or missing to the master bathroom.



Exterior Doors

All components were found to be performing and in satisfactory condition on the day of the inspection.

Overhead Garage Door

All components were found to be performing and in satisfactory condition on the day of the inspection.

Garage Entry Door

Comments:

D=Deficient I=Inspected NI=Not Inspected **NP=Not Present** NI NP D H. Windows Comments: **Window Screens Note:** Window screens observed to be stacked in the attic area. Windows All components were found to be performing and in satisfactory condition on the day of the inspection. **Stairways (Interior and Exterior)** Comments: All components were found to be performing and in satisfactory condition on the day of the inspection. J. Fireplaces and Chimneys





I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D

 $oxed{oxed}$ $oxed{oxed}$ K. Porches, Balconies, Decks, and Carports

Comments:

Porches

Some deflection and/or cracking of the patio concrete flatwork was observed.

Driveway

• Exposed rebar observed at the end of the driveway. correction is recommended.



I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D

II. ELECTRICAL SYSTEMS

☑ □ □ ☑ A. Service Entrance and Panels

Comments:

Panel Box

Box Rating and/or Main Disconnect Rating: 225 amps

Box Location: Garage

Cabinet Manufacturer: EATON
Branch Circuit Wire Type: Copper





report Identification. <u>Odiffic, Opining, 177 17 1000</u>

NI=Not Inspected

the cabinet.

NI NP D

I=Inspected

The wires entering the electrical cabinet are not properly secured or protected from the sharp edges of

D=Deficient

• The outer wire insulation should extend at least 1/4" inside the panel.

NP=Not Present





Grounding / Bonding

Proper bonding was observed at the gas meter entrance area.



I=Inspected NI=Not Inspected NP=Not Present D=Deficient

NI NP D

 \square \square \square B. Branch Circuits, Connected Devices, and Fixtures

Type of Wiring: Copper *Comments*:

Receptacle Outlets

• One or more of the receptacles is missing its cover plate in the front porch.



• One or more of the receptacles were observed to have an open neutral connection in the Jack and Jill bathroom.





• One or more of the receptacles were observed to have an open neutral connection in the master bathroom.





I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

• One or more of the receptacles were observed to have an open neutral connection in the guest bathroom.



Switches


• The 3-way switch is not functioning properly in the stairway.





Fixtures

One or more of the light fixtures appear to be inoperative in the exterior area. This may be due to a
bad bulb or some other unknown condition. This condition should be further evaluated and corrected
as necessary.

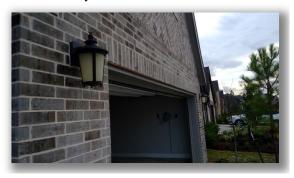

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

NI NP D

Smoke Alarms


Note: It is recommended to replace the batteries in all of the smoke detectors once a year for reasons of safety.

All components were found to be performing and in satisfactory condition on the day of the inspection.

Carbon Monoxide Alarms

All components were found to be performing and in satisfactory condition on the day of the inspection.

• **Note:** The carbon monoxide in the living room area was located extremely high. It is recommended to relocate the device so that changing the batteries will not become a problem.

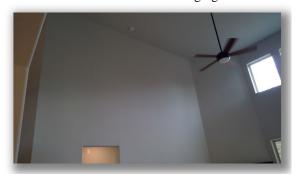

Doorbell / Chime

D=Deficient I=Inspected NI=Not Inspected **NP=Not Present**

NI NP D

HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS III.

A. Heating Equipment

Type of Systems: Energy Sources: Comments:

Upstairs Central Heating System – Energy Source: Gas


Brand Name: Carrier


This component appears to be performing adequately at the time of this inspection. It is achieving an operation, function, or configuration consistent with accepted industry practices for its age.







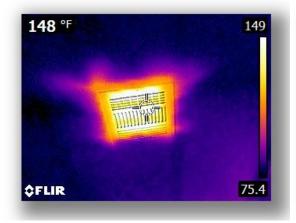

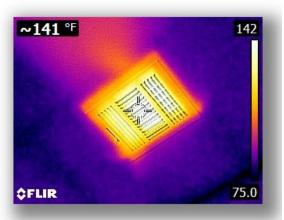

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

Downstairs Central Heating System – Energy Source: Gas


Brand Name: Carrier


This component appears to be performing adequately at the time of this inspection. It is achieving an operation, function, or configuration consistent with accepted industry practices for its age.







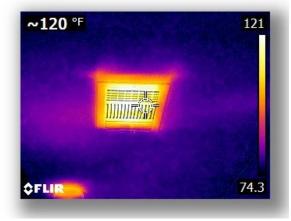

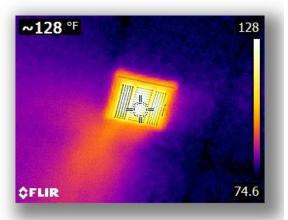

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D

☑ □ □ ☑ B. Cooling Equipment

Type of Systems: Comments:

Upstairs Central Cooling System

Today's Temperature Differential (Delta-T): 17

Approximate System Age: 2019

Approximate System SEER: Unable To Determine

Approximate System Size: 1.5 ton
Location: Interior Ceiling Mounted

Brand Name: Carrier





• The electrical wiring for the outside condenser/coils should be protected by conduit.




I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D

75.7 °F 81.1

◆FLIR 66.1

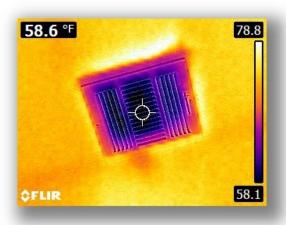

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

NI NP D

Downstairs Central Cooling System

Today's Temperature Differential (Delta-T): 16

Approximate System Age: 2019

Approximate System SEER: Unable To Determine

Approximate System Size: 5 ton
Location: Interior Ceiling Mounted

Brand Name: Carrier





• The electrical wiring for the outside condenser/coils should be protected by conduit.



NI=Not Inspected

\$FLIR

NI NP D


I=Inspected

~70.5 °F 80.3 ~54.1 °F 73.5

D=Deficient

53.3

NP=Not Present

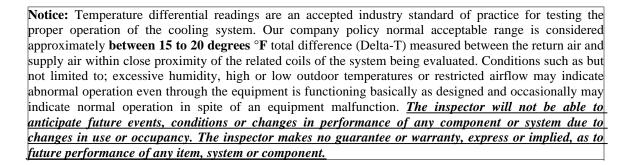

65.4

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

NI NP D

 \square \square \square \square C. Duct Systems, Chases, and Vents

Comments:

All components were found to be performing and in satisfactory condition on the day of the inspection.

General Photo(s) of duct work



• Note: Damaged return grate observed in gameroom area.



I=Inspected NI=Not Inspected NP=Not Present D=Deficient

NI NP D

IV. PLUMBING SYSTEM

 \square \square \square A. Plumbing Supply, Distribution Systems and Fixtures

Location of water meter: Within 5-feet of Front Curb Location of main water supply valve: south east exterior wall

Static water pressure reading: 60 to 70 psi

Comments:





Exterior Faucets/Fixtures

- **Note:** The exterior water hose bibb(s) (faucet) adjacent to the home should be protected from physical damage and/or possible freeze.
- Water was observed to be leaking back through the vacuum breaker on the southeast of the structure. The vacuum breaker is not working as designed.





Report Identification. <u>Odinpie, Opinig, 177777000</u>

NI=Not Inspected NP=Not Present D=Deficient

NI NP D

I=Inspected

Laundry Connections

All components were found to be performing and in satisfactory condition on the day of the inspection.







Kitchen Sink

NI NP D

I=Inspected

NP=Not Present D=Deficient

Bath Between Rooms - "Jack & Jill Bath"

Left Lavatory / Sink

NI=Not Inspected

All components were found to be performing and in satisfactory condition on the day of the inspection. *Right Lavatory / Sink*

All components were found to be performing and in satisfactory condition on the day of the inspection. *Bathtub*

All components were found to be performing and in satisfactory condition on the day of the inspection. Shower

• The shower head is missing.



Commode / Toilet

general de la company de la co

NI=Not Inspected NP=Not Present D=Deficient

NI NP D

I=Inspected

Master Bathroom

Left Lavatory / Sink

All components were found to be performing and in satisfactory condition on the day of the inspection. *Right Lavatory / Sink*

All components were found to be performing and in satisfactory condition on the day of the inspection. *Bathtub*

• Hardware loose at bathtub faucet area.



Shower

• The shower head is missing.



Commode / Toilet

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

Half Bath

Lavatory / Sink

All components were found to be performing and in satisfactory condition on the day of the inspection. *Commode / Toilet*

All components were found to be performing and in satisfactory condition on the day of the inspection.

Guest Bath

Lavatory / Sink

All components were found to be performing and in satisfactory condition on the day of the inspection. *Bathtub*

All components were found to be performing and in satisfactory condition on the day of the inspection. *Shower*

The shower head is missing.



Commode / Toilet

All components were found to be performing and in satisfactory condition on the day of the inspection.

Notice: The Inspector has attempted to discover and report conditions requiring further evaluation or repair. However; determining the condition of any component that is not visible and/or accessible, such as plumbing components that are buried, beneath the foundation, located within construction voids or otherwise concealed, and reporting any deficiency that does not appear or become evident during our limited cursory and visual survey is outside the scope of this inspection. The inspector will not be able to anticipate future events, conditions or changes in performance of any component or system due to changes in use or occupancy. The inspector makes no guarantee or warranty, express or implied, as to future performance of any item, system or component.

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D

☑ □ □ □ B. Drains, Wastes, and Vents

Comments:

All components were found to be performing and in satisfactory condition on the day of the inspection.

General Photo(s) of Plumbing Cleanout(s)



Notice: Reporting the condition of drains, wastes and vent piping that is not completely visible and/or accessible or; reporting any defect or deficiency that requires extended use of the system to develop or does not become evident during our limited cursory and visual survey is outside the scope of the inspection. This is a limited cursory and visual survey of the accessible general conditions and circumstances present at the time of this inspection. Opinions are based on general observations made without the use of specialized tools or procedures. Therefore, the opinions expressed are one of apparent conditions and not of absolute fact and are only good for the date and time of this inspection. *The inspector will not be able to anticipate future events, conditions or changes in performance of any component or system due to changes in use or occupancy. The inspector makes no guarantee or warranty, express or implied, as to future performance of any item, system or component.*

NI NP D

I=Inspected

NP=Not Present D=Deficient

C. Water Heating Equipment

Energy Sources: Capacity: Comments:

NI=Not Inspected





Water Heater 1 - Energy Source: Gas

Location: Attic

Approximate Capacity: 40 Gallons

Approximate Age: 2019 Brand Name: Rheem





The water heater flue connector should be mechanically attached to the draft hood with a minimum of three sheet metal screws.



I=Inspected NI=Not Inspected NP=Not Present D=Deficient

NI NP D

Water Heater 2 - Energy Source: Gas

Location: Attic

Approximate Capacity: 40 Gallons

Approximate Age: 2019
Brand Name: Rheem





• The water heater flue connector should be mechanically attached to the draft hood with a minimum of three sheet metal screws.



Report Identification: Sample, Spring, 1X ///386						
I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient			
I NI NP D						
	D. Hydro-Massage Thera	py Equipment				
	Comments:					

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D

V. APPLIANCES

 \square \square \square A. Dishwashers

Comments:

Brand Name: General Electric - GE


This component appears to be performing adequately at the time of this inspection.





 $\ \square \ \square \ \square \$ B. Food Waste Disposers

Comments:

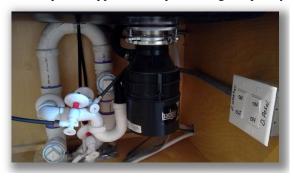

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D

☑ □ □ □ C. Range Hood and Exhaust Systems

Comments:







I=Inspected NI=Not Inspected **NP=Not Present D=Deficient**

NI NP D

D. Ranges, Cooktops, and Ovens

Comments:

Cooktop Brand Name: General Electric – GE

This component appears to be performing adequately at the time of this inspection.



Oven not present at the time of inspection.



I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient	
I NI NP D				

☑ □ □ □ E. Microwave Ovens

Comments:

Brand Name: General Electric - GE



I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D







I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient	
I NI NP D				

☑ □ □ □ G. Garage Door Operators

Comments:

This component appears to be performing adequately at the time of this inspection.

☑ □ □ □ H. Dryer Exhaust Systems

Comments:



INSPECTION AGREEMENT PLEASE READ THIS AGREEMENT CAREFULLY BEFORE SIGNING

This Inspection Agreement (herein after known as the Agreement) is entered into on this day, 01/16/2020, between Todd & Debbie Malone (herein known as the Client) and Texas Edge Home Inspections, PLLC (herein known as the Inspector) for the purpose of performing a general property condition inspection concerning Sample (herein known as the property).

I. SCOPE OF SERVICES

- A. A real estate inspection is a non-technically exhaustive, limited visual survey and basic performance evaluation of the systems and components of a building using normal controls and does not require the use of specialized equipment or procedures. The purpose of the inspection is to provide the Client with information regarding the general condition of the Property at the time of inspection.
- B. In exchange for the inspection fee (\$) paid by the Client, the Inspector agrees to provide the Client with an Inspection Report setting out the Inspector's professional opinions concerning the condition of the Property further described in the report. The inspection will be performed in accordance with the Standards of Practice promulgated by the Texas Real Estate Commission. Inspector will attempt to identify major defects and problems with the Property. However, Client acknowledges that the Inspection Report may not identify all defects or problems.
- C. The inspection is limited to those items which are easily accessible, seen, viewed or capable of being approached, entered and/or operated by the Inspector at the time of the inspection as set out in the Inspection Report. The Inspector will not climb over obstacles, move furnishings or large, heavy, or fragile objects, remove walls, floors, wall coverings, floor coverings and other obstructions in order to inspect concealed items. The inspector will not turn on decommissioned equipment, systems, utility services. Systems, components and conditions which are not specifically addressed in the Inspection Report are excluded.
- D. The Inspection Report may indicate one of the following opinions of the Inspector regarding a particular item:
 - 1. The item is performing its intended function, achieving an operation, function or configuration relative to accepted industry standard practices with consideration of age and normal wear and tear from ordinary use at the time of the inspection;
 - 2. The item is in need of replacement, maintenance or repair; or
 - 3. Further evaluation by an expert is recommended.

II. INSPECTION REPORT

- A. The Inspection Report provided by the Inspector will contain the Inspector's professional, good-faith opinions concerning the need for repair or replacement of certain observable items. All statements in the report are the Inspector's opinions and should not be construed as statements of fact or factual representations concerning the Property. By signing this Agreement, the Client understands that the services provided by the Inspector fall within the Professional Services Exemption of the Texas Deceptive Trade Practices Act ("DTPA") and agrees that no cause of action exists under the DTPA related to the services provided.
- B. Unless specifically stated, the report WILL NOT INCLUDE and should not be read to indicate OPINIONS AS TO;
 - 1. the presence, absence, or risk of environmental conditions such as asbestos, lead-based paint, <u>MOLD</u>, mildew, corrosive or contaminated drywall "Chinese Drywall" or any other environmental hazard, environmental pathogen, carcinogen, toxin, mycotoxin, pollutant, fungal presence or activity, poison, presence of toxic or hazardous waste or substances;
 - 2. presence or absence of pests, termites, or other wood-destroying insects or organisms;
 - 3. <u>COMPLIANCE WITH</u> compliance with any ordinances, statutes or restrictions, <u>CODE</u>, listing, testing or protocol authority, utility sources, property association guidelines or requirements, manufacturer or regulatory requirements;
 - 4. insurability, efficiency warrantability, suitability, adequacy, compatibility, capacity, durability, quality reliability, marketability, operating costs, recalls, counterfeit products, product lawsuits, age, energy efficiency; or
 - 5. anticipate future life or future events or changes in performance of any item inspected.
- C. The Inspection Report is not a substitute for disclosures by sellers and real estate agents. Said disclosure statements should be carefully investigated for any material facts that may influence or effect the desirability and/or market value of the Property.
- D. As noted above, the Inspection Report may state that further evaluation of certain items is needed by an expert in the field of the item inspected. By signing this Agreement, Client acknowledges that qualified experts may be needed to further evaluate such items as structural systems, foundations, grading, drainage, roofing, plumbing, electrical systems, HVAC, appliances, sprinkler systems pool system and components, fire/smoke detection systems, septic systems and other observable items as noted in the report. Any such follow-up should take place prior to the expiration of any time limitations such as option or warranty periods.

III. DISCLAIMER OF WARRANTIES

The inspector makes no guarantee or warranty, express or implied, as to any of the following:

- 1. That all defects have been found or that the Inspector will pay for repair of undisclosed defects;
- 2. That any of the items inspected are designed or constructed in a good and workmanlike manner;
- 3. That any of the items inspected will continue to perform in the future as they are performing at time of the inspection; and
- 4. That any of the items inspected are merchantable or fit for any particular purpose.

IV. LIMITATION OF LIABILITY

BY SIGNING THIS AGREEMENT, CLIENT ACKNOWLEDGES THAT THE INSPECTION FEE PAID TO THE INSPECTOR IS NOMINAL GIVEN THE RISK OF LIABILITY ASSOCIATED WITH PERFORMING HOME INSPECTIONS IF LIABILITY COULD NOT BE LIMITED. CLIENT ACKNOWLEDGES THAT WITHOUT THE ABILITY TO LIMIT LIABILITY, THE INSPECTOR WOULD BE FORCED TO CHARGE CLIENT MUCH MORE THAN THE INSPECTION FEE FOR THE INSPECTOR'S SERVICES. CLIENT ACKNOWLEDGES BEING GIVEN THE OPPORTUNITY TO HAVE THIS AGREEMENT REVIEWED BY COUNSEL OF HIS OR HER OWN CHOOSING AND FURTHER ACKNOWLEDGES THE OPPORTUNITY OF HIRING A DIFFERENT INSPECTOR TO PERFORM THE INSPECTION. BY SIGNING THIS AGREEMENT, CLIENT AGREES TO LIABILITY BEING LIMITED TO THE AMOUNT OF THE INSPECTION FEE PAID BY THE CLIENT. \$

V. DISPUTE RESOLUTION

In the event a dispute arises regarding an inspection that has been performed under this agreement, the Client agrees to notify the Inspector within ten (10) days of the date the Client discovers the basis for the dispute so as to give the Inspector a reasonable opportunity to reinspect the property. Client agrees to allow reinspection before any corrective action is taken. Client agrees not to disturb or repair or have repaired anything which might constitute evidence relating to a complaint against the Inspector. Client further agrees that the Inspector can either conduct the reinspection himself or can employ others (at Inspector's expense) to reinspect the property, or both. In the event a dispute cannot be resolved by the Client and the Inspector, the parties agree that any dispute or controversy shall be resolved by mandatory and binding arbitration administered by the American Arbitration Association ("AAA") pursuant to Chapter 171 of the Texas Civil Practice & Remedies Code and in accordance with this arbitration agreement and the commercial arbitration rules of the AAA.

VI. ATTORNEY'S FEES

The Inspector and the Client agree that in the event any dispute or controversy arises as a result of this Agreement, and the services provided hereunder, the prevailing party in that dispute shall be entitled to recover all of the prevailing party's reasonable and necessary attorneys' fees and costs incurred by that party.

VII. EXCLUSIVITY

The Inspection Report is to be prepared exclusively for the Client and is not transferable to anyone in any form. Client gives permission for the Inspector to discuss report findings with real estate agents, specialists, or repair persons for the sake of clarification. A copy of the Inspection Report may be released to the buyers Real Estate Agent.

BY MY SIGNATURE BELOW, I ACKNOWLEDGE THAT I HAVE READ THIS CONTRACT AND THAT THE INSPECTOR DID NOT COERCE, PRESSURE OR RUSH ME TO EXECUTE THIS CONTRACT WITHOUT OPPORTUNITY TO FULLY REVIEW THE CONTRACT AND IF NECESSARY HAVE THE CONTRACT REVIEWED BY AN ATTORNEY; THAT INSPECTOR AGREED TO RESCHEDULE THE INSPECTION IN THE EVENT I REQUIRED ADDITIONAL TIME TO REVIEW THE CONTRACT; THAT I UNDERSTAND THE TERMS AND CONDITIONS AND THAT I AGREE TO BE BOUND BY THESE TERMS AND CONDITIONS. IF CLIENT IS MARRIED, CLIENT REPRESENTS THAT THIS OBLIGATION IS A FAMILY OBLIGATION INCURRED IN THE INTEREST OF THE FAMILY.

Client Signature:		Date: <u>01/16/2020</u>
Inspector:	Matthew Brading	