ROCKY MOUNT, NORTH CAROLINA | AL-5743 (FAA) | 25331

ILS or LOC RWY 4

ROCKY MOUNT/WILSON RGNL (RWI)

LOC/DME I-RWI	APP CRS	Rwy Ldg	7099
108.3	042°	TDZE	158
Chan 20		Apt Elev	158

DME required for LOC only.

MALSR

MISSED APPROACH: Climb to 1200 then climbing right turn to 2100 direct TYI VORTAC and hold.

ASOS	WASHINGTON CENTER	UNICOM
118.875	123.85 279.65	123.05 (CTAF)

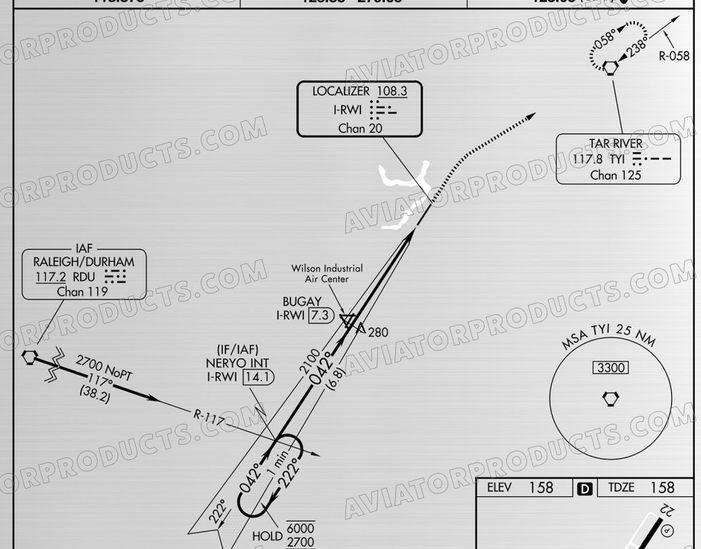

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 41).

1200	2100	TYI

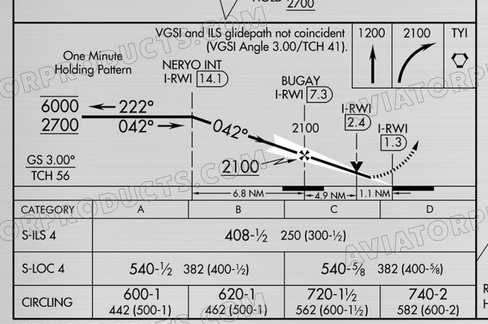

CATEGORY	A	B	C	D
S-ILS 4	408-½ 250 (300-½)			
S-LOC 4	540-½ 382 (400-½)		540-⅝ 382 (400-⅝)	
CIRCLING	600-1 442 (500-1)	620-1 462 (500-1)	720-1½ 562 (600-1½)	740-2 582 (600-2)

ROCKY MOUNT, NORTH CAROLINA
Amdt 17 27NOV25

35°51'N-77°54'W

ROCKY MOUNT/WILSON RGNL (RWI)
ILS or LOC RWY 4

ROCKY MOUNT, NORTH CAROLINA | AL-5743 (FAA) | 25331

RNAV (GPS) RWY 4

ROCKY MOUNT/WILSON RGNL (RWI)

WAAS	APP CRS	Rwy Ldg	7099
CH 56513	042°	TDZE	158
W04A		Apt Elev	158

RNP APCH - GPS.

Baro-VNAV and VDP NA when using GWW altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -7°C or above 54°C. When local altimeter setting not received, use GWW altimeter setting and increase LPV DA to 467 feet; increase LNAV/VNAV DA to 601 feet and all visibilities ⅛ SM, increase all MDAs 60 feet and LNAV Cats C/D and Circling Cat C visibilities ¼ SM. For inop ALS, increase LNAV Cats C/D visibility to 1⅛ SM. For inop ALS when using GWW altimeter setting, increase LPV all Cats visibility to ⅞ SM.

MALSR

MISSED APPROACH: Climb to 2500 direct FENIM and hold.

ASOS	WASHINGTON CENTER	UNICOM
118.875	123.85 279.65	123.05 (CTAF)

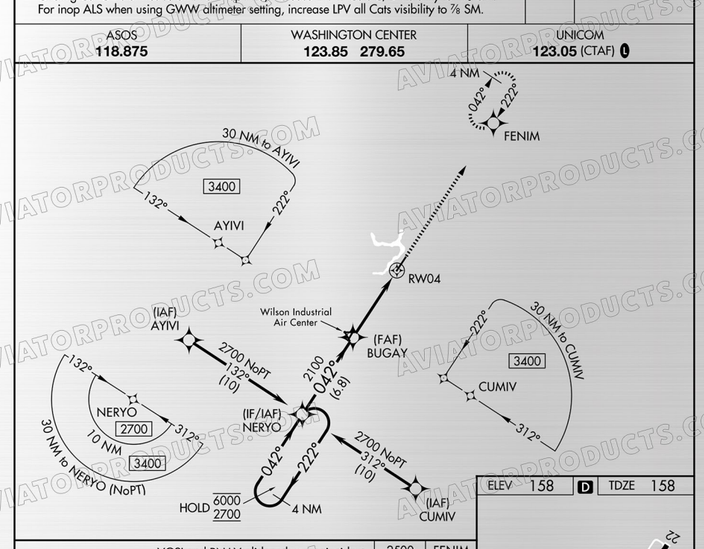

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 41).

2500	FENIM

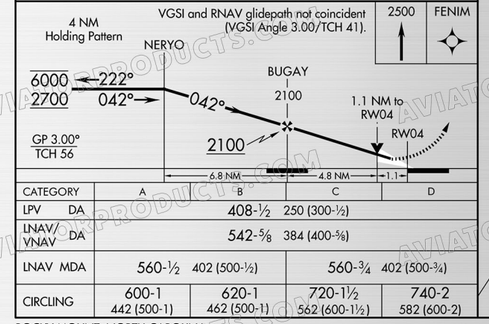

CATEGORY	A	B	C	D
LPV DA	408-½ 250 (300-½)			
LNAV/VNAV DA	542-⅝ 384 (400-⅝)			
LNAV MDA	560-½ 402 (500-½)		560-¾ 402 (500-¾)	
CIRCLING	600-1 442 (500-1)	620-1 462 (500-1)	720-1½ 562 (600-1½)	740-2 582 (600-2)

ROCKY MOUNT, NORTH CAROLINA
Amdt 3 27NOV25

35°51'N-77°54'W

ROCKY MOUNT/WILSON RGNL (RWI)
RNAV (GPS) RWY 4

ROCKY MOUNT, NORTH CAROLINA | AL-5743 (FAA) | 25331

RNAV (GPS) RWY 22

ROCKY MOUNT/WILSON RGNL (RWI)

WAAS	APP CRS	Rwy Ldg	6900
CH 70435	222°	TDZE	152
W22A		Apt Elev	158

For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -10°C (14°F) or above 54°C (130°F). DME/DME RNP-0.3 NA. Baro-VNAV and VDP NA when using Wayne Exec Jetport altimeter setting. When local altimeter setting not received, use Wayne Exec Jetport altimeter setting and increase all DA 59 feet and all visibilities ½ mile; increase all MDA 60 feet and LNAV Cats C/D and Circling Cat C visibility ¼ mile. Rwy 22 helicopter visibility reduction below ¾ SM NA.

MISSED APPROACH: Climb to 1000 then climbing right turn to 2500 direct FENIM and hold.

ASOS	WASHINGTON CENTER	UNICOM
118.875	123.85 279.65	123.05 (CTAF)

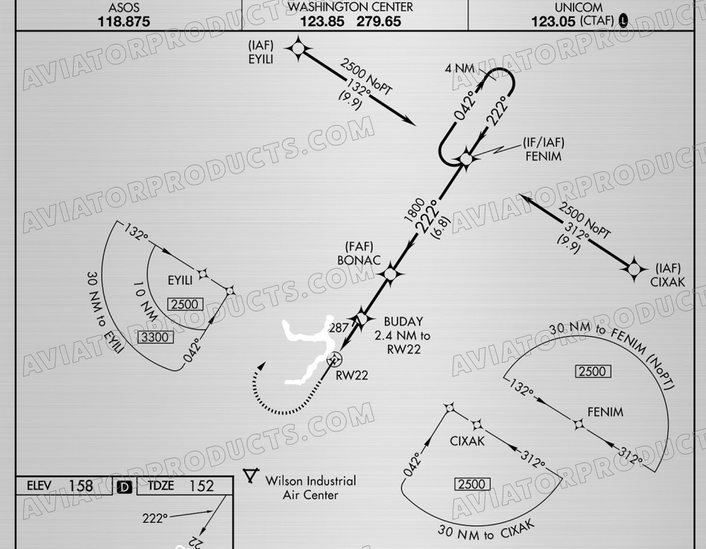

1000	2500	FENIM

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 42).

*LNAV only.

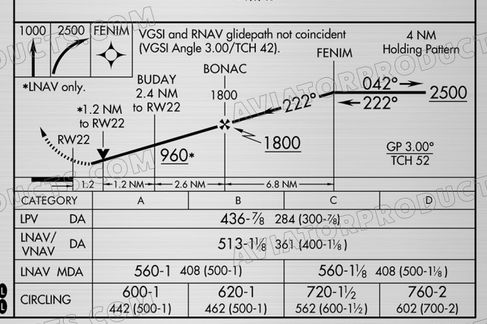

CATEGORY	A	B	C	D
LPV DA	436-⅞ 284 (300-⅞)			
LNAV/VNAV DA	513-1⅛ 361 (400-1⅛)			
LNAV MDA	560-1 408 (500-1)		560-1⅛ 408 (500-1⅛)	
CIRCLING	600-1 442 (500-1)	620-1 462 (500-1)	720-1½ 562 (600-1½)	760-2 602 (700-2)

ROCKY MOUNT, NORTH CAROLINA
Amdt 2A 22JUN17

35°51'N-77°54'W

ROCKY MOUNT/WILSON RGNL (RWI)
RNAV (GPS) RWY 22

ROCKY MOUNT/WILSON REGIONAL AIRPORT

ROCKY MOUNT, NORTH CAROLINA