BEARING FAILURES DEFICIENCIES AND THEIR CAUSES

BY: RICKY SMITH, CMRP, CMRT, CRL







Bearing Failures, Deficiencies, and Their Causes By Ricky Smith, CMRP, CMRT

The general classifications of failures and deficiencies requiring bearing removal are overheating, vibration, turning on the shaft, binding of the shaft, noise during operation, and lubricant leakage. Figure 1 is a troubleshooting guide that lists the common causes for each of these failures and deficiencies. As indicated by the causes of failure listed, bearing failures are rarely caused by the bearing itself.

Many abnormal vibrations generated by actual bearing problems are the result of improper sizing

of the bearing liner or improper lubrication. However, numerous machine and process-related problems generate abnormal vibration spectra in bearing data. The primary contributors to abnormal bearing signatures are: (1) imbalance, (2) misalignment, (3) rotor instability, (4) excessive or abnormal loads, and (5) mechanical looseness.

Defective bearings that leave the manufacturer are very rare, and it is estimated that defective

bearings contribute to only 2% of total failures. The failure is invariably linked to symptoms of misalignment, Imbalance, resonance, and lubrication—or the lack of it. Most of the problems that occur result from the following reasons: dirt, shipping damage, storage and handling, poor fit resulting in installation damage, wrong type of bearing design, overloading, improper lubrication practices, misalignment, bent shaft, imbalance, resonance, and soft foot. Anyone of these conditions will eventually destroy a bearing—two or more of these problems can result in disaster!

Although most industrial machine designers provide adequate bearings for their equipment, there

are some cases in which bearings are improperly designed, manufactured, or installed at the factory. Usually, however, the trouble is caused by one or more of the following reasons:

- 1. improper on-site bearing selection and/or installation
- 2. incorrect grooving
- 3. unsuitable surface finish
- 4. insufficient clearance
- 5. faulty relining practices
- 6. operating conditions
- 7. excessive operating temperature
- 8. contaminated oil supply
- 9. oil-film instability.

Improper Bearing Selection and/or Installation

There are several things to consider when selecting and installing bearings, including the issue of interchangeability, materials of construction, and damage that might have occurred during shipping, storage, and handling.

Interchangeability

Because of the standardization in envelope dimensions, precision bearings were once regarded as interchangeable among manufacturers. This interchangeability has since been considered a major cause of failures in machinery, and the practice should be used with extreme caution. Most of the problems with interchangeability stem from selecting and replacing bearings based only on bore size and outside diameters.







Bearing Failure Deficiencies and Their Causes

Often, very little consideration is paid to the number of rolling elements contained in the bearings. This can seriously affect the operational frequency vibrations of the bearing and may generate destructive resonance in the host machine or adjacent machines. More bearings are destroyed during their installation than fail in operation. Installation with a heavy hammer is the usual method in many plants. Heating the bearing with an oxy-acetylene burner is another classical method.

However, the bearing does not stand a chance of reaching its life expectancy when either of these installation practices are used. The bearing manufacturer's installation instructions should always be followed.

Overheating	Vibration	Turning on the shaft	Binding of the shaft	Noisy bearing	Lubricant leakage
Inadequate or insufficient lubrication	Dirt or chips in bearing	Growth of race due to overheating	Lubricant breakdown	Lubrication breakdown	Overfilling of lubricant
Excessive lubrication	Fatigued race or rolling elements	Fretting wear	Contamination by abrasive or corrosive materials	Inadequate lubrication	Grease churning due to too soft a consistency
Grease liquifaction or aeration	Rotor unbalance	Improper initial fit	Housing distortion or out-of-round pinching bearing	Pinched bearing	Grease deterioration due to excessive operating temperature
Oil foaming	Out-of-round shaft	Excessive shaft deflection	Uneven shimming of housing with loss of clearance	Contamination	Operating beyond grease life
Abrasion or corrosion due to contaminants	Race misalignment	Initial coarse finish on shaft	Tight rubbing seals	Seal rubbing	Seal wear
Housing distortion due to warping or out-of-round	Housing resonance	Seal rub on inner race	Preloaded bearings	Bearing slipping on shaft or in housing	Wrong shaft attitude (bearing seals designed for horizontal mounting only)
Seal rubbing or failure	Cage wear		Cocked races	Flatted roller or ball	Seal failure
Inadequate or blocked scavenge oil passages	Flats on races or rolling elements		Loss of clearance due to excessive adapter tightening	Brinelling due to assembly abuse, handling, or shock loads	Clogged breather
Inadequate bearing clearance or bearing preload	Race turning		Thermal shaft expansion	Variation in size of rolling elements	Oil foaming due to churning or air flow through housing
Race turning	Excessive			Out-of-round or lobular shaft	Gasket (O-ring) failure or misapplication
Cage wear	Corrosion			Housing bore waviness	Porous housing or closure
	False brinelling or indentation of races Electrical arcing Mixed rolling element diameters Out-of-square rolling paths in races	,		Chips or scores under bearing seat	Lubricator set at the wrong flow rate

Source: Integrated Systems Inc.







This interchangeability has since been considered a major cause of failures in machinery, and the practice should be used with extreme caution. Most of the problems with interchangeability stem from selecting and replacing bearings based only on bore size and outside diameters. Often, very little consideration is paid to the number of rolling elements contained in the bearings. This can seriously affect the operational frequency vibrations of the bearing and may generate destructive resonance in the host machine or adjacent machines.

More bearings are destroyed during their installation than fail in operation. Installation with a heavy hammer is the usual method in many plants. Heating the bearing with an oxy-acetylene burner is another classical method. However, the bearing does not stand a chance of reaching its life expectancy when either of these installation practices are used. The bearing manufacturer's installation instructions should always be followed.

Shipping Damage

Bearings and the machinery containing them should be properly packaged to avoid damage during shipping. However, many installed bearings are exposed to vibrations, bending, and massive shock loadings through bad handling practices during shipping. It has been estimated that approximately 40% of newly received machines have "bad" bearings. Because of this, all new machinery should be thoroughly inspected for defects before installation. Acceptance criteria should include guidelines that clearly define acceptable design/operational specifications. This practice pays big dividends by increasing productivity and decreasing unscheduled downtime.

Storage and Handling

Storeroom and other appropriate personnel must be made aware of the potential havoc they can cause by their mishandling of bearings. Bearing failure often starts in the storeroom rather than the machinery. Premature opening of packages containing bearings should be avoided whenever possible.

If packages must be opened for inspection, they should be protected from exposure to harmful dirt sources and then resealed in the original

wrappings. The bearing should never be dropped or bumped as this can cause shock loading on the bearing surface.

Incorrect Placement of Oil Grooves

Incorrectly placed oil grooves can cause bearing failure. Locating the grooves in high-pressure areas causes them to act as pressure-relief passages. This interferes with the formation of the hydrodynamic film, resulting in reduced load-carrying capability.

Unsuitable Surface Finish

Smooth surface finishes on both the shaft and the bearing are important to prevent surface variations from penetrating the oil film. Rough surfaces can cause scoring, overheating, and bearing failure. The smoother the finishes, the closer the shaft may approach the bearing without danger of surface contact. Although important in all bearing applications, surface finish is critical with the use of harder bearing materials such as bronze.

Insufficient Clearance

There must be sufficient clearance between the journal and bearing in order to allow an oil film to form. An average diametral clearance of 0.001 inches per inch of shaft diameter is often used. This







value may be adjusted depending on the type of bearing material, the load, speed, and the accuracy of the shaft position desired.

Faulty Relining

Faulty relining occurs primarily with babbitt bearings rather than precision machine-made inserts. Babbitted bearings are fabricated by a pouring process that should be performed under carefully controlled conditions. Some reasons for faulty relining are:

(1) improper preparation of the bonding surface

(2) poor pouring technique

(3) contamination of babbitt

(4) pouring bearing to size with journal in place.

Operating Conditions

Abnormal operating conditions or neglect of necessary maintenance precautions cause most bearing failures. Bearings may experience premature and/or catastrophic failure on machines that are operated heavily loaded, speeded up, or being used for a purpose not appropriate for the system design. Improper use of lubricants can also result in bearing failure.

Some typical causes of premature failure include:

(1) excessive operating temperatures

(2) foreign material in the lubricant supply

(3) corrosion

(4) material and fatigue

(5) use of unsuitable lubricant.

Excessive Temperatures

Excessive temperatures affect the strength, hardness, and life of bearing materials. Lower temperatures are required for thick babbitt liners than for thin precision babbitt inserts. Not only do high temperatures affect bearing materials, but they also reduce the viscosity of the lubricant and affect the thickness of the film, which affects the bearing's load-carrying capacity. In addition, high temperatures result in more rapid oxidation of the lubricating oil, which can result in unsatisfactory performance.

Dirt and Contamination in Oil Supply

Dirt is one of the biggest culprits in the demise of bearings. Dirt makes its appearance in bearings in many subtle ways, and it can be introduced

by bad work habits. It also can be introduced through lubricants that have been exposed to dirt, a problem that is responsible for approximately half of bearing failures throughout the industry.

To combat this problem, soft materials such as babbitt are used when it is known that a bearing will be exposed to abrasive materials. Babbitt metal embeds hard particles, which protects the shaft against abrasion. When harder materials are used in the presence of abrasives, scoring and galling occurs as a result of abrasives caught between the journal and bearing. In addition to the use of softer bearing materials for applications where abrasives may potentially be present, it is important to properly maintain filters and breathers, which should regularly be examined. In order to avoid oil supply contamination, foreign material that collects at the bottom of the bearing sump should be removed on a regular basis.

Oil-Film Instability

The primary vibration frequency components associated with fluid-film bearings problems are in fact displays of turbulent or nonuniform oil film. Such instability problems are classified as either *oil whirl* or *oil whip* depending on the severity of the instability. Machine-trains that use sleeve bearings are designed based on the assumption that rotating elements and shafts operate in a







balanced and, therefore, centered position. Under this assumption, the machine-train shaft will operate with an even, concentric oil film between the shaft and sleeve bearing. For a normal machine, this assumption is valid after the rotating element has achieved equilibrium. When the forces associated with rotation are in balance, the rotating element will center the shaft within the bearing. However, several problems directly affect this self-centering operation.

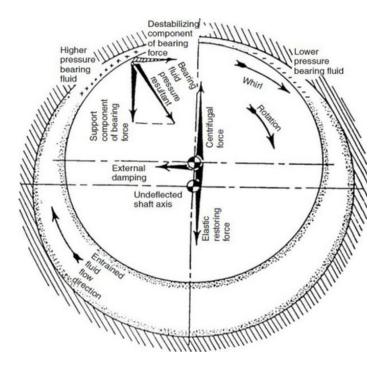


Figure 2

First, the machine-train must be at designed operating speed and load to achieve equilibrium.

Second, any imbalance or abnormal operation limits the machine-train's ability to center itself within the bearing. A typical example is a steam turbine. A turbine must be supported by auxiliary running gear during startup or shutdown to prevent damage to the sleeve bearings. The lower speeds during the startup and shutdown phase of operation prevent the self-centering ability of the rotating element. Once the turbine has achieved full speed and load, the rotating element and shaft should operate without assistance in the center of the sleeve bearings.

Oil Whirl

In an abnormal mode of operation, the rotating shaft may not hold the centerline of the sleeve bearing. When this happens, an instability called oil whirl occurs. Oil whirl is an imbalance in the hydraulic forces within a sleeve bearing. Under normal operation, the hydraulic forces such as velocity and pressure are balanced. If the rotating shaft is offset from the true centerline of the bearing, instability occurs.

As Figure 2 illustrates, a restriction is created by the offset. This restriction creates a high pressure and another force vector in the direction of rotation. Oil whirl accelerates the wear and failure of the bearing and bearing support structure.

Oil Whip

The most severe damage results if the oil whirl is allowed to degrade into oil whip. Oil whip occurs when the clearance between the rotating shaft and sleeve bearing is allowed to close to a point







approaching actual metal-to-metal contact. When the clearance between the shaft and bearing approaches contact, the oil film is no longer free to flow between the shaft and bearing. As a result, the oil film is forced to change directions. When this occurs, the high-pressure area created in the region behind the shaft is greatly increased. This vortex of oil increases the abnormal force vector created by the offset and rotational force to the point that metal-to-metal contact between the shaft and bearing occurs. In almost all instances where oil whip is allowed, severe damage to the sleeve bearing occurs.

This article is from "Industrial Machinery Repair" by Keith Mobley and Ricky Smith – Elsevier Publisher











#1 Software for Maintenance & Reliability Teams

UpKeep is a service-first company that builds software designed to make maintenance easier for technicians and managers everywhere. Reduce downtime up to 18% by switching over to a preventative maintenance solution!

www.upkeep.com

Our Products

Optimize Contract Contrac

Mobile-first maintenance management and collaboration across all location, assets, and teams

With nearly 340 different machines in our work environment, it's an impossible task to manually assign and track PM's. With UpKeep we can schedule regular maintenance without overlapping tasks with other critical jobs."

★ ★ ★ ★ ★ Paul D, Health and Safety Coordinator



An end-to-end solution for remote condition-based monitoring



Work Orders

4/13/20

4/12/20

🔅 UpKeep

IVAC Monthly Preventive Jaintenance - AC

00

Connected and secure IoT sensors for real-time remote condition asset monitoring



Integrated & Centralized Data Ecosystem for World Class Asset Operations

The only purpose built Asset Data Platform. Asset Focused ELT Solution for advanced analytics and integrated, real-time asset data.

The Maintenance Community Coalition was founded on the belief that working together will benefit everyone within our community

Committed to helping each other thrive in our individual professional journeys by sharing resources and expertise, granting scholarships, hosting events, and unlocking knowledge – always at no cost.

