

Alternate 5, install receiver and remote openers at 2 existing Liftmaster door openers. Receivers equal to Liftmaster 850LM. Power available at existing ceiling mounted receptacle between openers. Remotes equal to Liftmaster 811LM. Provide 2 remotes for each receiver. Verify compatibility between existing installations and new products before ordering. Existing hard wired wall mounted operators to remain. No electric eye required. Provide all wiring and programming so that installation is ready to use.

Alternate 3, patch water damaged drywall joints at two locations between beam and wall, patch paint wall to wall, 60 s.f. +/-
 .existing roof beam below drywall ceiling.

Alternate 3, patch water damaged drywall at bottom 4' of restroom wall. Lavatory removal optional. Temporarily remove and replace same toilet. New drywall totals approximately 7'-8" x 4". Spray knock down texture. Prime and paint affected wall full height. Replace faucet. Replace shut off valves at toilet and lavatory, 3 valves total.


Patch and paint drywall damaged during window replacement. This patching is part of alternate 2, independent of alternate 3.

Alternate 2, replace window patch drywall at window

Alternate 4, replace threshold and door sweep

Alternate 2, replace window patch drywall at window

OFFICE FLOOR PLAN

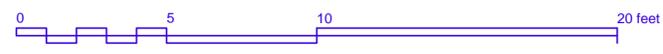

REVISIONS			
NO.	DATE	CHANGES	BY



Alpha Design ARCHITECTS
 108 Cook Ave.
 P.O. Box 241
 Raton, NM 87740
 Phone (575) 445-4235
 Email: alphadesign@buarvalley.com

REPAIRS & IMPROVEMENTS
 CAPULIN FIRE STATION
 CAPULIN, NEW MEXICO

DATE 3-10-21

SHEET NUMBER 2