

YEAR 20 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations <small>Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)</small>
--------------------	---------------------------	-------------------	-----------------------------	--

Date 4-03-2022

N2912L Left Engine 912ULS ESN: 6786559 Hobbs 179.8

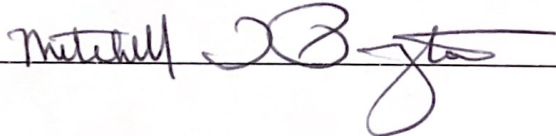
C/W Annual 100/Hour Condition Inspection. Changed oil and filter. Cleaned oil tank, installed new ROTAX Oil Filter Part # 825014 and serviced with Aeroshell Sport +4 oil. Leak checked okay.

C/W SI-912-018 Purging of lubrication system and Hydraulic Valve Tappet Check-checked okay.

Complied with 200 Hour Spark Plug Connector Pull-off check-checked okay. Installed 8 new DCPR8E spark plugs, gapped to .028 and applied heat transfer paste. Checked all ROTAX engine service bulletins for compliance. C/W 100 Hour differential compression test.

Cylinder # 1 78/80 Cylinder # 2 79/80 Cylinder # 3 78/80 Cylinder # 4 78/80

C/W ROTAX annual float bowl inspection – checked okay. Performed Pneumatic Carburetor Sync and Idle adjustment.

Signature  Mitchell T. Pennington, A&P, IA 2827083
