

Left engine log book - L

DATE	GROUND TIME	AIR TIME	TOTAL TIME	SIGNATURE OF PERSON MAKING ENTRY	TACHOMETER READING	INSPECTION REFERENCE DATA
BRT. FWD.	:	:	:			
3-28-95				Estergard Aviation 11 LLC 2330 S. Airport Blvd, #15 Chandler, AZ 85249 602-963-0173		
				3-28-95 10-360-C1E6 L8596-51A Tach Reading:		
				Engine overhaul completed this date. Magnafluxed and zyglod all parts as required. Installed 4 ea: new lycoming cylinder assemblies. Camshaft and counterweights reconditioned by Aircraft Specialties. Reconditioned oil coolers. Installed overhauled fuel servo, flow divider, magnetos, starter and alternator. Installed overhauled fuel pump by Aero Accessories, Inc. Complied with AD #91-14-22. All other AD's were either previously complied with or not applicable. This engine was repaired and assembled in accordance with Lycoming current overhaul and parts manuals. For details pertinent to this overhaul refer to Estergard Aviation 11 LLC Work Order #7746. CR Estergard A & P #1524560		
				<i>C.R. Estergard</i>		
				- cont -		
TOTALS	:	:	:	All repairs, inspections, alterations must be endorsed by a certificated mechanic or repair agency with name, rating and cert. no.		

OK - Westfield

INSPECTION REFERENCE DATA		MAINTENANCE, INSPECTIONS, REPAIRS AND ALTERATIONS					
DATE		cont Parts installed on NO #7746 Lycoming IO-360-C1E6, s/n L8596-514					
QTY.	PARTS NO.	DESCRIPTION	QTY.	PARTS NO.	DESCRIPTION		
1	Z5441-1	Gasket Set	4	73772	Nozzle		
2	LW13884	Bearing	4	LW11021	Bearing		
8	Z2877	Body	1	10288	Ball		
1	61084	Spring	1	75767	Tube		
1	R3819646	Gear	4	73810	Bushing		
2	60421696	Roller	2	72797	Roller		
8	W34820	Circlip	8	71907	Plate		
1	S-22213	Screw	2	LW13796	Shaft		
3	LW31H-.088	Bolt	1	std2168	Nut		
1	W2121	Shaft	1	75072	Gear		
1	AS555B1032H5	Set Screw	1	05K19423S	Kit		
1	CH48110	Filter	8	RHM38E	Spark Plug		
1	R2516	Harness	1	R0025-3-501	Fuel Pump		
4	LW13923	Bushing	8	LW13212	Bearing		
8	LW12596	Bolt	8	LW12186	Nut		
8	W389	Bushing	4	Std2180	Hose		
8	Q5100M6H	Clamp	1	72702	Tube		
1	LW703	Tube	1	24808	Tube		
1	LW707	Tube	2	75338	Baffle		
2	W2136	Bracket	4	05K21120	Cyl.		
2	LW12098-0-210	Line	2	LW12098-0-140	Line		
1	S-22213	Circlip	1	78290	Hyd unit		
8	W21031	Seal					

ificated


DATE	GROUND TIME	AIR TIME	TOTAL TIME	SIGNATURE OF PERSON MAKING ENTRY	TACHOMETER READING	INSPECTION REFERENCE DATA
BRT. FWD.	:	:	:			
6-20-95	Tach	1104.0	TTE 4039.6	TS MOHE (LT)	Performed	
					annual inspection in accordance with Piper Service	
					manual; installed Lycoming engine by Estemard	
					Aviation w/O #7146 S/N L8596-51A. Installed new	
					motor mounts & shock mounts. added 8 qts oil.	
					leak ck & run up good. I certify that I have inspected	
					this engine in accordance with current FAR's for an	
					annual inspection and have found it airworthy.	
					<i>[Signature]</i>	
					A+P 529869163JA	
TOTALS	:	:	:			

DATE

MAINTENANCE, INSPECTIONS, REPAIRS AND ALTERATIONS


8-24-95 Tach reads 1729.58 TSMOHE (LF) -25.58
Changed oil and filter, added 8 qts Aeroshell 50W Det.
New CH48103 oil filter, washed, leak check good.
Aircraft approved for return to service.

AFCONA AIRCRAFT SERVICES INC
KINGMAN AZ
520-752-7144


A+P529869163 IA

9-22-95 Tach reads 1750.8 TSMOHE (LF) -46.80 Changed oil
and filter, added 8 qts Aeroshell 50W Det. New CH48103
oil filter, washed, leak check good. Aircraft approved
for return to service.

AFCONA AIRCRAFT SERVICES INC
KINGMAN AZ
520-752-7144


A+P529869163 IA

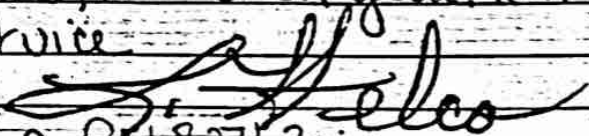
DATE	GROUND TIME	AIR TIME	TOTAL TIME	SIGNATURE OF PERSON MAKING ENTRY	TACHOMETER READING	INSPECTION REFERENCE DATA
BRT. FWD. 10-30-95						
Tach reads 1775.8 TSMOHE (LF)					71.80	
Changed oil and filter, added 8 qts Aeroshell Oil.						
New CH48103 oil filter, washed, Leak check good.						
Aircraft approved for return to service.						
		ARIZONA AIRCRAFT SERVICES INC.		 A-P529869163 IA		
		KINGMAN AZ				
		520-757-7744				
12-6-95						
Tach reads 1802.39 TSMOHE (LF)					124.98	
Changed oil and filter, added 8 qts Aeroshell Oil.						
New CH48103 oil filter, washed, Leak check good.						
Aircraft approved for return to service.						
		ARIZONA AIRCRAFT SERVICES INC.		 A-P529869163 IA		
		KINGMAN AZ				
		520-757-7744				
TOTALS				All repairs, inspections, alterations must be endorsed by a certificated mechanic or repair agency with name, rating and cert. no.		

DATE

MAINTENANCE, INSPECTIONS, REPAIRS AND ALTERATIONS

5-3-96 Tach reads ~~1855~~^{1841.5}, TSMOHE (LF) 164.09. Changed oil + filter, added 8 qts. A/S 50 W. Det oil. Installed new CH48103 oil filter. Washed engine, leak check good. Run-up good. Aircraft returned to service.

ARIZONA AIRCRAFT SERVICES INC

KINGMAN AZ
520-757-7744
A+P 529869163IA

A+P 529869163IA

Right side engine log

DATE	GROUND TIME	AIR TIME	TOTAL TIME	SIGNATURE OF PERSON MAKING ENTRY	TACHOMETER READING	INSPECTION REFERENCE DATA
BKT. TWD.						
3-28-95		3-38-95 LIP-360-C1E6 1200-67A		Estergard Aviation ll LLC 2330 S. Airport Blvd, #15 Chandler, AZ 85249 602-963-0173		
:	:	Tach Reading:				
:	:	Engine overhaul completed this date. Magnafuxed and zyglod				
:	:	all parts as required. Installed 4 ea. new Lycoming cylinder				
:	:	assemblies. Camshaft and counterweights reconditioned by Aircraft				
:	:	Specialties. Reconditioned oil coolers. Installed overhauled				
:	:	Fuel servo, flow divider, magnetos, starter and alternator.				
:	:	Installed overhauled fuel pump by Aero Accessories Inc. Complied				
:	:	with AD #91-14-22. All other ADs were either previously complied				
:	:	with or not applicable. This engine was repaired and assembled				
:	:	in accordance with parts manuals. For details pertinent to				
:	:	this overhaul refer to Estergard Aviation ll LLC Work Order				
:	:	#7745				
:	:	Ck Estergard A & P #1524560				
:	:	<i>C. Estergard</i>				
:	:				- Over -	
:	:				cont	
TOTALS	:	:	:	All repairs, inspections, alterations must be endorsed by a certificated mechanic or repair agency with name, rating and cert. no.		

- Westfield

DATE	MAINTENANCE, INSPECTIONS, REPAIRS AND ALTERATIONS					
- cont -	Parts installed on WO #7745					
	Lycoming LIQ-360-C1E6 s/n L230-67A					
	QTY.	PARTS NO.	DESCRIPTION	QTY.	PARTS NO.	DESCRIPTION
	1	35441-1	Gasket Set	4	73772	Nozzle
	2	LW13884	Bearing	4	LW11021	Bearing
	8	72877	Body	1	1028B	Ball
	1	61084	Spring	1	75767	Tube
	1	std2213	Bolt	1	13S19646	Gear
	4	73810	Bushing	2	14W21696	Roller
	2	72797	Roller	8	LW14820	Circlip
	8	71907	Plate	1	75072	Gear
	2	LW13796	Shaft	3	LW31H-0.88	Bolt
	1	std2168	Nut	1	76121	Shaft
	1	AN565B1032H5	Set screw	1	05K19423S	Kit
	1	CH48110	filter	8	RHm 38E	Spark Plug
	1	M2616	Harness	1		Fuel Pump
	4	LW13923	Bushing	8	LW13212	Bearing
	8	LW12596	Bolt	8	LW12186	Nut
	8	74389	Bushing	4	std 2180	Hose
	8	QS100M6H	Clamp	1	72702	Tube
	1	72703	Tube	1	74808	Tube
	1	73027	Tube	2	75338	Baffle
	2	73136	Bracket	4	05K21120	Cylinder
	2	LW12098-0-210	Line	2	LW12098-0-140	Line
	1	std2213	Fuel Line	4	77611	Gasket
	1	77450	Con Rod u/s			

DATE	GROUND TIME	AIR TIME	TOTAL TIME	SIGNATURE OF PERSON MAKING ENTRY	TACHOMETER READING	INSPECTION REFERENCE DATA
EXT. PWD. 6-20-95				Tach: reads 1704.0 TTE	4039.6 (RT)	
				TSmoHE & Installed o/H Lycoming engine		
				by: Estergard: Aviation w/o #1745 SN L889230-		
				67A. Performed annual inspection in		
				accordance with Piper Service manual. Added 80s		
				oil; leak: ok & run up good. I certify that I have		
				inspected this engine in accordance with current		
				FAR's for an annual inspection and have found it		
				airworthy.		
				AFRONT AIRCRAFT SERVICES INC.		
				KINGMAN AZ		
				620.752.7744		
TOTALS	:	:	:	All repairs, inspections, alterations must be endorsed by a certificated mechanic or repair agency with name, rating and cert. no.		

DATE	MAINTENANCE, INSPECTIONS, REPAIRS AND ALTERATIONS
8-24-95	Tach reads 1729.58 TFE 4065.18 (RT) changed oil and filter, added 8 qts Aerostell 50W Det. New CH 48103 oil filter, washed, leak check good. Aircraft approved for return to service. AIRZONA AIRCRAFT SERVICES INC KINGMAN AZ 520-757-7744 <i>[Signature]</i> A+ P529869163-IA
9-22-95	Tach reads 1750.8 TFE 4107.62 (RT) Changed oil and filter added 8 qts Aerostell 50W Det. New CH 48103 oil filter, washed, leak check good. Aircraft approved for return to service. AIRZONA AIRCRAFT SERVICES INC KINGMAN AZ 520-757-7744 <i>[Signature]</i> A+ P529869163-IA

DATE	GROUND TIME	AIR TIME	TOTAL TIME	SIGNATURE OF PERSON MAKING ENTRY	TACHOMETER READING	INSPECTION REFERENCE DATA
BKT. FWD.	10-30-95	Tach reads 1775.8	TTE 4204.42 (R#)			
	Changed oil and filter, added 8 qts Aeroshell Det. New CH 48103 oil filter washed, leak check good. Aircraft approved for return to service.					
	AIRZONA AIRCRAFT SERVICES INC.					
	KINGMAN AZ			A+P529869163 IA		
	820-751-7144					
	12-6-95	Tach reads 1802.39	TTE 4231.01 (RE)			
	changed oil and filter added 8 qts Aeroshell Det. New CH 48103 oil filter washed, leak check good. Aircraft approved for return to service.					
	AIRZONA AIRCRAFT SERVICES INC.					
	KINGMAN AZ			A+P529869163 IA		
	820-751-7144					
TOTALS	:	:	:	All repairs, inspections, alterations must be endorsed by a certificated mechanic or repair agency with name, rating and cert. no.		

DATE

MAINTENANCE, INSPECTIONS, REPAIRS AND ALTERATIONS

5-3-96 Tach reads 1841.5 TTE 4270.12 (RF) Changed oil +
filter, added 8 qts. A/S 50 W Det oil. Installed new
CH48103 oil filter. Washed engine, leak check good. Run-up
good. Aircraft returned to Service.

ARIZONA AIRCRAFT SERVICES INC
KINGMAN AZ
520-752-7744

W. J. Steg
A+P 56821601 A+P

Aircraft log - Westfield

INSPECTION RECORD

F.A.R. 43.11 - 91.217

DATE	AIRCRAFT TIME IN SERVICE	KIND OF INSPECTION - STATUS & DISCREPANCY LIST SIGNATURE - CERT. NO. OF PERSON APPROVING OR DISSAPPROVING AIRCRAFT FOR SERVICE
6-20-95	-CONT-	turbo systems (L) WO# 13258 (RT) #13257. installed both fuel pumps OH by aero accessories W/O# 16717. Replaced turbo control cables both sides with new. fabricated and replaced starter and ground cables with new. Repaired and painted all cowling with fiberglass and painting as necessary. replaced batt and nut on Lt gear door hinge. rebushed all pivots on Lt & Rt gear over center linkage. Replaced hinge pins on rt gear door hinge. Installed new brake rotors and linings both sides. Repaired Lt gear door crack with epoxy. serviced and installed new battery P/N 6-35. fabricated and installed nose baggage latch spring. installed new heat shield aft of rt segmentor tube. Adjusted rudder cable per manual. lubed elevator trim and checked cable tension and cleaned trim cable drum. pressure lubed Lt throttle cable - checks good. Replaced hinge on Lt intermate air box. fabricated and installed doubler on Lt power plant firewall cowling. installed new brake caliper seals and bled brake lines. fabricated, installed and adjusted CONT

INSPECTION RECORD

F.A.R. 43.11 - 91.217

DATE	AIRCRAFT TIME IN SERVICE	KIND OF INSPECTION - STATUS & DISCREPANCY LIST SIGNATURE - CERT. NO. OF PERSON APPROVING OR DISSAPPROVING AIRCRAFT FOR SERVICE
		RADCO FAA RS# ORGR708L I certify that the altimeter and static system tests req. by FAR's 91.411 & 43 app. E have been performed. Altimeter tested to 25K ft Signature <i>[Signature]</i> Date 3-15-95

June 80 995 Jack Reads 1704.4 Total Time Airframe 4
 1704.0 (RT) 1704.0 (LT) 1704.0 performed annual insp.
 in accordance with Piper service manual. C/w AD 93-24-14 nose gear
 collapse by inspection. installed new bolt and nut to nose gear. C/w
 AD 94-13-11 main gear collapse - not applicable. Due to new style
 trunion installed. C/w AD 73-11-02 main landing gear by inspection
 C/w AD 75-24-02 seat attach by inspection. C/w AD 78-09-07 R3
 impulse coupling failure by O/H see yellow tag. C/w AD 81-19-0
 rayon hose by installing new kits. R & R both engines sent for O.
 by Estergard aviation w/o. # 7745 and 7746. installed new ELT battery
 next due 6-98. installed O/H vacuum pump on rt side by Rapco 55
 installed both main turbochargers O/H by main CONT-

F.A.R. 43.11 - 91.217

KIND OF INSPECTION - STATUS & DISCREPANCY LIST
SIGNATURE - CERT. NO. OF PERSON APPROVING OR DISSAPPROVING AIRCRAFT FOR SERVICE

AIRZONA-AIRCRAFT SERVICES INC.
KINGMAN AZ
520-757-7744

Le Helco
AEP 529869163IA

F.A.R. 43.11 - 91.217

AIRCRAFT TIME
IN SERVICE

KIND OF INSPECTION - STATUS & DISCREPANCY LIST
SIGNATURE - CERT. NO. OF PERSON APPROVING OR DISSAPPROVING AIRCRAFT FOR SERVICE

Removed The following Equipment from
Aircraft: 1BA CR\$ 2000 Hoskins Fuel Flow SN/312, 1BA
RS08 XFR Relay, 1BA CI-121SP LORAN Ant. SN/8746, 1BA
2010 Ant Coupler, 1BA Northstar LORAN MIA SN/N16141/
Installed IN A/C The following Equip: 1BA SHADIN Fuel
Flow Indicator Model 910532T-D SN/2306, 1BA KA92 GPS
ANT. SN/2309, 1BA KLN 90B GPS RCVR SN/22172 AND
AI 90B Relay and ANNUNCIATOR system SN/046. All
INSTALLATIONS DONE IN ACCORDANCE WITH MANUFACTURERS
SPECIFICATIONS. GPS, Com. Check Performed AS PERSONAL
By FAA Regs. Checked Good. Ground Checked Performed
found NO interference to any system. Weight and
Balance Performed This Date By Ron's Aircraft.

VEGAS RADIO WO #

46425

FAA CRS #VQSR557K

2006

INSPECTION RECORD

F.A.R. 43.11 - 91.217

DATE	AIRCRAFT TIME IN SERVICE	KIND OF INSPECTION - STATUS & DISCREPANCY LIST SIGNATURE - CERT. NO. OF PERSON APPROVING OR DISSAPPROVING AIRCRAFT FOR SERVICE
6-20-95	Tach reads 1704.0	TTE 4039.6 Complete interior refurbished by West Coast Interiors. all materials meet FAR 25.833A, appendix F. I certify that I have inspected this engine in accordance with current FAR's for an annual inspection and have found it airworthy. <i>[Signature]</i> A+P529869163 IA AIRZONA AIRCRAFT SERVICES INC KINGMAN AZ 520-757-7744
8-24-95	Tach reads 1729.58	Replaced R/H CHT adapter with new. Part # 2856 aircraft approved for return to service. <i>[Signature]</i> A+P529869163 IA AIRZONA AIRCRAFT SERVICES INC KINGMAN AZ 520-757-7744
2-27-96	Tach reads 1813.7	-replaced nose gear tire. aircraft approved for return to service <i>[Signature]</i> A+P529869163 IA AIRZONA AIRCRAFT SERVICES INC KINGMAN AZ 520-757-7744

INSPECTION RECORD

F.A.R. 43.11 - 91.217

DATE	AIRCRAFT TIME IN SERVICE	KIND OF INSPECTION - STATUS & SIGNATURE - CERT. NO. OF PERSON APPROVING C
------	--------------------------	---

ARTEX AIRCRAFT SUPPLIES, INC. 24368 S. Skyway Dr. Gresham, OR 97030 (503) 255-3359 800-547-8301	
LOG BOOK ENTRY	_____
E.L.T. BATTERY REPLACEMENT DATE	JUNE 92

5-14-96	Tach reads 1825.0 R+R O/H vacuum pump by Rapco Inc. FAA ARS# NE5R064N w/o # 61798. Ops check good. Replace RH gear lightbulb with new. Aircraft returned to Service.
---------	---

AIRZONA-AIRCRAFT SERVICES INC.
KINGMAN AZ
520-757-7744

A+P529869163IA

5-9-96	Tach reads 1849.7 - Disassembled door, found door lock rod assembly broken - welded rod + reassembled, adjusted & installed interior. Aircraft returned to service.
--------	---

AIRZONA-AIRCRAFT SERVICES INC.
KINGMAN AZ
520-757-7744

A+P529869163IA