

Repair vs. Replace Analysis

XXXXXXXXXXXXXXXXXXXXXXXXXXXXX CONDOMINIUM ASSOCIATION.

1234 NE Testing Street

Anytown, USA

SAMPLE - Report date – XXXXXXXX

Services performed

At the request of XXXXXXXXXXXXXXXX., TSSA Storm Safe DAC Inc. has prepared this repair vs. replace analysis of the window and sliding glass door systems installed in the XXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXX Condominium Association.

After analyzing the data collected during our site inspection of the subject property, it has been determined that the resulting damages witnessed on the glazed systems when found in conjunction with each other create a non-repairable environment. This is because the manufacturer of the glazed systems installed at the subject property is defunct and no longer producing structural framing members that can be used in an engineered approved repair protocol.

Non-Repairable Damages


Frame Issues	Frame Separation	FS
	Frame Rotation	FR
	Mull Separation	MS
	Loose Panel	LP
System Movement	Header Movement	HM
	Jamb Movement	JM
	Footer Movement	FM
	Sill Movement	SM
	Mull Movement	MM
Finish Distress	Interior Finish Distress	IFD



	Exterior Finish Distress	EFD
Moisture Damage	Moisture Intrusion	MI
Fastener Damage	Damaged Fastener	DF
	Missing Fastener	MF

The above list of Non Repairable issues signifies a damage profile that has weakened the windows' ability to keep a congruent envelope of protection and is no longer performing to their original specified purpose.

Each of the discussed damages works together to create a sequential step toward system failure, diminishing the window systems' ability to keep a congruent envelope of protection.

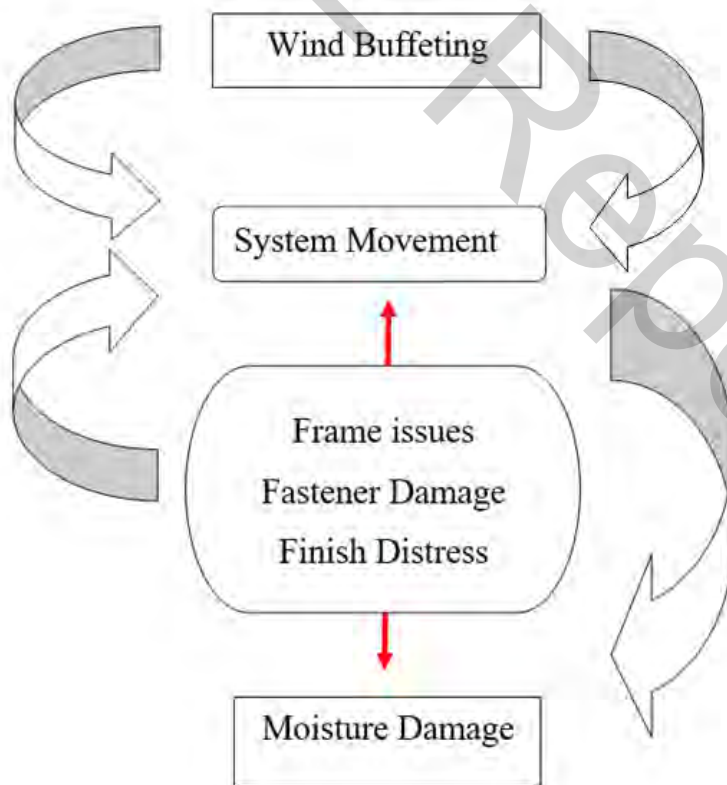

The buffeting force of wind creates window movement which in turn manifest a physical damages profile (frame issues, interior / exterior finish distress and fastener damage.) The System movement and subsequent system damage creates a breach in the glazed envelope, allowing moisture penetration as well as further weakening of the glazed systems within their installed position.

As referenced in the **Conclusion and Recommendations** section of our **XXXXXXXXXXXX Condominium Association Damage Assessment Findings Report dated XXXXXXXX**, If repair is a viable option, an engineer approved protocol of repair would have to be developed taking into

consideration frame removal, internal system evaluation, re-sealing frame corner coping, reinstallation of the frame system to recreate a proper weather-tight exterior primary seal and testing to certify the repairs have been completed and are successful. Replacement of the systems would be necessary if the systems were unable to be adequately repaired as per the engineer approved method or the systems framing components are no longer able to ensure a congruent exterior envelope of protection. Due to this fact, TSSA Storm Safe Inc. concludes that a repair protocol would be difficult and exceedingly costly to perform.

It is TSSA Storm Safe DAC Inc, professional opinion that the glazed systems installed at the XXXXXXXXXXXXXXXXXXXXXXXXXXXX Condominium Association presenting the above listed physical damages need to be replaced. This opinion is based on the fact that our investigation revealed excessive amounts of Primary Seal Damage, System Movement, Assembly system distress, screw spline disruption, and moisture damage.

Repairable Window Systems: Window systems that have not been found to have a combination of the above physical damage profile may be repaired by the execution of an Engineered approved repair protocol.


Repair vs. Replace Analysis:

After careful review of the data collected during our site inspection and performing statistical analysis of the damages witnessed, the following recommendations have been formed, taking into account what specific damages warrant replacement, and what are repairable damages.

System Types Installed	total systems in both buildings	Replace Systems	Repair Systems	New Systems installed	No Damage	Systems Not Inspected
2SGD_106x96	160	110 68.8%	28 17.5%	3	1 2.5%	18 11.3%
2SH_74x60	160	84 52.5%	33 20.6%	1	22 14.4%	20 12.5%
2SH_90x60	280	165 58.9%	40 14.3%	1	27 10.0%	47 16.8%
3SH_110x60	20	17 85.0%	0 0.0%	1	2 15.0%	0 0.0%
4SH_147x60	140	94 67.1%	18 12.9%	1	5 4.3%	22 15.7%
SH_44x60	40	29 72.5%	3 7.5%	2	6 20.0%	0 0.0%


2 panel sliding glass door (106 x 90)

- 160 - Total systems in installed in the campus
- 110 - Replace (68.8%)
- 28 - Repair (17.5%)
- 4 - New Systems, No Damage (2.5%),
- 18 - Systems Not Inspected (11.3%)

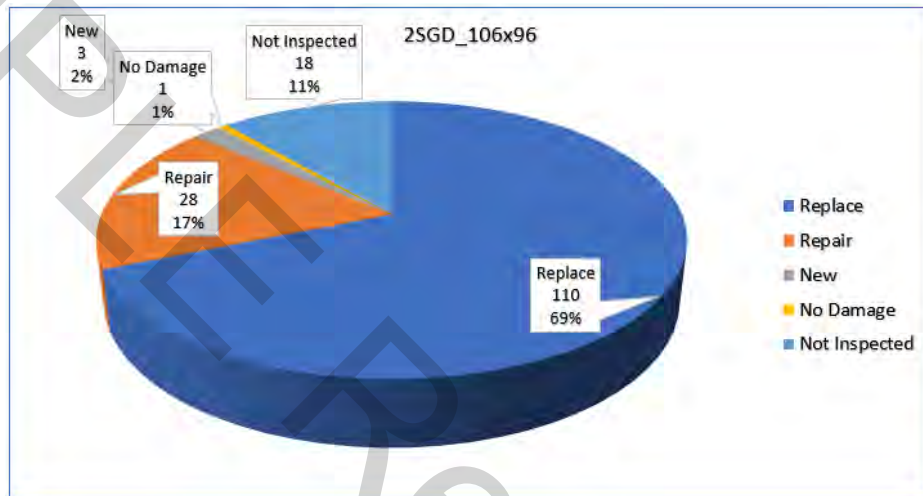


Double Mulled Single Hung Window System (74 x 60)

- 160 - Total systems in installed in the campus
- 84 - Replace (52.5%)
- 33 - Repair (20.6%)
- 23 - New Systems, No Damage (14.4%),
- 20 - Systems Not Inspected (12.5%)

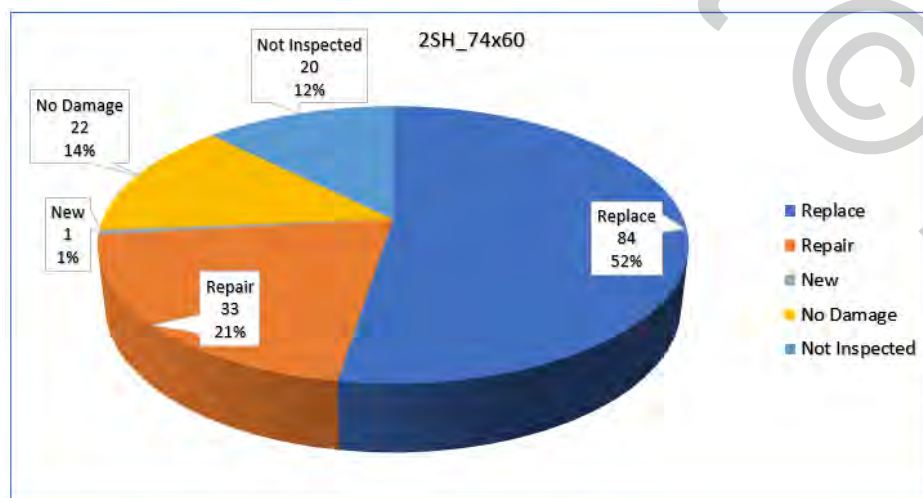


Double Mulled Single Hung Window System (90 x 60)

- 280 - Total systems in installed in the campus
- 165 - Replace (58.9%)
- 40 - Repair (14.3%)
- 28 - New Systems, No Damage (10.0%),
- 47 - Systems Not Inspected (16.8%)

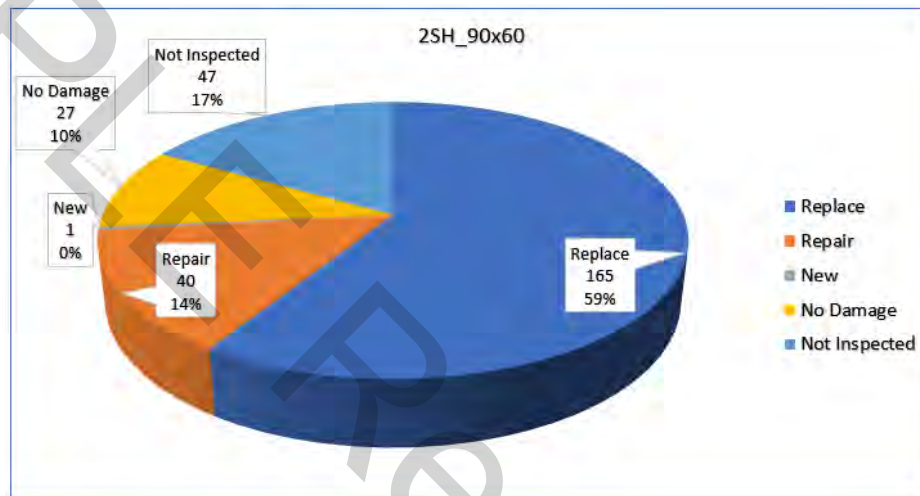


Triple Mulled Single Hung Window System (110 x 60)

- 20 - Total systems in installed in the campus
- 17 - Replace (85.0%)
- 0 - Repair (0.0%)
- 3 - New Systems, No Damage (15.0%),
- 0 - Systems Not Inspected (0.0%)

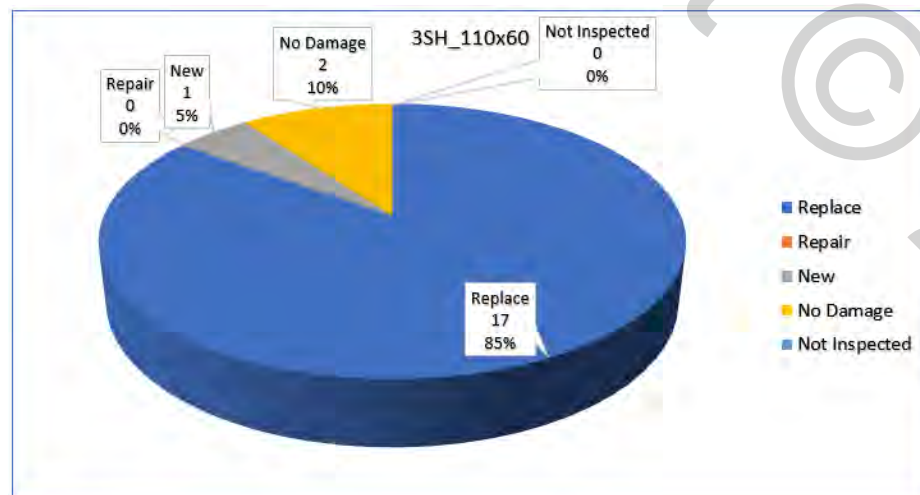


Quad Mulled Single Hung Window System (147 x 60)

- 140 - Total systems in installed in the campus
- 94 - Replace (67.1%)
- 18 - Repair (12.9%)
- 6 - New Systems, No Damage (4.3%),
- 22 - Systems Not Inspected (15.7%)

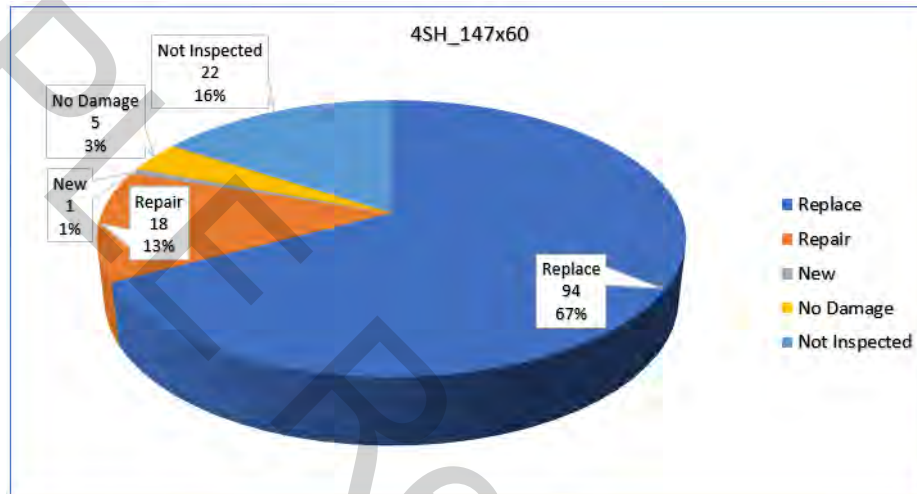

Single Hung Window System (44 x 60)

- 40 - Total systems in installed in the campus
- 29 - Replace (72.5%)
- 3 - Repair (7.5%)
- 8 - New Systems, No Damage (4.3%),
- 0 - Systems Not Inspected (0.0%)

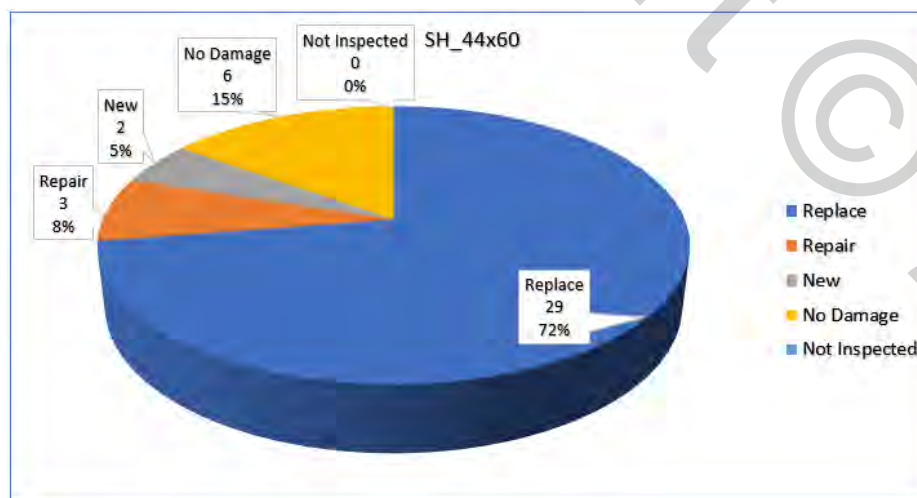

Appendix:

Exhibit A - Replace Specimens – Spreadsheet listing specimens that meet the criteria for replacement as specified in our analysis.

Exhibit B - Repair Specimens – Spreadsheet listing specimens that meet the criteria for repair as specified in our analysis. Note – Repair must be performed as per an engineered approved repair protocol as specified by a licensed professional engineer.

Limitations – The contents of this report are intended for the use of The XXXXXXXXXXXXXXXXXXXXXXXX Condominium Association and its representatives or clients. TSSA Storm Safe DAC Inc. assumes no liability for the misuse of this information by others. The professional opinions and recommendations included within this report are based on the results and interpretations of the non-invasive testing and the data collection activities performed at the site. TSSA Storm Safe DAC Inc. reserves the right to update this report should additional information become available.

As the author of this repair and replace analysis report, the basis for the opinions expressed herein is to a reasonable degree of professional certainty.

TSSA Storm Safe DAC Inc. appreciates this opportunity to have assisted The XXXXXXXXXXXXXXXXXXXXXXXX Condominium Association with this investigation. Please call if you have any questions concerning this information.

Sincerely,

Ivan Browner
President
TSSA Storm Safe DAC Inc.



Exhibit A

REPLACE SYSTEMS

PRJ_NAME	PRJ_BLDG	PRJ_STACK	PRJ_FLOOR	PRJ_UNIT	SPECIMEN	CORNERUNIT	FACING	ROOM	SPECNUM	
XXXXXXXXXX	B	A	Floor 1	1A	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXXXX	B	A	Floor 1	1A	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXXXX	B	A	Floor 1	1A	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	A	Floor 1	1A	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXXXX	B	B	Floor 1	1B	2SH_74X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	B	Floor 1	1B	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXXXX	B	B	Floor 1	1B	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXXXX	B	B	Floor 1	1B	4SH_147X60	N	E	LR	2	REPLACE
XXXXXXXXXX	B	C	Floor 1	1C	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXXXX	B	C	Floor 1	1C	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	C	Floor 1	1C	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXXXX	B	C	Floor 1	1C	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXXXX	B	E	Floor 1	1E	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXXXX	B	F	Floor 1	1F	2SGD_106X96	Y	S	MBR	1	REPLACE
XXXXXXXXXX	B	F	Floor 1	1F	2SH_90X60	Y	N	DR	1	REPLACE
XXXXXXXXXX	B	H	Floor 1	1H	2SGD_106X96	N	E	LR	2	REPLACE
XXXXXXXXXX	B	H	Floor 1	1H	2SH_90X60	N	N	DR	1	REPLACE
XXXXXXXXXX	B	H	Floor 1	1H	4SH_147X60	N	S	LR	1	REPLACE
XXXXXXXXXX	B	J	Floor 1	1J	2SGD_106X96	N	N	LR	1	REPLACE
XXXXXXXXXX	B	J	Floor 1	1J	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXXXX	B	K	Floor 1	1K	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXXXX	B	K	Floor 1	1K	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXXXX	B	L	Floor 1	1L	2SGD_106X96	N	N	LR	1	REPLACE
XXXXXXXXXX	B	L	Floor 1	1L	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXXXX	B	L	Floor 1	1L	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXXXX	B	L	Floor 1	1L	4SH_147X60	N	W	LR	2	REPLACE
XXXXXXXXXX	B	M	Floor 1	1M	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXXXX	B	Q	Floor 1	1Q	2SGD_106X96	N	E	LR	2	REPLACE
XXXXXXXXXX	B	A	Floor 2	2A	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXXXX	B	A	Floor 2	2A	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXXXX	B	A	Floor 2	2A	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	A	Floor 2	2A	4SH_147X60	Y	E	LR	1	REPLACE
XXXXXXXXXX	B	C	Floor 2	2C	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	C	Floor 2	2C	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXXXX	B	D	Floor 2	2D	2SGD_106X96	N	N	LR	1	REPLACE
XXXXXXXXXX	B	D	Floor 2	2D	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXXXX	B	D	Floor 2	2D	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	D	Floor 2	2D	4SH_147X60	N	E	LR	2	REPLACE
XXXXXXXXXX	B	E	Floor 2	2E	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXXXX	B	E	Floor 2	2E	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	G	Floor 2	2G	2SGD_106X96	N	W	LR	1	REPLACE
XXXXXXXXXX	B	G	Floor 2	2G	3SH_110X60	N	S	LR	1	REPLACE
XXXXXXXXXX	B	G	Floor 2	2G	SH_44X60	N	N	DR	1	REPLACE
XXXXXXXXXX	B	H	Floor 2	2H	2SGD_106X96	N	W	LR	2	REPLACE
XXXXXXXXXX	B	H	Floor 2	2H	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXXXX	B	H	Floor 2	2H	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	H	Floor 2	2H	2SH_90X60	N	N	DR	1	REPLACE
XXXXXXXXXX	B	J	Floor 2	2J	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXXXX	B	J	Floor 2	2J	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXXXX	B	L	Floor 2	2L	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXXXX	B	L	Floor 2	2L	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXXXX	B	M	Floor 2	2M	2SGD_106X96	N	N	LR	2	REPLACE
XXXXXXXXXX	B	N	Floor 2	2N	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXXXX	B	N	Floor 2	2N	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXXXX	B	N	Floor 2	2N	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXXXX	B	N	Floor 2	2N	4SH_147X60	N	W	LR	2	REPLACE
XXXXXXXXXX	B	P	Floor 2	2P	2SH_74X60	Y	N	MBR	1	REPLACE

XXXXXXXXXX	B	P	Floor 2	2P	2SH_90X60	Y	S	2BR	1	REPLACE
XXXXXXXXXX	B	P	Floor 2	2P	2SH_90X60	Y	W	3BR	1	REPLACE
XXXXXXXXXX	B	A	Floor 3	3A	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXXXX	B	A	Floor 3	3A	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	B	Floor 3	3B	2SGD_106X96	N	N	LR	1	REPLACE
XXXXXXXXXX	B	B	Floor 3	3B	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXXXX	B	B	Floor 3	3B	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	B	Floor 3	3B	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXXXX	B	B	Floor 3	3B	4SH_147X60	N	E	LR	2	REPLACE
XXXXXXXXXX	B	D	Floor 3	3D	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXXXX	B	E	Floor 3	3E	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXXXX	B	E	Floor 3	3E	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXXXX	B	E	Floor 3	3E	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	E	Floor 3	3E	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXXXX	B	F	Floor 3	3F	2SGD_106X96	Y	E	LR	1	REPLACE
XXXXXXXXXX	B	F	Floor 3	3F	2SH_74X60	N	N	2BR	1	REPLACE
XXXXXXXXXX	B	F	Floor 3	3F	2SH_90X60	Y	S	3BR	1	REPLACE
XXXXXXXXXX	B	F	Floor 3	3F	4SH_147X60	N	S	LR	1	REPLACE
XXXXXXXXXX	B	G	Floor 3	3G	2SGD_106X96	N	W	LR	2	REPLACE
XXXXXXXXXX	B	G	Floor 3	3G	3SH_110X60	N	S	LR	1	REPLACE
XXXXXXXXXX	B	G	Floor 3	3G	SH_44X60	N	N	2BR	1	REPLACE
XXXXXXXXXX	B	G	Floor 3	3G	SH_44X60	N	N	DR	1	REPLACE
XXXXXXXXXX	B	H	Floor 3	3H	2SGD_106X96	N	W	LR	1	REPLACE
XXXXXXXXXX	B	H	Floor 3	3H	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXXXX	B	H	Floor 3	3H	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	H	Floor 3	3H	4SH_147X60	N	S	LR	1	REPLACE
XXXXXXXXXX	B	J	Floor 3	3J	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXXXX	B	J	Floor 3	3J	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXXXX	B	J	Floor 3	3J	2SH_90X60	N	E	3BR	1	REPLACE
XXXXXXXXXX	B	J	Floor 3	3J	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXXXX	B	J	Floor 3	3J	4SH_147X60	N	W	LR	2	REPLACE
XXXXXXXXXX	B	K	Floor 3	3K	2SGD_106X96	N	W	LR	2	REPLACE
XXXXXXXXXX	B	K	Floor 3	3K	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXXXX	B	K	Floor 3	3K	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXXXX	B	N	Floor 3	3N	2SGD_106X96	N	N	LR	1	REPLACE
XXXXXXXXXX	B	N	Floor 3	3N	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXXXX	B	A	Floor 4	4A	2SGD_106X96	N	N	LR	1	REPLACE
XXXXXXXXXX	B	A	Floor 4	4A	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	A	Floor 4	4A	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXXXX	B	D	Floor 4	4D	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXXXX	B	D	Floor 4	4D	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	D	Floor 4	4D	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXXXX	B	D	Floor 4	4D	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXXXX	B	E	Floor 4	4E	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXXXX	B	E	Floor 4	4E	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXXXX	B	E	Floor 4	4E	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXXXX	B	E	Floor 4	4E	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXXXX	B	E	Floor 4	4E	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXXXX	B	F	Floor 4	4F	2SGD_106X96	N	E	LR	1	REPLACE
XXXXXXXXXX	B	F	Floor 4	4F	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXXXX	B	F	Floor 4	4F	2SH_90X60	N	N	2BR	1	REPLACE
XXXXXXXXXX	B	F	Floor 4	4F	2SH_90X60	N	N	DR	1	REPLACE
XXXXXXXXXX	B	F	Floor 4	4F	4SH_147X60	N	S	LR	1	REPLACE
XXXXXXXXXX	B	G	Floor 4	4G	2SGD_106X96	N	W	LR	1	REPLACE
XXXXXXXXXX	B	G	Floor 4	4G	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXXXX	B	G	Floor 4	4G	3SH_110X60	N	S	LR	1	REPLACE
XXXXXXXXXX	B	G	Floor 4	4G	SH_44X60	N	N	2BR	1	REPLACE
XXXXXXXXXX	B	G	Floor 4	4G	SH_44X60	N	N	DR	1	REPLACE

XXXXXXXX	B	H	Floor 4	4H	2SGD_106X96	N	W	LR	2	REPLACE
XXXXXXXX	B	H	Floor 4	4H	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	B	H	Floor 4	4H	2SH_90X60	N	N	3BR	1	REPLACE
XXXXXXXX	B	H	Floor 4	4H	2SH_90X60	N	N	DR	1	REPLACE
XXXXXXXX	B	H	Floor 4	4H	4SH_147X60	N	S	LR	1	REPLACE
XXXXXXXX	B	J	Floor 4	4J	2SGD_106X96	N	N	LR	1	REPLACE
XXXXXXXX	B	J	Floor 4	4J	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	B	J	Floor 4	4J	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	B	L	Floor 4	4L	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	B	L	Floor 4	4L	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	B	L	Floor 4	4L	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	B	M	Floor 4	4M	2SGD_106X96	N	N	LR	2	REPLACE
XXXXXXXX	B	M	Floor 4	4M	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	B	M	Floor 4	4M	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	B	M	Floor 4	4M	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	B	N	Floor 4	4N	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXX	B	N	Floor 4	4N	2SH_74X60	N	E	DR	1	REPLACE
XXXXXXXX	B	N	Floor 4	4N	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	B	P	Floor 4	4P	2SGD_106X96	Y	W	LR	1	REPLACE
XXXXXXXX	B	P	Floor 4	4P	4SH_147X60	Y	N	LR	2	REPLACE
XXXXXXXX	B	Q	Floor 4	4Q	2SGD_106X96	N	E	LR	1	REPLACE
XXXXXXXX	B	Q	Floor 4	4Q	3SH_110X60	N	N	LR	1	REPLACE
XXXXXXXX	B	Q	Floor 4	4Q	SH_44X60	N	S	2BR	1	REPLACE
XXXXXXXX	B	Q	Floor 4	4Q	SH_44X60	N	S	DR	1	REPLACE
XXXXXXXX	B	R	Floor 4	4R	2SGD_106X96	N	E	LR	1	REPLACE
XXXXXXXX	B	R	Floor 4	4R	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	B	R	Floor 4	4R	4SH_147X60	N	N	LR	1	REPLACE
XXXXXXXX	B	B	Floor 5	5B	2SGD_106X96	N	N	LR	1	REPLACE
XXXXXXXX	B	B	Floor 5	5B	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXX	B	C	Floor 5	5C	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXX	B	C	Floor 5	5C	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	B	D	Floor 5	5D	2SGD_106X96	N	N	LR	1	REPLACE
XXXXXXXX	B	E	Floor 5	5E	2SGD_106X96	N	W	2BR	1	REPLACE
XXXXXXXX	B	E	Floor 5	5E	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXX	B	E	Floor 5	5E	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	B	E	Floor 5	5E	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXX	B	G	Floor 5	5G	2SGD_106X96	N	W	LR	1	REPLACE
XXXXXXXX	B	G	Floor 5	5G	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXX	B	G	Floor 5	5G	3SH_110X60	N	S	LR	1	REPLACE
XXXXXXXX	B	G	Floor 5	5G	SH_44X60	N	N	2BR	1	REPLACE
XXXXXXXX	B	H	Floor 5	5H	2SGD_106X96	N	W	LR	2	REPLACE
XXXXXXXX	B	H	Floor 5	5H	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXX	B	H	Floor 5	5H	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	B	G	Floor 5	5H	2SH_90X60	Y	N	DR	1	REPLACE
XXXXXXXX	B	H	Floor 5	5H	4SH_147X60	N	S	LR	1	REPLACE
XXXXXXXX	B	J	Floor 5	5J	2SGD_106X96	N	N	LR	1	REPLACE
XXXXXXXX	B	J	Floor 5	5J	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	B	K	Floor 5	5K	2SGD_106X96	N	N	LR	1	REPLACE
XXXXXXXX	B	K	Floor 5	5K	2SH_74X60	N	E	DR	1	REPLACE
XXXXXXXX	B	K	Floor 5	5K	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	B	L	Floor 5	5L	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXX	B	L	Floor 5	5L	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	B	L	Floor 5	5L	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	B	L	Floor 5	5L	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	B	L	Floor 5	5L	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	B	M	Floor 5	5M	2SGD_106X96	N	N	LR	2	REPLACE
XXXXXXXX	B	M	Floor 5	5M	2SH_74X60	N	E	2BR	1	REPLACE
XXXXXXXX	B	N	Floor 5	5N	2SGD_106X96	N	S	LR	2	REPLACE

XXXXXXXX	B	N	Floor 5	5N	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	B	N	Floor 5	5N	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	B	N	Floor 5	5N	SH_44X60	N	E	2BR	1	REPLACE
XXXXXXXX	B	Q	Floor 5	5Q	2SH_74X60	N	N	MBR	1	REPLACE
XXXXXXXX	B	Q	Floor 5	5Q	3SH_110X60	N	N	LR	1	REPLACE
XXXXXXXX	B	Q	Floor 5	5Q	SH_44X60	N	S	2BR	1	REPLACE
XXXXXXXX	B	Q	Floor 5	5Q	SH_44X60	N	S	DR	1	REPLACE
XXXXXXXX	A	A	Floor 1	A-1A	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXX	A	A	Floor 1	A-1A	2SH_74X60	N	E	MBR	2	REPLACE
XXXXXXXX	A	A	Floor 1	A-1A	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	A	Floor 1	A-1A	4SH_147X60	N	E	LR	2	REPLACE
XXXXXXXX	A	A	Floor 1	A-1B	2SGD_106X96	N	N	LR	2	REPLACE
XXXXXXXX	A	A	Floor 1	A-1B	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXX	A	A	Floor 1	A-1B	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	A	Floor 1	A-1C	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXX	A	A	Floor 1	A-1C	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	A	Floor 1	A-1C	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	A	Floor 1	A-1C	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXX	A	F	Floor 1	A-1F	2SGD_106X96	N	E	LR	1	REPLACE
XXXXXXXX	A	A	Floor 1	A-1G	2SGD_106X96	N	W	LR	2	REPLACE
XXXXXXXX	A	A	Floor 1	A-1G	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXX	A	A	Floor 1	A-1G	3SH_110X60	N	S	LR	1	REPLACE
XXXXXXXX	A	H	Floor 1	A-1H	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXX	A	H	Floor 1	A-1H	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	H	Floor 1	A-1H	2SH_90X60	N	N	DR	1	REPLACE
XXXXXXXX	A	H	Floor 1	A-1H	4SH_147X60	N	S	LR	1	REPLACE
XXXXXXXX	A	K	Floor 1	A-1K	2SGD_106X96	N	N	LR	2	REPLACE
XXXXXXXX	A	K	Floor 1	A-1K	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	K	Floor 1	A-1K	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	K	Floor 1	A-1K	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	A	K	Floor 1	A-1K	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	L	Floor 1	A-1L	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	L	Floor 1	A-1L	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	L	Floor 1	A-1L	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	L	Floor 1	A-1L	4SH_147X60	N	E	LR	2	REPLACE
XXXXXXXX	A	M	Floor 1	A-1M	2SGD_106X96	N	N	LR	2	REPLACE
XXXXXXXX	A	M	Floor 1	A-1M	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	M	Floor 1	A-1M	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	A	M	Floor 1	A-1M	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	N	Floor 1	A-1N	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXX	A	P	Floor 1	A-1P	2SGD_106X96	N	W	LR	1	REPLACE
XXXXXXXX	A	P	Floor 1	A-1P	2SH_90X60	N	S	DR	1	REPLACE
XXXXXXXX	A	P	Floor 1	A-1P	4SH_147X60	N	N	LR	2	REPLACE
XXXXXXXX	A	Q	Floor 1	A-1Q	2SGD_106X96	N	E	LR	2	REPLACE
XXXXXXXX	A	Q	Floor 1	A-1Q	3SH_110X60	N	N	LR	1	REPLACE
XXXXXXXX	A	Q	Floor 1	A-1Q	SH_44X60	N	S	2BR	1	REPLACE
XXXXXXXX	A	Q	Floor 1	A-1Q	SH_44X60	N	S	DR	1	REPLACE
XXXXXXXX	A	R	Floor 1	A-1R	2SGD_106X96	N	E	LR	2	REPLACE
XXXXXXXX	A	R	Floor 1	A-1R	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	A	Floor 2	A-2A	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXX	A	A	Floor 2	A-2A	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	A	Floor 2	A-2A	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXX	A	B	Floor 2	A-2B	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	B	Floor 2	A-2B	4SH_147X60	N	E	LR	2	REPLACE
XXXXXXXX	A	C	Floor 2	A-2C	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXX	A	C	Floor 2	A-2C	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	C	Floor 2	A-2C	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	D	Floor 2	A-2D	2SGD_106X96	N	N	LR	1	REPLACE

XXXXXXXX	A	D	Floor 2	A-2D	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	D	Floor 2	A-2D	4SH_147X60	N	E	LR	2	REPLACE
XXXXXXXX	A	E	Floor 2	A-2E	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXX	A	E	Floor 2	A-2E	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	E	Floor 2	A-2E	2SH_74X60	N	W	DR	1	REPLACE
XXXXXXXX	A	F	Floor 2	A-2F	2SGD_106X96	N	E	LR	2	REPLACE
XXXXXXXX	A	F	Floor 2	A-2F	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXX	A	F	Floor 2	A-2F	2SH_90X60	N	N	2BR	1	REPLACE
XXXXXXXX	A	F	Floor 2	A-2F	2SH_90X60	N	N	DR	1	REPLACE
XXXXXXXX	A	F	Floor 2	A-2F	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	G	Floor 2	A-2G	2SGD_106X96	N	W	LR	2	REPLACE
XXXXXXXX	A	G	Floor 2	A-2G	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXX	A	G	Floor 2	A-2G	3SH_110X60	N	S	LR	1	REPLACE
XXXXXXXX	A	H	Floor 2	A-2H	2SGD_106X96	N	W	LR	1	REPLACE
XXXXXXXX	A	H	Floor 2	A-2H	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	H	Floor 2	A-2H	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	H	Floor 2	A-2H	2SH_90X60	N	N	DR	1	REPLACE
XXXXXXXX	A	H	Floor 2	A-2H	4SH_147X60	N	S	LR	2	REPLACE
XXXXXXXX	A	J	Floor 2	A-2J	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXX	A	J	Floor 2	A-2J	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	J	Floor 2	A-2J	2SH_90X60	N	E	2BDR	1	REPLACE
XXXXXXXX	A	J	Floor 2	A-2J	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	A	J	Floor 2	A-2J	4SH_147X60	N	N	LR	1	REPLACE
XXXXXXXX	A	K	Floor 2	A-2K	2SGD_106X96	N	N	LR	1	REPLACE
XXXXXXXX	A	K	Floor 2	A-2K	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	K	Floor 2	A-2K	2SH_90X60	N	E	2BDR	1	REPLACE
XXXXXXXX	A	K	Floor 2	A-2K	4SH_147X60	N	W	LR	2	REPLACE
XXXXXXXX	A	L	Floor 2	A-2L	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXX	A	L	Floor 2	A-2L	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	L	Floor 2	A-2L	4SH_147X60	N	W	LR	2	REPLACE
XXXXXXXX	A	M	Floor 2	A-2M	2SGD_106X96	N	W	LR	2	REPLACE
XXXXXXXX	A	M	Floor 2	A-2M	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	M	Floor 2	A-2M	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	M	Floor 2	A-2M	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	A	M	Floor 2	A-2M	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	N	Floor 2	A-2N	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	N	Floor 2	A-2N	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	P	Floor 2	A-2P	2SGD_106X96	N	W	LR	2	REPLACE
XXXXXXXX	A	P	Floor 2	A-2P	2SH_74X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	P	Floor 2	A-2P	2SH_74X60	N	N	MBR	1	REPLACE
XXXXXXXX	A	P	Floor 2	A-2P	2SH_90X60	N	S	3BR	1	REPLACE
XXXXXXXX	A	P	Floor 2	A-2P	2SH_90X60	N	S	DR	1	REPLACE
XXXXXXXX	A	P	Floor 2	A-2P	4SH_147X60	N	N	LR	1	REPLACE
XXXXXXXX	A	Q	Floor 2	A-2Q	2SGD_106X96	N	E	LR	2	REPLACE
XXXXXXXX	A	Q	Floor 2	A-2Q	3SH_110X60	N	N	LR	1	REPLACE
XXXXXXXX	A	Q	Floor 2	A-2Q	SH_44X60	N	S	2BR	1	REPLACE
XXXXXXXX	A	Q	Floor 2	A-2Q	SH_44X60	N	S	DR	1	REPLACE
XXXXXXXX	A	R	Floor 2	A-2R	2SGD_106X96	N	E	LR	2	REPLACE
XXXXXXXX	A	R	Floor 2	A-2R	2SH_74X60	N	N	MBR	1	REPLACE
XXXXXXXX	A	R	Floor 2	A-2R	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	R	Floor 2	A-2R	2SH_90X60	N	S	DR	1	REPLACE
XXXXXXXX	A	R	Floor 2	A-2R	4SH_147X60	N	N	LR	1	REPLACE
XXXXXXXX	A	R	Floor 2	A-2R	SH_44X60	N	S	3BR	1	REPLACE
XXXXXXXX	A	A	Floor 3	A-3A	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXX	A	A	Floor 3	A-3A	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXX	A	A	Floor 3	A-3A	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	A	Floor 3	A-3A	4SH_147X60	N	E	LR	2	REPLACE
XXXXXXXX	A	B	Floor 3	A-3B	2SGD_106X96	N	E	MBR	1	REPLACE

XXXXXXXX	A	C	Floor 3	A-3C	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXX	A	C	Floor 3	A-3C	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXX	A	C	Floor 3	A-3C	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	C	Floor 3	A-3C	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXX	A	D	Floor 3	A-3D	2SGD_106X96	N	E	LR	2	REPLACE
XXXXXXXX	A	D	Floor 3	A-3D	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	D	Floor 3	A-3D	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	A	D	Floor 3	A-3D	4SH_147X60	N	E	LR	2	REPLACE
XXXXXXXX	A	E	Floor 3	A-3E	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXX	A	E	Floor 3	A-3E	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXX	A	E	Floor 3	A-3E	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	E	Floor 3	A-3E	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	E	Floor 3	A-3E	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXX	A	F	Floor 3	A-3F	2SGD_106X96	N	S	MBR	1	REPLACE
XXXXXXXX	A	F	Floor 3	A-3F	2SH_90X60	N	N	DR	1	REPLACE
XXXXXXXX	A	F	Floor 3	A-3F	4SH_147X60	N	S	LR	2	REPLACE
XXXXXXXX	A	G	Floor 3	A-3G	3SH_110X60	N	S	LR	1	REPLACE
XXXXXXXX	A	G	Floor 3	A-3G	SH_44X60	N	N	2BR	1	REPLACE
XXXXXXXX	A	G	Floor 3	A-3G	SH_44X60	N	N	DR	1	REPLACE
XXXXXXXX	A	H	Floor 3	A-3H	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXX	A	K	Floor 3	A-3K	2SH_74X60	N	N	MBR	1	REPLACE
XXXXXXXX	A	K	Floor 3	A-3K	2SH_90X60	N	S	2BR	1	REPLACE
XXXXXXXX	A	K	Floor 3	A-3K	2SH_90X60	N	S	DR	1	REPLACE
XXXXXXXX	A	K	Floor 3	A-3K	4SH_147X60	N	N	LR	1	REPLACE
XXXXXXXX	A	L	Floor 3	A-3L	2SGD_106X96	N	W	LR	2	REPLACE
XXXXXXXX	A	L	Floor 3	A-3L	2SH_74X60	N	W	NBR	1	REPLACE
XXXXXXXX	A	L	Floor 3	A-3L	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	L	Floor 3	A-3L	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	A	L	Floor 3	A-3L	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	M	Floor 3	A-3M	2SGD_106X96	N	N	LR	1	REPLACE
XXXXXXXX	A	M	Floor 3	A-3M	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	M	Floor 3	A-3M	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	M	Floor 3	A-3M	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	A	M	Floor 3	A-3M	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	N	Floor 3	A-3N	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXX	A	N	Floor 3	A-3N	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	N	Floor 3	A-3N	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	N	Floor 3	A-3N	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	P	Floor 3	A-3P	2SGD_106X96	N	W	LR	1	REPLACE
XXXXXXXX	A	P	Floor 3	A-3P	2SH_74X60	N	N	MBR	1	REPLACE
XXXXXXXX	A	P	Floor 3	A-3P	2SH_90X60	N	N	2BR	1	REPLACE
XXXXXXXX	A	P	Floor 3	A-3P	4SH_147X60	N	N	LR	2	REPLACE
XXXXXXXX	A	Q	Floor 3	A-3Q	2SGD_106X96	N	E	LR	2	REPLACE
XXXXXXXX	A	Q	Floor 3	A-3Q	2SH_74X60	N	N	MBR	1	REPLACE
XXXXXXXX	A	Q	Floor 3	A-3Q	3SH_110X60	N	N	LR	1	REPLACE
XXXXXXXX	A	Q	Floor 3	A-3Q	SH_44X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	Q	Floor 3	A-3Q	SH_44X60	N	S	DR	1	REPLACE
XXXXXXXX	A	A	Floor 4	A-4A	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXX	A	A	Floor 4	A-4A	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	A	Floor 4	A-4A	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	A	Floor 4	A-4A	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXX	A	B	Floor 4	A-4B	2SGD_106X96	N	E	LR	1	REPLACE
XXXXXXXX	A	B	Floor 4	A-4B	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXX	A	B	Floor 4	A-4B	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	B	Floor 4	A-4B	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	B	Floor 4	A-4B	4SH_147X60	N	E	LR	2	REPLACE
XXXXXXXX	A	C	Floor 4	A-4C	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	D	Floor 4	A-4D	2SGD_106X96	N	E	MBR	1	REPLACE

XXXXXXXX	A	D	Floor 4	A-4D	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	D	Floor 4	A-4D	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	D	Floor 4	A-4D	4SH_147X60	N	E	LR	2	REPLACE
XXXXXXXX	A	E	Floor 4	A-4E	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXX	A	E	Floor 4	A-4E	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXX	A	E	Floor 4	A-4E	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	E	Floor 4	A-4E	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	E	Floor 4	A-4E	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXX	A	F	Floor 4	A-4F	2SGD_106X96	N	E	LR	2	REPLACE
XXXXXXXX	A	F	Floor 4	A-4F	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXX	A	F	Floor 4	A-4F	4SH_147X60	N	S	LR	1	REPLACE
XXXXXXXX	A	F	Floor 4	A-4F	SH_44X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	G	Floor 4	A-4G	3SH_110X60	N	S	LR	1	REPLACE
XXXXXXXX	A	H	Floor 4	A-4H	2SGD_106X96	N	W	LR	1	REPLACE
XXXXXXXX	A	H	Floor 4	A-4H	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXX	A	H	Floor 4	A-4H	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	H	Floor 4	A-4H	2SH_90X60	N	N	DR	1	REPLACE
XXXXXXXX	A	H	Floor 4	A-4H	4SH_147X60	N	S	LR	2	REPLACE
XXXXXXXX	A	J	Floor 4	A-4J	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXX	A	J	Floor 4	A-4J	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	J	Floor 4	A-4J	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	J	Floor 4	A-4J	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	A	J	Floor 4	A-4J	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	K	Floor 4	A-4K	2SGD_106X96	N	W	LR	1	REPLACE
XXXXXXXX	A	K	Floor 4	A-4K	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	K	Floor 4	A-4K	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	K	Floor 4	A-4K	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	A	K	Floor 4	A-4K	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	L	Floor 4	A-4L	2SH_74X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	L	Floor 4	A-4L	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	A	L	Floor 4	A-4L	2SH_90X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	L	Floor 4	A-4L	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	M	Floor 4	A-4M	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	M	Floor 4	A-4M	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	M	Floor 4	A-4M	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	N	Floor 4	A-4N	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXX	A	N	Floor 4	A-4N	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	N	Floor 4	A-4N	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	N	Floor 4	A-4N	4SH_147X60	N	W	LR	2	REPLACE
XXXXXXXX	A	P	Floor 4	A-4P	2SGD_106X96	N	W	LR	2	REPLACE
XXXXXXXX	A	P	Floor 4	A-4P	2SH_74X60	N	N	MBR	1	REPLACE
XXXXXXXX	A	P	Floor 4	A-4P	2SH_90X60	N	S	2BR	1	REPLACE
XXXXXXXX	A	P	Floor 4	A-4P	2SH_90X60	N	S	DR	1	REPLACE
XXXXXXXX	A	P	Floor 4	A-4P	4SH_147X60	N	N	LR	1	REPLACE
XXXXXXXX	A	Q	Floor 4	A-4Q	2SGD_106X96	N	E	LR	2	REPLACE
XXXXXXXX	A	Q	Floor 4	A-4Q	2SH_74X60	N	N	MBA	1	REPLACE
XXXXXXXX	A	Q	Floor 4	A-4Q	3SH_110X60	N	N	LR	1	REPLACE
XXXXXXXX	A	Q	Floor 4	A-4Q	SH_44X60	N	S	2BR	1	REPLACE
XXXXXXXX	A	Q	Floor 4	A-4Q	SH_44X60	N	S	DR	1	REPLACE
XXXXXXXX	A	R	Floor 4	A-4R	2SGD_106X96	N	E	LR	1	REPLACE
XXXXXXXX	A	R	Floor 4	A-4R	2SH_74X60	N	N	MBR	1	REPLACE
XXXXXXXX	A	R	Floor 4	A-4R	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	R	Floor 4	A-4R	2SH_90X60	N	S	DR	1	REPLACE
XXXXXXXX	A	R	Floor 4	A-4R	4SH_147X60	N	N	LR	2	REPLACE
XXXXXXXX	A	A	Floor 5	A-5A	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXX	A	A	Floor 5	A-5A	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXX	A	A	Floor 5	A-5A	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	A	Floor 5	A-5A	4SH_147X60	N	E	LR	1	REPLACE

XXXXXXXX	A	B	Floor 5	A-5B	2SGD_106X96	N	E	LR	1	REPLACE
XXXXXXXX	A	B	Floor 5	A-5B	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXX	A	B	Floor 5	A-5B	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	B	Floor 5	A-5B	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	B	Floor 5	A-5B	4SH_147X60	N	E	LR	2	REPLACE
XXXXXXXX	A	C	Floor 5	A-5C	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXX	A	C	Floor 5	A-5C	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	C	Floor 5	A-5C	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	C	Floor 5	A-5C	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXX	A	D	Floor 5	A-5D	2SGD_106X96	N	N	LR	1	REPLACE
XXXXXXXX	A	D	Floor 5	A-5D	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXX	A	D	Floor 5	A-5D	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	D	Floor 5	A-5D	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	D	Floor 5	A-5D	4SH_147X60	N	E	LR	2	REPLACE
XXXXXXXX	A	E	Floor 5	A-5E	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXX	A	E	Floor 5	A-5E	2SH_74X60	N	E	MBR	1	REPLACE
XXXXXXXX	A	E	Floor 5	A-5E	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	E	Floor 5	A-5E	2SH_90X60	N	W	DR	1	REPLACE
XXXXXXXX	A	E	Floor 5	A-5E	4SH_147X60	N	E	LR	1	REPLACE
XXXXXXXX	A	F	Floor 5	A-5F	2SGD_106X96	N	E	LR	1	REPLACE
XXXXXXXX	A	G	Floor 5	A-5G	2SGD_106X96	N	W	LR	2	REPLACE
XXXXXXXX	A	G	Floor 5	A-5G	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXX	A	G	Floor 5	A-5G	3SH_110X60	N	S	LR	1	REPLACE
XXXXXXXX	A	G	Floor 5	A-5G	SH_44X60	N	N	2BR	1	REPLACE
XXXXXXXX	A	G	Floor 5	A-5G	SH_44X60	N	N	DR	1	REPLACE
XXXXXXXX	A	H	Floor 5	A-5H	2SGD_106X96	N	S	LR	1	REPLACE
XXXXXXXX	A	H	Floor 5	A-5H	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXX	A	H	Floor 5	A-5H	2SH_90X60	N	W	2BR	1	REPLACE
XXXXXXXX	A	H	Floor 5	A-5H	2SH_90X60	N	N	DR	1	REPLACE
XXXXXXXX	A	H	Floor 5	A-5H	4SH_147X60	N	E	LR	2	REPLACE
XXXXXXXX	A	H	Floor 5	A-5H	SH_44X60	N	N	3BR	1	REPLACE
XXXXXXXX	A	J	Floor 5	A-5J	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXX	A	J	Floor 5	A-5J	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	J	Floor 5	A-5J	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	A	J	Floor 5	A-5J	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	L	Floor 5	A-5L	2SGD_106X96	N	S	LR	2	REPLACE
XXXXXXXX	A	L	Floor 5	A-5L	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	L	Floor 5	A-5L	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	L	Floor 5	A-5L	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	A	L	Floor 5	A-5L	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	M	Floor 5	A-5M	2SGD_106X96	N	N	LR	2	REPLACE
XXXXXXXX	A	M	Floor 5	A-5M	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	M	Floor 5	A-5M	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	M	Floor 5	A-5M	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	A	M	Floor 5	A-5M	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	N	Floor 5	A-5N	2SH_74X60	N	W	MBR	1	REPLACE
XXXXXXXX	A	N	Floor 5	A-5N	2SH_90X60	N	E	2BR	1	REPLACE
XXXXXXXX	A	N	Floor 5	A-5N	2SH_90X60	N	E	DR	1	REPLACE
XXXXXXXX	A	N	Floor 5	A-5N	4SH_147X60	N	W	LR	1	REPLACE
XXXXXXXX	A	P	Floor 5	A-5P	2SGD_106X96	N	W	LR	2	REPLACE
XXXXXXXX	A	P	Floor 5	A-5P	2SH_74X60	N	N	MBR	1	REPLACE
XXXXXXXX	A	P	Floor 5	A-5P	2SH_90X60	N	S	3BR	1	REPLACE
XXXXXXXX	A	P	Floor 5	A-5P	2SH_90X60	N	S	DR	1	REPLACE
XXXXXXXX	A	P	Floor 5	A-5P	4SH_147X60	N	N	LR	1	REPLACE
XXXXXXXX	A	P	Floor 5	A-5P	SH_44X60	N	E	2BDR	1	REPLACE
XXXXXXXX	A	Q	Floor 5	A-5Q	2SH_74X60	N	S	MBR	1	REPLACE
XXXXXXXX	A	Q	Floor 5	A-5Q	3SH_110X60	N	N	LR	1	REPLACE
XXXXXXXX	A	Q	Floor 5	A-5Q	SH_44X60	N	N	2BR	1	REPLACE

XXXXXXXXXX	A	Q	Floor 5	A-5Q	SH_44X60	N	S	DR	1	REPLACE
XXXXXXXXXX	A	R	Floor 5	A-5R	2SGD_106X96	N	E	LR	2	REPLACE
XXXXXXXXXX	A	R	Floor 5	A-5R	2SH_74X60	N	S	2BR	1	REPLACE
XXXXXXXXXX	A	R	Floor 5	A-5R	2SH_74X60	N	N	MBR	1	REPLACE
XXXXXXXXXX	A	R	Floor 5	A-5R	2SH_90X60	N	S	3BR	1	REPLACE
XXXXXXXXXX	A	R	Floor 5	A-5R	2SH_90X60	N	S	DR	1	REPLACE
XXXXXXXXXX	A	R	Floor 5	A-5R	4SH_147X60	N	N	LR	1	REPLACE
XXXXXXXXXX	B	B	Floor 2	B-2F	2SH_74X60	Y	S	MBR	1	REPLACE
XXXXXXXXXX	B	B	Floor 2	B-2F	2SH_90X60	Y	N	2BR	1	REPLACE
XXXXXXXXXX	B	B	Floor 2	B-2F	2SH_90X60	N	N	DR	1	REPLACE
XXXXXXXXXX	B	B	Floor 2	B-2F	4SH_147X60	Y	S	LR	2	REPLACE
XXXXXXXXXX	B	Q	Floor 2	B-2Q	3SH_110X60	Y	N	LR	1	REPLACE
XXXXXXXXXX	B	B	Floor 4	B-4B	2SGD_106X96	Y	N	LR	1	REPLACE
XXXXXXXXXX	B	B	Floor 4	B-4B	2SH_74X60	Y	E	MBR	1	REPLACE
XXXXXXXXXX	B	B	Floor 4	B-4B	2SH_90X60	Y	W	2BR	1	REPLACE
XXXXXXXXXX	B	B	Floor 4	B-4B	2SH_90X60	Y	W	DR	1	REPLACE
XXXXXXXXXX	B	B	Floor 4	B-4B	4SH_147X60	Y	E	LR	2	REPLACE
XXXXXXXXXX	B	B	Floor 4	B-4C	2SGD_106X96	Y	S	LR	2	REPLACE
XXXXXXXXXX	B	B	Floor 4	B-4C	2SH_90X60	Y	W	2BR	1	REPLACE
XXXXXXXXXX	B	B	Floor 4	B-4C	2SH_90X60	Y	W	DR	1	REPLACE
XXXXXXXXXX	B	B	Floor 4	B-4C	4SH_147X60	Y	E	LR	1	REPLACE
XXXXXXXXXX	B	B	Floor 5	B-5R	2SGD_106X96	Y	E	LR	2	REPLACE
XXXXXXXXXX	B	B	Floor 5	B-5R	2SH_74X60	N	N	MBR	1	REPLACE
XXXXXXXXXX	B	B	Floor 5	B-5R	2SH_90X60	Y	S	2BR	1	REPLACE
XXXXXXXXXX	B	B	Floor 5	B-5R	2SH_90X60	Y	S	DR	1	REPLACE



Exhibit B

REPAIR SYSTEMS

PRJ_NAME	PRJ_BLDG	PRJ_STACK	PRJ_FLOOR	PRJ_UNIT	SPECIMEN	CORNERUNIT	FACING	ROOM	SPECNUM	
XXXXXXXXXX	B	B	Floor 1	1B	2SGD_106X96	N	N	LR	1	Repair
XXXXXXXXXX	B	C	Floor 1	1C	2SH_74X60	N	E	MBR	1	Repair
XXXXXXXXXX	B	E	Floor 1	1E	2SGD_106X96	N	S	LR	2	Repair
XXXXXXXXXX	B	F	Floor 1	1F	2SGD_106X96	Y	E	LR	1	Repair
XXXXXXXXXX	B	F	Floor 1	1F	2SH_90X60	Y	W	2BR	1	Repair
XXXXXXXXXX	B	F	Floor 1	1F	4SH_147X60	Y	S	LR	2	Repair
XXXXXXXXXX	B	J	Floor 1	1J	2SH_74X60	N	W	MBR	1	Repair
XXXXXXXXXX	B	J	Floor 1	1J	2SH_90X60	N	E	DR	1	Repair
XXXXXXXXXX	B	K	Floor 1	1K	2SH_90X60	N	E	DR	1	Repair
XXXXXXXXXX	B	L	Floor 1	1L	2SH_90X60	N	E	2BR	1	Repair
XXXXXXXXXX	B	M	Floor 1	1M	2SH_74X60	N	W	MBR	1	Repair
XXXXXXXXXX	B	M	Floor 1	1M	4SH_147X60	N	W	LR	1	Repair
XXXXXXXXXX	B	Q	Floor 1	1Q	2SH_74X60	N	N	MBR	1	Repair
XXXXXXXXXX	B	C	Floor 2	2C	2SGD_106X96	N	S	LR	2	Repair
XXXXXXXXXX	B	C	Floor 2	2C	2SH_74X60	N	E	MBR	1	Repair
XXXXXXXXXX	B	C	Floor 2	2C	4SH_147X60	N	E	LR	1	Repair
XXXXXXXXXX	B	D	Floor 2	2D	2SH_90X60	N	W	DR	1	Repair
XXXXXXXXXX	B	E	Floor 2	2E	2SH_74X60	N	E	MBR	1	Repair
XXXXXXXXXX	B	E	Floor 2	2E	2SH_90X60	N	W	DR	1	Repair
XXXXXXXXXX	B	E	Floor 2	2E	4SH_147X60	N	E	LR	1	Repair
XXXXXXXXXX	B	H	Floor 2	2H	2SH_90X60	N	N	2BR	1	Repair
XXXXXXXXXX	B	H	Floor 2	2H	4SH_147X60	N	S	LR	1	Repair
XXXXXXXXXX	B	K	Floor 2	2K	2SGD_106X96	N	N	LR	2	Repair
XXXXXXXXXX	B	M	Floor 2	2M	2SH_90X60	N	E	2BR	1	Repair
XXXXXXXXXX	B	P	Floor 2	2P	2SGD_106X96	Y	W	LR	1	Repair
XXXXXXXXXX	B	P	Floor 2	2P	2SH_90X60	Y	S	DR	1	Repair
XXXXXXXXXX	B	A	Floor 3	3A	4SH_147X60	N	E	LR	1	Repair
XXXXXXXXXX	B	D	Floor 3	3D	2SGD_106X96	N	N	LR	1	Repair
XXXXXXXXXX	B	D	Floor 3	3D	2SH_74X60	N	E	MBR	1	Repair
XXXXXXXXXX	B	D	Floor 3	3D	2SH_90X60	N	W	2BR	1	Repair
XXXXXXXXXX	B	D	Floor 3	3D	4SH_147X60	N	E	LR	2	Repair
XXXXXXXXXX	B	E	Floor 3	3E	2SH_90X60	N	W	DR	1	Repair
XXXXXXXXXX	B	F	Floor 3	3F	2SH_90X60	Y	N	DR	1	Repair
XXXXXXXXXX	B	G	Floor 3	3H	2SH_74X60	N	N	DR	1	Repair
XXXXXXXXXX	B	K	Floor 3	3K	2SH_74X60	N	E	2BR		Repair
XXXXXXXXXX	B	K	Floor 3	3K	2SH_74X60	N	W	MBA	1	Repair
XXXXXXXXXX	B	N	Floor 3	3N	2SH_74X60	N	W	MBR	1	Repair
XXXXXXXXXX	B	N	Floor 3	3N	2SH_90X60	N	E	DR	1	Repair
XXXXXXXXXX	B	N	Floor 3	3N	4SH_147X60	N	W	LR	1	Repair
XXXXXXXXXX	B	D	Floor 4	4D	2SGD_106X96	N	N	LR	1	Repair
XXXXXXXXXX	B	H	Floor 4	4H	2SH_74X60	N	S	MBR	1	Repair
XXXXXXXXXX	B	J	Floor 4	4J	2SH_90X60	N	E	DR	1	Repair
XXXXXXXXXX	B	L	Floor 4	4L	2SGD_106X96	N	S	LR	2	Repair
XXXXXXXXXX	B	L	Floor 4	4L	2SH_74X60	N	W	MBR	1	Repair
XXXXXXXXXX	B	N	Floor 4	4N	2SH_74X60	N	W	MBR	1	Repair
XXXXXXXXXX	B	N	Floor 4	4N	2SH_90X60	N	E	2BR	1	Repair
XXXXXXXXXX	B	P	Floor 4	4P	2SH_74X60	Y	E	MBR	1	Repair
XXXXXXXXXX	B	P	Floor 4	4P	2SH_90X60	Y	E	3BR	1	Repair
XXXXXXXXXX	B	P	Floor 4	4P	2SH_90X60	Y	S	DR	1	Repair
XXXXXXXXXX	B	R	Floor 4	4R	2SH_74X60	N	N	MBR	1	Repair
XXXXXXXXXX	B	B	Floor 5	5B	2SH_74X60	N	E	MBR	1	Repair
XXXXXXXXXX	B	D	Floor 5	5D	2SH_90X60	N	W	2BR	1	Repair
XXXXXXXXXX	B	D	Floor 5	5D	2SH_90X60	N	W	DR	1	Repair
XXXXXXXXXX	B	E	Floor 5	5E	2SGD_106X96	N	S	LR	2	Repair
XXXXXXXXXX	B	G	Floor 5	5G	SH_44X60	N	N	DR	1	Repair
XXXXXXXXXX	B	H	Floor 5	5H	2SH_90X60	N	N	3BR	2	Repair
XXXXXXXXXX	B	J	Floor 5	5J	2SH_74X60	N	W	MBR	1	Repair

XXXXXXXX	B	J	Floor 5	5J	2SH_90X60	N	E	2BR	1	Repair
XXXXXXXX	B	J	Floor 5	5J	4SH_147X60	N	W	LR	2	Repair
XXXXXXXX	B	K	Floor 5	5K	2SH_90X60	N	E	2BR	1	Repair
XXXXXXXX	B	M	Floor 5	5M	2SH_74X60	N	W	MBR	1	Repair
XXXXXXXX	B	M	Floor 5	5M	2SH_90X60	N	E	DR	1	Repair
XXXXXXXX	B	M	Floor 5	5M	4SH_147X60	N	W	LR	1	Repair
XXXXXXXX	B	N	Floor 5	5N	4SH_147X60	N	W	LR	1	Repair
XXXXXXXX	B	Q	Floor 5	5Q	2SGD_106X96	N	E	LR	2	Repair
XXXXXXXX	A	A	Floor 1	A-1B	4SH_147X60	N	E	LR	1	Repair
XXXXXXXX	A	A	Floor 1	A-1C	2SH_74X60	N	E	MBR	1	Repair
XXXXXXXX	A	F	Floor 1	A-1F	2SH_74X60	N	W	MBR	1	Repair
XXXXXXXX	A	F	Floor 1	A-1F	2SH_90X60	N	N	2BR	1	Repair
XXXXXXXX	A	F	Floor 1	A-1F	2SH_90X60	N	N	DR	1	Repair
XXXXXXXX	A	F	Floor 1	A-1F	4SH_147X60	N	W	LR	2	Repair
XXXXXXXX	A	M	Floor 1	A-1M	2SH_74X60	N	W	MBR	1	Repair
XXXXXXXX	A	N	Floor 1	A-1N	2SH_90X60	N	E	2BR	1	Repair
XXXXXXXX	A	N	Floor 1	A-1N	2SH_90X60	N	E	DR	1	Repair
XXXXXXXX	A	N	Floor 1	A-1N	4SH_147X60	N	W	LR	2	Repair
XXXXXXXX	A	P	Floor 1	A-1P	2SH_74X60	N	W	MBR	1	Repair
XXXXXXXX	A	P	Floor 1	A-1P	2SH_90X60	N	E	2BR	1	Repair
XXXXXXXX	A	Q	Floor 1	A-1Q	2SH_74X60	N	N	MBR	1	Repair
XXXXXXXX	A	A	Floor 2	A-2A	2SGD_106X96	N	S	LR	2	Repair
XXXXXXXX	A	B	Floor 2	A-2B	2SGD_106X96	N	N	LR	1	Repair
XXXXXXXX	A	B	Floor 2	A-2B	2SH_74X60	N	E	MBR	1	Repair
XXXXXXXX	A	B	Floor 2	A-2B	2SH_90X60	N	W	DR	1	Repair
XXXXXXXX	A	C	Floor 2	A-2C	2SH_74X60	N	E	MBR	1	Repair
XXXXXXXX	A	C	Floor 2	A-2C	4SH_147X60	N	E	LR	2	Repair
XXXXXXXX	A	K	Floor 2	A-2K	2SH_90X60	N	E	DR	1	Repair
XXXXXXXX	A	L	Floor 2	A-2L	2SH_74X60	N	W	MBR	1	Repair
XXXXXXXX	A	L	Floor 2	A-2L	2SH_90X60	N	E	DR	1	Repair
XXXXXXXX	A	N	Floor 2	A-2N	2SGD_106X96	N	S	LR	2	Repair
XXXXXXXX	A	N	Floor 2	A-2N	2SH_74X60	N	W	MBR	1	Repair
XXXXXXXX	A	Q	Floor 2	A-2Q	2SH_74X60	N	N	MBR	1	Repair
XXXXXXXX	A	A	Floor 3	A-3A	2SH_90X60	N	W	DR	1	Repair
XXXXXXXX	A	B	Floor 3	A-3B	2SGD_106X96	N	N	LR	2	Repair
XXXXXXXX	A	C	Floor 3	A-3C	2SH_90X60	N	W	2BR	1	Repair
XXXXXXXX	A	D	Floor 3	A-3D	2SGD_106X96	N	E	LR	1	Repair
XXXXXXXX	A	F	Floor 3	A-3F	2SGD_106X96	N	E	LR	1	Repair
XXXXXXXX	A	F	Floor 3	A-3F	2SH_90X60	N	N	3BR	1	Repair
XXXXXXXX	A	G	Floor 3	A-3G	2SGD_106X96	N	W	LR	2	Repair
XXXXXXXX	A	G	Floor 3	A-3G	2SH_74X60	N	S	MBR	1	Repair
XXXXXXXX	A	H	Floor 3	A-3H	2SGD_106X96	N	W	LR	1	Repair
XXXXXXXX	A	H	Floor 3	A-3H	2SH_90X60	N	W	2BR	1	Repair
XXXXXXXX	A	H	Floor 3	A-3H	2SH_90X60	N	N	DR	1	Repair
XXXXXXXX	A	H	Floor 3	A-3H	4SH_147X60	N	S	LR	2	Repair
XXXXXXXX	A	K	Floor 3	A-3K	2SGD_106X96	N	E	LR	2	Repair
XXXXXXXX	A	P	Floor 3	A-3P	2SH_90X60	N	S	DR	1	Repair
XXXXXXXX	A	C	Floor 4	A-4C	2SH_90X60	N	W	2BR	1	Repair
XXXXXXXX	A	F	Floor 4	A-4F	2SH_90X60	N	N	DR	1	Repair
XXXXXXXX	A	G	Floor 4	A-4G	2SGD_106X96	N	W	LR	2	Repair
XXXXXXXX	A	M	Floor 4	A-4M	2SGD_106X96	N	N	LR	2	Repair
XXXXXXXX	A	M	Floor 4	A-4M	2SH_90X60	N	E	DR	1	Repair
XXXXXXXX	A	C	Floor 5	A-5C	2SH_74X60	N	E	MBR	1	Repair
XXXXXXXX	A	J	Floor 5	A-5J	2SH_74X60	N	W	MBR	1	Repair
XXXXXXXX	A	N	Floor 5	A-5N	2SGD_106X96	N	S	LR	2	Repair
XXXXXXXX	A	Q	Floor 5	A-5Q	2SGD_106X96	N	E	LR	2	Repair
XXXXXXXX	B	B	Floor 2	B-2F	2SGD_106X96	Y	E	LR	1	Repair
XXXXXXXX	B	Q	Floor 2	B-2Q	2SGD_106X96	Y	E	LR	2	Repair

XXXXXXXX	B	Q	Floor 2	B-2Q	2SH_74X60	Y	N	MBR	1	Repair
XXXXXXXX	B	Q	Floor 2	B-2Q	SH_44X60	Y	S	2BR	1	Repair
XXXXXXXX	B	Q	Floor 2	B-2Q	SH_44X60	Y	S	DR	1	Repair
XXXXXXXX	B	B	Floor 4	B-4C	2SGD_106X96	Y	E	MBR	1	Repair
XXXXXXXX	B	B	Floor 5	B-5R	4SH_147X60	Y	N	LR	1	Repair
XXXXXXXX	B	J	Floor 1	IJ	4SH_147X60	N	W	LR	2	Repair
XXXXXXXX	B	K	Floor 1	IK	2SGD_106X96	N	N	LR	1	Repair