


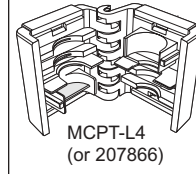


RingFlare™ Connector

with Waterproof Interface for HELIAX® LDF4-50A Coaxial Cable

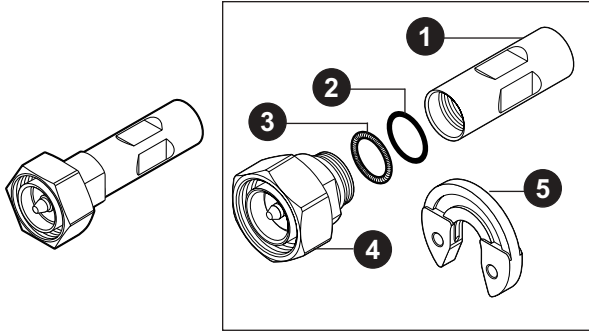

Tool	Cuts per Blade	Blade Part Number
MCPT-L4	24 (typ)	MCPT-BK4
207866	24 (typ)	209874
CPT-L4ARC	150 (typ)	CPT-BKS












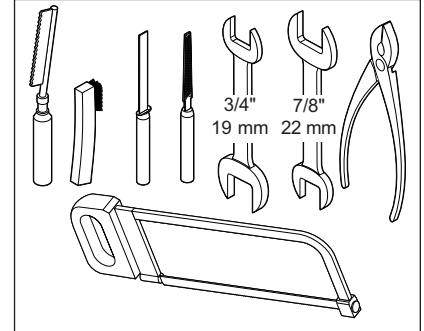


FAX-On-Demand: +1-708-873-3614 • North America: 1-800-861-1700

Tips and Techniques (SP50047) available by FAX-On-Demand.
Los consejos prácticos y técnicas (SP50047) pueden solicitarse por fax.


Conseils et techniques (SP50047) disponibles par fax à la demande.
Tips und Anleitungen (SP50047) auf Faxanfrage erhältlich.

Dicas e Técnicas (SP50047) disponíveis via pedido por fax.
提示與方法 (SP50047) 可以通過電傳獲得

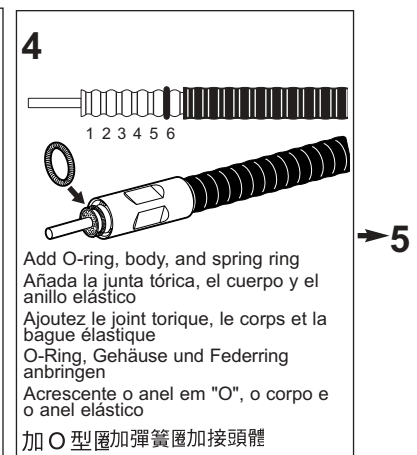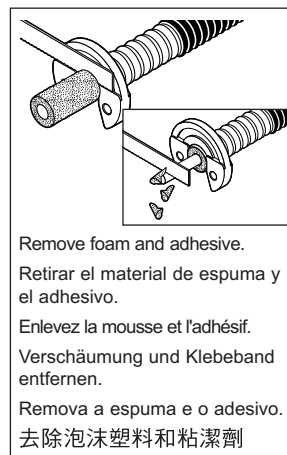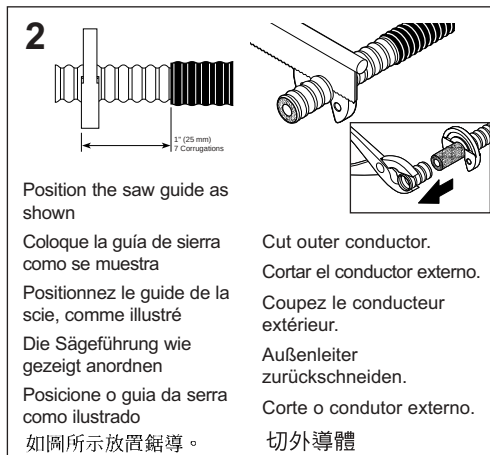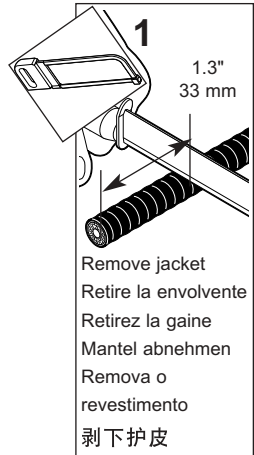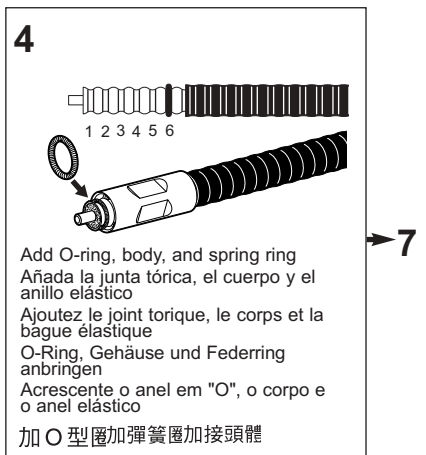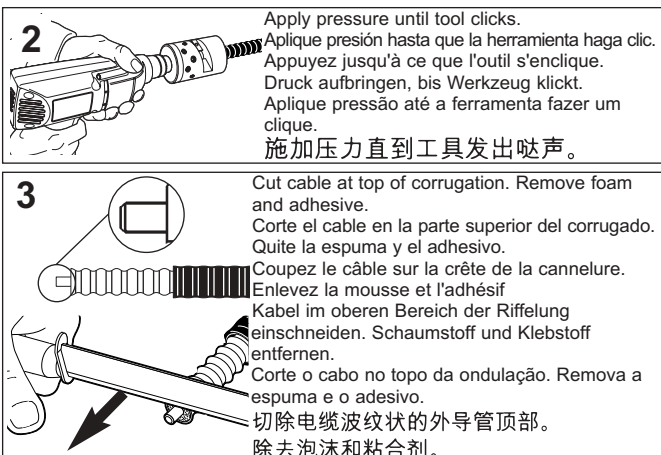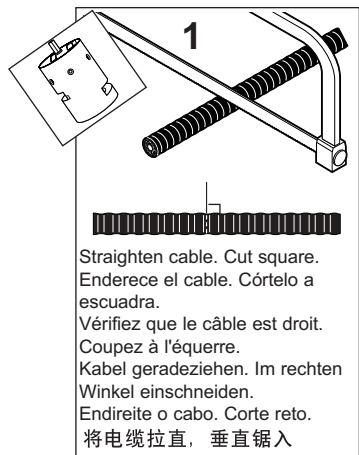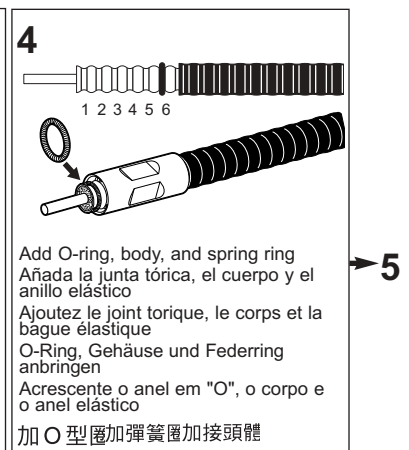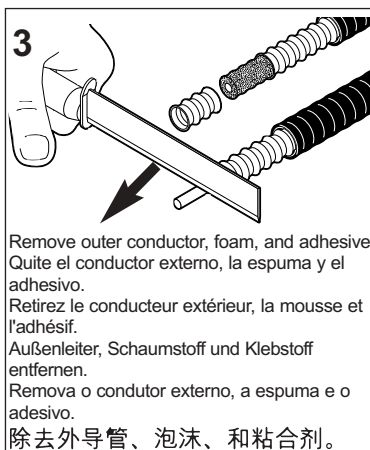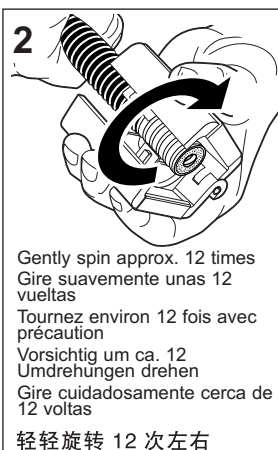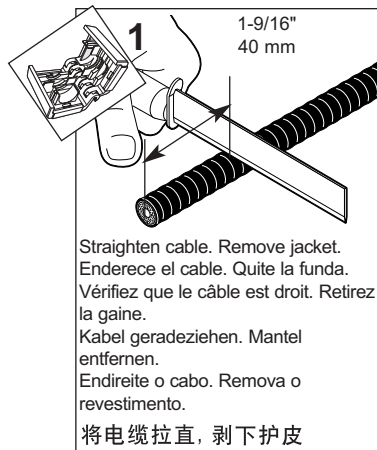


5

Trim inner conductor.
Cortar el conductor interno.
Coupez le conducteur intérieur.
Innenleiter abschneiden.
Limpe o condutor interno.
修整內心導體

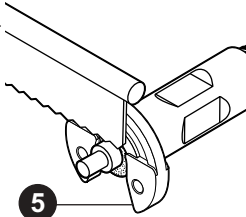


6

Taper inner conductor.
Dar forma cónica al conductor interno.
Effilez le conducteur intérieur.
Innenleiter abschrägen.
Ataraxe o condutor interno.
錐削內心導體

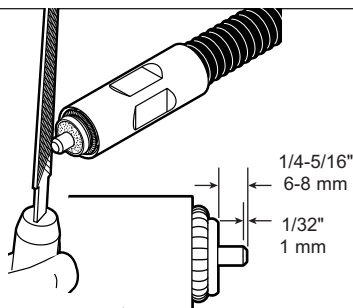

7


Deburr
Quitar las virutas
Ebavurez
Entgraten
Tirar as rebarbas
Sbavare
去毛刺

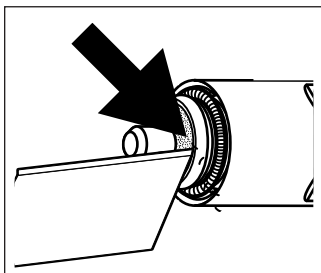

Inside edge, outer conductor
Borde interior, conductor externo
Bord interne, conducteur extérieur
Innenkante, Außenleiter
Borda interna, condutor externo
Bordo interno, conduttore esterno
内缘, 外导体


8

Remove debris.
Retirar los restos.
Enlevez les débris.
Metallspäne entfernen.
Remova os detritos.
去除殘渣

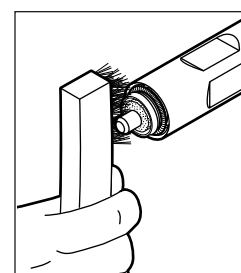


9

Compress foam.
Comprimir el material de espuma.
Comprimez la mousse.
Verschäumung zusammendrücken.
Comprima a espuma.
壓緊泡沫塑料。

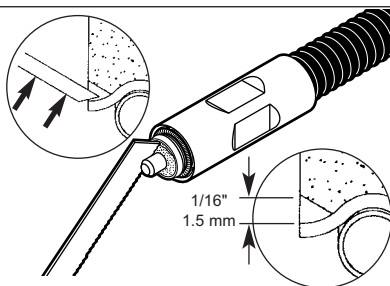


10

Add grease
Añadir la grasa
Ajoutez de la graisse
O-Ring einfetten
Acrescente graxa
加油脂

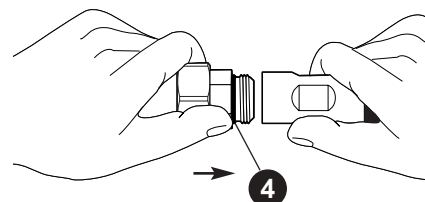


11

Attach connector body.
Añadir el cuerpo del conector.
Fixez le corps du connecteur.
Steckergehäuse befestigen.
Coloque o corpo do conector.
安裝接頭體

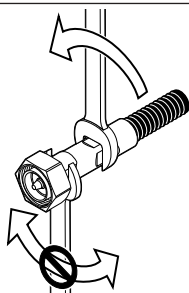


12

Examine flare
Examine el acampanado
Vérifiez l'évasement
Aufweitung kontrollieren
Examinar o flangeamento
檢查擴張表面

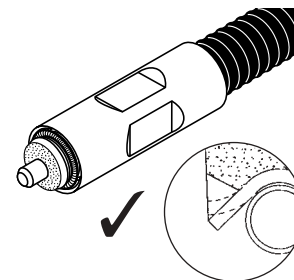


13

Reattach connector body.
Vuelva a acoplar el cuerpo del conector.
Attachez à nouveau le corps du connecteur.
Steckverbinder wieder anbringen.
Volte a ligar o corpo do conector.
重新安裝连接器。

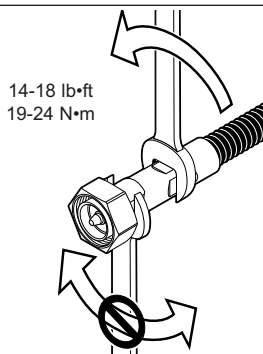

14

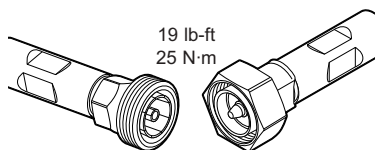

Coupling torque.
Couple de serrage.
Torque de conjugação.

Par de acoplamiento.
Anschlußdrehmoment.
配合扭矩：

Connector Reattachment Kit Part Number = L4RCN-RKIT

Número de Pieza del Juego de Reinserción del Conector = L4RCN-RKIT

Numéro de référence de trousse de rattachement de connecteur = L4RCN-RKIT

Steckverbinder-Wiederanschließ-Set Teile-Nr. = L4RCN-RKIT

Número de Peça do Kit para Religação de Conector = L4RCN-RKIT

连接器再连接工具包配件号码 = L4RCN-RKIT

Notice: Andrew disclaims any liability or responsibility for the results of improper or unsafe installation, inspection, maintenance, or removal practices.
Aviso: Andrews no acepta ninguna obligación ni responsabilidad como resultado de prácticas incorrectas o peligrosas de instalación, inspección, mantenimiento o retiro.
Avis: Andrew décline toute responsabilité pour les conséquences de procédures d'installation, d'inspection, d'entretien ou de retrait incorrectes ou dangereuses.
Hinweis: Andrew lehnt jede Haftung oder Verantwortung für Schäden ab, die aufgrund unsachgemäßer Installation, Überprüfung, Wartung oder Demontage auftreten.
Atenção: A Andrew abdica do direito de toda responsabilidade pelos resultados de práticas inadequadas e sem segurança de instalação, inspeção, manutenção ou remoção.

注意 Andrew 公司申明對於不恰當或不安全的安裝、檢驗、維修或拆卸操作所導致的後果不負任何義務和責任



This product may be covered by one or more of the following patents, or other patents pending. United States 5,154,636; 5,137,470; 5,354,217; 5,344,051; 5,435,745; 5,595,502; Switzerland, Spain, France, United Kingdom 0 495 467; Germany P692 13 034.9; p692 14 199.5; Italy 70,732-BE/96; 71,436-BE/96; Australia 668,812

Andrew Corporation
10500 West 153rd Street
Orland Park, IL U.S.A. 60462

Telephone: 708-349-3300
FAX (U.S.A.): 1-800-349-5444
Internet: <http://www.andrew.com>

Customer Service, 24 hours: U.S.A. • Canada • Mexico: 1-800-255-1479
U.K.: 0800 250055
Other Europe: +44 1592 782612

Printed in U.S.A 08/03

Copyright © 2003 by Andrew Corporation