



**Precision Imports**  
 183 Faltin Drive,  
 Manchester, NH 03103  
 (603) 624-1113  
 help@precisionimports.com

**Invoice #133739**  
 Page 1 of 7  
 06/02/2026 12:49 PM

**2023 BMW 5 Series**  
 WBA73BJ04PWY06525  
 Engine: 3.0L I6 Turbo  
 Gas/Electric Mild Hybrid DI  
 335HP  
 Plate: 4LNB 26  
 Odometer In: 39998  
 Odometer Out: 39998

**Advisor: Austin Sevigny**  
 Technician: Pete Gelinias

**SERVICES**

**1 Precision Imports Complimentary Inspection**

**LABOR**

Check vehicle for needed maintenance and repairs

**2 Vehicle will not start after colission**

Performed vehicle scan to vehicle. Found vehicle has no communication to ECM to vehicle. Tried creating jumper harness to get vehicle to jump start and get vehicle running. Vehicle still will not start. After performing further testing. Found when vehicle air bags deployed it had the battery kill switch for vehicle deploy as well to prevent any fires to vehicle electrical system during collision. Vehicle will need battery kill switch cable installed to get vehicle started at this time.

**LABOR**

Verify customer concern

Check failed system for cause

Consult info sources for relevant TSB

Provide solution for repair

**3 Remove and replace battery kill switch cable**

Removed and replaced fuse box and kill switch battery cable to vehicle. Found vehicle now starts up and runs. Vehicle does shift into gear as it should and moves back and forth. Vehicle is limited in mobility due to damaged suspension components so vehicle can not be road tested. Multiple warning lights on instrument cluster due to air bags being deployed due to vehicle going off road. No further action needed at this time.

**LABOR**

Replace Battery kill switch cable

<b>PARTS</b>	<b>QTY</b>
Battery Kill Switch	1.0
Rear power distribution box	1.0



**Precision Imports**  
183 Faltin Drive,  
Manchester, NH 03103  
(603) 624-1113  
help@precisionimports.com

**Invoice #133739**

Page 2 of 7  
06/02/2026 12:49 PM

---

**Terms of Service:**

1. "YES, DO THIS WORK"

I hereby authorize the corresponding service to be done along with the necessary materials.

2. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

Precision Imports staff may operate my vehicle for the purpose of testing, inspection, and delivery.

3. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto.

4. "ONLINE COMMUNICATION OK"

I welcome email from Precision Imports as a means of receiving copies of my estimate, work order, and invoice.

5. "HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to these five terms.

6. Carrigan Auto Group shall not be held liable for any damage, loss, or destruction of vehicles left on the premises, including but not limited to damage caused by fire, theft, vandalism, acts of nature, or any other unforeseen circumstances beyond our control.

**Authorization:**

---

**INSPECTION REPORT**

**Precision Imports Complimentary Inspection**

- Vehicle Registration**
- Body / Glass Damage**
- Under hood inspection. Inspect air and cabin filter condition. Inspect and note any concerns such as leaks, damaged hoses & cables, battery & hold down, etc.**
- Lights. Operation and condition**
- Tires & wheels. Note tread depth, PSI initial & final, tread wear, sidewall damage, & any other concerns like bent/cracked wheels, etc. Note tire mfg date, size, weight/speed rating, & brand-Only if recommending replacement**
- Windshield / Glass condition
- Wiper operation and condition**
- Warning and malfunction lights**
- Maintenance reminder system / Due for service**

Synthetic Oil Change is overdue by 4 months (Recommended every 6,000 miles or 12 months)  
Brake Fluid Service needs attention (No history - Recommended every 20,000 miles or 2 years)

Written by Pete Gelinias at 05/27/2026 03:01 PM

- Fluid leaks
- Steering and suspension. Check for wear or damage**
- Heat / AC operation
- Belts. Inspect all belt, idler, tensioner, & accessory condition. Inspect timing belt condition & service interval (if applicable).
- Braking system condition ( pictures if concerns are found )**

brakes rusted over

Written by Pete Gelinias at 05/27/2026 03:01 PM


- Front brakes. Inspect and note any concerns with brake pads, rotors, calipers, hoses, steel lines, etc.**
- Rear brakes. Inspect and note any concerns with brake pads, rotors, calipers, hoses, steel lines, parking brake cables, etc.**
- Engine under vehicle. Note any concerns such as under engine shields, engine & transmission mounts, frame/subframe, fluid leaks, differential, transfer case, fuel filter, etc.
- Exhaust system. Leaks / Noises/ Condition ( pictures if concerns are found )


- ✓
- ✓ Misc recommendations. Note any concerns not addressed above.



### Vehicle will not start after colission

- ✓ **Customer concern verified**
- ✓ **Information sources checked for TSB / Recall**
- ✓ **Picture of failed component if possible**

Damaged right front suspension components and wheel

 [https://services.shop-ware.com/uploads/v1/original/4ZP-AYrNR111qf\\_FNVgek](https://services.shop-ware.com/uploads/v1/original/4ZP-AYrNR111qf_FNVgek)




<https://services.shop-ware.com/uploads/v1/original/rAVLUzvN9LoP70dstoflb>

Written by Pete Gelinat at 05/27/2026 04:27 PM

**FINDINGS**

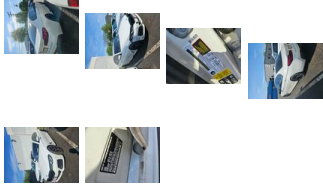

Written by Austin Sevigny at 05/19/2026 09:20 AM

Vehicle system scan





<https://services.shop->

[ware.com/uploads/v1/original/kwY5RAN60f0KcpTE\\_zT-x](https://services.shop-ware.com/uploads/v1/original/kwY5RAN60f0KcpTE_zT-x)

Written by Austin Sevigny at 05/27/2026 03:00 PM

**Attached Images:**

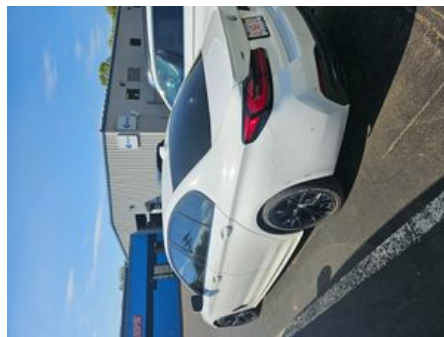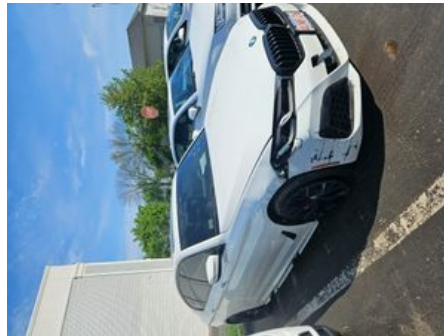



Foreign & Domestic Auto Repairs

### Precision Imports

183 Faltin Drive,  
Manchester, NH 03103  
(603) 624-1113  
help@precisionimports.com

Invoice #133739

Page 7 of 7  
06/02/2026 12:49 PM

