

Appendix 4

Pollution Incident Response Management Plan



Pollution Incident Response Management Plan

Haerses Road Quarry

Version: V 5.0

Date: July 2023

File Name: Haerses Road Quarry - PIRMP

File No.: DS-ENV-EMS-HR005



| Version | Revision Date | Revision Details | Prepared by | Approved by |
|---------|---------------|--|------------------------------|-------------|
| 1.0 | 16/03/18 | PIRMP first issued (previously combined with the Old Northern Road Quarry PIRMP) | H.C. | D.D. |
| 2.0 | 15/03/19 | Reviewed pollution inventory and risk assessment. Revised Section 6.0 to include DS-OHS-140-F1. Revised company name change. Amended relevant Code of Practice. Inserted Roles and Responsibilities | H.C. | D.D. |
| 3.0 | 13/03/20 | Review of roles, contact numbers and update of sections 7 | H.C. / R.R. / M.M. / B.G. | D.D. |
| 4.0 | 25/03/2021 | Update document in line with Guideline: Pollution Incident Response Management Plan (EPA, March 2020), Pollution Inventory and Site Plans. Additional sections have been added to the document including: Section 3 Environment Protection License details, Section 10 Incident Notification. Authorities contact details and pollutant register have been reviewed and revised. | H.C. / R.R. / B.G. | D.D. |
| 5.0 | 12/07/2023 | Update document in line with Guideline: Pollution Incident Response Management Plans (EPA, September 2022) and utilise new company template. Contact details revised | H.C. / B.G. | D.D. |



Table of Contents

| 1.0 | Purpose | 1 |
|--------------|---|------|
| 1.1 | Definition of a Pollution Incident | 1 |
| 1.2 | Requirement of Notification of a Pollutant Incident | 1 |
| 2.0 | Scope | 2 |
| 2.1 | Environment Protection Licence | 2 |
| 3.0 | Legal and Other Requirements | 3 |
| 4.0 | Roles and Responsibilities | |
| 5.0 | Identification of Potential Pollution Hazards & Risk Assessment | 4 |
| 6.0 | Pollutant Inventory | |
| 7.0 | Pollution Incident Response Contact Details | |
| 8.0 | Pollution Incident Response Procedure & Actions Flow Chart | |
| 9.0 | Notification of Incident | |
| 10.0 | Training, Plan Testing & Review | |
| 11.0 12.0 | Site Plans PIRMP Training and Testing | |
| 12.0 | FINIT ITAIIIIII and Testing | . 10 |
| | ares 1 Pollution Incident Response Management Plan – Haerses Road Quarry Site Plan 2 Location of Sensitive Receivers | |
| i iguic | , 2 Location of ochalive receivers | . 13 |
| Tab | les | |
| | 1: Environment Protection Licence (EPL) Details | |
| | Roles and Responsibilities Risk Assessment Matrix | |
| | 4: Hazard Identification and Risk Assessment (Note: Assessment to pre-control actions | 5 |
| | implemented) | 6 |
| | 5: Pollutants kept on premise | |
| | 6: Dixon Sand Incident Contact Details (Responsible persons for reporting to authorities) 7: Authorities Incident Contact Details | |
| | 8: Receivers on EPL 12513 (Haerses Rd Quarry) | |
| | 9: PIRMP Training and Mock Incident Record | |



1.0 Purpose

This Pollution Incident Response Management Plan (PIRMP) has been prepared, to address the requirements of the *Protection of the Environment Operations Act 1997*, specifically Part 5.7A of the Act, and to ensure compliance with Dixon Sand Environment Protection Licence # 12513, Development Consent DA 165-7-2005, legal and other requirements.

The purpose of the PIRMP is to ensure that pollution incidents and impacts which have the potential to occur during activities associated with the operation of the Haerses Road Quarry, Maroota, are prevented or minimised so that no significant harm occurs to human health and the environment. This plan provides details of management procedures to be implemented in the event of a pollution incident.

1.1 Definition of a Pollution Incident

For the purpose of this plan, a **pollution incident** is defined by the NSW Environment Protection Authority (EPA) as:

'an incident or set of circumstances during or as a consequence of which there is or is likely to be a leak, spill or other escape or deposit of a substance, as a result of which pollution has occurred, is occurring or is likely to occur. It includes an incident or set of circumstances in which a substance has been placed or disposed of on premises, but it does not include an incident or set of circumstances involving only the emission of any noise.'

1.2 Requirement of Notification of a Pollutant Incident

If a pollution incident occurs, it is the duty of the premises to notify the incident if it causes or threatens 'Material Harm' to the environment, which is defined under the *POEO Act* as:

- a) Material harm to the environment is:
 - I. the actual or potential harm to the health or safety of human beings or to ecosystems that is not trivial, or
 - II. actual or potential Loss or property damage of an amount, or amounts in aggregate, exceeding \$10,000. Loss includes the reasonable costs and expenses that would be incurred in taking all reasonable and practicable measures to prevent, mitigate or make good harm to the environment.
- b) Harm to the environment includes:

'any direct or indirect alteration of the environment that has the effect of degrading the environment and, without limiting the generality of the above, includes any act or omission that results in pollution.'

This Plan further describes how materials are to be handled and stored on site in accordance with applicable Safety and Environmental Legislation.

A written copy of this plan is to be kept at the Haerses Road Quarry, Maroota and be made available on request by an authorised NSW EPA Officer and to any person who is responsible for implementing this plan.

File No: DS-ENV-EMS-HR005



2.0 Scope

The scope of this management plan is to provide:

- Procedures to be followed by the licence holder or occupier of the premises in notifying pollution incidents to appropriate personnel, authorities, and regulatory bodies
- A description of the action to be taken, immediately after a pollution incident by the licence holder to reduce or control any pollution
- Procedures to be followed for co-ordinating any action taken in combating the pollution caused by the incident (with appropriate personnel, authorities, and regulatory bodies), and the communication pathways that need to be utilised in order to do this

This management plan applies to the employees and contractors operating at Haerses Road Quarry, Maroota.

2.1 Environment Protection Licence

Table 1: Environment Protection Licence (EPL) Details

| Name of Licensee: | Dixon Sand Pty Ltd | | | | |
|------------------------|---------------------------------------|--|--|--|--|
| | ABN: 80 002 278 686 | | | | |
| EPL Number | 12513 | | | | |
| Premise name and | Haerses Road Quarry | | | | |
| address | Haerses Road and Intersection of Wise | emans Ferry Road, Maroota | | | |
| Company Contact | Name: | David Dixon | | | |
| Details | Position: | Director / Quarry Manager | | | |
| | Business Hours Contact Number: | 02 4566 8348 | | | |
| | After Hours Contact Number: | 0414 330 490 | | | |
| | Emails: | david@dixonsand.com.au | | | |
| | | environment@dixonsand.com.au | | | |
| Website Address | www.dixonsand.com.au | | | | |
| Scheduled | Crushing, grinding or separating | | | | |
| activities on EPL | Extractive activities | | | | |
| Fee based activities | Crushing, grinding or separating | > 100000 – 500000 T annual processing | | | |
| on EPL | | capacity | | | |
| | Extractive activities | > 100000 – 500000 T annual capacity to | | | |
| | | extract or process | | | |

File No: DS-ENV-EMS-HR005



3.0 Legal and Other Requirements

All activities carried out on site are to comply with the following licences, legislation, regulations and guidelines relevant to

All activities carried out on site are to comply with the following licences, legislation, regulations and guidelines relevant to the notification and management of environmental pollution.

- Environment Protection Licence 12513 Haerses Road Quarry
- Development Application DA165-7-2005 Haerses Road Quarry
- Protection of the Environment Operations Act, 1997 (POEO Act)
- Protection of the Environment Operations (General) Regulation, 2009
- Protection of the Environment Operations (Waste) Regulation, 2005
- Protection of the Environment Legislation Amendment, 2011
- Environmentally Hazardous Chemicals Act, 1985 (NSW)
- Managing Risks of Hazardous Chemicals in the Workplace Code of Practice (July 2012)
- Storage and Handling Liquids: Environmental Protection Participant's Manual (DECC 2007)
- Soils and Construction: Managing Urban Stormwater (Landcom 2004)
- Relevant Australia/New Zealand Standards
- · Safety Data Sheets applicable to materials stored on site

By adhering to the requirements set out in the abovementioned legislation, regulations and guidelines, this will aid in preventing or minimising the release of pollution into the environment.

In addition, Dixon Sand has procedures outlined in the Environmental Management Strategy documentation relevant to pollution management and reporting.

File No: DS-ENV-EMS-HR005



4.0 Roles and Responsibilities

Dixon Sand has set out the roles and responsibilities for the overall conduct and control of any pollution incident until such time the incident is under control and any investigation completed. Once the 'all clear' is given by emergency services and/or regulatory authorities, the responsibility is transferred back to the Quarry Managers.

The roles and responsibilities are outlined in Table 2 below.

Table 2: Roles and Responsibilities

| Position | Activities / Responsibilities |
|--|---|
| Quarry Managers (Production Managers) | Contact Emergency services Assess the incident situation and activate the response team, if required Prevent further harm by controlling the incident scene, if safe to do so Activate the site emergency evacuation procedure, if required Manage the site evacuation procedure Liaise with emergency services and regulatory authorities Assist in clean-up and remediation |
| Environmental Officer (or delegate) | Assist in incident controlling, if safe to do so Notify the relevant regulatory authorities, if required Assist in clean-up and remediation Collate information and record incident in the Environmental Incident Register |
| Safety Advisor (or delegate) | Assist in incident controlling, if safe to do so Notify the relevant regulatory authorities, if required Assist in clean-up and remediation |
| Operators and Contractors | Report incident to the Quarry Managers or Management Team Prevent further harm by controlling the incident scene, if safe to do so Assist in clean-up and remediation |

5.0 Identification of Potential Pollution Hazards & Risk Assessment

The following risk matrix and table has been developed to:

- Identify site specific hazards that may result in a pollution incident occurring;
- Assess the likelihood of an incident occurring as a result of a particular hazard;
- · Assess the likely degree of impact if an incident occurs; and
- Outline preventative management actions to be implemented in order to control, minimise or avoid impacts.
- Monitor implemented controls.

Table 3 contains the Risk Assessment Matrix adopted by Dixon Sand. Table 4 contains the hazards identified on site and associated risk assessment and proposed actions.

File No: DS-ENV-EMS-HR005



Table 3: Risk Assessment Matrix

| | RISK ASSESSMENT MATRIX | | | | | | | |
|--|---|--|-------------------------|-----------------------------|----------------------|--|--|--|
| | Consequence | | | | | | | |
| Likelihood | 1 | 2 | 3 | 4 | 5 | | | |
| Α | Extreme | Extreme | High | Med | Low | | | |
| В | Extreme | High | High | Med | Low | | | |
| С | Extreme | High | Med | Low | Low | | | |
| D | High | Med | Med | Low | Low | | | |
| E | High | Med | Low | Low | Low | | | |
| | | LIKELIH | OOD | | | | | |
| A - Almost C | ertain (<i>is expected to c</i> | | | | | | | |
| B - Likely (wi | III probably occur) | | | | | | | |
| C - Possible | (may occur at some po | pint) | | | | | | |
| D - Unlikely (| could occur but doubt | ful) | | | | | | |
| E - Rare (ma | y occur but highly unli | kely) | | | | | | |
| | | | | | | | | |
| 4 0 1 1 | 1. / / | CONSEQU | <u>JENCE</u> | | | | | |
| | hic (critical unmanage | • • • | | | | | | |
| | ense, manageable imp | • | | | | | | |
| | (serious impacts, eas | , , | | | | | | |
| , | nor management actio | . , | | | | | | |
| 5 - Insignifica | ant (<i>impacts requiring i</i> | no treatment) | | | | | | |
| | | RESPONSE T | O RISK RANKINGS | | | | | |
| Extreme | | ence until the hazard is is to authorise the work. | | vel of risk is reduced. T | he quarry manager or | | | |
| High | | ed if it is not reasonably ր a risk assessment and be | | the risk further. The a | ctivity must not be | | | |
| Medium | Work can be underta | aken with the identified c | ontrols in place. | | | | | |
| Low | Low Work that is part of the day-to-day operation of the quarry with known controls, control measures are to be effective, reliable, and subject to appropriate monitoring. | | | | | | | |
| | | HIERARCHY | of RISK CONTROL | | | | | |
| Eliminat | e the hazard | Highest level of health a | nd safety protection, | most reliability of contr | rol measures. | | | |
| | Substitute the hazard with something safer Change the substance being used to a safer one, use two people to lift items, change from one energy source to another e.g. From air to hydraulics. | | | | | | | |
| Isolate the hazard from people Putting up barriers, sound walls, acoustic enclosures | | | | | | | | |
| | ne risk through ring controls | Put in guards or other ba | arriers, use design ar | nd engineering solution | S. | | | |
| | osure by applying rative actions | Procedures, signs, traini | ng | | | | | |
| | onal protective uipment. | _owest level of health ar | nd safety protection, l | least reliability of contro | ol measures | | | |



Table 4: Hazard Identification and Risk Assessment (Note: Assessment to pre-control actions being implemented)

| Hazard | Potential Pollution Incident & Condition influencing Likelihood of Occurrence | Likelihood of Incident occurring | Consequence of Incident | Assessed Risk Level | Proposed Actions • Pre-emptive Actions (avoid impact) • Control Actions (minimise impact) |
|--|---|--|---------------------------------|------------------------|---|
| Storage of oils in garage. | Polluting Incident 1. Chemical spill to land/water from fuel tanks/oil & grease drums 2. Chemical spill to land/water from chemical containers Influencing Conditions • Chemical not stored correctly • Poor maintenance on site • Impact/damage to tank/bunding releasing chemical • Incorrect use of equipment • Maximum size of any chemical containers is 20 litres | 1. E (Rare) 2. D (Unlikely) | 1. 4 (Minor) 2. 4 (Minor) | 1. Low 2. Low | Pre-emptive Actions EPA approved bunding containment installed for all tanks / containers Spill kits located on site at vantage points Regular inspections Correct refuelling procedures and training Site induction for all employees/contractors All maintenance work is generally undertaken on a concrete hard stand Incident Control Actions Notify Quarry Managers or delegate Stop release at source Contain release using spill kits or earth bunding Follow incident response procedure outline in Section 8 Remove contaminated material from site by licenced contractor/facility |
| Silt/Tailings ponds Note: majority of ponds are cut into rock | Polluting Incident 1. Dam wall collapse releasing sediment laden water off site 2. Silt pond overtopping Influencing Conditions • Poor construction / maintenance of dam • Machine impacting dam wall • Poor monitoring of water levels resulting in over topping | 1. E (Rare) 2. E (Rare) | 1. 3 (Moderate) 2. 3 (Moderate) | 1. Low 2. Low | Pre-emptive Actions Daily monitoring, regular inspections Pond wall maintenance as required and identified in inspections Incident Control Actions Notify Quarry Managers or delegate Cease pumping of tailing into pond immediately Control release of silt/water by installing temporary earth bunding downslope of release Follow incident response procedure outline in Section 8 Remediate area of sediment release Repair pond wall when practical to do so |

File No: DS-ENV-EMS-HR005



| | | | | | GROUP |
|---|--|---|--|---------------------------------------|--|
| Main water storage dam (storm water) Note: dam is cut into rock | Potential Pollution Incident & Condition influencing Likelihood of Occurrence Polluting Incident 1. Dam wall collapse or leaking releasing sediment laden water off site 2. Sediment laden water released from water storage pond Influencing Conditions • Poor construction / maintenance of dam • Machine impacting dam wall • Dam not treated correctly prior to release • Storm event exceeding design capacity | Likelihood of Incident occurring 1. E (Rare) 2. E (Rare) | Consequence of Incident 1. 3 (Moderate) 2. 3 (Moderate) | Assessed Risk Level 1. Low 2. Low | Proposed Actions Pre-emptive Actions (avoid impact) Control Actions (minimise impact) Pre-emptive Actions Daily monitoring of water level, regular inspections Dam wall maintenance as required and identified in inspections Incident Control Actions Notify Quarry Managers or delegate Cease flow of water into dam and repair pond wall when practical to do so Monitor water quality Follow incident response procedure outline in Section 8 |
| Waste materials E.g. • Putrescible • Recycle | Polluting Incident Contamination of land/water Influencing Conditions Poor waste management / storage | C (Possible) | 4 (Minor) | Low | Pre-emptive Actions Regular inspections and segregated bins All waste removed from site by licenced contractor Incident Control Actions Notify Quarry Managers or delegate Waste materials to be removed from site by licenced contractor Any contaminated land to be remediated and removed from site by licenced contractor to licenced waste management facility |
| Mobile plant operating in quarry | Polluting Incident Release of fuel/oil from plant Influencing Conditions Worn hoses Fuel cart malfunction, break in hose Poor maintenance | B (Likely) | 4 (Minor) | Medium | Pre-emptive Actions Regular maintenance Plant pre-start inspections Spill kits located on site Incident Control Actions Notify Quarry Managers or delegate Control release of fuel/oil using spill kit or earth bund Follow incident response procedure outline in Section 8 Collect and remove contaminated material from site by licenced contractor |



| | | | | | andur |
|--------------------------------------|--|--|-------------------------|------------------------|--|
| Hazard | Potential Pollution Incident & Condition influencing Likelihood of Occurrence | Likelihood of Incident occurring | Consequence of Incident | Assessed Risk Level | Proposed Actions Pre-emptive Actions (avoid impact) Control Actions (minimise impact) |
| Refuelling plant and equipment | Polluting Incident 1. Release of fuel/oil from plant during refuel from mobile fuelling vehicle Influencing Conditions Damage to plant due to collision Fuel cart malfunction, break in hose Poor maintenance | D (Unlikely) | 4 (Minor) | Low | Pre-emptive Actions Plant pre-start inspections Spill kits located on site Regular inspections Correct refuelling procedures and training Site induction for all employees/contractors Incident Control Actions Notify Quarry Managers or delegate Stop release at source Contain release using spill kits or earth bunding Follow incident response procedure outline in Section 8 Remove contaminated material from site by licenced contractor/facility |
| Water pumping equipment | Polluting Incident Release of fuel/oil into the water storage Influencing Conditions Pump malfunction / break in hose Poor maintenance Spillage during refuelling | C (Possible) | 3 (Minor) | Low | Pre-emptive Actions Daily monitoring, regular inspections Correct refuelling procedure Regular maintenance Incident Control Actions Notify Quarry Managers or delegate Cease operation of pump Control release of sediment/fuel/oil using spill kit or earth bund Follow incident response procedure outline in Section 8 Remove contaminated material from site by licenced contractor |
| Dust generation | Polluting Incident Significant release of dust from site operations Influencing Conditions Extreme weather conditions Excessive machinery movements Poor maintenance of haul roads Inadequate use of water cart | C (Possible) | 4 (Minor) | Low | Pre-emptive Actions Monitor weather conditions and cease works or modify operations when significant dust is visible leaving site Maintain haul roads in good condition Regular use of water cart and street sweeper Incident Control Actions Notify Quarry Managers or delegate Following procedure outlined in EPL (condition M2.4) if TEOM alarm is triggered |



| | | | | | GROUP |
|---|--|--|-------------------------|------------------------|---|
| Hazard | Potential Pollution Incident & Condition influencing Likelihood of Occurrence | Likelihood of Incident occurring | Consequence of Incident | Assessed Risk Level | Proposed Actions Pre-emptive Actions (avoid impact) Control Actions (minimise impact) |
| Excessive noise generation | Polluting Incident Excessive noise generation from quarry activities Excessive noise generation from trucks Influencing Conditions Staff and contractors not properly inducted. Poor maintenance of haul roads | D (Unlikely) | 4 (Minor) | Low | Pre-emptive Actions Implement mitigation measures and controls contained in the Noise Management Plan Conduct annual attended noise monitoring at sensitive receivers Provide environmental inductions to all staff and contractors Regular maintenance of machinery and equipment. Construction of noise bunds Operating within approved hours of operation Replacement of old noisy equipment. Incident Control Actions Notify Quarry Managers or delegate Cease noise generating activity immediately Follow incident response procedure outline in Section 8 |
| Working outside approved areas | Polluting Incident Working outside the approved areas of extraction Clearing outside the approved areas Influencing Conditions Staff and contractors not properly inducted. Unclear boundary marking | E (Unlikely) | 3 (Moderate) | Low | Pre-emptive Actions Provide environmental inductions to all staff and contractors Maintain pegs and boundary markers for extraction, clearing and buffer areas in good order. Incident Control Actions Notify Quarry Managers or delegate Cease activity outside the approved area immediately Follow incident response procedure outline in Section 8 |
| Herbicide spillage | Polluting Incident Spillage of herbicide onto non-targeted areas Influencing Conditions Mis-handling of herbicide container and application hose Poor maintenance of equipment Mis-application of targeted area | E (Unlikely) | 3 (Moderate) | Low | Pre-emptive Actions Storage of herbicide in bunded containers in the site vehicle. Spill kit SDS on site Incident Control Actions Notify Quarry Managers or delegate Stop release at source and follow SDS's instructions. Contain release using spill kits or earth bunding Follow incident response procedure outline in Section 8 Remove contaminated material from site by licenced contractor/facility if applicable Engaging competent contractors to undertake the work. |



6.0 Pollutant Inventory

Table 5: Pollutants kept on premise

| Pollutant | Quantity | Location | Controls (spill kits, bunding etc.) |
|------------------------------|---|---|---|
| Diesel Fuel Truck | 3000 litres | Mobile fuel tank fitted with a bowser head on a truck | Shut off valve and Spill kit |
| Petrol | 20 litres x 2 | Storage Container (bunded tray) | Enclosed + bunded storage area and Spill kit |
| Grease | 205 L drum x 2 | Storage Container (bunded tray) | Enclosed + bunded storage area and Spill kit |
| Hydraulic oil (46) | 205 L drum x 2 | Storage Container (bunded tray) | Enclosed + bunded storage area and Spill kit |
| Hydraulic oil (68) | 205 L drum x 2 | Storage Container (bunded tray) | Enclosed + bunded storage area and Spill kit |
| Paint | Spray Cans x multiple | Storage Container | Enclosed + Spill kit |
| Herbicide and wetting agents | Round-up Taskforce Garlon Starane Advance Enviro-dye Pulse | Contractor's vehicle | Chemicals stored in approved containers in a tub with absorbent material in the base. Spill equipment and SDS contained in vehicle |



7.0 Pollution Incident Response Contact Details

Table 6: Dixon Sand Incident Contact Details (Responsible persons for reporting to authorities)

| Name | Position | Contact Number |
|----------------|-----------------------|-------------------------------|
| David Dixon | Quarry Manager | UHF Ch. 18 or 47 |
| | (Managing Diractor) | Office - 02 4566 8348 |
| | | Mobile - 0414 330 490 (24hrs) |
| Mick Munnoch | Quarry Manager | UHF Ch. 18 or 47 |
| | (Operations Manager) | Office - 02 4566 8348 |
| | | Mobile - 0458 079 241 (24hrs) |
| Ben Grogan | Quarry Manager | UHF Ch. 18 or 47 |
| | (Operations Manager) | Office - 02 4566 8348 |
| | | Mobile - 0458 187 378 (24hrs) |
| Jamie Baker | Business Development | UHF Ch. 18 or 47 |
| | Manager | Office - 02 4566 8348 |
| | | Mobile – 0405 135 198 |
| Hunny Churcher | Environmental Officer | Mobile - 0405 844 207 (24hrs) |
| Rowan Russell | Safety Advisor | UHF Ch. 18 or 47 |
| | - | Office - 02 4566 8348 |
| | | Mobile - 0418 243 576 (24hrs) |
| Ashleigh Hard | Safety Officer | UHF Ch. 18 or 47 |
| _ | - | Office - 02 4566 8348 |
| | | Mobile - 0427 997 119 (24hrs) |

Table 7: Authorities Incident Contact Details

| Name | Location | Contact Number |
|--------------------|-----------------------|--|
| Emergency | - | 000 |
| Lineigency | _ | (when incident presents immediate threat |
| | | to human health and property) |
| EPA | | 131 555 |
| : : : | - | ' |
| (Environment Line) | | (At recorded prompt, press 1 to be |
| | | connected to 24hr response line) |
| Fire & Rescue | - | 1300 729 579 |
| | | (No need to dial this number if have |
| | | previously dialled 000) |
| Department of | - | 02 8275 1156 (Maria Divis – Senior |
| Planning and | | Compliance Officer) |
| Environment (DPE) | | Or other delegated Compliance Officers |
| Ministry of Public | Nepean Blue Mountains | 02 4734 2022 (normal hours, report to |
| Health | Public Health | Environmental Health Team) |
| | (Environmental Health | 02 4734 2000 (after hours switch – ask for |
| | ` Team) | Public Health Officer) |
| NSW Resources | - | 1300 814 609 |
| Regulator | | |
| The Hills Shire | Castle Hill | 02 9843 0555 |
| Council | | |
| SafeWork NSW | - | 13 10 50 |

Table 8: Receivers on EPL 12513 (Haerses Rd Quarry)

| Name | Address | |
|----------------|---|--|
| Maroota Public | 4540 Old northern Road, Maroota | |
| School | | |
| Receivers | As identified in Environmental Assessment (Umwelt, Sept 2017) | |



Pollution Incident Response Procedure & Actions Flow Chart

Pollution Incident occurs

1. Prevent any further release of pollutant ASAP (if it is safe and possible to do so) 2. Follow the Incident and Emergency Reporting Procedure

Notify Dixon Sand's Incident Response Contacts:

- David Dixon Quarry Manager (UHF Ch.18 or 47, 02 4566 8348, 0414 330 490)
- Mick Munnoch Quarry Manager (UHF Ch.18 or 47, 02 4566 8348, 0458 079 241)
- Ben Grogan Quarry Manager (UHF Ch.18 or 47, 02 4566 8348, 0458 187 378)
- Hunny Churcher Environmental Officer, 0405 844 207)
- Rowan Russell Safety Advisor (UHF Ch.18 or 47, 02 4566 8348, 0418 243 576)
- Ashleigh Harb Safety Officer (UHF Ch.18 or 47, 02 4566 8348, 0427 997 119)

Acting Quarry Manager to determine scale of incident in consultation with Env. Officer ASAP & initiate incident response procedure

Record pollution incident details on Environmental Incident Register:

- Emission type (air, water, land)
- Pollution type (fuel, gas, sediment, oil etc.)
- Time/duration/volume/location of release
- Action taken or proposed action
- Any other relevant information

Trivial

Minor

Minor remediation required and is reversible: <\$10,000 remediation cost

Not a reportable pollution incident under POEO Act

Remediate as per applicable procedure / management plan

Material Harm

Short term effect

Actual or potential harm that is not trivial:

>\$10,000 remediation cost

Material Harm

Medium to Long term effect

Significant remediation / ongoing management required

Reportable pollution incident under POEO Act and Development Consent 250-09-01

Responsible Person to report incident to authorities:

EPA Environment Line Ministry of Health The Hills Shire Council Fire & Rescue/Police/Ambulance Department of Planning & Environment NSW Resources Regulator SafeWork NSW

131 555 02 4734 2022 02 9843 0555 000 or 1300 729 579 02 8275 1156 1300 814 609 13 10 50

If pollution incident is likely to directly affect the community, contact all relevant sensitive receivers

(Refer to Section 7.0, Table 8)

Remediate pollution as per advice from **Authorities and Environmental Officer**

Monitor and document status of clean up actions, report back to authorities as required

File No: DS-ENV-EMS-HR005



9.0 Notification of Incident

Notification of Relevant Authorities

In the event of a notifiable incident, relevant authorities will be contacted via telephone call (and email if required) and notified through the contact details contained in Table 7.

Notification of Neighbours and Local Community

In the event where the incident has the potential to impact or cause an impact to nearby residents and the Maroota Public School (Table 8), notification will be provided in the form of door-knock, phone call or letter box drop. The most suitable notification methodology will be determined by the Quarry

10.0 Training, Plan Testing & Review

All staff, visitors and contractors coming on to site will be briefed on their responsibilities under this plan as part of site induction requirements, with a copy of this plan being available to all personnel for viewing.

The incident response and action flow chart (Section 8) will also be made available as a notice posted at appropriate locations around the site office and workshop area.


Annual testing and review of this plan is to be undertaken, which would involve two components. The first component will involve a desktop review of the plan components to ensure all details are up to date and still relevant to site operations. The second component will involve a practical exercise with all relevant site staff, in the form of a toolbox training exercise on the implementation of the response procedure (flow chart in Section 8 of this plan).

This plan would be tested and reviewed annually on an on-going basis, within 12 months of the latest approved revision date.

PIRMP and mock incident training details are contained in the quarry's toolbox talk and training records.


11.0 Site Plans

File No: DS-ENV-EMS-HR005

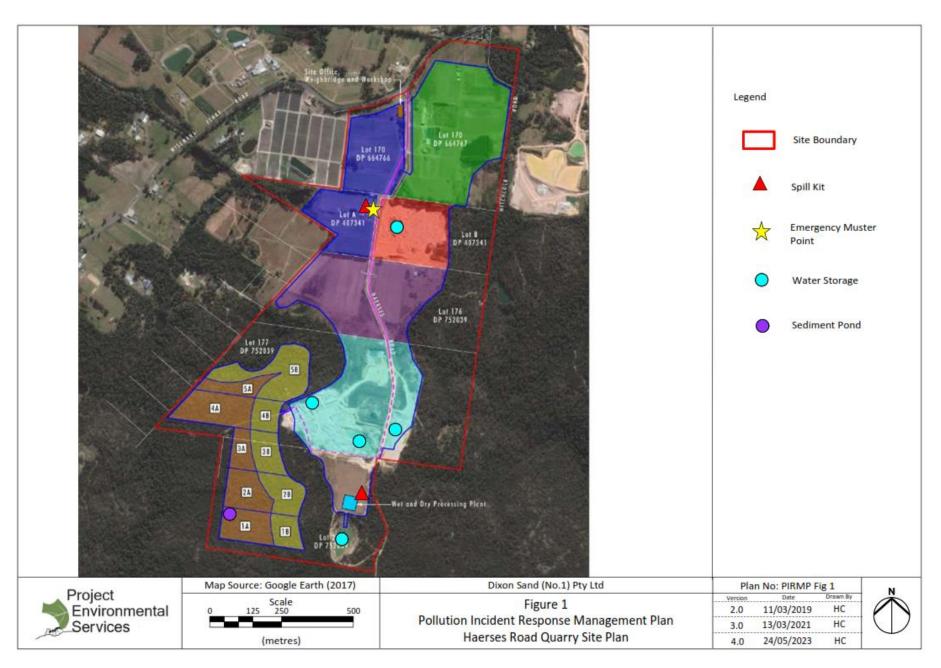

File No: DS-ENV-EMS-HR005



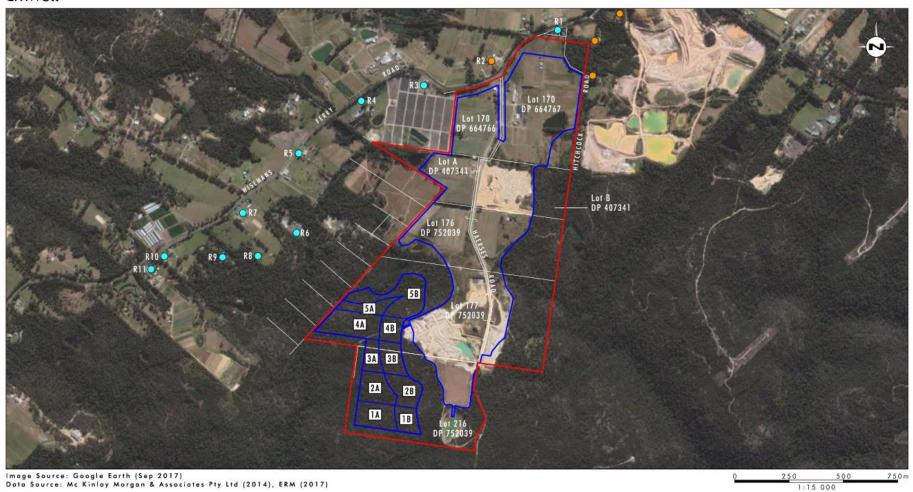

Legend

Haerses Road Quarry Site
Approved Extraction Area
Extraction Cell Number

O Noise Receiver Location

O Noise Receiver with Private Agreement

File Name (A4): R03/4272_036.dgn 20180504 13.30

File No: DS-ENV-EMS-HR005

Figure 2 Location of Sensitive Receivers



12.0 PIRMP Training and Testing

Table 9: PIRMP Training and Mock Incident Record

| Test Date | Test Organiser | Details |
|------------|--------------------------------|---------------------------------------|
| 11/07/2014 | Hunny Churcher | As per Toolbox Talk record |
| 29/03/2016 | Hunny Churcher | As per Toolbox Talk record |
| 23/03/2019 | Hunny Churcher + Rowan Russell | As per Toolbox Talk record |
| 13/03/2020 | Hunny Churcher + Rowan Russell | As per Toolbox Talk record |
| 12/03/2021 | Hunny Churcher + Rowan Russell | As per Toolbox Talk record |
| 22/04/2022 | Hunny Churcher + Rowan Russell | As per Toolbox Talk record |
| 21/07/2023 | Hunny Churcher + Rowan Russell | Training Provided to operators. |
| | | Mock Incident: Dump Truck Rollover |
| | | with diesel spill and driver trapped. |

File No: DS-ENV-EMS-HR005