



832-206-9949

[www.texasedgeinspect.com](http://www.texasedgeinspect.com)

[matt@texasedgeinspect.com](mailto:matt@texasedgeinspect.com)



INSPECTED FOR

**Mark Marrows**  
**7854 Green Trail Dr**  
**Tomball, TX 77375**

April 2, 2021

## PROPERTY INSPECTION REPORT

---

Prepared For: Mark Marrows  
(Name of Client)

Concerning: 7854 Green Trail Dr, Tomball, TX 77375  
(Address or Other Identification of Inspected Property)

By: Matthew Brading, Lic #TREC # 22654 04/02/2021  
(Name and License Number of Inspector) (Date)

\_\_\_\_\_  
(Name, License Number of Sponsoring Inspector)

---

### PURPOSE, LIMITATIONS AND INSPECTOR / CLIENT RESPONSIBILITIES

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions. If any item or comment is unclear, you should ask the inspector to clarify the findings. It is important that you carefully read ALL of this information.

This inspection is subject to the rules ("Rules") of the Texas Real Estate Commission ("TREC"), which can be found at [www.trec.texas.gov](http://www.trec.texas.gov).

The TREC Standards of Practice (Sections 535.227-535.233 of the Rules) are the minimum standards for inspections by TREC-licensed inspectors. An inspection addresses only those components and conditions that are present, visible, and accessible at the time of the inspection. While there may be other parts, components or systems present, only those items specifically noted as being inspected were inspected. The inspector is NOT required to turn on decommissioned equipment, systems, utility services or apply an open flame or light a pilot to operate any appliance. The inspector is NOT required to climb over obstacles, move furnishings or stored items. The inspection report may address issues that are code-based or may refer to a particular code; however, **THIS IS NOT A CODE COMPLIANCE INSPECTION** and does NOT verify compliance with manufacturer's installation instructions. **THE INSPECTION DOES NOT IMPLY INSURABILITY OR WARRANTABILITY OF THE STRUCTURE OR ITS COMPONENTS.** Although some safety issues may be addressed in this report, **THIS REPORT IS NOT A SAFETY / CODE INSPECTION**, and the inspector is NOT required to identify all potential hazards.

In this report, the inspector shall indicate, by checking the appropriate boxes on the form, whether each item was inspected, not inspected, not present or deficient and explain the findings in the corresponding section in the body of the report form. The inspector must check the Deficient (D) box if a condition exists that adversely and materially affects the performance of a system or component or constitutes a hazard to life, limb or property as specified by the TREC Standards of Practice. General deficiencies include inoperability, material distress, water penetration, damage, deterioration, missing components, and unsuitable installation. Comments may be provided by the inspector whether or not an item is deemed deficient. The inspector is not required to prioritize or emphasize the importance of one deficiency over another.

Some items reported may be considered life-safety upgrades to the property. For more information, refer to Texas Real Estate Consumer Notice Concerning Recognized Hazards or Deficiencies below.

**THIS PROPERTY INSPECTION IS NOT A TECHNICALLY EXHAUSTIVE INSPECTION OF THE STRUCTURE, SYSTEMS OR COMPONENTS. THE INSPECTION MAY NOT REVEAL ALL DEFICIENCIES. A REAL ESTATE INSPECTION HELPS TO REDUCE SOME OF THE RISK INVOLVED IN PURCHASING A HOME, BUT IT CANNOT ELIMINATE THESE RISKS, NOR CAN THE INSPECTION ANTICIPATE FUTURE EVENTS OR CHANGES IN PERFORMANCE DUE TO CHANGES IN USE OR OCCUPANCY.** It is recommended that you obtain as much information as is available about this property, including any seller's disclosures, previous inspection reports, engineering reports, building/remodeling permits, and reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should also attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have taken place at this property. It is not the inspector's responsibility to confirm that information obtained from these sources is complete or accurate or that this inspection is consistent with the opinions

expressed in previous or future reports.

**ITEMS IDENTIFIED IN THE REPORT DO NOT OBLIGATE ANY PARTY TO MAKE REPAIRS OR TAKE OTHER ACTIONS, NOR IS THE PURCHASER REQUIRED TO REQUEST THAT THE SELLER TAKE ANY ACTION.** *When a deficiency is reported, it is the client's responsibility to obtain further evaluations and/or cost estimates from qualified service professionals. Any such follow-up should take place prior to the expiration of any time limitations such as option periods. Evaluations by qualified tradesmen may lead to the discovery of additional deficiencies which may involve additional repair costs.* Failure to address deficiencies or comments noted in this report may lead to further damage of the structure or systems and add to the original repair costs. The inspector is not required to provide follow-up services to verify that proper repairs have been made.

Property conditions change with time and use. For example, mechanical devices can fail at any time, plumbing gaskets and seals may crack if the appliance or plumbing fixture is not used often, roof leaks can occur at any time regardless of the apparent condition of the roof, and the performance of the structure and the systems may change due to changes in use or occupancy, effects of weather, etc. These changes or repairs made to the structure after the inspection may render information contained herein obsolete or invalid. ***This report is provided for the specific benefit of the client named above and is based on observations at the time of the inspection. If you did not hire the inspector yourself, reliance on this report may provide incomplete or outdated information.*** Repairs, professional opinions or additional inspection reports may affect the meaning of the information in this report. It is recommended that you hire a licensed inspector to perform an inspection to meet your specific needs and to provide you with current information concerning this property.

### **TEXAS REAL ESTATE CONSUMER NOTICE CONCERNING HAZARDS OR DEFICIENCIES**

Each year, Texans sustain property damage and are injured by accidents in the home. While some accidents may not be avoidable, many other accidents, injuries, and deaths may be avoided through the identification and repair of certain hazardous conditions. Examples of such hazards include:

- malfunctioning, improperly installed or missing ground fault circuit protection (GFCI) devices for electrical receptacles in garages, bathroom, kitchens, and exterior areas;
- malfunctioning arc fault protection (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- the lack of fire safety features, such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

To ensure that consumers are informed of hazards such as these, the Texas Real Estate Commission (TREC) has adopted Standards of Practice requiring licensed inspectors to report these conditions as "Deficient" when performing an inspection for a buyer or seller, if they can be reasonably determined.

These conditions may not have violated building codes or common practices at the time of the construction of the home, or they may have been "**grandfathered**" because they were present prior to the adoption of codes prohibiting such conditions. While the TREC Standards of Practice do not require inspectors to perform a code compliance inspection, TREC considers the potential for injury or property loss from the hazards addressed in the Standards of Practice to be significant enough to warrant this notice.

Contract forms developed by TREC for use by its real estate licensees also inform the buyer of the right to have the home inspected and can provide an option clause permitting the buyer to terminate the contract within a specified time. ***Neither the Standards of Practice nor the TREC contract forms requires a seller to remedy conditions revealed by an inspection. The decision to correct a hazard or any deficiency identified in an inspection report is left to the parties to the contract for the sale or purchase of the home.***

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

**This confidential report is prepared exclusively for Mark Marrows on 04/02/2021.**

---

---

**ADDITIONAL INFORMATION PROVIDED BY INSPECTOR**

---

Inspection Time In: **9 am** Time Out: **12:45 pm** Property was: **Vacant**  
Building Orientation (For Purpose Of This Report Front Faces): **North**  
Weather Conditions During Inspection: **Cloudy Overcast**  
Outside temperature during inspection: **60 ° or Below Degrees**  
Parties present at inspection: **Buyer**  
**Builders Representative**

**THIS REPORT IS PAID AND PREPARED FOR THE EXCLUSIVE USE BY Mark Marrows. THIS COPYRIGHTED REPORT IS NOT VALID WITHOUT THE SIGNED INSPECTION AGREEMENT.**

**THIS REPORT IS NOT TRANSFERABLE FROM CLIENT NAMED ABOVE.**

---

**SCOPE OF INSPECTION**

These standards of practice define the minimum levels of inspection required for substantially completed residential improvements to real property up to four dwelling units. A real estate inspection is a non-technically exhaustive, limited visual survey and basic performance evaluation of the systems and components of a building using normal controls and does not require the use of specialized equipment or procedures. The purpose of the inspection is to provide the client with information regarding the general condition of the residence at the time of inspection. The inspector may provide a higher level of inspection performance than required by these standards of practice and may inspect components and systems in addition to those described by the standards of practice.

**GENERAL LIMITATIONS**

**The inspector is not required to:**

**(A) inspect:**

- (i) items other than those listed within these standards of practice;
- (ii) elevators;
- (iii) detached buildings, decks, docks, fences, or waterfront structures or equipment;
- (iv) anything buried, hidden, latent, or concealed;
- (v) sub-surface drainage systems;
- (vi) automated or programmable control systems, automatic shut-off, photoelectric sensors, timers, clocks, metering devices, signal lights, lightning arrestor system, remote controls, security or data distribution systems, solar panels, outdoor kitchens, gas grills (built-in or free standing), refrigerators (built-in or free standing), wine coolers, ice makers or smart home automation components; or refrigerators (built-in or free standing), wine coolers, ice makers or smart home automation components; or
- (vii) concrete flatwork such as; driveways, sidewalks, walkways, paving stones or patios;

**(B) report:**

- (i) past repairs that appear to be effective and workmanlike except as specifically required by these standards;
- (ii) cosmetic or aesthetic conditions; or
- (iii) wear and tear from ordinary use;

**(C) determine:**

- (i) insurability, warrantability, suitability, adequacy, compatibility, capacity, reliability, marketability, operating costs, recalls, counterfeit products, product lawsuits, life expectancy, age, energy efficiency, vapor barriers, thermostatic performance, compliance with any code, listing, testing or protocol authority, utility sources, or manufacturer or regulatory requirements except as specifically required by these standards;
- (ii) the presence or absence of pests, termites, or other wood-destroying insects or organisms;
- (iii) the presence, absence, or risk of asbestos, lead-based paint, **MOLD**, mildew, corrosive or contaminated drywall "Chinese Drywall" or any other environmental hazard, environmental pathogen, carcinogen, toxin, mycotoxin, pollutant, fungal presence or activity, or poison;
- (iv) types of wood or preservative treatment and fastener compatibility; or
- (v) the cause or source of a conditions;

**(D) anticipate future events or conditions, including but not limited to:**

- (i) decay, deterioration, or damage that may occur after the inspection;
- (ii) deficiencies from abuse, misuse or lack of use;
- (iii) changes in performance of any component or system due to changes in use or occupancy;
- (iv) the consequences of the inspection or its effects on current or future buyers and sellers;
- (v) common household accidents, personal injury, or death;
- (vi) the presence of water penetrations; or
- (vii) future performance of any item;

(E) operate shut-off, safety, stop, pressure or pressure-regulating valves or items requiring the use of codes, keys, combinations, or similar devices;

(F) designate conditions as safe;

(G) recommend or provide engineering, architectural, appraisal, mitigation, physical surveying, realty, or other specialist services;

(H) review historical records, installation instructions, repair plans, cost estimates, disclosure documents, or other reports;

(I) verify sizing, efficiency, or adequacy of the ground surface drainage system;

(J) verify sizing, efficiency, or adequacy of the gutter and downspout system;

(K) operate recirculation or sump pumps;

(L) remedy conditions preventing inspection of any item;

(M) apply open flame or light a pilot to operate any appliance;

(N) turn on decommissioned equipment, systems or utility services; or

(O) provide repair cost estimates, recommendations, or re-inspection services.

**THE CLIENT, BY ACCEPTING THIS PROPERTY INSPECTION REPORT OR RELYING UPON IT IN ANY WAY, EXPRESSLY AGREES TO THE SCOPE OF INSPECTION, GENERAL LIMITATIONS AND INSPECTION AGREEMENT INCLUDED IN THIS INSPECTION REPORT.**

This inspection report is made for the sole purpose of assisting the purchaser to determine his and/or her own opinion of feasibility of purchasing the inspected property and does not warrant or guarantee all defects to be found. If you have any questions or are unclear regarding our findings, please call our office prior to the expiration of any time limitations such as option periods.

This report contains technical information. If you were not present during this inspection, please call the office to arrange for a consultation with your inspector. If you choose not to consult with the inspector, this inspection company cannot be held liable for your understanding or misunderstanding of the reports content.

The contents of this report are for the sole use of the client named above and no other person or party may rely on this report for any reason or purpose whatsoever without the prior written consent of the inspector who authored the report. Any person or party who chooses to rely on this report for any reason or purpose whatsoever without the express written consent of the inspector does so at their own risk and by doing so without the prior written consent of the inspector waives any claim of error or deficiency in this report.

This report is not intended to be used for determining insurability or warrantability of the structure and may not conform to the Texas Department of Insurance guidelines for property insurability. *This report is not to be used by or for any property and/or home warranty company.*

The digital pictures within this report are a representative sample of inaccessible areas, deficiencies or damages in place and should not be considered to show all of the inaccessible areas, deficiencies or damages observed. There will be inaccessible areas, deficiencies or damages not represented with digital imaging.

---

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

## I. STRUCTURAL SYSTEMS

### A. Foundations

Type of Foundation(s): Slab on Ground

Comments:

#### Foundation Is Performing Adequately

In my opinion, the foundation appears to be providing adequate support for the structure at the time of this inspection. I did not observe any apparent evidence that would indicate the presence of adverse performance or significant deficiencies in the foundation. The interior and exterior stress indicators showed little affects of adverse performance and I perceived the foundation to contain no significant unlevelness after walking the 1st level floors.

**Notice:** This inspection is one of first impression and the inspector was not provided with any historical information pertaining to the structural integrity of the inspected real property. This is a limited cursory and visual survey of the accessible general conditions and circumstances present at the time of this inspection. Opinions are based on general observations made without the use of specialized tools or procedures. Therefore, the opinions expressed are one of apparent conditions and not of absolute fact and are only good for the date and time of this inspection. The inspection of the foundation may show it to be providing adequate support for the structure or having movement typical to this region, at the time of the inspection. This does not guarantee the future life or failure of the foundation. ***The Inspector is not a structural engineer. This inspection is not an engineering report or evaluation and should not be considered one, either expressed or implied.*** If any cause of concern is noted on this report, or if you want further evaluation, you should consider an evaluation by an engineer of your choice.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**B. Grading and Drainage**

*Comments:*

**Grading & Drainage**

All components were found to be performing and in satisfactory condition on the day of the inspection.

**Gutter & Downspout System**

- **Note:** The gutter downspouts should discharge water at least thirty-six inches (36") away from the foundation perimeter beam. Storm water should be encouraged to flow away from the structure at the points of discharge.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**C. Roof Covering Materials**

Type(s) of Roof Covering: Composition

Viewed From: Walked on roof

Comments:

**General Photos of Roof**





I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

### Roof Covering

**Note:** When D (**D=Deficient**) is marked. It is recommended that all of the roofing material and its components be fully evaluated by a Qualified Roofing Specialist, prior to the expiration of any time limitations such as option or warranty periods.

- Damaged shingles were observed on the left side of the roof structure.



- Damaged shingles were observed on the back side of the roof structure.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

### Flashing Details

- Recommend painting all metal flashing & flues to help prevent rust/deterioration.



- The storm collar(s) at the roof level gas equipment vent pipe(s) need to be properly sealed to help prevent water intrusion into the structure.



**Notice:** Life expectancy of the roofing material is not covered by this property inspection report. If any concerns exist about the roof covering life expectancy or potential for future problems, a roofing specialist should be consulted. The Inspector cannot offer an opinion or warranty as to whether the roof has leaked in the past, leaks now, or may be subject to future leaks, either expressed or implied.

The inspection of this roof may show it to be functioning as intended or in need of minor repairs. This inspection does not determine the insurability of the roof. You are strongly encouraged to have your Insurance Company physically inspect the roof, prior to the expiration of any time limitations such as option or warranty periods, to fully evaluate the insurability of the roof.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

- 
- 
- 
- 

**D. Roof Structures and Attics**

*Viewed From:* From Interior of Attic

*Approximate Average Depth of Insulation:* 13+”

(**Note:** Generally recommended depth of attic floor insulation is approximately 10+ inches to achieve a R30 rating.)



*Insulation Type:* Loose Filled

*Description of Roof Structure:* Rafter Assembly

*Attic Accessibility:* Partial

*Comments:*

**General Photos of Rafter Assembly**

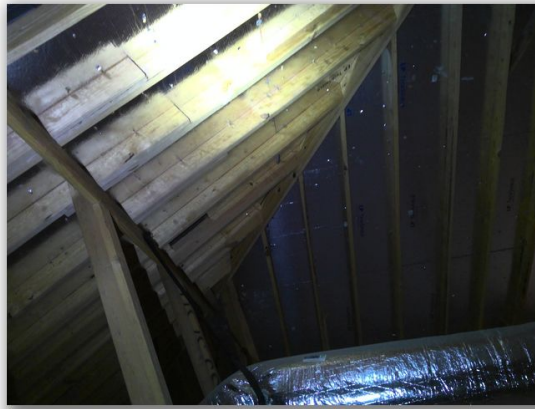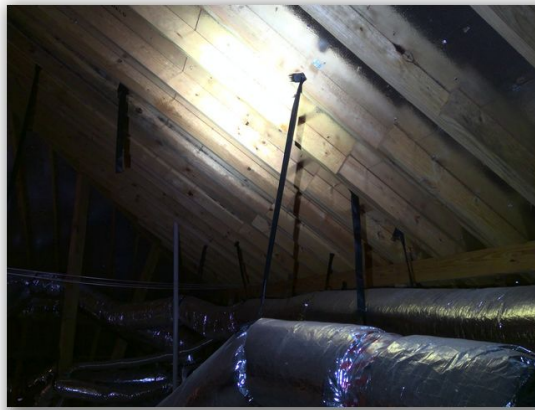

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**Roof Structure**

- **Note:** Visible evidence of rodent activity was observed in the attic area. It is recommended to have a Certified Pest Control Operator further evaluate this condition and make corrections as necessary.



**Attic Ventilation**

All components were found to be performing and in satisfactory condition on the day of the inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**Attic Insulation**

All components were found to be performing and in satisfactory condition on the day of the inspection.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

### Attic Ladder

- The attic ladder was observed to be damaged and the ladder will not close properly.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**E. Walls (Interior and Exterior)**

*Comments:*

*Description of Exterior Cladding: Brick Veneer*

**Interior Walls & Surfaces**

- Caulking improvements are recommended at one or more of the interior windows.



- Incomplete wall repairs were observed in the master bedroom closet area.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

### Exterior Walls & Surfaces

- The area between the exterior cladding / veneer and all of the wall penetrations / openings need to be properly sealed. Areas such as utility connections, downspouts, hose bibbs, lighting fixtures, receptacles etc. It is recommended to use an elastomeric caulking / sealant.





I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

- Caulking improvements are recommended for the area between the exterior veneer and the window frames. It is recommended to use an elastomeric caulking.



I=Inspected

NI=Not Inspected


NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|



- The wall expansion joint(s) need to be properly sealed on the front of structure/outside front door of the structure. It is recommended to use an elastomeric caulking.

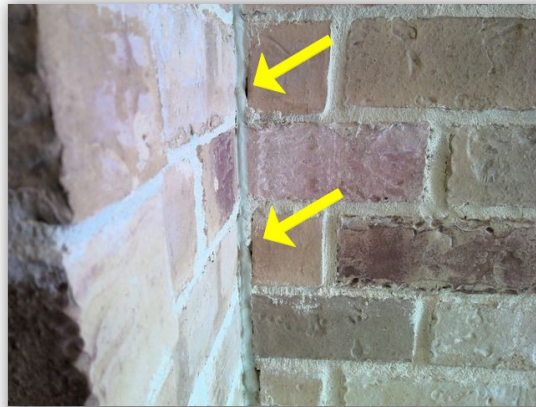

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

- The steel lintels over the exterior doors and windows need to be painted.



- **Note:** Minor mortar and/or brick cracks were observed in the exterior veneer on the right side of the structure.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**F. Ceilings and Floors**

*Comments:*

**Ceilings**

All components were found to be performing and in satisfactory condition on the day of the inspection.

**Floors**

All components were found to be performing and in satisfactory condition on the day of the inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**G. Doors (Interior and Exterior)**

*Comments:*

**Interior Doors**

- The door hardware is missing to the front corner bedroom closet.
- The door hardware is missing to the side middle bedroom closet front corner bedroom closet.
- \*\*\*No bottom bracket/brace\*\*\*



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

### Exterior Doors

- The door hardware is loose to the backyard entry door.



### Overhead Garage Door

- The garage door shakes excessively when starting to close. Further evaluation is recommended.



### Garage Entry Door

All components were found to be performing and in satisfactory condition on the day of the inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**H. Windows**

*Comments:*

**Window Screens**

All components were found to be performing and in satisfactory condition on the day of the inspection.

**Windows**

- Cracked and/or broken window glass was observed in the front corner bedroom.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**I. Stairways (Interior and Exterior)**

*Comments:*

**J. Fireplaces and Chimneys**

*Comments:*

**K. Porches, Balconies, Decks, and Carports**

*Comments:*

**Porches**

All components were found to be performing and in satisfactory condition on the day of the inspection.

**Driveway**

All components were found to be performing and in satisfactory condition on the day of the inspection.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

## II. ELECTRICAL SYSTEMS

### A. Service Entrance and Panels

*Comments:*


#### **Panel Box**

*Box Rating and/or Main Disconnect Rating: 150 amps*

*Box Location: Garage*

*Cabinet Manufacturer: EATON*

*Branch Circuit Wire Type: Copper*

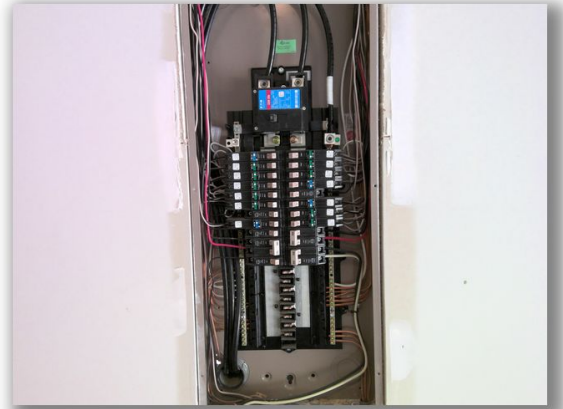

I=Inspected


NI=Not Inspected

NP=Not Present


D=Deficient

I NI NP D

- White hot wires should be labeled with black tape.
- The panel box is not mounted to be flush with the drywall.

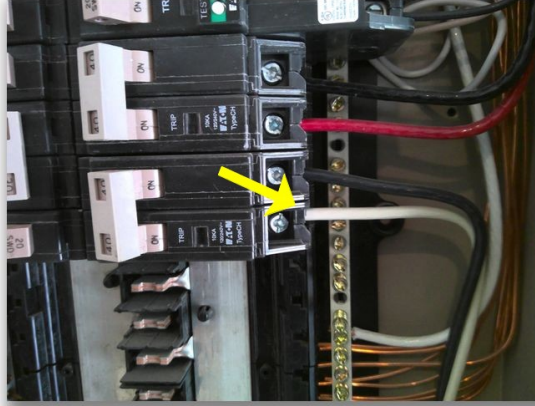

- The breakers (overcurrent devices) in the electrical panel are not properly labeled.

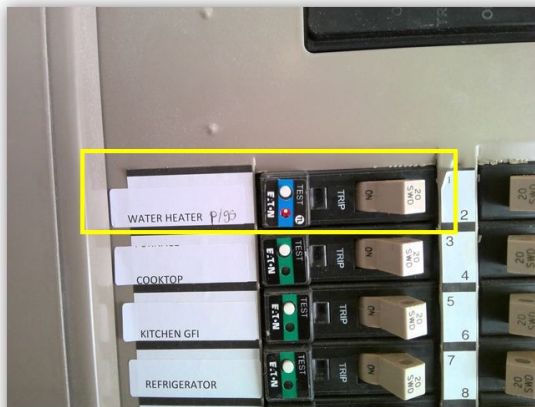

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient


|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**Grounding / Bonding**

- Gas pipe bonding was observed at the gas meter entrance area.



**General Photo(s) of Grounding Electrode(s)**

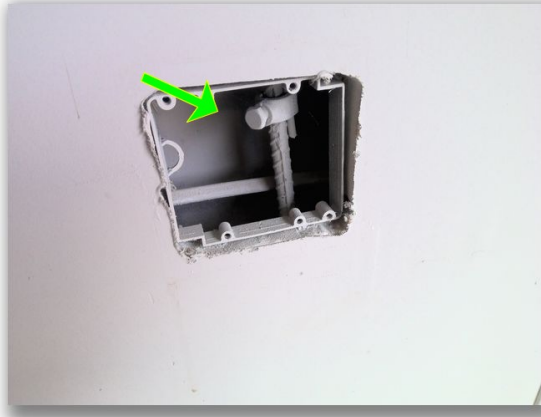

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

- 

**B. Branch Circuits, Connected Devices, and Fixtures**

*Type of Wiring:* Copper

*Comments:*

**Receptacle Outlets**

**Note:** Some of the receptacles in the home were inaccessible and could not be reached for inspection due to height, personal effects, heavy storage, furniture or conditions outside the control of the inspector.



All components were found to be performing and in satisfactory condition on the day of the inspection.

**Switches**

- **Note:** I was unable to determine the operation end of one or more of the switches.

**Fixtures**

- One or more of the light fixtures appear to be inoperative in various locations throughout the house. This may be due to a bad bulb or some other unknown condition. This condition should be further evaluated and corrected as necessary.
- One or more of the light fixtures are loose at the ceiling mount in the half bathroom.

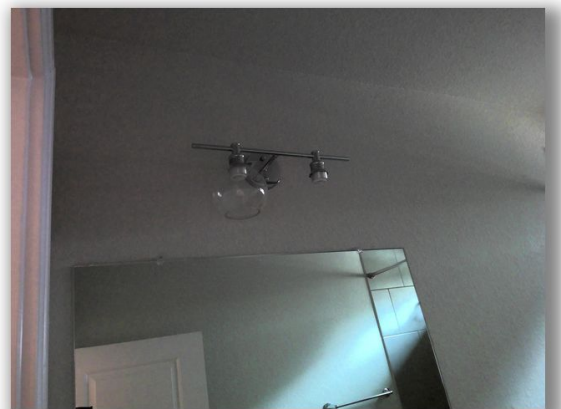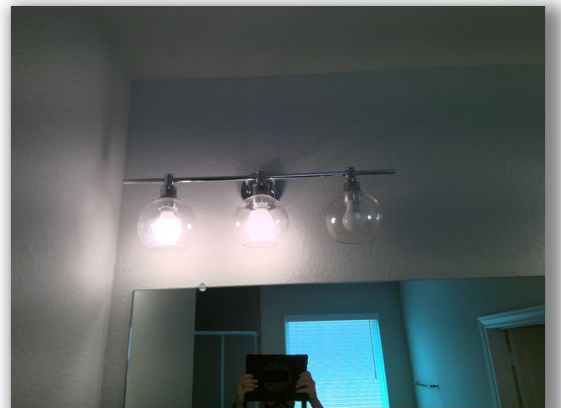

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

- One or more of the light fixtures were observed to be damaged in the kitchen.



- The ceiling fan appears to be inoperative in the master bedroom.
- The ceiling fan appears to be missing in the living room.



### Smoke Alarms

**Note:** It is recommended to replace the batteries in all of the smoke detectors once a year for reasons of safety.

All components were found to be performing and in satisfactory condition on the day of the inspection.

### Carbon Monoxide Alarms

All components were found to be performing and in satisfactory condition on the day of the inspection.

### Doorbell / Chime

All components were found to be performing and in satisfactory condition on the day of the inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

### III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

#### A. Heating Equipment

Type of Systems:


Energy Sources:

Comments:

**Central Heating System** – Energy Source: Gas

Brand Name: Lennox

This component appears to be performing adequately at the time of this inspection.

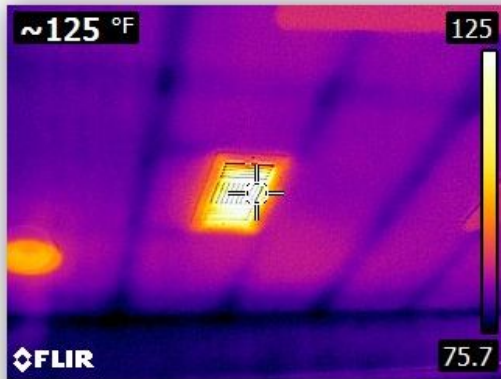

I=Inspected

NI=Not Inspected


NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

The HVAC system needs to be checked and serviced by a Qualified / Licensed HVAC Technician. The observations made to support the rendering of this opinion are listed but may not be limited to the following:

- The heating unit vent pipe is separated in the attic. This configuration will emit Carbon Monoxide into the attic area, which is a known safety hazard.
- The heating unit flue (vent pipe) has inadequate clearance from combustibles. Double walled vent pipes should have at least 1-inch of clearance and single walled vent pipes should have at least 6-inches of clearance from combustible material.

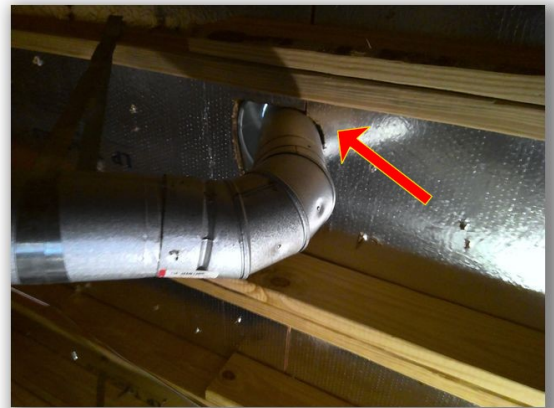

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

**B. Cooling Equipment**

Type of Systems:

Comments:

**Central Cooling System**

Today's Temperature Differential (Delta-T): 21

Approximate System Age: **2020**


Approximate System SEER: **Unable To Determine**

Approximate System Size: **4 ton**

Location: **At Attic Unit**

Brand Name: Lennox

This component appears to be performing adequately at the time of this inspection.

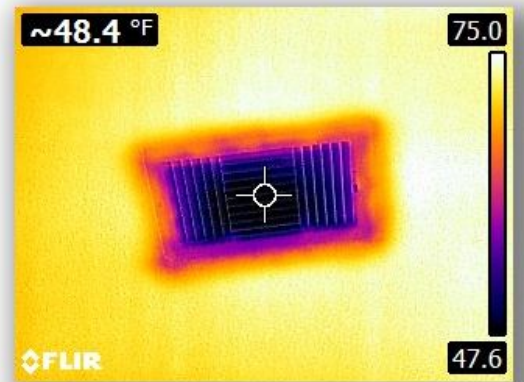



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

- The manufacturers listing plate on the outside condenser/coil list that the maximum over current device (breaker) to be used should not exceed 35-amp. There is a 40-amp breaker in place at this time. This breaker in place does not meet the manufacturers listing plate requirements.



**Notice:** Temperature differential readings are an accepted industry standard of practice for testing the proper operation of the cooling system. Our company policy normal acceptable range is considered approximately **between 15 to 20 degrees °F** total difference (Delta-T) measured between the return air and supply air within close proximity of the related coils of the system being evaluated. Conditions such as but not limited to; excessive humidity, high or low outdoor temperatures or restricted airflow may indicate abnormal operation even through the equipment is functioning basically as designed and occasionally may indicate normal operation in spite of an equipment malfunction. *The inspector will not be able to anticipate future events, conditions or changes in performance of any component or system due to changes in use or occupancy. The inspector makes no guarantee or warranty, express or implied, as to future performance of any item, system or component.*

I=Inspected

NI=Not Inspected

NP=Not Present


D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**C. Duct Systems, Chases, and Vents**

*Comments:*

- The duct work in the attic area appears to have excessive sags between the supports. This condition can cause pressure loss and affect the airflow through the duct system.

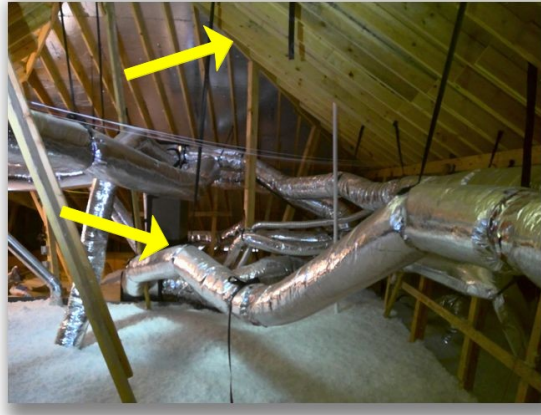

I=Inspected



NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**General Photo(s) of duct work**

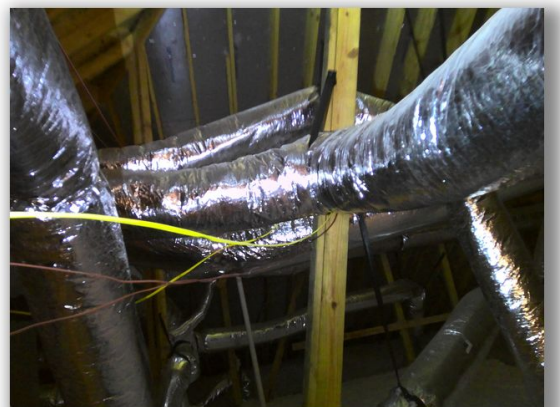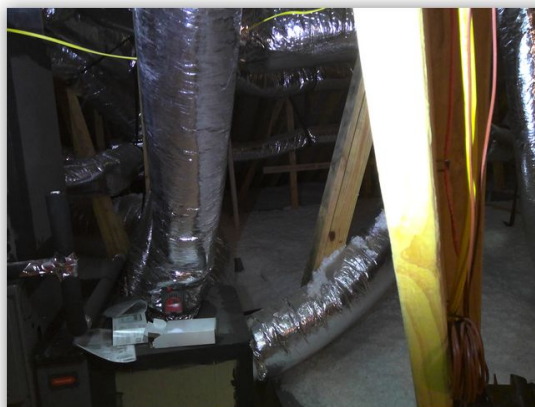

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

#### IV. PLUMBING SYSTEM

##### A. Plumbing Supply, Distribution Systems and Fixtures

*Location of water meter: Within 5-feet of Front Curb*

*Location of main water supply valve: Garage Area*

*Static water pressure reading: 60 to 70 psi*

*Comments:*



##### Exterior Faucets/Fixtures

All components were found to be performing and in satisfactory condition on the day of the inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**Laundry Connections**

All components were found to be performing and in satisfactory condition on the day of the inspection.



**Kitchen Sink**

- The sink has some surface damage.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

**Hall Bathroom**

*Lavatory / Sink*

All components were found to be performing and in satisfactory condition on the day of the inspection.

*Bathtub*

All components were found to be performing and in satisfactory condition on the day of the inspection.

*Shower*

All components were found to be performing and in satisfactory condition on the day of the inspection.

*Commode / Toilet*

All components were found to be performing and in satisfactory condition on the day of the inspection.

**Half Bath**

*Lavatory / Sink*

All components were found to be performing and in satisfactory condition on the day of the inspection.

*Commode / Toilet*

All components were found to be performing and in satisfactory condition on the day of the inspection.

**Master Bathroom**

*Left Lavatory / Sink*

All components were found to be performing and in satisfactory condition on the day of the inspection.

*Right Lavatory / Sink*


All components were found to be performing and in satisfactory condition on the day of the inspection.

*Bathtub*

All components were found to be performing and in satisfactory condition on the day of the inspection.

*Shower*

- The shower was not achieving the same temperature as the other fixtures throughout the house. Further evaluation is recommended.

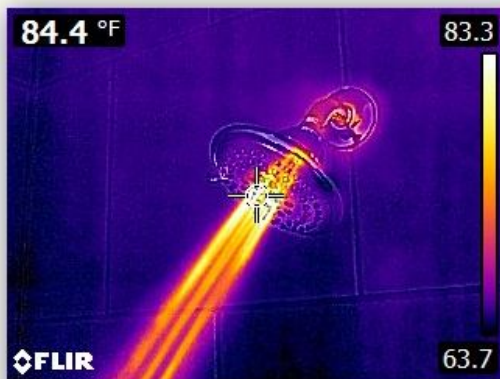

*Commode / Toilet*

All components were found to be performing and in satisfactory condition on the day of the inspection.

**Notice:** The Inspector has attempted to discover and report conditions requiring further evaluation or repair. However; determining the condition of any component that is not visible and/or accessible, such as plumbing components that are buried, beneath the foundation, located within construction voids or otherwise concealed, and reporting any deficiency that does not appear or become evident during our limited cursory and visual survey is outside the scope of this inspection. *The inspector will not be able to anticipate future events, conditions or changes in performance of any component or system due to changes in use or occupancy. The inspector makes no guarantee or warranty, express or implied, as to future performance of any item, system or component.*

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

- 

**B. Drains, Wastes, and Vents**

*Comments:*

All components were found to be performing and in satisfactory condition on the day of the inspection.

**General Photo(s) of Plumbing Cleanout(s)**

**Note:** The inspector was unable to locate the main plumbing cleanout at the time of inspection.



**Notice:** Reporting the condition of drains, wastes and vent piping that is not completely visible and/or accessible or; reporting any defect or deficiency that requires extended use of the system to develop or does not become evident during our limited cursory and visual survey is outside the scope of the inspection. This is a limited cursory and visual survey of the accessible general conditions and circumstances present at the time of this inspection. Opinions are based on general observations made without the use of specialized tools or procedures. Therefore, the opinions expressed are one of apparent conditions and not of absolute fact and are only good for the date and time of this inspection. ***The inspector will not be able to anticipate future events, conditions or changes in performance of any component or system due to changes in use or occupancy. The inspector makes no guarantee or warranty, express or implied, as to future performance of any item, system or component.***

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**C. Water Heating Equipment**

*Energy Sources:*

*Capacity:*

*Comments:*

**Water Heater** – *Energy Source: Gas*

*Location: Attic*


*Approximate Capacity: 50 Gallons*

*Approximate Age: 2019 Approximate Design Life: 15 years*

*Brand Name: Bradford White*

This component appears to be performing adequately at the time of this inspection. It is achieving an operation, function, or configuration consistent with accepted industry practices for its age.

- The vent pipe is not properly mounted at the top of the water heater. This configuration will emit Carbon Monoxide into the heater compartment, which is a known safety hazard.

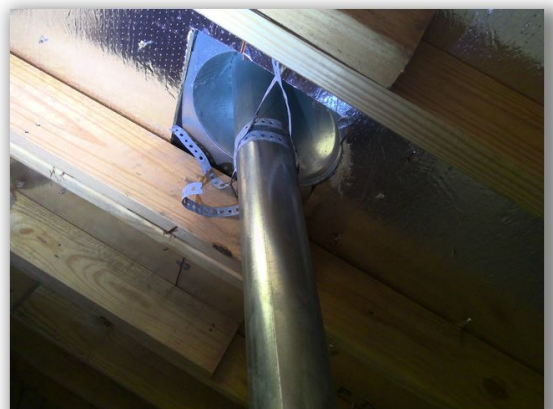






I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

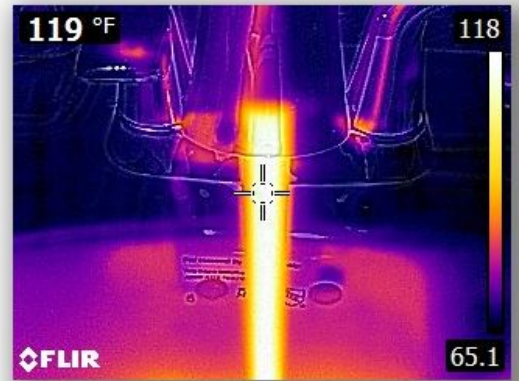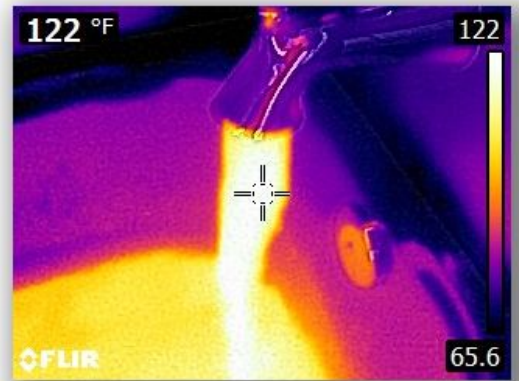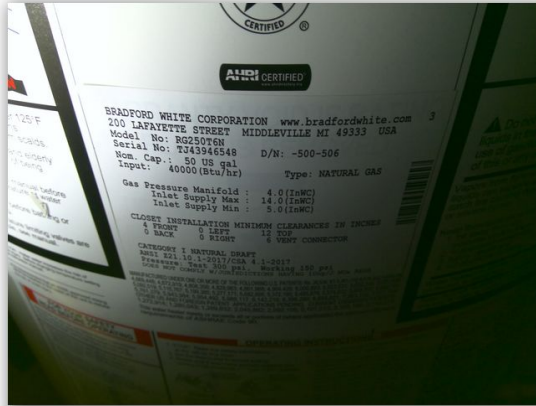





I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

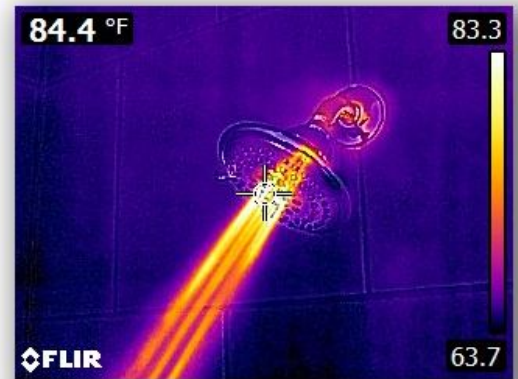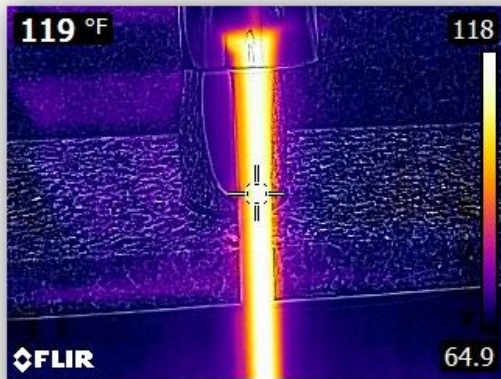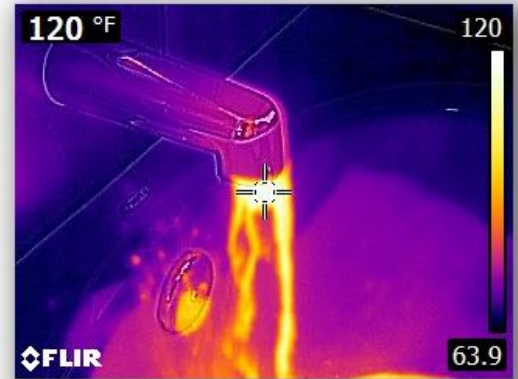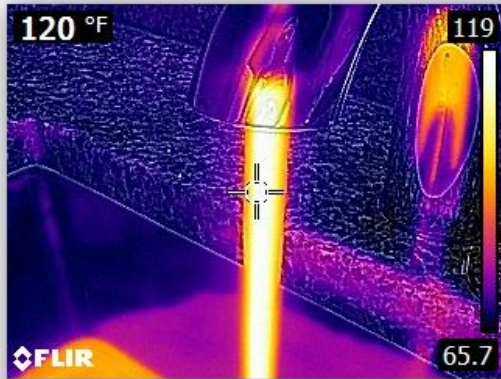

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

- 
- 
- 
- 

**D. Hydro-Massage Therapy Equipment**

*Comments:*


- 
- 
- 
- 

**E. Gas Distribution System**

*Comments:*

This component appears to be performing adequately at the time of this inspection.

**General Photo(s) of Inspector Checking Gas Lines**

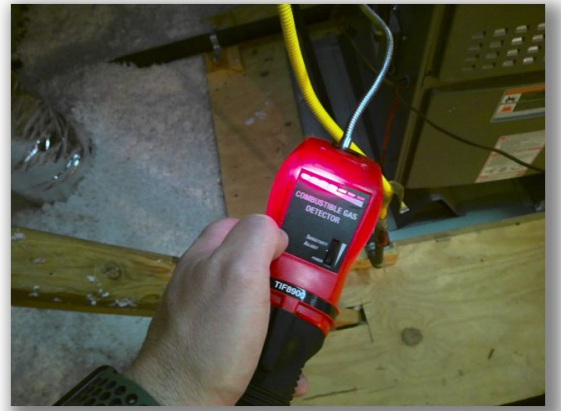

**I=Inspected**

**NI=Not Inspected**

**NP=Not Present**

**D=Deficient**

|                  |
|------------------|
| <b>I NI NP D</b> |
|------------------|

**Notice:** The Inspector will use a combustible gas leak detector on accessible gas lines, joints, unions and connectors and report visible deficiencies found at the time and date of the inspection. The inspector inspects the gas lines from the point they enter the structure and will complete the inspection without digging, damaging property, permanent construction or building finish. When performing the inspection, the inspector will keep in consideration the age of the system and normal wear and tear from ordinary use when rendering opinions.

The inspector is not required to and will not inspect sacrificial anode bonding or for its existence. The Inspector is not licensed to and will not perform a pressure test on the gas line system. The Inspector cannot detect gas leaks below the finished grade (underground), construction voids, between the walls or behind fireplace hearths. Propane tanks will not be inspected. If any further concerns exist about possible gas line failure and/or deficiencies or code compliance, we recommend the buyer have the gas system further evaluated by the local controlling gas supplier and/or a qualified licensed master plumber prior to the expiration of any time limitations such as option or warranty periods.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

## V. APPLIANCES

### A. Dishwashers

*Comments:*

**Brand Name:** General Electric – GE

- The dishwasher was inoperative at the time of this inspection.



### B. Food Waste Disposers

*Comments:*

- The food waster disposer was unusually noisy at the time of the inspection.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

- 
- 
- 
- 

**C. Range Hood and Exhaust Systems**

*Comments:*

**Range Exhaust Systems**

This component appears to be performing adequately at the time of this inspection.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

- 
- 
- 
- 

**D. Ranges, Cooktops, and Ovens**

*Comments:*

**Range Brand Name:** General Electric – GE

This component appears to be performing adequately at the time of this inspection.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

- 

**E. Microwave Ovens**

*Comments:*





I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

**F. Mechanical Exhaust Vents and Bathroom Heaters**

*Comments:*

- **General Photo(s) of Mechanical Exhaust Vents**



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

- The ducting to one of the mechanical exhaust fans was observed to be separated in the attic area over the master bathroom.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

- 
- 
- 
- 

**G. Garage Door Operators**

*Comments:*

This component appears to be performing adequately at the time of this inspection.

- 
- 
- 
- 

**H. Dryer Exhaust Systems**

*Comments:*

This component appears to be performing adequately at the time of this inspection.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

## VI. OPTIONAL SYSTEMS

### A. Landscape Irrigation (Sprinkler) Systems

*Comments:*

When the system is operational, all of the sprinkler system associated components are inspected and operated in the manual settings only.

Note: Some municipalities now require moisture (rain/freeze) sensors to be installed on all new installation and existing sprinkler systems. Our company does not maintain a list of municipalities that require the installation of a moisture sensor. Please check with your municipality for moisture sensor requirements. Sprinkler system equipped with a moisture (rain/freeze) sensor  Yes or  No.

Total Number of Zones Wired: 8

### Sprinkler System and Associated Components

#### General Pictures of Sprinkler System Back-flow Preventer, Control Box, & Rain Sensor



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

|   |    |    |   |
|---|----|----|---|
| I | NI | NP | D |
|---|----|----|---|

- One or more of the sprinkler heads do not disperse water in stations(s); 1.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



- 
- 
- 
- 

**B. Thermal Imaging / Infrared**

*Comments:*

**Thermal Imaging / Infrared**

All components were found to be performing and in satisfactory condition on the day of the inspection.

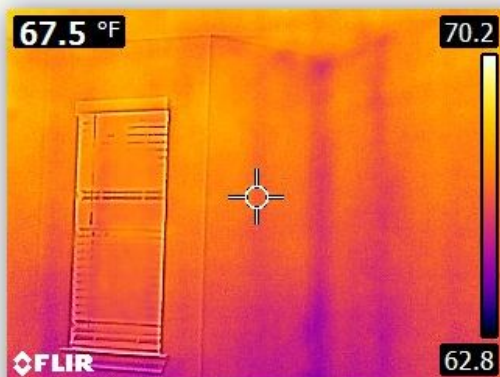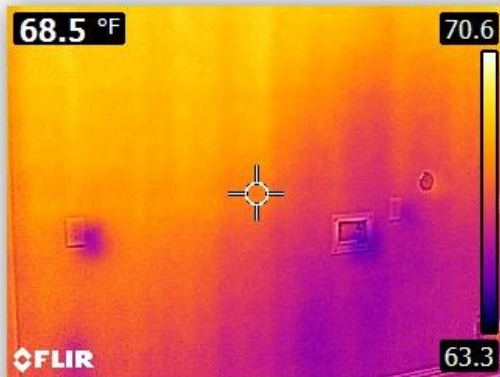




I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

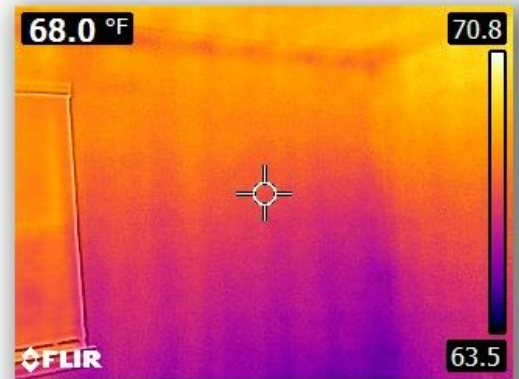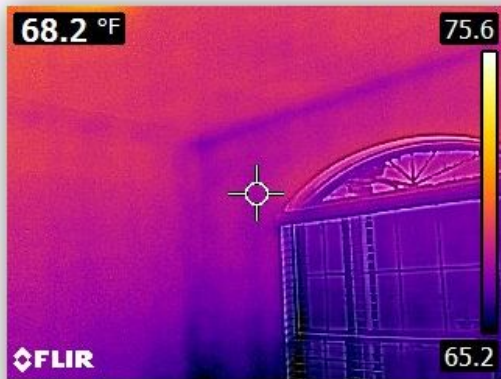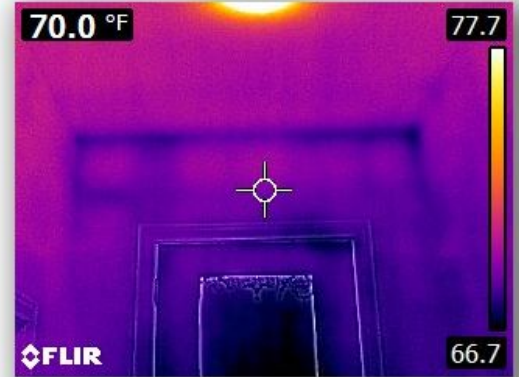

**INSPECTION AGREEMENT**  
**PLEASE READ THIS AGREEMENT CAREFULLY BEFORE SIGNING**

This Inspection Agreement (herein after known as the Agreement) is entered into on this day, 04/02/2021, between Mark Marrows (herein known as the Client) and Texas Edge Home Inspections, PLLC (herein known as the Inspector) for the purpose of performing a general property condition inspection concerning 7854 Green Trail Dr (herein known as the property).

**I. SCOPE OF SERVICES**

- A. A real estate inspection is a non-technically exhaustive, limited visual survey and basic performance evaluation of the systems and components of a building using normal controls and does not require the use of specialized equipment or procedures. The purpose of the inspection is to provide the Client with information regarding the general condition of the Property at the time of inspection.
- B. In exchange for the inspection fee (\$) paid by the Client, the Inspector agrees to provide the Client with an Inspection Report setting out the Inspector's professional opinions concerning the condition of the Property further described in the report. The inspection will be performed in accordance with the Standards of Practice promulgated by the Texas Real Estate Commission. Inspector will attempt to identify major defects and problems with the Property. However, Client acknowledges that the Inspection Report may not identify all defects or problems.
- C. The inspection is limited to those items which are easily accessible, seen, viewed or capable of being approached, entered and/or operated by the Inspector at the time of the inspection as set out in the Inspection Report. The Inspector will not climb over obstacles, move furnishings or large, heavy, or fragile objects, remove walls, floors, wall coverings, floor coverings and other obstructions in order to inspect concealed items. The inspector will not turn on decommissioned equipment, systems, utility services. Systems, components and conditions which are not specifically addressed in the Inspection Report are excluded.
- D. The Inspection Report may indicate one of the following opinions of the Inspector regarding a particular item:
  - 1. The item is performing its intended function, achieving an operation, function or configuration relative to accepted industry standard practices with consideration of age and normal wear and tear from ordinary use at the time of the inspection;
  - 2. The item is in need of replacement, maintenance or repair; or
  - 3. Further evaluation by an expert is recommended.

**II. INSPECTION REPORT**

- A. The Inspection Report provided by the Inspector will contain the Inspector's professional, good-faith opinions concerning the need for repair or replacement of certain observable items. All statements in the report are the Inspector's opinions and should not be construed as statements of fact or factual representations concerning the Property. **By signing this Agreement, the Client understands that the services provided by the Inspector fall within the Professional Services Exemption of the Texas Deceptive Trade Practices Act ("DTPA") and agrees that no cause of action exists under the DTPA related to the services provided.**
- B. **Unless specifically stated, the report WILL NOT INCLUDE and should not be read to indicate OPINIONS AS TO;**
  - 1. the presence, absence, or risk of environmental conditions such as asbestos, lead-based paint, **MOLD**, mildew, corrosive or contaminated drywall "Chinese Drywall" or any other environmental hazard, environmental pathogen, carcinogen, toxin, mycotoxin, pollutant, fungal presence or activity, poison, presence of toxic or hazardous waste or substances;
  - 2. presence or absence of pests, termites, or other wood-destroying insects or organisms;
  - 3. **COMPLIANCE WITH compliance with any ordinances, statutes or restrictions, CODE, listing, testing or protocol authority, utility sources, property association guidelines or requirements, manufacturer or regulatory requirements;**
  - 4. insurability, efficiency warrantability, suitability, adequacy, compatibility, capacity, durability, quality reliability, marketability, operating costs, recalls, counterfeit products, product lawsuits, age, energy efficiency; or
  - 5. anticipate future life or future events or changes in performance of any item inspected.
- C. The Inspection Report is not a substitute for disclosures by sellers and real estate agents. Said disclosure statements should be carefully investigated for any material facts that may influence or effect the desirability and/or market value of the Property.
- D. As noted above, the Inspection Report may state that further evaluation of certain items is needed by an expert in the field of the item inspected. By signing this Agreement, Client acknowledges that qualified experts may be needed to further evaluate such items as structural systems, foundations, grading, drainage, roofing, plumbing, electrical systems, HVAC, appliances, sprinkler systems pool system and components, fire/smoke detection systems, septic systems and other observable items as noted in the report. Any such follow-up should take place prior to the expiration of any time limitations such as option or warranty periods.



### III. DISCLAIMER OF WARRANTIES

The inspector makes no guarantee or warranty, express or implied, as to any of the following:

1. That all defects have been found or that the Inspector will pay for repair of undisclosed defects;
2. That any of the items inspected are designed or constructed in a good and workmanlike manner;
3. That any of the items inspected will continue to perform in the future as they are performing at time of the inspection; and
4. That any of the items inspected are merchantable or fit for any particular purpose.

### IV. LIMITATION OF LIABILITY

**BY SIGNING THIS AGREEMENT, CLIENT ACKNOWLEDGES THAT THE INSPECTION FEE PAID TO THE INSPECTOR IS NOMINAL GIVEN THE RISK OF LIABILITY ASSOCIATED WITH PERFORMING HOME INSPECTIONS IF LIABILITY COULD NOT BE LIMITED. CLIENT ACKNOWLEDGES THAT WITHOUT THE ABILITY TO LIMIT LIABILITY, THE INSPECTOR WOULD BE FORCED TO CHARGE CLIENT MUCH MORE THAN THE INSPECTION FEE FOR THE INSPECTOR'S SERVICES. CLIENT ACKNOWLEDGES BEING GIVEN THE OPPORTUNITY TO HAVE THIS AGREEMENT REVIEWED BY COUNSEL OF HIS OR HER OWN CHOOSING AND FURTHER ACKNOWLEDGES THE OPPORTUNITY OF HIRING A DIFFERENT INSPECTOR TO PERFORM THE INSPECTION. BY SIGNING THIS AGREEMENT, CLIENT AGREES TO LIABILITY BEING LIMITED TO THE AMOUNT OF THE INSPECTION FEE PAID BY THE CLIENT. \$**

### V. DISPUTE RESOLUTION

In the event a dispute arises regarding an inspection that has been performed under this agreement, the Client agrees to notify the Inspector within ten (10) days of the date the Client discovers the basis for the dispute so as to give the Inspector a reasonable opportunity to reinspect the property. Client agrees to allow reinspection before any corrective action is taken. Client agrees not to disturb or repair or have repaired anything which might constitute evidence relating to a complaint against the Inspector. Client further agrees that the Inspector can either conduct the reinspection himself or can employ others (at Inspector's expense) to reinspect the property, or both. In the event a dispute cannot be resolved by the Client and the Inspector, the parties agree that any dispute or controversy shall be resolved by mandatory and binding arbitration administered by the American Arbitration Association ("AAA") pursuant to Chapter 171 of the Texas Civil Practice & Remedies Code and in accordance with this arbitration agreement and the commercial arbitration rules of the AAA.

### VI. ATTORNEY'S FEES

The Inspector and the Client agree that in the event any dispute or controversy arises as a result of this Agreement, and the services provided hereunder, the prevailing party in that dispute shall be entitled to recover all of the prevailing party's reasonable and necessary attorneys' fees and costs incurred by that party.

### VII. EXCLUSIVITY

The Inspection Report is to be prepared exclusively for the Client and is not transferable to anyone in any form. Client gives permission for the Inspector to discuss report findings with real estate agents, specialists, or repair persons for the sake of clarification. A copy of the Inspection Report may be released to the buyers Real Estate Agent.

**BY MY SIGNATURE BELOW, I ACKNOWLEDGE THAT I HAVE READ THIS CONTRACT AND THAT THE INSPECTOR DID NOT COERCE, PRESSURE OR RUSH ME TO EXECUTE THIS CONTRACT WITHOUT OPPORTUNITY TO FULLY REVIEW THE CONTRACT AND IF NECESSARY HAVE THE CONTRACT REVIEWED BY AN ATTORNEY; THAT INSPECTOR AGREED TO RESCHEDULE THE INSPECTION IN THE EVENT I REQUIRED ADDITIONAL TIME TO REVIEW THE CONTRACT; THAT I UNDERSTAND THE TERMS AND CONDITIONS AND THAT I AGREE TO BE BOUND BY THESE TERMS AND CONDITIONS. IF CLIENT IS MARRIED, CLIENT REPRESENTS THAT THIS OBLIGATION IS A FAMILY OBLIGATION INCURRED IN THE INTEREST OF THE FAMILY.**

Client Signature: \_\_\_\_\_

Date: 04/02/2021

Inspector: Matthew Brading