1997 Ferrari 355 ZFFXR48A5V0106798

Item	Status	Mileage	Cost
106798	Purchased 3/21/12		
Replace CV joint boot / dye seats	Completed 3/16/2012	32,458	\$1,067.97
Touch Up Paint	Purchased 4/10/2012	32,458	\$22.64
Lift Supports (Sachs SG404018 4@29.97)	Completed 4/14/2012	33,418	\$119.88
Air Temperature Sensor (Bosch 0280130039)	Completed 4/21/2012	33,456	\$22.23
Oil Pressure Sending Unit/Adapter	Completed 4/21/2012	33,456	\$80.00
HVAC cover	Completed 4/21/2012	33,456	\$80.00
MOMO Steering wheel	Completed 4/21/2012	33,456	\$370.00
Roof fluid filled	Completed 4/21/2012	33,456	\$10.00
Continental ExtremeContact DW	Completed 5/6/2012	33,602	\$961.99
Continental Tires Mount & Balance	Completed 5/6/2012	33,602	\$120.00
Replace passenger foot rest	Completed 9/7/2012	33,619	\$146.50
Roof elastic replaced / fluid filled	Completed 3/16/2013	33,621	\$20.00
Oil & Filter Change Valvoline 5/40	Completed 3/23/2013	33,630	\$250.00
Air Filter Mounts (6@12.50)	Completed 4/12/2013	33,633	\$75.00
Leather restoration kit	Purchased 4/18/2013	33,633	\$187.95
Cat delete pipes	Completed 8/10/2013	34,422	\$425.00
Oil & Filter Change Mobil 1 5/40	Completed 3/21/2014	35,207	\$250.00
Battery cover replaced	Completed 8/1/2014	35,900	\$100.00
Oil & Filter Change Mobil 1 5/40	Completed 3/27/2015	36,498	\$250.00
Brake Pads replaced	Completed 4/5/2015	36,535	\$690.00
Brake Fluid flushed	Completed 4/5/2015	36,535	\$12.00
Oil Analyisis (from 3/27/15 oil change)	Completed 4/27/2015	36,498	\$30.00
Rear diffusers replaced	Completed 6/12/2015	36,651	\$400.00
Major Service Kit	Purchased 1/27/2016	37,342	\$1,311.50
Major Service	Completed 4/13/2016	37,364	\$9,964.61
Oil & Filter Change Mobil 1 5/40	Completed 6/24/2017	37,995	\$250.00
Replace O2 sensors (Bosch 13819/13820)	Completed 6/24/2017	37,995	\$451.96
Replace Tenax fasteners on top cover	Completed 6/24/2017	37,995	\$61.69
Oil & Filter Change	Completed 5/6/2018	38,412	\$250.00
Battery replaced	Completed 8/11/2018	28,507	\$138.22
Roof elastic replaced / fluid flushed	Completed 6/6/2020	38,922	\$25.00
Oil & Filter Change Red Line 5/40	Completed 9/29/20	39,093	\$355.33




Vehicle History Report™

US \$39.99

1997 FERRARI F355 SPIDER

VIN: ZFFXR48A5V0106798 CONVERTIBLE 3.5L V8 F DOHC 40V GASOLINE REAR WHEEL DRIVE

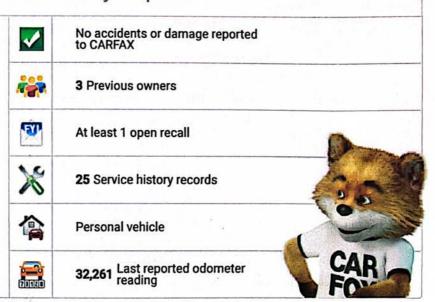

This CARFAX Vehicle History Report is based only on information supplied to CARFAX and available as of 9/1/20 at 12:12:30 PM (CDT). Other information about this vehicle, including problems, may not have been reported to CARFAX. Use this report as one important tool, along with a vehicle inspection and test drive, to make a better decision about your next used car.

CARFAX Ownership History The number of owners is estimated	🚨 Owner 1	🚨 Owner 2	🚨 Owner 3
Year purchased	1996	2006	2012
Type of owner	Personal	Personal	Personal
Estimated length of ownership	9 yrs. 5 mo.	5 yrs. 9 mo.	8 yrs. 3 mo.
Owned in the following states/provinces	Florida	See Details	Illinois
Estimated miles driven per year	3,166/yr		_
Last reported odometer reading	29,838	32,261	_

CARFAX Title History CARFAX guarantees the information in this section	🚨 Owner 1	🚨 Owner 2	🚨 Owner 3
Salvage Junk Rebuilt Fire Flood Hail Lemon	Guaranteed No Problem	Guaranteed No Problem	Guaranteed No Problem
Not Actual Mileage Exceeds Mechanical Limits	Guaranteed No Problem	Guaranteed No Problem	Guaranteed No Problem



GUARANTEED - None of these major title problems were reported by a state Department of Motor Vehicles (DMV). If you find that any of these title problems were reported by a DMV and not included in this report, CARFAX will buy this vehicle back.

Register | View Terms | View Certificate

CARFAX Additional History Not all accidents / issues are reported to CARFAX	🚨 Owner 1	🚨 Owner 2	🚨 Owner 3
Total Loss No total loss reported to CARFAX.	No Issues Reported	No Issues Reported	No Issues Reported
Structural Damage No structural damage reported to CARFAX.	No Issues Reported	No Issues Reported	No Issues Reported
Airbag Deployment	No Issues	No Issues	No Issues

CARFAX Vehicle History Report for this 1997 FERRARI F355 SPIDER: ZFFXR48A5V0106798

No airbag deployment reported to CARFAX.	Reported Reported	Reported Reported	Reported Reported
Odometer Check No indication of an odometer rollback.	No Issues Indicated	No Issues Indicated	No Issues Indicated
Accident / Damage No accidents or damage reported to CARFAX.	No Issues Reported	No Issues Reported	No Issues Reported
Manufacturer Recall At least 1 manufacturer recall requires repair.	No Recalls Reported	Recall Reported	No New Recalls Reported
Basic Warranty Original warranty estimated to have expired. Interested in an extended warranty?	Warranty Expired	Warranty Expired	Warranty Expired

CARFAX Detailed History

Owner Purchase	A same		Personal Vehicle 3,166 mi/yr
N	/lileage	Source	Comments
10/15/1996		Florida Motor Vehicle Dept. Miami, FL	Titled or registered as personal vehicle
10/19/1996	83	Florida Motor Vehicle Dept. Miami, FL	Odometer reading reported
11/04/1996		Florida Motor Vehicle Dept. Miami, FL Title #71871818	Title issued or updated - First owner reported - Loan or lien reported
03/20/1998	10,119	Service Facility	Vehicle serviced - Ignition system checked - Fuel injector(s) replaced - Vehicle washed/detailed
06/24/1998	11,276	Service Facility	Vehicle serviced - Ignition system checked - Catalytic converter replaced - Vehicle washed/detailed
09/23/1998	11,470	Service Facility	Vehicle serviced - Tire repaired - Vehicle washed/detailed
10/13/1998	11,478	Service Facility	Vehicle serviced - Brake fluid flushed/changed - A/C refrigerant recharged - Vehicle washed/detailed
02/24/1999	12,000	Florida Inspection Station Miami, FL	Passed emissions inspection
04/27/1999	13,459	Service Facility	Vehicle serviced - Computer(s) checked - Vehicle washed/detailed
10/22/1999	15,673	Service Facility	Vehicle serviced - 15,000 mile service performed - Vehicle washed/detailed
03/21/2000	17,959	THE COLLECTION Coral Gables, FL 305-444-5555 thecollection.com 4.5 / 5.0 322 Verified Reviews 503 Customer Favorites	Vehicle serviced - Catalytic converter replaced - Clutch replaced - Two tires mounted - Two tires balanced - Vehicle washed/detailed - Brake fluid flushed/changed - Oil and filter changed
06/05/2000	19,246	THE COLLECTION Coral Gables, FL	Vehicle serviced - Vehicle washed/detailed

		305-444-5555 thecollection.com	1997 FERRARI F355 SPIDER: ZFFXR48A5V0106798 - Engine/powertrain computer/module replaced
		503 Customer Favorites	
10/05/2000		Florida Motor Vehicle Dept. Miami, FL Title #0071871818	Title issued or updated - Loan or lien reported
12/22/2000	21,676	THE COLLECTION Coral Gables, FL 305-444-5555 thecollection.com 4.5 / 5.0 322 Verified Reviews 503 Customer Favorites	Vehicle serviced - Glove box lock replaced - Vehicle washed/detailed
02/19/2001	21,702	THE COLLECTION Coral Gables, FL 305-444-5555 thecollection.com	Vehicle serviced - Battery replaced - Vehicle washed/detailed
03/02/2001		Stolen Report Florida	Vehicle reported stolen
03/06/2001	21,800	THE COLLECTION Coral Gables, FL 305-444-5555 thecollection.com	Vehicle serviced
03/06/2001		Stolen Report Florida	Vehicle recovered after theft
03/15/2001	22,023	THE COLLECTION Coral Gables, FL 305-444-5555 thecollection.com 4.5 / 5.0 322 Verified Reviews 503 Customer Favorites	Vehicle serviced
08/02/2001	22,661	Service Facility	Vehicle serviced - Oil and filter changed
09/12/2001		Florida Motor Vehicle Dept. Miami, FL Title #0071871818	Registration issued or renewed - Titled or registered as personal vehicle - Vehicle color noted as Red
12/07/2001	22,721	THE COLLECTION Coral Gables, FL 305-444-5555 thecollection.com	Vehicle serviced - Battery charged - Vehicle washed/detailed
		322 Verified Reviews 503 Customer Favorites	
02/14/2002		THE COLLECTION Coral Gables, FL 305-444-5555 thecollection.com	Vehicle serviced - Clutch slave cylinder replaced

CARFAX Vehicle History Report for this 1997 FERRARI F355 SPIDER: ZFFXR48A5V0106798

322 Verified Reviews



503 Customer Favorites

03/04/2002

22,747

THE COLLECTION Coral Gables, FL 305-444-5555 thecollection.com



Vehicle serviced Vehicle washed/detailed

- Battery/charging system checked

Battery charged

4.5 / 5.0

322 Verified Reviews



503 Customer Favorites

04/22/2002

22,749

THE COLLECTION Coral Gables, FL 305-444-5555 thecollection.com



Vehicle serviced

Vehicle washed/detailed

- Battery charged

4.5 / 5.0

322 Verified Reviews




503 Customer Favorites

07/03/2002

22,753


THE COLLECTION Coral Gables, FL 305-444-5555 thecollection.com

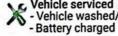

Vehicle serviced

Vehicle washed/detailed

4.5 / 5.0

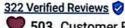

503 Customer Favorites

08/16/2002

22,826

THE COLLECTION Coral Gables, FL 305-444-5555 thecollection.com 4.5 / 5.0



Vehicle serviced

- A/C clutch/pulley replaced

322 Verified Reviews



503 Customer Favorites

03/08/2004

25,922

Service Facility



Vehicle serviced

03/08/2004

THE COLLECTION Coral Gables, FL 305-444-5555 thecollection.com



Vehicle serviced

Two tires mounted
 Two tires balanced

 Battery replaced Instrument cluster replaced/repaired

322 Verified Reviews

4.5 / 5.0

503 Customer Favorites

06/07/2004

27,509

Service Facility

Vehicle serviced

- 30,000 mile service performed

- Clutch replaced

Flywheel/flexplate replaced

06/07/2004

Barrett Motors Cars San Antonio, TX 210-341-2800 barrettjaguar.com

4.6 / 5.0 34 Verified Reviews

Vehicle serviced
- 30,000 mile service performed

06/16/2004

27,540

Service Facility

Vehicle serviced

06/16/2004

Barrett Motors Cars San Antonio, TX 210-341-2800



34 Verified Reviews

Yehicle serviced

CARFAX Vehicle History Report for this 1997 FERRARI F355 SPIDER: ZFFXR48A5V0106798

03/08/2006	29,678	Texas Inspection Station Houston, TX	Passed safety inspection - Passed emissions inspection
03/16/2006	29,838	Dealer Inventory Houston, TX	Vehicle offered for sale

Owne Purchas	r 2 sed: 2006		Personal Vehicle
	Mileage	Source	Comments
03/22/2006		Texas Motor Vehicle Dept. Houston, TX Title #10173738783100938	Title issued or updated - Registration issued or renewed - New owner reported - Loan or lien reported - Passed safety inspection
02/20/2007		Arkansas Motor Vehicle Dept. Beebe, AR Title #999407B5440	Title issued or updated - Exempt from odometer reporting - Vehicle repossessed
06/02/2007	31,884	Texas Inspection Station Spring, TX	Passed safety inspection - Passed emissions inspection
11/01/2009		Ferrari North America	Manufacturer recall issued - Recall #000048 - FUEL DISTRIBUTOR
			Click here to locate an authorized Ferrari dealership near you to obtain more information about this recall
01/16/2012	32,261	Dealer Inventory	Vehicle offered for sale
03/21/2012		Illinois Motor Vehicle Dept.	Vehicle purchase reported
05/24/2012		Illinois Motor Vehicle Dept. Delavan, IL	Registration issued or renewed

Owner 3 Purchased: 2012		Personal Vehicle
Mileage	Source	Comments
06/01/2012	Illinois Motor Vehicle Dept. Delavan, IL Title #X2153692668	Title issued or updated - Registration issued or renewed - New owner reported - Exempt from odometer reporting - Vehicle color noted as Red
03/23/2013	Illinois Motor Vehicle Dept. Delavan, IL	Registration issued or renewed
04/04/2014	Illinois Motor Vehicle Dept. Delavan, IL	Registration issued or renewed
03/18/2015	Illinois Motor Vehicle Dept. Delavan, IL	Registration issued or renewed
05/13/2015	Illinois Motor Vehicle Dept. Delavan, IL	Registration issued or renewed
03/16/2016	Illinois Motor Vehicle Dept. Delavan, IL	Registration issued or renewed
05/21/2017	Illinois Motor Vehicle Dept. Delavan, IL	Registration issued or renewed
04/02/2018	Illinois	Registration issued or renewed

9/1	1/2020	Motor Vehicle Dept.	this 1997 FERRARI F355 SPIDER: ZFFXR48A5V0106798
	04/23/2019	Delavan, IL Illinois Motor Vehicle Dept. Delavan, IL	Registration issued or renewed - Correction to record

Have Questions? Please visit our Help Center at www.carfax.com.

Registration issued or renewed

CARFAX

Glossary

Illinois

Motor Vehicle Dept. Delavan, IL

04/09/2020

When the first owner(s) obtains a title from a Department of Motor Vehicles as proof of ownership.

Automobile manufacturers issue recall notices to inform owners of car defects that have come to the manufacturer's attention. Manufacturer Recall Recalls also suggest improvements that can be made to improve the safety of a particular vehicle. Most manufacturer recalls can be repaired at no cost to you.

When a vehicle is sold to a new owner, the Title must be transferred to the new owner(s) at a Department of Motor Vehicles.

CARFAX defines an owner as an individual or business that possesses and uses a vehicle. Not all title transactions represent changes in ownership. To provide estimated number of owners, CARFAX proprietary technology analyzes all the events in a vehicle history. Estimated ownership is available for vehicles manufactured after 1991 and titled solely in the US including Puerto Rico. Dealers Estimated ownership is available for vehicles manufactured after 1991 and titled solely in the US including Puerto Rico. Dealers estimated ownership of a vehicle and are required to in the following states: Maine, Massachusetts, New Jersey, Ohio, Sometimes opt to take ownership of a vehicle and are required to in the following states: Maine, Massachusetts, New Jersey, Ohio, Oklahoma, Pennsylvania and South Dakota. Please consider this as you review a vehicle's estimated ownership history.

When a repossession occurs a vehicle owner fails to make loan payments, and the financial institution holding the title takes possession of the vehicle.

A state issues a title to provide a vehicle owner with proof of ownership. Each title has a unique number. Each title or registration record on a CARFAX report does not necessarily indicate a change in ownership. In Canada, a registration and bill of sale are used as proof of ownership.

Follow Us:



facebook.com/CARFAX



@CARFAXinc



About CARFAX

CARFAX DEPENDS ON ITS SOURCES FOR THE ACCURACY AND RELIABILITY OF ITS INFORMATION. THEREFORE, NO RESPONSIBILITY IS ASSUMED BY CARFAX OR ITS AGENTS FOR ERRORS OR OMISSIONS IN THIS REPORT. CARFAX FURTHER EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. CARFAX®

© 2020 CARFAX, Inc., a unit of IHS Markit. All rights reserved. Covered by United States Patent Nos. 7,113,853; 7,778,841; 7,596,512, 8,600,823; 8,595,079; 8,606,648; 7,505,838. 9/1/20 12:12:30 PM (CDT)

	YEAR		MAKE/MODE	450		VIN	LICENS	E M	ILEAG	E IN/ OUT	TAG
DITTE		100 2002									1.00
RED	97	FER	RARI 355		ZFFXR	48A5V0106798		27	507/	27509	T2444
DEL DATE	PROD.	DATE	WARR. EXP.	PROMIS	ED	PO NO.	RATE	PAYME		. INV. DA	
290CT1996			20000100	1			A 1	29596532000000			- 1- 1/2
R.O. OPE			PEADY	8 17:00 15	APRO4	D1 / D10		CASH		07JUN2(004
	1120	_	NEADI	OPTIONS	. DPK	:P14740 ENG:	F129C				
11:42 15A	PR04	14.	43 07.TIM	04							
LINE OPCO	DE TEC	TH T	VDF HOTTO	0-1		A STATE OF THE STA					
SUBL ENVI	RONMEN	TAT.	OII. FIL	TER DISPOS	AL PPP		LIST		NET	TOTA	AL
	0#1354		OLD ILD	IBK DIGEOG	ALI ESE						
			CO					2	00		
SUBL REPA	IRED E	XPA	NSION TA	NK				2	.00	2.0	10
	O#PETT										
			CR					40	.00	40.0	10
PARTS:	2472.4	3	LABOR:	4626.80	OTHER:	42.00	TOTAL L			7141.2	
										1141.2	
7507 30K	SERVI	CE :	FLAGG 12	HRS OF 501	HRS CO	MPLETE SERVI	CE PEDTA	מקיוו אי			
SELIS KEPI	ACE L	RTA.	E BELTS	REPLACE V/C	COVER (TACKETS AND	PRONT IIO	UDINGO			
EPLACE ME	THUMBLE	Links	FILTER R	EPLACE SPAT	RK PLII	IS REMOVE DA	CC CIDE	משמאשם			
MD INSEE	T FOR	CK	ACKS SER	VICE TRANS	CHANG	TE PILITO DED	TACE ATD	DIT OUT	20		
TOOL BKA	CH. SAV	THE M	ודים שיניו ואדיי	ויזיכע כעאאכיו	E COOT	ARTH DESIGN TOTAL	*********	-			
WELD) CH	MGE	T.T.	TT.TT CIÑA	ED GEDUTCE	PACOTI	TH DRIER (R	YEAULION	TANK			
EPLACE E	GINE	MOIT	NES FLAC	2 20 UDC	MAN COMM	TIN DETEK (K	EPLACE D	KTRK) 🕹			
	**	***	*****	*******	Man Draw	**************************************		MA			
CUSTOME	STAT	RO.	PORTEM I	ATTU OTTUO	T DDD	SURE ON PED	******	K-K-K-			
R	MATNE	FN	WEITTON'	ATTH CHOICE	H, PRES	SORE ON PED	AL - VEH	ICIE.			
627R	REPT.	URD	TI.VWUDE	L, CLUTCH AS		ALID~					
	REART	NG 7	ית זקם חואם	PPD CEAFO	SSEMBL	RELEASE	MAS	ED	AT	·γ	
š	BEARL	NG_{\sim}	AND RELAT	red seals 7	AND OR	RELEASE INGS FLUSHED	MAS	ER.	AT	.]	
2770075	AND B	NG LED	AND RELAT	red seals 7	AND OR	RELEASE INGS : FLUSHED	MAS				
2000000	AND B	NG. LED 4	AND RELATEM SYSTEM CR	red seals	AND OR	release Ings. Flushed		1156.	70	1156.7	573
1	AND B 202 15950	NG LED 4 7 FI	AND RELAY SYSTEM CR LYWHEEL	red seals 7	AND OR	redease Ings.flushed	4033.39	1156. 3630.	70	1156.7 3630.0	5
1	AND B 202 15950 15775	NG J LED 4 7 Fl 4 Cl	AND RELAY SYSTEM CR LYWHERL LUTCH	red seals 7	AND OR	release ings.flushed	4033.39 715.09	1156. 3630. 607.	70 05 83	1156.7 3630.0 607.8	5 3
1 1 1	AND B 202 15950 15775 16859	NG J 4 7 Fl 4 Cl 4 T	AND RELATES SYSTEM CR LYWHEEL LUTCH O BEARIN	red seals 7	SSEMBLAND OR	release ings.flushed	4033.39 715.09 801.32	1156. 3630. 607. 681.	.70 .05 .83	1156.7 3630.0 607.8 681.1	5 3 2
1 1 1 1	202 15950 15775 16859 17656	NG 4 7 Fl 4 Cl 4 T, 3 Gi	AND RELAY SYSTEM CR LYWHERL LUTCH O BEARIN	red seals 7	SSEMBL)	release ings.flushed	4033.39 715.09 801.32 36.75	1156. 3630. 607. 681. 29.	70 05 83 12 40	1156.7 3630.0 607.8 681.1 29.4	5 3 2 0
1 1 1 1	202 15950 15775 16859 17656 17249	NG J 4 7 Fl 4 Cl 4 T, 3 Gi 9 Si	AND RELAY SYSTEM CR LYWHEEL LUTCH O BEARIN ASKET	red seals 7	SSEMBLAND OR	release ings.flushed	4033.39 715.09 801.32 36.75	1156. 3630. 607. 681. 29.	70 05 83 12 40	1156.7 3630.0 607.8 681.1 29.4	5 3 2 0
111111	202 15950 15775 16859 17656 17249	NG 7 4 7 F1 4 C1 4 T, 3 G2 9 S1 2 G2	AND RELAY SYSTEM CR LYWHEEL LUTCH O BEARIN ASKET BAL ASKET	red seals 7	SSEMBLA AND OR	release ings.flushed	4033.39 715.09 801.32 36.75 10.18 28.27	1156. 3630. 607. 681. 29. 8.	70 05 83 12 40 14 62	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6	5 3 2 0 4
1111112	15950 15950 15775 16859 17656 17249 17656	NG 1 4 7 F1 4 C1 4 T, 3 G1 9 S1 2 G1 1 S1	AND RELAY SYSTEM CR LYWHERL LUTCH O BEARIN ASKET BAL ASKET EALING RI	red seals 7	SSEMBLAND OR	RELEASE INGS. FLUSHED	4033.39 715.09 801.32 36.75 10.18 28.27 29.60	1156. 3630. 607. 681. 29. 8. 22.	70 05 83 12 40 14 62 68	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3	5 3 2 0 4 2
111111111111111111111111111111111111111	15950 15775 16859 17656 17656 17656 14163	NG	AND RELAY SYSTEM CR LYWHERL LUTCH O BEARIN ASKET BAL ASKET EALING RI FLEXIBLE	red seals 7	SSEMBLAND OR	RELEASE INGS. FLUSHED	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98	1156. 3630. 607. 681. 29. 8. 22. 23.	70 05 83 12 40 14 62 68 78	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3 0.7	5 3 2 0 4 2 6 8
11111121212	15950 15950 15775 16859 17656 17249 17656 14163 15520	7 F1 4 C1 4 T, 3 G2 9 S1 2 G2 1 S1 670 7 S1	AND RELAY SYSTEM CR LYWHEEL LUTCH O BEARIN ASKET BAL ASKET EALING RI FLEXIBLE PRING	red seals 7	SSEMBLA AND OR	RELEASE INGS. FLUSHED	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98 9.17	1156. 3630. 607. 681. 29. 8. 22. 23. 0.	70 05 83 12 40 14 62 68 78 34	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3 0.7	5 3 2 0 4 2 6 8
111111212121	15950 15950 15775 16859 17656 17249 17656 14163 15520 10498	1 FI 4 CI 4 T, 3 GI 9 SI 2 GI 1 SI 670 7 SI 4 O	AND RELAY SYSTEM CR LYWHEEL LUTCH O BEARIN ASKET EAL ASKET EALING RI FLEXIBLE PRING RING	red seals 7 NG Ing 3 Pin	AND OR	ings. Flushed	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98 9.17 5.41	1156. 3630. 607. 681. 29. 8. 22. 23. 0. 7.	70 05 83 12 40 14 62 68 78 34 33	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3	5 3 2 0 4 2 6 8 8
111111212121	15950 15950 15775 16859 17656 17249 17656 14163 15520 10498	1 FI 4 CI 4 T, 3 GI 9 SI 2 GI 1 SI 670 7 SI 4 O	AND RELAY SYSTEM CR LYWHEEL LUTCH O BEARIN ASKET EAL ASKET EALING RI FLEXIBLE PRING RING	red seals 7	AND OR	RELEASE INGS. FLUSHED	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98 9.17	1156. 3630. 607. 681. 29. 8. 22. 23. 0. 7.	70 05 83 12 40 14 62 68 78 34 33	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3 0.7 14.6	5 3 2 0 4 2 6 8 8 8
1 1 1 1 1 2 1 2 1 ARTS: 5	15950 15950 15775 16859 17656 17249 17656 14163 15520 10498 046.3	1 ED 4 T, 4 C, 4 T, 9 S, 1 S, 670 7 S, 4 O	AND RELAY SYSTEM CR LYWHEEL LUTCH O BEARIN ASKET EAL ASKET EALING RI FLEXIBLE PRING RING LABOR:	TED SEALS 7	OTHER:	0.00	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98 9.17 5.41 TOTAL LI	1156. 3630. 607. 681. 29. 8. 22. 23. 0. 7. 4.	70 05 83 12 40 14 62 68 78 34 33	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3 0.7 14.6	5 3 2 0 4 2 6 8 8 8
ARTS: 5	15950 15950 15775 16859 17656 17249 17656 14163 15520 10498 046.3	1 ED 4 7 F1 4 C1 4 T, 3 G1 9 S1 2 G2 1 S1 670 7 S1 4 O	AND RELAY SYSTEM CR LYWHEEL LUTCH O BEARIN ASKET EAL ASKET EALING RI FLEXIBLE PRING RING LABOR:	NG ING PIN 1156.70 C	OTHER:	0.00	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98 9.17 5.41 TOTAL LI	1156. 3630. 607. 681. 29. 8. 22. 23. 0. 7. 4.	70 05 83 12 40 14 62 68 78 34 33	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3 0.7 14.6	5 3 2 0 4 4 2 6 8 8 8 3 1
1 1 1 1 1 2 1 2 1 ARTS: 5	15950 15950 15775 16859 17656 17249 17656 14163 15520 10498 046.3	THE PORT OF THE PO	AND RELATED SYSTEM CR LYWHEEL LUTCH O BEARINA ASKET EALL ASKET EALING RI FLEXIBLE PRING RING RING LABOR: LER, I HEREBY NIS ACCURATE	ING ING ING CERTIFY THAT THE UNLESS OTHERWISE	OTHER:	O.00 EMENT OF DISCLAIMER tory warranty constitutes all warranties with respect to le of this terminary. The	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98 9.17 5.41 TOTAL LI	1156. 3630. 607. 681. 29. 8. 22. 23. 0. 7. 4. ENE B:	70 05 83 12 40 14 62 68 78 34 33	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3 0.7 14.6 4.3 6203.0	5 3 2 0 4 4 2 6 8 8 8 3 1
1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	15950 15775 16859 17656 17656 17656 14163 15520 10498 046.3 SERVICIN ONTAINED ESDESCR	7 F) 4 C) 4 T, 3 G) 9 S) 6 7 S) 6 7 S) 4 O 1 I G DEACHERECK BEDWIDICATI	AND RELATED SYSTEM CR LYWHEEL LUTCH O BEARINA ASKET EALING RI EALING RI FLEXIBLE PRING RING LABOR: LER I HEREBY WIS ACCURATE ERE PERFORME ERE PERFORME ERE PERFORME	ING ING ING CERTIFY THAT THE UNLESS OTHERWIS DAT NO CHARGE TAPPEARANCE OF THE	OTHER:	O.00 EMENT OF DISCLAIMER tory warrantly conclusives to the left of this iterations. The match warrantees disclaimers. The match warrantees disclaimers.	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98 9.17 5.41 TOTAL LI	1156. 3630. 607. 681. 29. 8. 22. 23. 0. 7. 4. EIPTION	70 05 83 12 40 14 62 68 78 34 33	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3 0.7 14.6 4.3 6203.0	5 3 2 0 4 4 2 6 8 8 8 3 1
ARTS: 5	15950 15950 15775 16859 17656 17249 17656 14163 15520 10498 046.3 SERVICIN DISTRIBUTION	7 F1 4 C1 4 T, 3 G/ 670 7 S1 4 O 1 I G DEA	AND RELATED AND RE	ING ING ING CERTIFY THAT THE UNLESS OTHERWIS DAT NO CHARGE TAPPEARANCE OF THE APPEARANCE OF THE APPEAR	OTHER:	O.00 EMENT OF DISCLAIMER tory warrantly conclusives to the left of this iterations. The match warrantees disclaimers. The match warrantees disclaimers.	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98 9.17 5.41 TOTAL LI	1156. 3630. 607. 681. 29. 8. 22. 23. 0. 7. 4. INE B:	70 05 83 12 40 14 62 68 78 34 33	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3 0.7 14.6 4.3 6203.0	5 3 2 0 4 4 2 6 8 8 8 3 1
ARTS: 5 ON BEHALF OF INFORMATION CONNER. THERE'S VEHICLE OR OTHUNDER THIS CLAACCIDENT. NEG	15950 15775 16859 17656 17656 17656 14163 15520 10498 046.3 SERVICIN ONTAINED ES DESCR WAS NO IN-	4 T F F F F F F F F F F F F F F F F F F	AND RELAY SYSTEM CR LYWHERL LUTCH O BEARIN ASKET EALING RI EALING RI FLEXIBLE PRING RING LABOR: LER, I HEREBY ONIS ACCURATE ERE PERFORME ERE PERFORME ERE PERFORME ANY PART REFONNECTED IN A SUSE. RECORD	ING ING ING CERTIFY THAT THE UNLESS OTHERWIS DAT NO CHARGE T APPEARANCE OF THE AIRED OR REPLACE WY WAY WITH AN S SUPPORTING THE SUPPORTING THE AIRED OR REPLACE WY WAY WITH AN S SUPPORTING THE SUPPORTING THE AIRED OR REPLACE WY WAY WITH AN S SUPPORTING THE AIRED OR REPLACE WY WAY WI	OTHER: STATI The fisse of the order of the	O.00 EMENT OF DISCLAIMER tory warranty constitutes all warrantes with respect to le of this intensitien. The foretoy expressly disclaims all see either express or including any impiled y of merchanishity or for a peritualer ourness.	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98 9.17 5.41 TOTAL LI	1156. 3630. 607. 681. 29. 8. 22. 23. 0. 7. 4. INE B:	70 05 83 12 40 14 62 68 78 34 33	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3 0.7 14.6 4.3 6203.0	5 3 2 0 4 4 2 6 8 8 8 3 1
ARTS: 5	15950 15950 15775 16859 17656 17249 17656 14163 15520 10498 046.3 SERVICIN DATAINED ES DESCR WAS NO IN- HERWISE, WAS NO IN- HERWISE, WAS LIGENCE (LABLE FO)	TO SI OF SI	AND RELATER SYSTEM CR LYWHEEL LUTCH O BEARINA ASKET EALING RI EALING RI FLEXIBLE PRING RING LABOR: LER, I HEREBY MIS ACCURATE EANY PART RE ONNECTED IN A SUSE. RECORD (EAR FROM THE LING FROM THE LING PART RE ONNECTED IN A SUSE. RECORD (EAR FROM THE LING DEALER FROM LING DEALER FROM THE SYSTEM THE SYS	ING ING ING CERTIFY THAT THE UNLESS OTHERWIS DAT NO CHARGE TAPPEARANCE OF THE APPEARANCE OF THE APPEAR	OTHER: STATI The factor of the of th	O.OO EMENT OF DISCLAIMER tory warranty constitutes all warranties with respect to lee of this therefore the corress of including any implied by of merchantability or for a particular purpose, neither assertments.	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98 9.17 5.41 TOTAL LI	1156. 3630. 607. 681. 29. 8. 22. 23. 0. 7. 4. INE B: RIPTION DUNT JUNT JUNT JUNT JUNT JUNT JUNT JUNT J	70 05 83 12 40 14 62 68 78 34 33	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3 0.7 14.6 4.3 6203.0	5 3 2 0 4 4 2 6 8 8 8 3 1
ARTS: 5	15950 15950 15775 16859 17656 17249 17656 14163 15520 10498 046.3 SERVICIN DATAINED ES DESCR WAS NO IN- HERWISE, WAS NO IN- HERWISE, WAS LIGENCE (LABLE FO)	TO SI OF SI	AND RELATER SYSTEM CR LYWHEEL LUTCH O BEARINA ASKET EALING RI EALING RI FLEXIBLE PRING RING LABOR: LER, I HEREBY MIS ACCURATE EANY PART RE ONNECTED IN A SUSE. RECORD (EAR FROM THE LING FROM THE LING PART RE ONNECTED IN A SUSE. RECORD (EAR FROM THE LING DEALER FROM LING DEALER FROM THE SYSTEM THE SYS	ING	OTHER: STATI The fixe of the or the se of the or the se	O.00 EMENT OF DISCLAIMER at a surprise of this iteration and the surprise of	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98 9.17 5.41 TOTAL LI DESCI LABOR AMC PARTS AMC GAS, OIL, LI SUBLET AM MISC. CHAR	1156. 3630. 607. 681. 29. 8. 22. 23. 0. 7. 4. INE B: RIPTION DUNT JUNT JUNT JUNT JUNT JUNT JUNT JUNT J	70 05 83 12 40 14 62 68 78 34 33	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3 0.7 14.6 4.3 6203.0	5 3 2 0 4 4 2 6 8 8 8 3 1
ARTS: ON BEHALF OF INFORMATION CONNER. THERE IN VEHICLE OR OTHER INFORMATION CONNER. THERE IN VEHICLE OR OTHER INFORMATION PROCESS AND ACCIDENT, NEGULAIM ARE AVAINOTHEICATION ACCIDENT.	15950 15950 15775 16859 17656 17249 17656 14163 15520 10498 046.3 SERVICIN DATAINED ES DESCR WAS NO IN- HERWISE, WAS NO IN- HERWISE, WAS LIGENCE (LABLE FO)	TO SI OF SI	AND RELATER SYSTEM CR LYWHEEL LUTCH O BEARINA ASKET EALING RI EALING RI FLEXIBLE PRING RING LABOR: LER, I HEREBY MIS ACCURATE EANY PART RE ONNECTED IN A SUSE. RECORD (EAR FROM THE LING FROM THE LING PART RE ONNECTED IN A SUSE. RECORD (EAR FROM THE LING DEALER FROM LING DEALER FROM THE SYSTEM THE SYS	ING	OTHER: STATI The fixe of the or the se of the or the se or the	O.00 EMENT OF DISCLAIMER tory warranty constitutes all warranties with respect to led this termiterra. The leteby expressly disclaims all les either express or a particular purpose, neither assumes nor of a particular purpose, neither assumes nor let or it any liability in list of the sale of this list of the sale of this list of the sale of this	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98 9.17 5.41 TOTAL LI DESCI LABOR AMC PARTS AMC GAS, OIL, LI SUBLET AM MISC. CHAR	1156. 3630. 607. 681. 29. 8. 22. 23. 0. 7. 4. INE B: RIPTION DUNT JUNT JUNT JUNT JUNT JUNT JUNT JUNT J	70 05 83 12 40 14 62 68 78 34 33	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3 0.7 14.6 4.3 6203.0	5 3 2 0 4 4 2 6 8 8 8 3 1
ARTS: ON BEHALF OF INFORMATION CONNER. THEREV VEHICLE OR OTH UNDER THIS CLARCIDENT, NEG CLAIM ARE AVAINOTIFICATION A MANUFACTURER	15950 15775 16859 17656 17656 17656 17656 14163 15520 10498 046.3 SERVICIN ONTAINED EST DESCR VAS NO IN- HERWISE, IN- LIGENCE (LABLE FOLL) THE SERVICE (LABLE FOLL)	TO SI DEAR MY THAT CONTROL OF THE CO	AND RELAY SYSTEM CR LYWHEEL LUTCH O BEARIN ASKET EALING RI EALING RI FLEXIBLE PRING RING LABOR: LER, I HEREBY MIS ACCURATE EIER PERFORME ION FROM THE ANY PART REP ONNECTED IN SUSE. RECORD FEAR FROM THE ING DEALER F	ING ING ING ING CERTIFY THAT THE UNLESS OTHERWIS DAT NO CHARGE TAPPEARANCE OF THAIRED OR REPLACE WY WAY WITH AN S SUPPORTING THE DATE OF PAYMEN OR INSPECTION B	OTHER: STATI The factor of the control of the cont	O.00 EMENT OF DISCLAIMER tory warranty constitutes all warranties with respect to le of this item/sterns. The interest express or including any implied to for a peritoular purpose, neither essumes nor see any other person to for it in the sale of this me.	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98 9.17 5.41 TOTAL LI	1156. 3630. 607. 681. 29. 8. 22. 23. 0. 7. 4. INE B: RIPTION DUNT JUNT JUNT JUNT JUNT JUNT JUNT JUNT J	70 05 83 12 40 14 62 68 78 34 33	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3 0.7 14.6 4.3 6203.0	5 3 2 0 4 4 2 6 8 8 8 3 1
ARTS: ON BEHALF OF INFORMATION CONNER. THEREV VEHICLE OR OTH UNDER THIS CLAACCIDENT, NEG CLAIM ARE AVAINOTIFICATION A MANUFACTURER	15950 15775 16859 17656 17656 17656 17656 14163 15520 10498 046.3 SERVICIN ONTAINED EST DESCR VAS NO IN- HERWISE, IN- LIGENCE (LABLE FOLL) THE SERVICE (LABLE FOLL)	TO SI DEAR MY THAT CONTROL OF THE CO	AND RELATER SYSTEM CR LYWHEEL LUTCH O BEARINA ASKET EALING RI EALING RI FLEXIBLE PRING RING LABOR: LER, I HEREBY MIS ACCURATE EANY PART RE ONNECTED IN A SUSE. RECORD (EAR FROM THE LING FROM THE LING PART RE ONNECTED IN A SUSE. RECORD (EAR FROM THE LING DEALER FROM LING DEALER FROM THE SYSTEM THE SYS	ING ING ING ING CERTIFY THAT THE UNLESS OTHERWIS DAT NO CHARGE TAPPEARANCE OF THAIRED OR REPLACE WY WAY WITH AN S SUPPORTING THE DATE OF PAYMEN OR INSPECTION B	OTHER: STATI The factor of the control of the cont	O.00 EMENT OF DISCLAIMER tory warranty constitutes all warranties with respect to led this termiterra. The leteby expressly disclaims all les either express or a particular purpose, neither assumes nor of a particular purpose, neither assumes nor let or it any liability in list of the sale of this list of the sale of this list of the sale of this	4033.39 715.09 801.32 36.75 10.18 28.27 29.60 0.98 9.17 5.41 TOTAL LI	1156. 3630. 607. 681. 29. 8. 22. 23. 0. 7. 4. ENE B: ENPTION JUNT JUNT JUNT JUNT JUNT JUNT JUNT JUN	70 05 83 12 40 14 62 68 78 34 33	1156.7 3630.0 607.8 681.1 29.4 8.1 22.6 47.3 0.7 14.6 4.3 6203.0	5 3 2 0 4 4 2 6 8 8 8 3 1

COLOR MAKE/MODEL | YEAR VIN LICENSE MILEAGE IN/ OUT TAG RED 97 FERRARI 355 ZFFXR48A5V0106798 27509/27540 T2444 DEL DATE PROD. DATE WARR. EXP. PROMISED PO NO. RATE PAYMENT ' INV. DATE 290CT1996 290CT1998 17:00 07JUN04 CASH 16JUN2004 R.O. OPENED READY OPTIONS: DLR: P14740 ENG: F129C 15:33 07JUN04 13:29 16JUN04 LINE OPCODE TECH TYPE HOURS LIST NET TOTAL A ENGINE LIGHT ON REPAIRED .. REPLACED ALL INTERMITTENTLY OPEN ALL EXHAUST TEMP ECU'S.REPAIRED LEAK IN VACUUM SYSTEM TO "T" PIPE CR 0.00 0.00 3 179278 CATALYST TEMP. ECU 878.40 306.00 292.80 PARTS: 878.40 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: 878.40

27540 EXAUST ECU'S INTERMIT. OPEN REPLACE ALL EXAUST TEMP ECU'S N/C ALSO FOUND LEAK IN VAC. SYSTEM TO "T" PIPE REPAIR WITH HOSE N/C



IF YOU RECEIVE A JAGUAR SURVEY, PLEASE RATE US 100% OR ALLOW US TO ADDRESS YOUR CONCERNS WE RECOMMEND OIL AND FILTER CHANGE EACH 3000 MILES, CHECK ALL FLUIDS EVERY 500 MILES IT WAS OUR PLEASURE TO SERVE YOU TODAY!

CCAR MASERATI

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREONIS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBEDWERE PERFORMEDAT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE, RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE. STATEMENT OF DISCLAIMER DESCRIPTION AND TOTALS The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all LABOR AMOUNT 0.00 the sale of this Item/tierns.
Selfor hereby expressly declaims
warranties either express
implied, including any impl
warranty of merchantability
fitness for a particular purpo
Selfor neither assumes
authorizes any other person
assume for it any liability
connection with the sale of it PARTS AMOUNT 878.40 GAS, OIL, LUBE 0.00 SUBLET AMOUNT 0.00 MISC. CHARGES 0.00 TOTAL CHARGES 878.40 LESS INSURANCE 0.00 SALES TAX 0.00 (SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE) **CUSTOMER SIGNATURE** PLEASE PAY THIS AMOUNT 878.40 EFFICIE SUBJECT TO THE REPAIR AGREEMENT, I UNDER D TRANSATION IS STOPPED, DISHONORED BECAUSE OF AM THE PERSON OR AGENT ACTING ON BEHILF OF THE PERSON, WHO IS OBLIGATED TO PAY FOR THE REPAIR OF THE M NAMED AND ADMINISTRATION OF PAYMENT FOR THE REPAIR OF THE MOTOR YERGLE BY A CHECK, MONEY GROSE, OR A CHE REDIT CARD NOLDER HAS NO COCURT OR THE ACCOUNT (FROM WASCELL TO PERSON OF THE COUNTY OF THE ACCOUNTY OF THE AC TAND THAT THE VEHICLE IS SUBJECT TO R

COLOR	YEAR	MAKE/MOD	EL,		VIN	LICENSE	MILEA	GE IN/ OUT	TAG
RED	97	FERRARI 35	5	700	KR48A5V0106798		27507	/27509	T2444
DEL DATE		DATE WARR. EXP			PO NO.	RATE	PAYMENT	INV. D	
DELDAIL	I NOD.	DATE MARK EX	1110	HOLD .		.,,,,,		H I	
90CT1996		290CT19	98 17:00 1	SAPRO	4		CASH	07JUN2	004
RO. OPEN	VED	READY	OPTION		LR:P14740 ENG:F	129C	1		
				No.		18.0017.00TE.			
1:42 15A	PR04	14:43 07JU	N04						
		CH TYPE HOU				LIST	NET	TOT	AL
CUSTOME	R STA	TES PERFORM	30K SERVI	CE	The second second		- 1		
		O MILE SERV							2012
	20	24 CR					4626.80		
1	1914	62 OIL FILT	ER.			28.70			
2	1515	62 FILTER/A	IR			75.58			
		56 GASKET				35.96			
1	1761	57 GASKET				35.96	28.77	28:	
		87 GASKET				23.17	18.54		
		33 BELT POL	Y-V K6			62.53	50.02		
		32 BELT				29.75	23.80		
		30 BELT				40.72	32.58	32.	
		10 TIMING B	ELT			119.26	95.41	190.	32
		7060 WASHER				2.86	1 2.28		
1	1026	860 WASHER	/COPPER	are management		2.03	► 丁 ¥.62	1.6	52
1	1177	92 FILTER/F	DEL 4	1 may 8	STORAGE STORE STOR	77.14	A61.71	61.	71
		0060 WASHER		San Shipper	Service Servic	3.42	2.74	2.	74
		10 WASHER/C		369	A. Add	3.48	309.75	8.3	34
2	1674	64 CYLINDRI	CAL POTAR	RRAR	ING / PULLEY	387.19	309.75	619.	50
						,19.19	. , 15.35		
า	1636	61 GROMMET/ 21 GASKET		U.		23/11	E 18/49	1 18.4	19
		20 GASKET	,av			23.11	18.49		
		75 O RING				16.43	13.14		
		54 O RING				2.86	2.29		
		278 O RING				3.24	2.59		
		4300 DRYER				324.19	259.35		
		08 O RING				3.54	2.83		
		69 ENGINE M	TOTINT			156.17	124.94		
		69 ENGINE M				146.11	116.89		
		83 SPARK PL				40.49	32.39		
		5/SHELL SHE		TC		11.18	8.94		
		Q/S COOLAN				14.76	11.81		
		TRANS/FLUI				4.80	3.84		
		4 R-134 FRE				18.94	15.15		
		02 BG A/C C				12.24	9.79		
			rts systematics and the second	THE !	STATEMENT OF DISCLAIMER		RIPTION	TOTAL	
INFORMATION (CONTAINE	ING DEALER, I HER D HEREONIS ACCUR	ATE UNLESS OTHER	RWISE 6	he factory warranty constitutes all if the warranties with respect to	LABOR AMO	TAUC	- Minister	
SHOWN, SERVI	CES DESC	RIBEDWERE PERFOR	RMEDAT NO CHARG			PARTS AMO	TAUC		1712
VEHICLE OR O'	THERWIS	E. THAT ANY PART	REPAIRED OR REPL	ACED	varranties either express or	GAS, OIL, L	UBE		
UNDER THIS C	LAIM HAD	BEEN CONNECTED	IN ANY WAY WITH	ANY	seller hereby expressly disclaims all varianties either express or mipled, including any implied varianty of merchantsbility or thess for a particular purpose.	SUBLET AM	OUNT		100
CLAIM ARE AV	AILABLE	FOR (1) YEAR FROM	THE DATE OF PAY	MEIAI	Perior Indicate according to	MISC, CHAP	RGES		25
NOTIFICATION MANUFACTURE	AT THE	SERVICING DEALE	R FOR INSPECTIO	N BY	uthorizes any other person to assume for it any liability in	TOTAL CHA		A THEO WILLIAM	
MANUFACIURE	NO REPR	LOCITIATIVE.		1 0	connection with the sale of this termitems.	LESS INSU			
				14.		SALES TAX			
(SIGNED) DEAL	ER, GENER	AL MANAGER OR AUTHO	RIZED PERSON (DA	TE)	CUSTOMER SIGNATURE	PLEASE P		**	*
THE PROPERTY OF THE PARTY OF TH			was a market of the party	1 STATE OF 1 1		THIS AMO			1000

COLOR	YEAR		MAKE/MODEL			27	VIN	LICENSE	MILEA	GE IN/ OUT	TAG
RED	97	FER	RARI 355			ZFFXF	48A5V0106798		27507	/27509	T2444
DEL DATE	PROD.	DATE	WARR. EXP.		PROMISE		PO NO.	RATE	PAYMENT	INV. E	DATE
290CT1996			290CT1998	17:0	00 15A	PR04			CASH	07JUN2	2004
R.O. OPE	NED		READY		PTIONS:		:P14740 ENG:	129C			11
11:42 15A	PR04	14:	43 07JUNO	4							
LINE OPCO		_	YPE HOURS		April 10			LIST	NET	TOT TO	CAL

IF YOU RECEIVE A JAGUAR SURVEY, PLEASE RATE US 100% OR ALLOW US TO ADDRESS YOUR CONCERNS WE RECOMMEND OIL AND FILTER CHANGE EACH 3000 MILES, CHECK ALL FLUIDS EVERY 500 MILES IT WAS OUR PLEASURE TO SERVE YOU TODAY! ***********







DESCRIPTION

LABOR AMOUNT

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREONIS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBEDWERE PERFORMEDAT NO CHARGE TO OWNER. THEREWAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)


STATEMENT OF DISCLAIMER The factory warranty constitution of the warranties with resp for a particular pur neither assumes

CLISTOMER SIGNATURE

5783.50 PARTS AMOUNT 7518.74 GAS, OIL, LUBE 0.00 SUBLET AMOUNT 42.00 MISC. CHARGES 0.00 TOTAL CHARGES 13344.24 LESS INSURANCE 0.00 SALES TAX 0.00 **PLEASE PAY** THIS AMOUNT 13344.24

TOTALS

AND THAT THE VEHICLE IS SUBJECT TO AM THE PERSON OR AGENT ACTING ON BEHALF OF THE PERSON, WHO IS OBLIGATED TO PAY FOR THE RE withinks and Commission Code, IF PAYMENT FOR THE REPAIR OF THE MOTION PERSON. IS 'A CHEEK, MOMEN' AND THE WORLD WITHIN AN ADMINISTRATION THE ACCOUNT HE ON WHICH IT IS DEPENDED OF THE MOTION OF THE ACCOUNT OF THE ACCOUNT HE ON THE ACCOUNT OF THE ACCOUNT HE OF THE ACCOUNT OF THE ACCOUNT OF THE ACCOUNT HE OF THE ACCOUNT OF THE ACCOUNT OF THE ACCOUNT HE OF THE ACCOUNT OF THE ACCOUNT

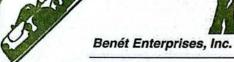





1013 N. Orange, Peoria, IL 61606-1882 phone: (309) 673-1412 • (800) 747-4507 • fax: (309) 673-5828

Nation Graffin 786 U Third St Delavan, IL 5173 Na () 244-787		Engine: License: RI VIN: ZF	997 Fertari F3) BRCTA FFXR4645V01067 3550 CORSA		Invoice number : Started: B1/25/16 (OWednesday, April 13, Mileage: 3736	Jobh 24 Completed: 8 2016, 9:33	
•	Description o	f work			Service history	Date	Mileage
selector shaft there were now the transmiss. reservoir, rep pivot & replace E/A Mitch has (Confirmed).	ed we perform the major service with parts provided. We have treat, the right side radiato serous hoses that have been to low oil, replaced the water publaced the knock sensors, cleaned the left side plate bulb). Asked Michael to order the health offer the Norman of the left of the health offer the health offer the Norman of the left of the health offer the Norman of the left of the health offer the Norman of the left of t	also replant has been required/rep. instal ned/lubric haders & he	red the shifte removed for a laced, we have led updated by ated the throt at shields fro	erformed the er bushings, repair, changed educatic cable cable me Fabspeed.	Oil Change Service Maintenance Service Cooling System Service Coygen Sensor Auto Trans Service New Tires Brakes Service Tires, Rotate Wheel Alignment Replaced Battery Mobil 1 Timing Belt	84/13/16 84/13/16 84/13/16 -/-/- 84/13/16 -/-/- -/-/- -/-/- 84/13/16 -/-/- 84/13/16	37364 37364 37364 37364
Stock no.	Sty Description	Each	Price	Ta	I I Carrenbiro Talk	-/-/-	
Labor Labor	Rpl knock sensors Clean/lube thrttl cbl		133.50 178.60	20 ·	Serpentine Belt AC Serviced Brake Fluid Service	-1-1- -1-1- -1-1-	
Labor . Labor	Install headers Adjust exhaust system		262.30 267.00	20 20		-/-/-	
Labor Labor	R&R N/S radiator Rpl shift bshng/seal Misc labor		267.00 311.50 1335.60	28 29 28		-//-	
Labor Labor	Perform belt service	7.65	3562.26 7.65	29 28		Totals	
85-SAIPPING 85-SAIPPING 10-AFRS	1 Shipping 1 Shipping headers 1 Syn hydrualic fluid	45.50 27.88	45.50 27.00	28 28			
38-1711171278 38-3241685121 45-139555	1 Bleeder strew	4.30 31.88 119.92	4.33 31.80 119.92	28 29 23	i Gasoline & Oil :	8,58 217,68 6274,58	
45-146366 45-PART	1 Sealing ring 1 Headers price	2.78 2695.56	2.78 2695.58	26 28	Parts 1	3849.73 9.88	
58-6869978982 58-01838682	8 Antifreeze	6.22 6.88	6.22 55.64	28	Sublet :	53.15 9.88 9.88	
68-15484 68-58384 78-5887	11 Redline5w4B 4 75w98ns GL-5 redline 1 Bulb 5W		154.88 63.68 2.14	20	1 Sales Tires 1 1 Xpress Rental 1 1 ENV/Shop Supplies:	0.00	
76-3667 73-7X3 74-GENICAL	5 Fuel hose	6.02	30.10 9.98	28 28	l Sub Total :		
76-HARDWARE 76-HARDWARE	1 Brake line adaptor # 1 Dil cooler bushing	3.45 3.99	3.99			269.55	
76-HARGAIANE 76-HARGAIANE	1 Seal ring 4 Seal ring	1.99 1.99 1.99	1.99 7.96 15.92	20 20 20	TOTAL DUE :	9964.61	
76-HARDWARE 76-HARDWARE 78-ELAMP	8 Exhaust nut 8 Fastner 6 Hose clamp	1.99	15.92 15.92 16.68	20	Thanks! Kauth & May Status : Completed		

M-PERFORMANCE AUTO REPAIR ORDER

17545-A KUYKENDAHL Dr. SPRING, TX 77379 281-257-6602

DATE 08/24/10 TIME 6:23:00 PM INVOICE NUMBER:

(101)

NAME:	(MATERIAL MATERIAL)
ADDRESS:	[[[(((YKE))]),]]]]
CITY,STATE:	W. Comercial Marie Community
MAKE:	1997 FERRARI F355 SPIDER
SERIAL NO.:	
MILEAGE	30
PHONE:	(((44))))))

QUAN.	NAME OF PART	U.PRICE	TOTAL		LABOR	
2	Timing belt	\$ 135.79	\$ 271.5	8 1	REMOVE ENGINE FOR 30 K MILES SERVICE	\$ 2,000.00
2	Tensioner bearing	\$ 631.00	\$ 1,262.0	0 2	REPAIR A/C SYSTEM 1 90	\$ 90.00
1	WATER PUMP KIT	\$ 300.51	\$ 300.5	1 3		\$
2	VALVE COVERS GASKETS	\$ 34.04	\$ 68.0	8 4		\$
8	SPARK PLUGS	\$ 33.64	\$ 269.1	2 5		\$
4	CAM OIL SEAL	\$ 32.92	\$ 131.6	8 6		\$
4	CAM O-RING	\$ 2.95	\$ 11.8	0 7	PARTS CONTI.	\$
4	CAM BOLT O-RING	\$ 1.29	\$ 5.1	6 8	OIL FILTER 34.00	\$ 100
2	V/C O-RING	\$ 6.00	\$ 12.0	0 9	CABLE GROMET 100.00	\$ THE THE SE
2	WC END GASKET	\$ 13.52	\$ 27.0	4 10	WIRE SET 850.00	\$ # 1 11TH
1	FUEL FILTER	\$ 46.97	\$ 46.9	7 11	ENGINE OIL SYNT 5W30 108.00	\$
2	AIR FILTERS	\$ 43.58	\$ 87.1	6 12		\$
2	HOSE COOLANT	\$ 91.11	\$ 182.2	2 13		\$
1	COOLING HOSE	\$ 112.89	\$ 112.8	9 14		\$
3	DRIVE BELTS		\$ 72.3	6 15		\$
	TOTAL PAR	TS	\$ 3,952.5	7	LABOR ONLY	\$ 2,090.00
TV V		W. Park	4000		PARTS	\$ 3,952.57
)		TAX	\$ 286.56
	PAID: CARD	CASH/	CHECK	100	TOTAL DIJE	\$ 6 329 13

PAID:

CARD (CASH)

6,329.13

AUTHORIZED BY:



Kauth & Mayeur

1710 W Detweiller Dr Peoria, IL 61615 (309) 673-1412 service@kauthmayeur.com Invoice #1535

Page 1 of 3 10-30-20 Mitch Griffin 1997 Ferrari F355

Mitch Griffin

702 W Third St Delavan, IL 61734 mitch@masgconsulting.com (309) 241-3562

1997 Ferrari F355

ZFFXR48A5V0106798

Engine: V8, 3.5L: DOHC 40V Plate: RD BRCTA

Odometer In: 39093 Odometer Out:

GRAND TOTAL: \$1,647.90

✓ PAID

SUBTOTAL: \$536.00

Labor: \$456.00 Parts: \$0.00

Sublet: \$80.00

Fees: \$0.00

SERVICES

Remove & Replace Header

There is an exhaust leak at the header. Please remove the header for Fabspeed to make a repair.

Advisor: Sean Benet

Technician: Brian Smith

(Confirmed).

LABOR

Remove header Install header

SUBLETS

Shipping outbound

TOTAL

\$40.00

Shipping inbound

\$40.00

Replace O2 Sensors

10/19. Mitch has sold the F355 on BaT: Please replace the four O2 sensors per his request.

LABOR

Replace O2 Sensors

SUBTOTAL: \$1,001.34

Labor: \$312.00 Parts: \$670.34

Fees: \$0.00 Sublet: \$19.00

PARTS	PART#	QTY	EACH	TOTAL
Oxygen sensor	165170	2.0	\$148.70	\$297.40
Oxygen sensor	169953	2.0	\$186.47	\$372.94
SUBLETS				TOTAL
shipping				\$19.00

Terms of Service:

1. "YES, DO THIS WORK"

I hereby authorize the corresponding service to be done along with the necessary materials.

2. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

Kauth and Mayeur staff may operate my vehicle to: the purpose of testing, inspection, and delivery.

3. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto.

4. "ONLINE COMMUNICATION OK"

I welcome email from Kauth and Mayeur as a means of receiving copies of my estimate, work order, and invoice.

GRAND TOTAL: \$1,647.90

Total Labor: \$768.00 Total Parts: \$670.34

Total Fees: \$0.00 Total Sublets: \$99.00 Shop Supplies: \$46.08

Sales Tax: \$64.48

✓ PAID

10-30-2020 4:22 PM Paid by Credit Card: \$1,647.90

Notation and of


BOSCH Service (m. (m)



7817 N. Dale Mabry Hwy Tampa, FL 33614 (813) 582-5202 MV-90977

/Or Hourly at \$_

Estimate/Diagnostic Fee: \$_

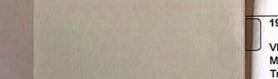

1997 FERR F355

VIN: ZFFXR48A5V0106798

Mileage In 41086 Out

Trans: License : RED Colr : RED

Sub:

Proposed Completion Date:

Supply Charge - "This charge represents costs &

1/14/2022 2:42 pm

Service Req	uests:	Category Summary Miscellaneous	<u>Parts</u> \$33.92	<u>Labor</u> \$770.00	Job Total \$803.92	
Technician	Service Description			Parts	Labor	Job Total
TD	CUSTOMER REQUESTS INSTALLATION OF SUPP	LIED TAILLIGHTS. COMPLE	TED		310.00	310.00
8	CUSTOMER REQUESTS INSTALLATION OF SUPP	LIED FOGLIGHTS. COMPLE	TED INSTALL	33.92	310.00	343.92
	CUSTOMER STATES AC COMPRESSOR CYCLING OPERATING NORMALLY AT THIS TIME	ON/OFF PLEASE CHECK A	ND ADVISE. AC		0.00	
SUB	DRIVERS SEAT RECONDITIONING				150.00	150.00

Per Hour

PLEASE READ CAREFULLY, CHECK ONE OF THE ST BELOW, AND SIGN: I UNDERSTAND THAT, UNDER STATE LAW, I AM WRITTEN ESTIMATE IF MY FINAL BILL WILL EXCE	I ENTITLED TO A	Supply Charge - "This charge repre- profits to the motor repair facility for shop supplies or waste disposal." [s The state of Florida mandates a \$1, for each new tire sold, [s.403.718], each new or remanufactured batter	r miscellaneous s. 559.904(4)] .00 fee be collected and \$1.50 fee for
I REQUEST A WRITTEN ESTIMATE I DO NOT REQUEST A WRITTEN ESTIMATE A REPAIR COST DO NOT EXCEED \$ THE SHOP THIS AMOUNT WITHOUT MY WRITTEN OR ORAL A I DO NOT REQUEST A WRITTEN ESTIMATE. SIGNED X DATE	AS LONG AS THE MAY NOT EXCEED APPROVAL.	I DO DO NOT request parts replaced, excluding warrate exhange parts. Initials X A \$20.00 per day storage charge vehicles left over three (3) days at that work has been completed or been declined.	will apply to all
*U/Used R/Rebuilt RC/Reconditioned NC/No Chg/Warranty RD/Reduced Additional Person Permitted to Authorize Repairs:	Intended Payment Meti Cash Credit C Check Other		THE COURSE OF TH
Name: Phone Number:	An express mechanic's Customer agrees	s lien is granted to secure the amount to pay all the costs of collection or litig	of repairs.
6 MONTH OR 6,000 MILE WARRANTY, WHICH EVER OCCURS FIR LABOR UNLESS OTHERWISE SPECIFIED		TOTAL PARTS TOTAL LABOR SUBLET SHOP SUPPLIES SUBTOTAL OTHER FEES SALES TAX TOTAL INVOICE PAID DUE	\$33.92 \$770.00 \$0.00 \$803.92 \$0.00 \$60.29 \$864.21 \$0.00 \$864.21
Customer Signature:	Date:		
This Is Not An Invoice.	Do Not Pay From This D	ocument.	Page 1 of 1

Print Receipt

erchant: EUROPEAN EXOTIC CENTER

7817 N Dale Mabry Highway

Tampa, FL 33614

US

8135825202

Order Information

Description:

Order Number:

Customer ID:

P.O. Number:

Invoice Number:

1668

Billing Information

TAYLOR

Shipping Information

Shipping:

0.00

Tax:

0.00

Total: USD 864.21

Payment Information

Date/Time:

14-Jan-2022 12:58:56 PST

Transaction ID:

63480521070

Transaction Type:

Authorization w/ Auto Capture

Transaction Status:

Captured/Pending Settlement

Authorization Code:

215597

Payment Method:

American Express XXXX2000



7817 N. Dale Mabry Hwy Tampa, FL 33614 (813) 582-5202 MV-90977



1997 FERR F355

VIN: ZFFXR48A5V0106798

Mileage In 40679 Out

Trans : License :

Colr : Sub : 5/28/2021 2:07 pm

	<u>Job Total</u> \$2,298.23	<u>Labor</u> \$2,181.00	<u>Parts</u> \$117.23	Category Summary Miscellaneous	uests:	Service Requ
Job To	Labor	Parts	Maria Balis	Anton the Committee of	Service Description	Technician
465.0	465.00	ND OIL			CUSTOMER STATES BATTERY/ALTERNATOR LEAK CAUSE OF ALTERNATOR FAILURE. SE	TD
77.5	77.50				CUSTOMER STATES MIL IS ON. CHECK AND	TD
1202.23	1085.00	EAKING17.23	E COVERS L	CK AND ADVISE, FOUND VAL	CUSTOMER STATES OIL LEAK PRESENT. CH	
- Valley Breez					ALSO FOUND OIL SUMP RETURN LINE LEAK	
		33.55	33.55		GASKET	S
Part William		33.55	33.55		GASKET	S
	A STATE OF	1 14.93	14.93		RING	S
	A CONTRACTOR OF THE PARTY OF TH	1 17.60 1 17.60	17.60 17.60		GASKET	S
Training World	0.00	along confermen	CONTRACTOR AND ADDRESS	ONNEAU COVER. (STEVE)	CUSTOMER REQUESTS QUOTE TO REDYDE	SUB
	0.00	TER	UMENT CLUS		CUSTOMER REQUESTS QUOTE TO REDYE B	
	0.00				CUSTOMER STATES RECLINING SEAT HAND	
					REBUILD ALTERNATOR INVOICE 44032- HUT	
166.00	166.00					

rge - "This charge represent of the control of the	or miscellaneous [s. 559.904(4)] 1.00 fee be collected 1, and \$1.50 fee for ery sold. [s. 403.7185] est the return of tranty and ge will apply to all s after notification
Both Apply	Hourly Rate
ted to secure the amou e costs of collection or	unt of repairs.
TAL PARTS TAL LABOR BLET OP SUPPLIES BTOTAL HER FEES LES TAX TAL INVOICE D	\$117.23 \$2,015.00 \$166.00 \$50.00 \$2,348.23 \$0.00 \$176.12 \$2,524.35 \$0.00 \$2,524.35
D	

D	Delough the	
Print	Rece	ıpı

Merchant: EUROPEAN EXOTIC CENTER

13000 AUTOMOBILE BLVD #100

CLEARWATER, FL 33762

US

(727)223-6797

Order Information

Description:

Order Number:

Customer ID:

P.O. Number:

Invoice Number:

Billing Information

33607

Shipping Information

Shipping:

0.00

Tax:

0.00

Total: USD 2,524.35

Payment Information

Date/Time:

28-May-2021 11:15:31 PDT

Transaction ID:

42704829210

Transaction Type:

Authorization w/ Auto Capture

Transaction Status:

Captured/Pending Settlement

Authorization Code:

246676

Payment Method:

American Express XXXX1002





8060 W WATERS AVE **TAMPA, FL 33615** Jan 14, 2021 1:04 PM 813-886-8700 Out Feb 03, 2021 11:56 AM

INVOICE****

Ship To:

Unit #:

Vehicle: 1997 Ferrari F355

License:

Mileage: In: 0 Out: 1

Vin#: PO#:

BAR ID: 2508067

EPA ID: MV79691

4	7	29	QTY Description	Parts	Labor		A PARTIE OF THE
4	-	A CONTRACTOR OF THE PARTY OF TH	4.00 . COMPUTER BALANCE - PASS.	The second secon	A STATE OF THE PARTY OF THE PAR	FET	Total
-	,	SHOP	4.00 . SHOP CHARGE	0.00	25.00	0.00	100.00
4	7	21	400 STATE TIME	3.00	0.00	0.00	12.00
4	7	43	4.00 . STATE TIRE TAX (FEE)	1.00	0.00	0.00	4.00
4	7	A CONTRACTOR OF THE PROPERTY O	4.00 . TIRE DISPOSAL - LT.	3.00	0.00	0.00	12.00
7		85587	2.00 2654018 MIC PILOT SPORT 4 S 101Y	0.7.07.7			
4	7	02717	2.00 225 4040 410 711 07 07 07 07	260.50	0.00	0.00	521.00
	- 19	02.11	2.00 2254018 MIC PILOT SPORT 4 S 92Y	260.50	0.00	0.00	521.00

Card Type: AMERICAN

CC#: ******1002

Auth. # 829358

Amount: \$1,269.45

Signature:

Buyer agrees to pay total amount above, according to cardholder's agreement with issuer.

RETURNS:

- Special order products are non-returnable and non-refundable.
- Mounted or installed products are non-returnable and non-refundable.
- Stocking items require an RGA. Products must be in the original boxes, in new condition. A 25% restocking fee will apply.
- Lug Nuts, spline keys, locks, spacers, and small parts are non-returnable and non-refundable.
- No returns on sales items.

WARRANTIES:

All warranties are offered by the manufacturer. Warranty Claims will be made with manufacturer and they will have final determination. All labor is guaranteed for 30 days/ 500 miles. Warranties may no apply to Chinese tires.

Pitting is caused by brake dust, chemical abuse or lack of maintenance and is not covered by the manufacturer's warranty.

Cash: 0.00 Check: 0.00 Credit: 1,269.45 Change: 0.00 1,070.00 Parts: 100.00 Labor: I have received the above goods and/or services. If this is a credit card purchase, I agree to pay and comply with my cardholder agreement with the issuer. 1,170.00 Subtotal: 99.45 Sales Tax: Signature: \$1,269.45 Total:

Printed: 2/27/2021 3:38:17 PM

Sales Receipt #58090

2/27/2021 Cashier: JM Page 1

Auto Styles 3947 Tampa Rd Oldsmar, FL 34677 (813) 430-7000 AutoStyles.net MV87464





Item Name	Item Description		Qty	Price	Ext Price	
MISC PARTS	SONY GS80		1	\$229.95	\$229.95	_
INS RADIO/BLUETOOTH	INSTALL RADIO W/BLUETOOTH	The state of the s	1	\$119.95	\$119.95	
CUSTOM ENCLOSURE	CUSTOM ENCLOSURE - STARTING		1	\$200.00	\$200.00	
INS SPEAKER PAIR	INSTALL SPEAKER PAIR		1	\$89.95	\$89.95	
LABOR / INST & FAB	REMOVE AND REPLACE BATTERY		1	\$99.00	\$99.00	
TAX FREE MISC PARTS	OPTIMA BATTERY R34980		00.	\$279.80	\$279.80	
P152	ROCKFORD P1 5.25" COAX SPEAKER PAIR		1	\$79.95	\$79.95	
			17 TO 1	Subtotal:	\$1,098.60	Ī
		Florida		7 % Tax	+ \$57.32	
			RECEIP	T TOTAL:	\$1,155.92	

nerican Express

Auto Styles Inc 3947 Janipa Rd Oldsmar, FL 34677

MID 8788014048885

CC Sale

BRIC: 07GXGEYU5HU299JL1TK

Batch # 0303 02/27/21 Item 0007 15:37.52

Involve 9296

Alericantel mark

Amount

\$1155.92

APPROVEI AMERICAN EXPRESS AID: A000000025010801 TVR: 0000008000 TSI: F800

CUSTOMER COPY

1997 FERRARI 355
RED
VIN#
INSTALL NEW HIGH POWER RADIO
KEEP 3 SUBS, ADD 5X7 - NEW CHANNEL TO RADIO

REPLACE BATTERY
From Sales Order #9296

__* DATE: ____

*By signing above I agree to the terms and conditions below
Auto Styles offers a manufacturer warranty on all purchased electronics.

Deposits made on above items valid for 6 months from purchase date.

Il us how we did! Leave a google review for us at www.autostyles.net/review <<---
t Facebook.com/AutoStyles** Concerns should be addressed to ken@autostyles.net

Date:

March 16, 2012

Vehicle:

Ferrari F355 Spider ZFFXR48A5V0106798

VIN#: Color:

Rossa Corsa

Mileage:

32,265

Customer:

Inspected by: Mark Darragh

Mitch Griffin

Good morning Mitch.

The car runs and drives well. There are several items that need to be addressed. Here is a rough estimate of what the car needs.

SDS	Parts	Labour
Rear diffusers	\$344.55 (L) \$367.37 (R)	\$110
Battery cover	\$136.67	\$110
Roof elastic/oil	\$150.00	\$550 (5 hours min)
CV boot	\$129.90	\$528
Nut	\$ 11.85	
HVAC panel	\$150	\$110
Wheel repair	\$450	
Air filter mounts	\$100.38 (6)	\$165
Front/Rear struts	\$120 (4)	\$220
Ball joint	\$260	\$165
Alarm siren	\$560	\$165
Seat re-dye	\$440	
Total	\$3220.72	\$2123 A total of \$5343.72

Please remember this is a very rough quote and is not allowing for issues that may arise during the work.

Thank you, Mark Darragh Sphere Motorsports LLc832-277-7062

	1	No	4				
	GOOD	FAIR	NOTES	ROAD TEST	GOOD	FAIR	NOTE
WPER BLADES	1		142		0000	IAIK	NOIE
DOOR HANDLES	V	1 3 3 5	Session -	CHECK FOR PULLING/WANDERING	1		
SIDE PANEL TRIM	20 0	~	140	ACCELERATION	1		
DOOR WEATHER STRIP	~	80.7	425	RATTLES/BUZZING SOUNDS	1.7		
MIRROR ADJUSTMENT	THE WAY	1000	~		1	117	
OPERATION OF SOFT TOP(IF APPLICABLE)	with the		1	BRAKING	1		Tale
BADGES		V	-	NOISES	1		
WATER HOSES	1	110000	7-15	THE REPORT OF THE PERSON OF A STATE OF THE PERSON OF THE P	74 14 1		
CONDITION OF ENGINE BAY		1	U.S.	DATE			
AIR FILTERS	~	1/1	1000	VEHICLE	10	-	
BELT CONDITION (IF VISABLE)	./		11-11/9	VIN#		1000	-
ENGINE LID RAMS	3 3 3	15-	1	COLOR			100000
BONNET(HOOD) RAMS	1.0	1776		MILEAGE	A ISO	ARL S	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
BOOT (TRUNK) CARPET	V		a del	CUSTOMER	AL SU EUR	0.000	
BOOKS/ MANUALS		ONZ		INSPECTED BY MARK DARRAGH			
CAR COVER/ TONEAU COVER		ONE					100
WASHERS	T E SAL	TAR CAST	TO STATE	NOTES		A James	
REMOTE FUEL RELEASE	V			·RIF INDICATOR			
EMERGENCY RELEASES	/	1	19 11/18	- RIF DRIVING LAMP			
ROADSIDE TOOL KIT	1		Marie F	· RP SIDE LIGHT.			410
BATTERY SECURITY	1	(F1.1)	Fine 6	· HVAC PANEL NEEDS TO BE REPLA	CED		
TERMINALS	1	1910	13° 8 .	BONNET STRUTS NEED AEPLICING	· · · · · · · · · · · · · · · · · · ·		
WATER LEVEL		1000	1000	· ALARM SIREN IN-OP			
OIL LEVEL		WE81	J	· ENGINE DECK LID RAMS NEED T	~ 0=	o= a	ACED
BRAKE FLUID LEVEL	/	t	W. L.	· AIR FILTER MOUNTS	0 66	14516	il CD
CLUTCH FLUID LEVEL		7 1/2 B	100	RIF WHEEL DAMAGE			
. RF UPPER BALL JOINT BOOTS	PLIT		142	"LIM MANNER LAMP CRACKED			
· BATTEMY COVER MISSING!	100	T-LE	1 27	I NEAK STRAIGS BOTH DOMAGED		7	
. EROTT BUMPER IS DAMAGED ON UN	DERSIDE		Se Vit	· EXHAUT SHMUFFUCK SHIELD DO	MAGE	7	
· SCREWS MISSING FROM LOWER P.	WEZ	Harris	r Fail	· KIR WHEEL DAMAGED	3/1/1 02		
· ALL TYNES HAVE DRY ROT!			11.90	· KIR SKINT DAMAGED			
· ALL UNDERTRAS HAVE DAMAGE.	S REAL	M. Te	11.5	· A) C COMPESSOR BOLTS LOSE		1,14	40 1000
. ROOF BAR NEED NEW ELASTIC	10000	o'tt	300	· MEAR BUMPER HAS BEEN PAINTED	BADI	Y	
. ROOP IS LOW ON OIL AND NEEDS	BUED	WG		· RR INNER CV BOOT IS SPL	IT	-	THE RES
. DRVENS SEAT BOLSTER IS WORN.			Tasb"	11 11 10 10 10 11 11 11	1),	20	1
			300			-	

* FUEL CAP DOES NOT CLOSE ALL THE TIME

Page 2

1103 1203 3103 1903

Sphere MotorsportsLLC 3233 west 11th Street Unit J2 Houston Texas 77008


Bill To:
Mitch Griffin

	Date	Invoice No.
	03/16/12	695
Car Type	A STATE OF THE STA	
The special section of the section o		

355 spider Vin # ZFFXR48A5V0106798

Miles 32458

	Description	Quantity	Flate	Amount
Item CV Grease 109184 1512244 1512243 1512245 ABOUR GUBLET SHOP SUPPLIES	CV Joint Grease Hub nut for driveshaft Large clamp ring CV boot Small clamp ring Replace CV boot Redye front seats only 3% of total invoice to a max	1 1 1 1 1 4.8 1 1	7.869 18.96 6.21 33.45 2.38 110.00 440.00 31.10	7.8 18.9 6.2 33.4 2.3 528.0 440.0 31.1
			Total	\$1,067.9

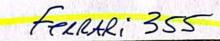

Invoice #: 10539 Date: 03/26/2012 Customer ID:

INVOICE

DYNAMIC TECHNOLOGY GROUP

P.O. Box 646 San Ramon, CA 94583-0646 V (925) 743-8167

e-mail: sales@dynamtechgroup.com

Authorizing Signature

Mitch Gri	ffin				Mary transfer
702 West	Third Street				
Delavan, I	L 61734				
Credit Card	Special Order	Sales Person	FOB	SHIP VIA	Terms
			# //	USPS	Tayla
Qty		Description		Unit Price	Total
/	ARB-1	alorn kg	Lutter	1	\$10-
	Vi	7			
	100				ž.
			1-	Later Comment	ter and the
		(6)			
	ran Kasabasa	18/	1746		
			SE VE SESSION		
			\cap		
		1/1/			
	-//	hanh Va	11	A STATE OF	
		with the	The many		
V Parlie /			As Maria		
		(3) (A 45) - (A)			
			14. 18. 17. 1. 18.		
				The Transfer of the	5,4
		and the second s	, Subt	otal	d 10
electronic eq	uipment and speci	al order items sales	are final		\$10

Total

Deposit Bal Due



Microfinish LLC

208 Plauche Ct New Orleans, LA 70123 (888) 710-5192

Bill To: Bryce Griffin

702 West Third Street DELAVAN, IL 61734

US

Pay By:

Email: mg@bradley.edu Phone: 309-244-7075

Fax:

Credit Card: PayPal Express

Name on Card:

Card Number: ******TSFN

Expiration Date: Security Number: ****

Result:

Transaction ID:

Mailing List: Business: No Gift Message: Order ID: 7093219 Order Date: 4/10/2012 Order Time: 7:56:12 PM



Ship To: Bryce Griffin

702 West Third Street DELAVAN, IL 61734

Email: mg@bradley.edu Phone: 309-244-7075

Fax:

Order Date: 4/10/2012 / 7:56:12 PM

Merchant: 0

Shipping Details:

Type:

US Post Office

Service: US Post Office

Ship Cost: \$3.95

Account#:

Name:

Order Details

Qua	ntity Item	Description	Price	Item Total	Sub Total
1	PEN-BC	1/2 oz Paint Pen, 1997 Ferrari All Models: Rosso Corsa 231191	\$12.95	\$12.95	\$12.95
1	PEN-CC	Paint Pen High Gloss Clearcoat	\$5.74	\$5.74	\$5.74
				Shinnin	n Coet- \$3 05

Total Taxes: \$0.00 Grand Total: \$22.64

Return Policy: All custom mixed paints are non-returnable. There is a 30 day limitation from the date of order to remix paint or to return non-made to order products (25% restock fee less shipping and handling apply). Please call before sending anything back for individual case instructions and/or a Return Authorization number. If you are unhappy with your color match, send us the test card with the back of card completed. Any remixes are shipped to you free of charge. For additional information, please click on the E-Store Policies link from the home page.

PACKING LIST

Order Number: 9333929 placed Tuesday, April 10, 2012 01:58 PM



Ship Via: Priority Mail

From: RockAuto, LLC 5200 W. 130 St. Brook Park, OH 44142

Ship To:

Bill To:

MITCH GRIFFIN 702 W 3RD ST

DELAVAN, IL 617349659 United States 309-241-3562 mg@bradley.edu MITCH GRIFFIN 702 W 3RD ST

DELAVAN, IL 617349659 United States

309-241-3562 mg@bradley.edu

Manufacturer	Part Number	AutoPart Category	Quantity (This Box)	Quantity Ordered	Shipped
0 No Vehicle S	Specified				
SACHS	SAC SG404018	Lift Support	47	4	

Thank you for choosing us as your parts supplier. If you have questions about your order, please call 1-866-762-5288 (toll free in US and Canada) or 02071 833854 (in the UK) or 1-608-661-1376 (worldwide) or e-mail sérvice@rockauto.com. All returns require prior authorization. If you need to return something, please visit http://www.rockauto.com/orderstatus or call or e-mail for instructions.

Packed By:

Date:

dib.

RockAuto Order Confirmation Order 9383713



Saturday, April 14, 2012 01:01 PM (Central Time)

Ship To:

Bryce Griffin

702 W 3rd St

Delavan, IL 61734

United States

3092413562

mg@bradley.edu

Bill To:

Bryce Griffin

702 West Third Street

Delavan, IL 61734

United States

3092413562

mg@bradley.edu

	Part Number	Part Type	Price EA	Core EA	Quantity	<u>Total</u>
1997 FERRA	RI F355 SPIC	DER 3.5L V8				
BOSCH	0280130039	Air Temperature Sensor	\$ 16.73	\$ 0.00	1	\$ 16.73
Shipping Priority Mail						
Order Total			Yan in your			\$ 22.23

Thank you for paying with PayPal Express. Your order will ship when your PayPal payment has been processed.

To check order status or get return instructions, please visit http://www.rockauto.com/orderstatus (NOTE: All returns require authorization--parts do not necessarily go back to the location from which they shipped!)

Please click on the part number above to check the RockAuto Advice Wiki for other customers' installation tips. After you complete your repair, please return to the Wiki and add your advice to help others.

Please print this page as your receipt.

Thanks again for buying your auto parts at RockAuto!

www.RockAuto.com service@rockauto.com

1-866-ROCKAUTO (1-866-762-5288)

(608) 661-1376

Fax: (608) 819-6350

*	PICKING	QT.TP	*
	PICKTING	PHIL	0.00

Page: 1 Date: 4/15/12 Time: 10:40:08

SA: >< SP: IA

Order: 08 93988 Orig: 93987

Bill To: 00 64356 ROCKAUTO LLC

ROCKAUTO LLC .
67 WHITSON STREET
HEMPSTEAD NY 11550

Ship To:

BRYCE GRIFFIN

DOMESTIC ORDER DOMESTIC ORDER

DELAVAN IL 61734

Ship Method: UNITED STATES PRIORITY MAIL Terms: CHG OPEN ACCOUNT

P/O: 9383713

Priority: 99

Lines: 1

Units: 1 Weight: .10000

Location Part Number Pick Ship Order Description UM Lin A A05L08 BS0280130039 1 1 1 TEMPRTURE SE 1

Units:	1	Picker		/Time:_
			the state of the s	







42 Park Blvd Winston Salem, NC 27127

ORDER #12084

Payment Method: Credit Card: with CCV

Credit Card: with CCV: Visa

Date Purchased: 2012-04-17 15:56:14

SOLD TO:

Premier Motorcars Mitch Griffin 702 West Third Street Delavan, Illinois 61734 United States SHIP TO:

Premier Motorcars Mitch Griffin 702 West Third Street Delavan, Illinois 61734 United States

 Products
 Model
 Price (ex)
 Total (inc)

 1 x SWS-355B
 SWS-355B F355 Steering Wheel Spacer
 \$120.00
 \$120.00

 1 x 64502200R
 355 HVAC Panel Replacement
 \$80.00
 \$80.00

Sub-Total: \$200.00

Super Saver (Postal/Ground): \$6.50

Total: \$206.50

LOG IN

ORDER TRACKING

MY ACCOUNT

WISH LIST

ESPAÑOL CART (8 Items)

1-888-541-1777

UPGRADE GARAGES GIFT CERTIFICATES PRODUCTS SHOPPING TOOLS

Why Tire Rack Contact Info Installation **Using This Site**

Check Out

Order Summary

THANK YOU FOR YOUR ORDER

You will receive an order confirmation with an order number by email. You will also be notified once your order has been shipped.

PRINT THIS PAGE

Billing Address:

Bryce Griffin 117 East Fourth Street Delavan, IL 61734

Shipping Address:

Marcs Auto Service 200 East Fifth Street Delavan, IL 61734

Make Sure You Get Your **Order-Related Emails**

Add orders@email.tirerack.com to your list of approved senders.

This will ensure that you receive all order confirmation and shipment emails, as well as correspondence pertaining to customer service or other purchase-related issues.

Items shipping from Shreveport, Louislana BY UPS Ground

Estimated Delivery Date: 04/23/2012

Item Description	Availability	Qty.	Price Each	Item Total
225/40ZR18 Continental ExtremeContact DW for 1997 Ferrari F355 Download Warranty Brochure PDF	In Stock	2	\$162.00	\$324.00
265/40ZR18 Continental ExtremeContact DW for 1997 Ferrari F355 Download Warranty Brochure PDF	In Stock	2	\$252.00	\$504.00
225/45ZR17 Continental ExtremeContact DWS for 2001 Audi S4 Avant Download Warranty Brochure PDF	In Stock	4	\$129.00	\$516.00
		Shippi	ng Sub-Total:	\$121.99
			Sales Tax:	\$0.00
			Excise Tax	\$0.00
	State W	aste T	ire Fund Fee:	\$0.00
			Order Total:	\$1,465.99

If you have any other questions regarding tires or wheels for your vehicle, please call one of our specialists at 1-888-541-1777 during our sales and customer service phone hours.

JOIN US











Add your email address to our subscriber list and stay on the inside track!



ABOUT TIRE RACK

The Experts Installation

Order Tracking Returns/Refunds Contact Info **Using This Site**

ORDER INFO

Terms of Use | Privacy Pledge | Affiliate Program | Dealer Inquiries | Career Opportunities

C2012 Tire Rack









42 Park Blvd Winston Salem, NC 27127

ORDER #12911

Payment Method: Credit Card: with CCV

Credit Card: with CCV: Visa

Date Purchased: 2012-08-29 20:49:08

SOLD TO:

Premier Motorcars Mitch Griffin 702 West Third Street Delavan, Illinois 61734 United States

Products

Model

1 x PFR355-LHD-RED PFR355-LHD-RED (RED)

SHIP TO:

Premier Motorcars
Mitch Griffin
702 West Third Street
Delavan, Illinois 61734
United States

Price (ex)

Total (inc)

\$140.00

\$140.00


Sub-Total: \$140.00


Ground/Postal (Ground/Postal (US customers only)): \$6.50

Total: \$146.50

Leatherique 2013

106 Englewood Road Aiken, SC 29803

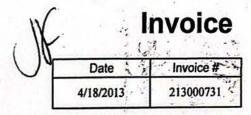

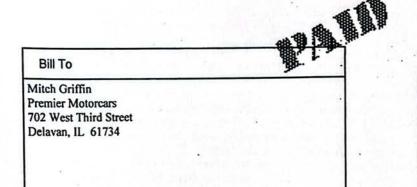

		·*
Ship To		
Mitch Griffin	77 Y	10.4
Premier Motorcars		
702 West Third Street		
Delavan, IL 61734		
		-7 19 1
	*	

P.O. Number	Terms	Rep	Ship	Via	F.O.B.		Project
	paypal	KIP	4/19/2013	1		-	· M.
Quantity	Item Code		Descripti	on	Price I	Each	Amount :
THE PERSON NAMED IN	RDS-03-32OZ SG Paypal	32oz Ferrari Lo Jaguar XJS, Mo and Ottoman, 3218 Saddle fo GROUND SHI Paypal internet	#3 Includes 11/320 (1/320z Prepping A eatherique Dye This ercedes Benz Coupe r 1997 Ferrari 355] PPING AND HAND	z Rejuvepator (1) 3 gent (1) 2 oz Crack l kit will do: Most Bl or, Sofa, Large Cha	MW,	17.95 -187.95 0.00%	17.9.00 17.9. -187.9. 0.00
Thank you for yo	our business.				Tota	1	\$0.0

Eagle Day - Order Shipment Status

The following items have been shipped to:

Mitch Griffin **PremierMotorcars** 702 West Third Street Delayan IL 61734 US United States 3092413562

using UPS Ground Residential

The shipper's tracking number is 1ZRV35710350209118

You can always find out the current status of your order by going to https://order.store.yahoo.net/OS/stat?eagleday+51971+d1f0dbb1204de3e8421a

Name Code **Qty Each Options** TENAX Fasteners "Made In Tenax-3000079-81 6 7.95

Germany": Tenax Large

Head Kit Chrome

(Shipped)

UPS Tracking Number:

1ZRV35710350209118

Subtotal 47.70 Shipping 13.99 Tax 0.00 Total 61.69

This completes your order. Thank you for shopping with us.



OIL REPORT LAB NUMBER: G73414

REPORT DATE: 4/27/2015

UNIT ID: F355

CODE: 63/501

CLIENT ID: 80900

PAYMENT: CC: Visa

MAKE/MODEL: Ferrari 3.5L V-8 **FUEL TYPE:** Gasoline (Unleaded) 1997 ADDITIONAL INFO:

OIL TYPE & GRADE:

Mobil 1 5W/30

OIL USE INTERVAL:

1,291 Miles

MITCH GRIFFIN CLIENT

PREMIER MOTORCARS 702 WEST THIRD STREET DELAVAN, IL 61734

PHONE: (309) 241-3562

FAX:

ALT PHONE:

EMAIL: mg@bradley.edu, mitch@masgconsulting.com,

PremierMotorcars@masgconsulting.com

MITCH: You said that this was Mobil 1 5W/30, but Mobil 1 doesn't use sodium as part of its additive package. Maybe the sodium in this sample is just residual from a different type of oil, like Valvoline, or maybe we've just got the wrong type of oil listed. The other possibility is that sodium is from antifreeze, but we don't see any other signs of a coolant leak. Metals look good (averages are based on ~1,900-miles of oil use) and potassium (a marker for coolant) is low. Fuel is fine at 0.5%. The TBN is good at 3.8 (a reading of 1.0 is low). Aside from sodium, this is a nice report!

19	MI/HR on Oil	1,291	REPORT OF STREET	1 may 1				
	MI/HR on Unit	36,498	UNIT /			Walter Williams		UNIVERSAL
	Sample Date	03/27/15	LOCATION AVERAGES		AUTO DE TOTAL			AVERAGES
	Make Up Oil Added	0 qts	AVENAGES		Service Control			Shipping the same of
NO	ALUMINUM	5	5					3
임	CHROMIUM	Ö	0		THE VICE OF			
MILLIC	IRON	10	10					8
Σ	COPPER	11	11	einson)				9
E	LEAD	1	1			1000	10.00	3
Зd	TIN	2	2					0
S	MOLYBDENUM	1	1.001 14964				Fundada II	85
RT	NICKEL	0	0					2
PA	MANGANESE	1	S/Selforerestif	Alteral		die grant in		0
	SILVER	0	0				and the second	0
Z	TITANIUM	0	0	i sa mwana i	12.75			0
TS	POTASSIUM	2	2	110			A VIIII	3
EN	BORON	2	2					86
ELEMI	SILICON	7	7		and the last of th			16
쁘	SODIUM	210	210		To be true and			24
ш	CALCIUM	1860	1860	10000	mach = elli		HILL YOU IS NOT	2203
	MAGNESIUM	234	234					167
	PHOSPHORUS	732	732	VOLE		14	THE STATE OF THE S	818
	ZINC	880	880	VIII OF A			The second of	941
	BARIUM	0	0					0
			Values					

Should Bot

			Official De	-			
S.P.	SUS Viscosity @ 210°F	56.9	55-62		المالية الأمالية	The Original Property	
	cSt Viscosity @ 100°C	9.33	8.8-11.1				
S	Flashpoint in °F	355	>365				White the state of
Ш	Fuel %	0.5	<2.0				
PERT	Antifreeze %	?	0.0		La Vincentina		
	Water %	0.0	0.0				
RO	Insolubles %	0.1	<0.6				
PF	TBN	3.8	>1.0	The same			
	TAN			Land I		7 2 10	
	ISO Code	le le	Sala ivental				

* THIS COLUMN APPLIES ONLY TO THE CURRENT SAMPLE

www.blackstone-labs.com 416 E. PETTIT AVE. FORT WAYNE, IN 46806 (260) 744-2380

RICAMBI AMERICA

314 Indera Mills Court - Winston Salem - North Carolina - 27101

Order #145000667

Order Date: January 27, 2016

Shipping Address

Mitch Griffin
Premier Motorcars
702 W. 3rd St.
Delavan, Illinois, 61734
United States
T: 3092413562

Billing Address

Mitch Griffin
Premier Motorcars
117 East 4th Street
PO Box 216
Delavan, Illinois, 61734
United States
T: 3092413562

Shipping Method

Ground/Postal (US customers only) - Fixed

Payment Method

Credit Cards

Credit Card Type: Visa

Credit Card Number:xxxx-3840 Processed Amount: \$1,311.50

Items Ordered

Product Name	SKU	Price	Qty	Subtotal
355 30K Service Kit	355SK1	\$1,450.00	Ordered: 1 Shipped: 1	\$1,450.00
			Subtotal	\$1,450.00

RICAMBI AMERICA

314 Indera Mills Court - Winston Salem - North Carolina - 27101

Order #145000667

Order Date: January 27, 2016

Shipping Address

Mitch Griffin
Premier Motorcars
702 W. 3rd St.
Delavan, Illinois, 61734
United States
T: 3092413562

Shipping Method

Ground/Postal (US customers only) - Fixed

Billing Address

Mitch Griffin
Premier Motorcars
117 East 4th Street
PO Box 216
Delavan, Illinois, 61734
United States
T: 3092413562

Payment Method

Credit Cards

Credit Card Type: Visa

Credit Card Number:xxxx-3840 Processed Amount: \$1,311.50

Items Ordered

Product Name	SKU	Price	Qty	Subtotal
355 30K Service Kit	355SK1	\$1,450.00	Ordered: 1	\$1,450.00
			Subtotal	\$1,450.00
		Shippin	g & Handling	\$6.50
		Discour	it (FCA2016)	-\$145.00
			Grand Total	\$1,311.50

Close Window



Kauth & Mayeur

1710 W Detweiller Dr Peoria, IL 61615 (309) 673-1412 service@kauthmayeur.com Invoice #1436

Page 1 of 3 09-29-20 Mitch Griffin 1997 Ferrari F355

Mitch Griffin

702 W Third St Delavan, IL 61734 (309) 241-3562 1997 Ferrari F355

ZFFXR48A5VO106798

Advisor: Adam Tanner

TOTAL

\$154.00

\$59.83

TOTAL

\$2.99

\$1.99

\$15.00

Technician: Brian Smith

1.0

\$15.00

Engine: v8 Plate: RD BRCTA

Odometer In: 39093 Odometer Out: 39093 **GRAND TOTAL: \$355.33**

BALANCE DUE: \$355.33

SERVICES

Oil Change Service

LABOR

Oil change service

QTY **EACH** PART# PARTS \$14.00 11.0 Redline 5/40 motor oil 15404 \$59.83 1.0 oil filter 197654 **QTY** FEE **HAZMATS & FEES** \$2.99 1.0 disposal charges \$1.99 1.0 seal ring

SUBTOTAL: \$329.81

Labor: \$96.00 Parts: \$213.83

Fees: \$19.98

Sublet: \$0.00

Exhaust Leak

Shipping oil filter

Mitch mentioned on his way in he thought he heard an exhaust leak.(check and advise) Confirmed. The header has developed a hole. We will get in contact with the supplier for a replacement.

SUBTOTAL: \$0.00

Labor: \$0.00 Parts: \$0.00

Fees: \$0.00 Sublet: \$0.00

Terms of Service:

1. "YES, DO THIS WORK"

I hereby authorize the corresponding service to be done along with the necessary materials.

2. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

Kauth and Mayeur staff may operate my vehicle for the purpose of testing, inspection, and delivery.

3. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto.

4. "ONLINE COMMUNICATION OK"

I welcome email from Kauth and Mayeur as a means of receiving copies of my estimate, work order, and invoice.

5. "HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to these five terms.

Authorization:

GRAND TOTAL: \$355.33

Total Labor: \$96.00 Total Parts: \$213.83 Total Fees: \$19.98 Total Sublets: \$0.00 Shop Supplies: \$5.76

Sales Tax: \$19.76

BALANCE DUE: \$355.33

BOSCH Service