




1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 1								
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION											
STATUS ⊗		SYS A	DATE 17 Mar 17	NO 4	TIME 06:11	PID Generated, Cor			DATE 31 Dec 20	TIME 08:49	ACFT HRS 6068.0						
FAULTS/REMARKS USE OF PERSONAL RESTRAINT TETHER RESTRICTED PER H-60-17-ASAM-07						ACTION Unit has replaced all old tethers with updated ones per H-60-17-ASAM-07. Restriction no longer applies.											
ACFT HRS 5713.6						WHEN DISC O	HOW REC G	MAL EFF 2	PID CURTIS, A.	CAT F	HRS 0.1	PID	CAT	HRS	PID	CAT	HRS
DELAY						WUC 00			TIPIID CURTIS, ANDREW			TI MANHOURS 0.1					
STATUS ⊗		SYS A	DATE 24 Aug 17	NO 1	TIME 06:30	PID HICKEY, LOUIS			DATE 31 Dec 20	TIME 08:51	ACFT HRS 6068.0						
FAULTS/REMARKS RESCUE HOIST OPERATIONS RESTRICTED PER H-60-16-SOF-02						ACTION Unit has replaced all hoist hooks with updated ones per H-60-16-SOF-02. Restriction no longer applies.											
ACFT HRS 5038.9						WHEN DISC O	HOW REC G	MAL EFF 1	PID CURTIS, A.	CAT F	HRS 0.1	PID	CAT	HRS	PID	CAT	HRS
DELAY						WUC 14A			TIPIID CURTIS, ANDREW			TI MANHOURS 0.1					
STATUS /		SYS A	DATE 28 Jun 19	NO 2	TIME 08:43	PID Conversion, Ulls			DATE 10 Aug 20	TIME 11:08	ACFT HRS 6012.1						
FAULTS/REMARKS RECEPTAL LEFT OF CENTER ON SOUNDPROOFING AFT OF DRIP PAN REQUIRES REPAIR						ACTION repaired											
ACFT HRS 5949.2						WHEN DISC K	HOW REC G	MAL EFF 1	PID EISENHAU	CAT F	HRS 0.1	PID	CAT	HRS	PID	CAT	HRS
DELAY w/osm01610002						WUC 02B37			TIPIID ,			TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 2				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS O	DATE 01 Sep 19	NO 1	TIME 00:00	PID Generated, Cor		DATE 03 Jun 20	TIME 11:09	ACFT HRS 5994.8						
FAULTS/REMARKS INSP O800 LOGBOOK RECON DUE FOR HELICOPTER, UTILITY CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 31 AUG 2019 REFERENCE: AASF SOP								ACTION Complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CURTIS, A.	F	1.0						
ACFT HRS 5966.5		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID CURTIS, ANDREW			TI MANHOURS 0.1					
STATUS —		SYS A	DATE 09 Oct 19	NO 10	TIME 15:46	PID GORCZOK, PETE		DATE 04 Sep 20	TIME 13:53	ACFT HRS 6022.6						
FAULTS/REMARKS 40 HR TQ CHECK REQUIRED ON TAIL PYLON ATTACHING BOLTS DUE AT 6020.2 ACFT HRS FOR FOLDING TAIL								ACTION TRQ STABILIZED, TRQ CHECK COMPLETE								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bender, T.	F	0.5						
ACFT HRS 5980.2		WHEN DISC X	HOW REC G	MAL EFF 1												
DELAY Due @ 6016.2 - 6024.2				WUC 02				TIPIID ,			TI MANHOURS					
STATUS /		SYS A	DATE 04 Nov 19	NO 5	TIME 07:40	PID MILLIKEN, JEREM		DATE 01 Jun 20	TIME 10:44	ACFT HRS 5994.8						
FAULTS/REMARKS hit checks could not be completed through ivhms. manual checks ok								ACTION Updated write up. #1 side now works, #2 eng TGT incorrect								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CURTIS, A.	F	1.0						
ACFT HRS 5986.1		WHEN DISC B	HOW REC G	MAL EFF 2												
DELAY w/o uatc12900013				WUC 02				TIPIID ,			TI MANHOURS					

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 3				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /	P CLOSED	SYS A	DATE 21 Nov 19	NO 5	TIME 08:34	PID EISENHAUER, JE		DATE 11 Aug 20	TIME 14:53	ACFT HRS 6012.1						
FAULTS/REMARKS female end zues fastener top l/h tgb cover over output shaft broken								ACTION replaced fastner								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 5987.2		WHEN DISC X	HOW REC G	MAL EFF 2												
DELAY WO# SM00070001				WUC 02				TIPIID ,				TI MANHOURS				
STATUS —	B CLOSED	SYS A	DATE 22 Nov 19	NO 1	TIME 07:53	PID GORCZOK, PETE		DATE 10 Jun 20	TIME 14:41	ACFT HRS 5994.8						
FAULTS/REMARKS 9-11 hr tq check due on section three driveshaft both ends between 5999.2 - 5601.2 hrs 2nd check								ACTION Write up entered in error, inccorect hour range								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bender, T.	F	0.1						
ACFT HRS 5990.2		WHEN DISC O	HOW REC G	MAL EFF 2												
DELAY				WUC 06				TIPIID ,				TI MANHOURS				
STATUS —	D CLOSED	SYS A	DATE 06 Dec 19	NO 4	TIME 18:58	PID GORCZOK, PETE		DATE 06 May 20	TIME 15:00	ACFT HRS 5993.3						
FAULTS/REMARKS maintenance test flight required due to replacement of pitch/trim assembly								ACTION completed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUNHAM,	F	1.0						
ACFT HRS 5990.2		WHEN DISC X	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 4				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	C Closed	SYS A	DATE 10 Feb 20	NO 1	TIME 14:42	PID DUFFY, JOSHUA		DATE 01 Jun 20	TIME 10:43	ACFT HRS 5994.8						
							ROUNDS	ACTION CODE 4		WUC 00						
FAULTS/REMARKS VIB CHECK OF CABIN VIBRATION ABSORBER DUE FOR REMOVAL AND REPLACEMENT OF CABIN VIBRATION ABSORBER L/H AND R/H FITTINGS								ACTION Complete. Aircraft cabin is tuned to 100.5% at .28 IPS								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CURTIS, A.	F	1.0						
ACFT HRS 5990.2		WHEN DISC G	HOW REC G	MAL EFF 2												
DELAY				WUC 02				TIPIID ,				TI MANHOURS				
STATUS —	E Closed	SYS A	DATE 04 Mar 20	NO 2	TIME 09:42	PID Pacheco, Jason		DATE 02 Jun 20	TIME 12:38	ACFT HRS 5994.8						
							ROUNDS	ACTION CODE J		WUC 00						
FAULTS/REMARKS 3-13 HOUR TQ CHECK OF #1 AND #2 ENGINE HSS ATTACHING HDWR DUE BETWEEN 5993.0 - 6003.2 ACFT HOURS								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 5990.2		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 04A				TIPIID ,				TI MANHOURS				
STATUS —	D Closed	SYS A	DATE 04 Mar 20	NO 4	TIME 09:46	PID Pacheco, Jason		DATE 06 May 20	TIME 15:07	ACFT HRS 5993.3						
							ROUNDS	ACTION CODE 4		WUC 00						
FAULTS/REMARKS MTF REQ'D FOR THE #1 AND #2 ENGINES FOR REMOVAL AND REPLACEMENT OF ENGINES								ACTION completed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUNHAM,	F	1.0						
ACFT HRS 5990.2		WHEN DISC K	HOW REC G	MAL EFF 2												
DELAY				WUC 04A				TIPIID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 5					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A		DATE 04 Mar 20		NO 6		TIME 09:51		PID Pacheco, Jason		DATE 06 May 20		TIME 15:00		ACFT HRS 5993.3	
												ROUNDS		ACTION CODE 4		WUC 00	
FAULTS/REMARKS ENGINE CHECK OUTS REQ'D ON THE #1 AND #2 ENGINES IAW TM 1-2840-248-23&P WP 0117 FOR REMOVAL AND REPLACEMENT OF ENGINES										ACTION completed							
												PID		CAT		HRS	
												DUNHAM,		F		1.0	
ACFT HRS 5990.2				WHEN DISC K				HOW REC G				MAL EFF 1					
DELAY				WUC 04A				TIPIID ,				TI MANHOURS					
STATUS /		SYS A		DATE 06 Mar 20		NO 5		TIME 12:49		PID DUFFY, JOSHUA		DATE 03 Jun 20		TIME 11:03		ACFT HRS 5994.8	
												ROUNDS		ACTION CODE G		WUC 02	
FAULTS/REMARKS MACHINE GUN MOUNT GUN ARM (M240) L/H AND R/H RMVD FROM A/C AT 48 LBS MOMENT 13.44 CHART C ENTRY NOT COMPLETED, MUST BE COMPLETED N/L/T 04JUN2020										ACTION re-wrote fault							
												PID		CAT		HRS	
												EISENHAU		F		0.1	
ACFT HRS 5990.2				WHEN DISC G				HOW REC G				MAL EFF 2					
DELAY N/L/T 04JUN20				WUC 02				TIPIID ,				TI MANHOURS					
STATUS /		SYS A		DATE 07 Mar 20		NO 3		TIME 10:21		PID ROXBY, MICHEL		DATE 18 May 20		TIME 12:32		ACFT HRS 5993.3	
												ROUNDS		ACTION CODE S		WUC 00	
FAULTS/REMARKS UHF radio inop. Could not receive or transmit.										ACTION REINSTALLED UHF COAX ANTENNA ON UHF CONTROL HEAD							
												PID		CAT		HRS	
												Bartlett, C.		F		0.3	
ACFT HRS 5990.7				WHEN DISC G				HOW REC B				MAL EFF 4					
DELAY w/o submitted				WUC 19B01				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 6				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 11 Mar 20	NO 3	TIME 15:04	PID BISHOP, JEFFER		DATE 03 Jun 20	TIME 14:54	ACFT HRS 5994.8						
FAULTS/REMARKS copilot wiper arm req adjustment.								ACTION adjusted								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.2						
ACFT HRS 5990.7		WHEN DISC K		HOW REC G		MAL EFF 1										
DELAY repair next available maint				WUC 00				TIPIID ,				TI MANHOURS				
STATUS X		SYS A	DATE 12 Mar 20	NO 3	TIME 16:08	PID CURTIS, ANDREI		DATE 05 May 20	TIME 16:26	ACFT HRS 5992.3						
FAULTS/REMARKS #2 Converter failed in flight followed by #2 Gen failure. Was able to reset #2 gen twice, but the third time this happened the gen would not reset.								ACTION troubleshoot syatem								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								TARBOX, C	F	0.1						
ACFT HRS 5990.7		WHEN DISC G		HOW REC G		MAL EFF 2										
DELAY				WUC 00				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				
STATUS X		SYS A	DATE 12 Mar 20	NO 4	TIME 16:10	PID CURTIS, ANDREI		DATE 05 May 20	TIME 16:30	ACFT HRS 5992.3						
FAULTS/REMARKS Uncommanded pitch inputs during flight. Happened intermittantly duing the entire flight								ACTION replaced pitch servo								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Pacheco, J	F	0.1						
ACFT HRS 5990.7		WHEN DISC G		HOW REC K		MAL EFF 2										
DELAY				WUC 00				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 7				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /	B Closed	SYS A	DATE 12 Mar 20	NO 5	TIME 16:12	PID CURTIS, ANDRE		DATE 18 May 20	TIME 12:28	ACFT HRS 5993.3						
FAULTS/REMARKS #1, #2 engine torque inaccurate in IVHMS. Could not compute HIT check using IVHMS.								ACTION UPDATED IVHMU SOFTWARE								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								TARBOX, C	F	0.5						
ACFT HRS 5990.7		WHEN DISC G		HOW REC G		MAL EFF 2										
DELAY found chaffed wires, moc system				WUC 00				TIPIID ,				TI MANHOURS				
STATUS /	B Closed	SYS A	DATE 12 Mar 20	NO 6	TIME 16:14	PID CURTIS, ANDRE		DATE 18 May 20	TIME 12:24	ACFT HRS 5993.3						
FAULTS/REMARKS #2 engine tgt showed 150 degrees high on IVHMS during HIT check. During flight the IVHMS TGT was accurate.								ACTION UPDATED SOFTWARE.								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								TARBOX, C	F	0.5						
ACFT HRS 5990.7		WHEN DISC G		HOW REC G		MAL EFF 2										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS X	H Closed	SYS O	DATE 13 Mar 20	NO 1	TIME 00:01	PID Generated, Com		DATE 22 Jun 20	TIME 10:18	ACFT HRS 6002.3						
FAULTS/REMARKS INSP O801 128D DAFIF AND WAYPOINT UPDATE REQUIRED FOR HELICOPTER, UTILITY CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 12 MAR 2020 REFERENCE: AASF SOP								ACTION COMPLETED DAFIF AND WAYPOINT UPDATE								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								TARBOX, C	F	0.4						
ACFT HRS 5992.3		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID HICKEY, LOUIS				TI MANHOURS 0.1				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 8				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 23 Mar 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 06 May 20	TIME 13:30	ACFT HRS 5992.3						
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HELICOPTER, UTILITY CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 22 MAR 2020 REFERENCE: TM 1-1520-237-23&P								ACTION Complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CURTIS, A.	F	1.0						
ACFT HRS 5992.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID CURTIS, ANDREW			TI MANHOURS 0.1					
STATUS /		SYS A	DATE 02 Apr 20	NO 1	TIME 07:19	PID TARBOX, CHARL		DATE 04 May 20	TIME 08:36	ACFT HRS 5992.3						
FAULTS/REMARKS COMPLY WITH THE REQUIREMENTS OF AWR 1823 REV 7. IVHMU SOFTWARE UPDATE TO VERSION 5.0C1.								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 5992.3		WHEN DISC O	HOW REC G	MAL EFF 2												
DELAY				WUC 08F01				TIPID ,			TI MANHOURS					
STATUS X		SYS A	DATE 08 Apr 20	NO 1	TIME 00:01	PID Generated, Com		DATE 05 May 20	TIME 14:25	ACFT HRS 5992.3						
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 6034.2 AIRCRAFT HOURS OR 07 APR 2020 REFERENCE: TM 1-1520-237-23&P								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								BISHOP, J.	F	0.5						
ACFT HRS 5992.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID EISENHAUER, JEFFREY			TI MANHOURS 0.1					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 9		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION				
STATUS X		SYS A	DATE 08 Apr 20	NO 2	TIME 00:01	PID Generated, Cor	DATE 05 May 20	TIME 14:24	ACFT HRS 5992.3	
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 07 APR 2020 REFERENCE: TM 1-1500-344-23						ACTION complete				
ACFT HRS 5992.3						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 00		TIPIID EISENHAEUER, JEFFREY		TI MANHOURS 0.1
STATUS ⊗		SYS A	DATE 08 Apr 20	NO 4	TIME 12:38	PID CURTIS, ANDRE	DATE 28 May 20	TIME 13:20	ACFT HRS 5993.3	
FAULTS/REMARKS OPERATE IN ACCORDANCE WITH AWR 2120 R3 DATED 27 SEP 2019 (GeTac Computer), AWR 1956 R3 DATED 31 OCT 2018 (APR-39), AWR 1913 R4 DATED 17 JAN 2020 (ACN LOGBOOK), AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C), AWR 1800 R9 DATED 18 JUL 2019 (EDM/BFT), AWR 1753 R7 DATED 31 OCT 2018 (128D GPS), AWR 1738 R6 DATED 18 JAN 2019 (APX-118), AWR 1694 R7 DATED 29 JAN 2020 (DSC), AWR 1682 R25 DATED 01 AUG 2019 (701D TDI), AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU), AWR 1566 R7 DATED 05 FEB 2019 (HPH CABLE GUARD), AWR 1516 R12 DATED 07 FEB 2019 (ELT EBC-406HM), AWR 1513 R13 19 APR 2019						ACTION updated				
ACFT HRS 5992.3						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 00		TIPIID CURTIS, ANDREW		TI MANHOURS 0.1
STATUS ⊗		SYS A	DATE 08 Apr 20	NO 5	TIME 12:38	PID CURTIS, ANDRE	DATE 28 May 20	TIME 13:20	ACFT HRS 5993.3	
FAULTS/REMARKS OPERATE IAW THE FOLLOWING AWR'S IF APPLICABLE - AWR 1965 R9 DATED 18 MAR 2020 (APPLE IPAD DEVICES), AWR 1930 R12 17 JAN 2020 (PMI), AWR 1784 R4 DATED 31 JUL 2019 (SHIP BOARD OPS), AWR 1632 R7 DATED 05 OCT 2018 (ALP LASER POINTER), AWR 1466 R9 DATED 23 AUG 2019 (GARMIN GPS), AWR 1453 R7 DATED 06 JUN 2019 (MCS), AWR 1407 R5 DATED 31 MAY 2018 (DAY HUD), AWR 1309 R12 DATED 30 JUL 2019 (OREGON SEAT CUSHION), AWR 1308 R13 DATED 24 APR 2019 (IRH R5), AWR 1279 R8 DATED 15 MAY 2018 (COCKPIT/CABIN DRS REMOVED), AWR 1270 R12 DATED 5 SEP 2018 (EIBF), AWR 1127 R9 DATED 11 SEP 2018 (ELL),						ACTION updated				
ACFT HRS 5992.3						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 00		TIPIID CURTIS, ANDREW		TI MANHOURS 0.1




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 10				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS E	DATE 14 Apr 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 01 May 20	TIME 13:15	ACFT HRS 5992.3						
FAULTS/REMARKS INSP E220 EMERGENCY LOCATOR TRANSMITTER SELF-TEST (AS REQUIRED) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 13 APR 2020 OR 6115.7 AIRCRAFT HOURS REFERENCE: AWR 1516 R12								ACTION complete								
ACFT HRS 5992.3								WHEN DISC	O	HOW REC	O	MAL EFF		1		
DELAY								WUC 00				TIPIID EISENHAEUER, JEFFREY				TI MANHOURS 0.1
STATUS X		SYS E	DATE 14 Apr 20	NO 2	TIME 00:01	PID Generated, Com		DATE 04 May 20	TIME 08:20	ACFT HRS 5992.3						
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 13 APR 2020 REFERENCE: TM 11-5810-262-23								ACTION complete								
ACFT HRS 5992.3								WHEN DISC	O	HOW REC	O	MAL EFF		1		
DELAY								WUC 00				TIPIID EISENHAEUER, JEFFREY				TI MANHOURS 0.1
STATUS X		SYS A	DATE 15 Apr 20	NO 1	TIME 00:01	PID Generated, Com		DATE 01 May 20	TIME 13:27	ACFT HRS 5992.3						
FAULTS/REMARKS INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 14 APR 2020 REFERENCE: TM 11-6140-203-23 P								ACTION complete								
ACFT HRS 5992.3								WHEN DISC	O	HOW REC	O	MAL EFF		1		
DELAY								WUC 00				TIPIID EISENHAEUER, JEFFREY				TI MANHOURS 0.1




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 11				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	 SYS E	DATE 16 Apr 20	NO 1	TIME 00:01	PID Generated, Cor			DATE 23 Apr 20	TIME 00:00	ACFT HRS 5992.3						
		ROUNDS	ACTION CODE			WUC 00										
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 22 APR 2020 REFERENCE: TM 11-5821-357-12P								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON APR 23 2020 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
ACFT HRS 5992.3		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 SYS A	DATE 17 Apr 20	NO 1	TIME 00:01	PID Generated, Com			DATE 04 May 20	TIME 09:18	ACFT HRS 5992.3						
		ROUNDS	ACTION CODE G			WUC 00										
FAULTS/REMARKS INSP A160 90 DAY CORROSION INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 05 MAY 2020 REFERENCE: TM 1-1520-237-23&P								ACTION complete								
ACFT HRS 5992.3		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 SYS A	DATE 20 Apr 20	NO 1	TIME 00:01	PID Generated, Com			DATE 04 May 20	TIME 09:15	ACFT HRS 5992.3						
		ROUNDS	ACTION CODE J			WUC 00										
FAULTS/REMARKS INSP A502 INSPECT AND TEST GROUND RECEPTACLE IAW TM 1-1500-204-23 FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 26 MAY 2020 REFERENCE: TM 1-1520-237-23&P								ACTION complete								
ACFT HRS 5992.3		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
ACFT HRS 5992.3		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 12			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS X	E CLOSED	SYS E	DATE 23 Apr 20	NO 1	TIME 00:00	PID Generated, Cor		DATE 01 May 20	TIME 13:23	ACFT HRS 5992.3					
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 22 APR 2020 REFERENCE: TM 11-5821-357-12P								ACTION complete							
ACFT HRS 5992.3		WHEN DISC O	HOW REC O	MAL EFF 1				PIID		CAT	HRS	PIID	CAT	HRS	
DELAY				WUC 00				TIID EISENHAUER, JEFFREY			TI MANHOURS 0.1				
STATUS —	B CLOSED	SYS E	DATE 27 Apr 20	NO 1	TIME 00:00	PID Generated, Com		DATE 01 May 20	TIME 13:39	ACFT HRS 5992.3					
FAULTS/REMARKS INSP E125 KY-58 PMCS/OPNL CHECK FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 MAY 2020 REFERENCE: TM 11-5810-262-23								ACTION complete							
ACFT HRS 5992.3		WHEN DISC O	HOW REC O	MAL EFF 1				PIID		CAT	HRS	PIID	CAT	HRS	
DELAY				WUC 00				TIID ,			TI MANHOURS				
STATUS —	B CLOSED	SYS E	DATE 27 Apr 20	NO 2	TIME 00:00	PID Generated, Com		DATE 01 May 20	TIME 13:40	ACFT HRS 5992.3					
FAULTS/REMARKS INSP E040 APR-39 RADAR/LASER WARNING OPNL CHECK, 5841-01-236-8951 FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 MAY 2020 REFERENCE: TM 11-5841-294-12								ACTION complete							
ACFT HRS 5992.3		WHEN DISC O	HOW REC O	MAL EFF 1				PIID		CAT	HRS	PIID	CAT	HRS	
DELAY				WUC 00				TIID ,			TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 13				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	 SYS A	DATE 28 Apr 20	NO 1	TIME 08:36	PID Generated, Cor			DATE 30 Apr 20	TIME 07:26	ACFT HRS 5992.3						
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-05 DESCRIPTION: FIRE EXTINGUISHING SYSTEM FORWARD DISTRIBUTION TUBE. IS DUE: 11 MAY 2020 CALENDAR								ROUNDS	ACTION CODE G	WUC 12C						
ACTION COMPLIED WITH																
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								HICKEY, L	F	0.1						
ACFT HRS 5992.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID HICKEY, LOUIS				TI MANHOURS 0.1				
STATUS X	 SYS A	DATE 28 Apr 20	NO 2	TIME 09:37	PID Pacheco, Jason			DATE 01 May 20	TIME 08:37	ACFT HRS 5992.3						
FAULTS/REMARKS REMOVAL OF PITCH TRIM SERVO REQUIRED FOR TROUBLE SHOOTING PURPOSES								ROUNDS	ACTION CODE A	WUC 11A21						
ACTION REPLACED PITCH TRIM SERVO ASSY W/ S/N- C112-06399 PER CONTROL EXCHANGE # 20-14																
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Pacheco, J	F	4.0						
ACFT HRS 5992.3		WHEN DISC K	HOW REC G	MAL EFF 2												
DELAY				WUC 11A21				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				
STATUS —	 SYS A	DATE 29 Apr 20	NO 1	TIME 00:01	PID Generated, Com			DATE 26 May 20	TIME 08:47	ACFT HRS 5993.3						
FAULTS/REMARKS INSP A534 FIRST AID KIT INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 28 JUN 2020 REFERENCE: TM 1-1500-204-23-1								ROUNDS	ACTION CODE F	WUC 00						
ACTION ANNUAL INSPECTION COMPLETE																
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								HARRINGT	F	1.0						
ACFT HRS 5992.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 14			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 30 Apr 20	NO 1	TIME 14:21	PID Pacheco, Jason			DATE 01 May 20	TIME 08:30	ACFT HRS 5992.3					
		ROUNDS	ACTION CODE J			WUC 11A21									
FAULTS/REMARKS OPERATIONAL CHECK OF #2 HYRAULIC SYSTEM REQ'D FOR REMOVAL AND REPLACEMENT OF OF PITCH/ TRIM SERVO								ACTION COMPLETED							
ACFT HRS 5992.3		WHEN DISC L	HOW REC G	MAL EFF 2		PID Pacheco, J		CAT F	HRS 0.5	PID OILER, K		CAT F	HRS 0.5		
DELAY				WUC 11A21				TIPIID ,				TI MANHOURS			
STATUS —	 SYS A	DATE 30 Apr 20	NO 2	TIME 14:23	PID Pacheco, Jason			DATE 06 May 20	TIME 15:01	ACFT HRS 5993.3					
		ROUNDS	ACTION CODE 4			WUC 00									
FAULTS/REMARKS MTF REQ'D IAW TM 1-1520-237-MTF FOR REMOVAL AND REPLACEMENT OF PITCH/ TRIM SERVO								ACTION completed							
ACFT HRS 5992.3		WHEN DISC K	HOW REC G	MAL EFF 2		PID DUNHAM,		CAT F	HRS 1.0						
DELAY				WUC 11A21				TIPIID ,				TI MANHOURS			
STATUS /	 SYS A	DATE 01 May 20	NO 1	TIME 14:15	PID EISENHAUER, JE			DATE 04 May 20	TIME 08:49	ACFT HRS 5992.3					
		ROUNDS	ACTION CODE G			WUC 00									
FAULTS/REMARKS tail wheel tire needs servicing								ACTION complete							
ACFT HRS 5992.3		WHEN DISC X	HOW REC G	MAL EFF 2		PID EISENHAU		CAT F	HRS 0.1						
DELAY				WUC 03B03				TIPIID ,				TI MANHOURS			

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 15					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS /	E CLOSED	SYS A	DATE 01 May 20	NO 2	TIME 14:33	PID BISHOP, JEFFER		DATE 04 May 20	TIME 08:23	ACFT HRS 5992.3		ROUNDS		ACTION CODE G		WUC 02	
FAULTS/REMARKS female end zeus fastener broken on upper r/h tgb cover								ACTION duplicste write up									
ACFT HRS 5992.3		WHEN DISC X	HOW REC G	MAL EFF 2		PID EISENHAU	CAT F	HRS 0.1	PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 02				TIPIID ,				TI MANHOURS					
STATUS /	E CLOSED	SYS A	DATE 04 May 20	NO 1	TIME 09:46	PID EISENHAUER, JE		DATE 10 Aug 20	TIME 11:06	ACFT HRS 6012.1		ROUNDS		ACTION CODE C		WUC 00	
FAULTS/REMARKS fwd upper l/h cabin soundproofing has blown out fastener hole and tear on aft end								ACTION repaired									
ACFT HRS 5992.3		WHEN DISC X	HOW REC G	MAL EFF 2		PID EISENHAU	CAT F	HRS 0.1	PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY w/o uatc12000046				WUC 02				TIPIID ,				TI MANHOURS					
STATUS —	B CLOSED	SYS A	DATE 05 May 20	NO 1	TIME 13:13	PID Generated, Com		DATE 05 May 20	TIME 15:39	ACFT HRS 5992.3		ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS PMD DUE								ACTION complete									
ACFT HRS 5992.3		WHEN DISC O	HOW REC G	MAL EFF 2		PID BISHOP, J.	CAT F	HRS 1.0	PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 16				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —			SYS A	DATE 05 May 20		NO 2	TIME 13:13	PID Generated, Cor			DATE 05 May 20		TIME 15:40		ACFT HRS 5992.3	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R8 DATED 15 MAY 18, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R5 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION complete								
ACFT HRS 5992.3		WHEN DISC X		HOW REC G		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —			SYS A	DATE 05 May 20		NO 3	TIME 14:38	PID Generated, Com			DATE 05 May 20		TIME 14:38		ACFT HRS	
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
ACFT HRS 5992.3		WHEN DISC O		HOW REC O		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS /			SYS A	DATE 05 May 20		NO 4	TIME 15:43	PID EISENHAUER, JE			DATE 10 Aug 20		TIME 11:07		ACFT HRS 6012.1	
FAULTS/REMARKS upper r/h fwd cabin soundproofing has 2 blown out fastener holes on aft end								ACTION repaired								
ACFT HRS 5992.3		WHEN DISC X		HOW REC G		MAL EFF 2		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY w/o uatc 12000047				WUC 02				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 17				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 05 May 20	NO 5	TIME 15:45	PID BISHOP, JEFFER		DATE 03 Jun 20	TIME 13:15	ACFT HRS 5994.8						
FAULTS/REMARKS h bar has working rivet on center section								ACTION rewrote fault								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 5992.3		WHEN DISC X		HOW REC G		MAL EFF 2										
DELAY repair next 120 hrs				WUC 02				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 06 May 20	NO 1	TIME 08:22	PID TARBOX, CHARL		DATE 01 Jun 20	TIME 10:42	ACFT HRS 5994.8						
FAULTS/REMARKS MTF REQUIRED FOR REMOVAL AND REINSTALLATION OF AFCC AND DSC.								ACTION MTF Complete. Aircraft released for flight								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CURTIS, A.	F	1.0						
ACFT HRS 5992.3		WHEN DISC K		HOW REC G		MAL EFF 2										
DELAY				WUC 52A				TIPIID ,				TI MANHOURS				
STATUS /		SYS A	DATE 06 May 20	NO 2	TIME 15:02	PID DUNHAM, NICH		DATE 18 May 20	TIME 12:11	ACFT HRS 5993.3						
FAULTS/REMARKS Both radar alt wont come on								ACTION TURNED PILOT SIDE RAD ALT ON. MOC OK								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bartlett, C.	F	0.5						
ACFT HRS 5992.3		WHEN DISC G		HOW REC G		MAL EFF 2										
DELAY				WUC 19E05				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 18				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS ⊗		SYS A	DATE 06 May 20	NO 3	TIME 15:03	PID DUNHAM, NICH		DATE 14 May 20	TIME 09:33	ACFT HRS 5993.3						
FAULTS/REMARKS Both RAD ALTs wont come on ACFT restricted from night and NVG								ACTION TURNED PILOT SIDE RAD ALT ON. MOC OK								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bartlett, C.	F	0.3						
ACFT HRS 5992.3		WHEN DISC M	HOW REC G	MAL EFF 2												
DELAY				WUC 19E05				TIPIID OILER, KENNETH				TI MANHOURS 0.2				
STATUS ×		SYS E	DATE 06 May 20	NO 1	TIME 15:04	PID DUNHAM, NICH		DATE 25 Jun 20	TIME 13:38	ACFT HRS 6004.0						
FAULTS/REMARKS Ice detected light constant flash on caution advisory panel through out entire flight and only came on solid for a few seconds with no ice in the area								ACTION REPLACED ICE DETECTOR AND ELECTRICAL CONNECTOR P326. MOC OK.								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								TARBOX, C.	F	2.0						
ACFT HRS 5992.3		WHEN DISC M	HOW REC G	MAL EFF 2												
DELAY Troubleshoot with now malfunctions IAW				WUC 12E				TIPIID HICKEY, LOUIS				TI MANHOURS 0.1				
STATUS ⊗		SYS A	DATE 06 May 20	NO 4	TIME 15:06	PID DUNHAM, NICH		DATE 25 Jun 20	TIME 13:42	ACFT HRS 6004.0						
FAULTS/REMARKS Ice detected light constant flash on caution advisory panel through out entire flight and only came on solid for a few seconds with no ice in the area ACFT restricted from known icing								ACTION REPLACED ICE DETECTOR AND ELECTRICAL CONNECTOR P326. MOC OK.								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								TARBOX, C.	F	0.1						
ACFT HRS 5992.3		WHEN DISC M	HOW REC G	MAL EFF 2												
DELAY				WUC 12E				TIPIID HICKEY, LOUIS				TI MANHOURS 0.1				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 19							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS X		SYS A	DATE 06 May 20	NO 5	TIME 15:08	PID DUNHAM, NICH		DATE 18 May 20	TIME 12:08	ACFT HRS 5993.3									
FAULTS/REMARKS # 2 Converter light came on multiple times in flight kicking trim fps and stab out of the auto mode light would go off on its own and only had a #2 generator failure twice during the 5 times. The generator was able to be reset and came back on line. No change in flight changed when it would come on.								ACTION CONTACTS B AND C FROM P215 GCU SWAPPED.						ROUNDS		ACTION CODE B		WUC 00	
ACFT HRS 5992.3								WHEN DISC M		HOW REC G		MAL EFF 3							
DELAY								WUC 12A07				TIPIID OILER, KENNETH				TI MANHOURS 0.2			
STATUS X		SYS A	DATE 06 May 20	NO 6	TIME 15:14	PID DUNHAM, NICH		DATE 13 May 20	TIME 08:23	ACFT HRS 5993.3									
FAULTS/REMARKS Pilots side right pedal heel has a recessed screw proud of the mounting surface. Pilots heel catches on the screw head.								ACTION Installed correct length screw						ROUNDS		ACTION CODE S		WUC 02	
ACFT HRS 5992.3								WHEN DISC G		HOW REC K		MAL EFF 2							
DELAY								WUC 00				TIPIID OILER, KENNETH				TI MANHOURS 0.2			
STATUS —		SYS A	DATE 06 May 20	NO 7	TIME 15:18	PID Generated, Com		DATE 10 Jun 20	TIME 10:33	ACFT HRS 5994.8									
FAULTS/REMARKS INSP A213 ENGINE COMPRESSOR CLEANING FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6002.5 AIRCRAFT HOURS REFERENCE: TM 1-2840-248-23								ACTION complete						ROUNDS		ACTION CODE E		WUC 00	
ACFT HRS 5993.3								WHEN DISC O		HOW REC O		MAL EFF 1							
DELAY								WUC 00				TIPIID ,				TI MANHOURS			

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 20				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	E Closed	SYS A	DATE 06 May 20	NO 8	TIME 15:18	PID Generated, Cor		DATE 10 Jun 20	TIME 10:31	ACFT HRS 5994.8						
							ROUNDS	ACTION CODE 3	WUC 00							
FAULTS/REMARKS INSP A210 120 HOUR INSPECTION REQUIREMENTS FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6002.5 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-23&P								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.1						
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				
STATUS —	E Closed	SYS A	DATE 06 May 20	NO 9	TIME 15:18	PID Generated, Com		DATE 03 Jun 20	TIME 08:39	ACFT HRS 5994.8						
							ROUNDS	ACTION CODE G	WUC 00							
FAULTS/REMARKS INSP A214 CLEAN TAIL WHEEL ADAPTER FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6002.5 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-23&P								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				
STATUS —	D Closed	SYS A	DATE 07 May 20	NO 1	TIME 00:00	PID Generated, Com		DATE 02 Jul 20	TIME 08:31	ACFT HRS 6011.1						
							ROUNDS	ACTION CODE 3	WUC 02							
FAULTS/REMARKS INSP A495 LUBRICATE WINDSHIELD WIPER CONVERTER (P/N 70209-01012-104) FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 JUL 2020 REFERENCE: TM 1-1520-237-23&P								ACTION completed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUFFY, J.	F	1.5						
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A			3. DATE			4. PAGE 21																			
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION																							
STATUS X		SYS A	DATE 08 May 20	NO 1	TIME 10:53	PID Bartlett, Christo			DATE 18 May 20	TIME 13:33	ACFT HRS 5993.3																		
FAULTS/REMARKS TAIL WHEEL LOCK PIN BENT.						ACTION REPLACED LOCK PIN																							
						<table border="1"> <thead> <tr> <th>PID</th> <th>CAT</th> <th>HRS</th> <th>PID</th> <th>CAT</th> <th>HRS</th> <th>PID</th> <th>CAT</th> <th>HRS</th> </tr> </thead> <tbody> <tr> <td>Bender, T.</td> <td>F</td> <td>3.0</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </tbody> </table>						PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	Bender, T.	F	3.0						
PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS																					
Bender, T.	F	3.0																											
ACFT HRS 5993.3		WHEN DISC X	HOW REC G	MAL EFF 2																									
DELAY			WUC 03B04A			TIPIID GATHRIGHT, ANTHONY			TI MANHOURS 0.1																				
STATUS —		SYS A	DATE 12 May 20	NO 1	TIME 00:00	PID Generated, Com			DATE 15 May 20	TIME 12:52	ACFT HRS 5993.3																		
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 MAY 2020 REFERENCE: TM 1-1520-237-23						ACTION COMPLETE																							
						<table border="1"> <thead> <tr> <th>PID</th> <th>CAT</th> <th>HRS</th> <th>PID</th> <th>CAT</th> <th>HRS</th> <th>PID</th> <th>CAT</th> <th>HRS</th> </tr> </thead> <tbody> <tr> <td>MILLIKEN,</td> <td>F</td> <td>0.1</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </tbody> </table>						PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	MILLIKEN,	F	0.1						
PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS																					
MILLIKEN,	F	0.1																											
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1																									
DELAY			WUC 00			TIPIID ,			TI MANHOURS																				
STATUS —		SYS A	DATE 12 May 20	NO 2	TIME 00:00	PID Generated, Com			DATE 15 May 20	TIME 12:53	ACFT HRS 5993.3																		
FAULTS/REMARKS INSP A100 LH/RH ENGINE HISTORY RECORDER READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 18 MAY 2020 REFERENCE: DA PAM 738-751						ACTION COMPLETE																							
						<table border="1"> <thead> <tr> <th>PID</th> <th>CAT</th> <th>HRS</th> <th>PID</th> <th>CAT</th> <th>HRS</th> <th>PID</th> <th>CAT</th> <th>HRS</th> </tr> </thead> <tbody> <tr> <td>MILLIKEN,</td> <td>F</td> <td>0.1</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </tbody> </table>						PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	MILLIKEN,	F	0.1						
PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS																					
MILLIKEN,	F	0.1																											
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1																									
DELAY			WUC 00			TIPIID ,			TI MANHOURS																				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 22				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	 SYS A	DATE 13 May 20	NO 1	TIME 00:00	PID Generated, Cor			DATE 01 Jul 20	TIME 14:56	ACFT HRS 6011.1						
		ROUNDS	ACTION CODE 1			WUC 02										
FAULTS/REMARKS INSP A299 LUBRICATE SWASHPLATE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6434.2 AIRCRAFT HOURS OR 12 JUL 2020 REFERENCE: TM 1-1520-237-23&P								ACTION SWASHPLATE LUBE COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Ellis, Z.	F	8.0						
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 SYS A	DATE 13 May 20	NO 2	TIME 00:00	PID Generated, Com			DATE 02 Jul 20	TIME 12:49	ACFT HRS 6011.1						
		ROUNDS	ACTION CODE 1			WUC 02										
FAULTS/REMARKS INSP A302 LUBRICATE MAIN LANDING GEAR WHEEL BEARINGS FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6434.2 AIRCRAFT HOURS OR 12 JUL 2020 REFERENCE: TM 1-1520-237-23&P								ACTION MLG WHEEL BEARINGS LUBRICATED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Ellis, Z.	F	1.5	Belyeu, C.	F	1.5			
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 SYS A	DATE 13 May 20	NO 3	TIME 00:00	PID Generated, Com			DATE 18 May 20	TIME 12:02	ACFT HRS 5993.3						
		ROUNDS	ACTION CODE G			WUC 03B03A01										
FAULTS/REMARKS INSP A298 LUBRICATE TAIL WHEEL BEARINGS FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6434.2 AIRCRAFT HOURS OR 12 JUL 2020 REFERENCE: TM 1-1520-237-23&P								ACTION ISNP COMPLETED IN CONJUNCTION WITH TAIL LANDING GEAR FORK REPLACEMENT								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bender, T.	F	1.0						
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 23				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 15 May 20	NO 1	TIME 10:57	PID OILER, KENNETH	DATE 15 May 20			TIME 10:59			ACFT HRS 5993.3			
							ROUNDS			ACTION CODE A			WUC 03B05A			
FAULTS/REMARKS TAIL LANDING GEAR YOKE LOWER BONDED LINER DAMAGED BEYOND LIMITS								ACTION REPLACED BONDED LINER								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bender, T.	F	1.5						
ACFT HRS 5993.3		WHEN DISC B		HOW REC G		MAL EFF 1										
DELAY				WUC 03B05A				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				
STATUS X		SYS A	DATE 15 May 20	NO 2	TIME 12:36	PID OILER, KENNETH	DATE 18 May 20			TIME 10:41			ACFT HRS 5993.3			
							ROUNDS			ACTION CODE A			WUC 03B05B			
FAULTS/REMARKS TAIL LANDING GEAR FORK WEAR PLATE DAMAGED BEYOND LIMITS								ACTION REPLACED FORK								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bender, T.	F	1.0						
ACFT HRS 5993.3		WHEN DISC B		HOW REC G		MAL EFF 1										
DELAY				WUC 03B05B				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				
STATUS X		SYS A	DATE 15 May 20	NO 3	TIME 12:37	PID OILER, KENNETH	DATE 18 May 20			TIME 09:19			ACFT HRS 5993.3			
							ROUNDS			ACTION CODE A			WUC 03B05A			
FAULTS/REMARKS TAIL LANDING GEAR YOKE TEFLON WASHERS DISBONDED								ACTION REPLACED UPPER AND LOWER BONDED WASHERS								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bender, T.	F	1.0						
ACFT HRS 5993.3		WHEN DISC B		HOW REC G		MAL EFF 1										
DELAY				WUC 03B05A				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 24					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A		DATE 18 May 20		NO 1		TIME 12:01		PID Generated, Cor		DATE 18 May 20		TIME 13:05		ACFT HRS 5993.3	
												ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS PMD Due								ACTION COMPLETED									
												PID		CAT		HRS	
												Leone, M.		F		1.0	
ACFT HRS 5993.3				WHEN DISC O		HOW REC O		MAL EFF 1									
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A		DATE 18 May 20		NO 2		TIME 12:05		PID Generated, Com		DATE 18 May 20		TIME 13:14		ACFT HRS 5993.3	
												ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R8 DATED 15 MAY 18, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R5 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION INSP COMPLETED									
												PID		CAT		HRS	
												Bender, T.		F		0.5	
ACFT HRS 5993.3				WHEN DISC X		HOW REC G		MAL EFF 1									
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A		DATE 18 May 20		NO 3		TIME 12:05		PID Generated, Com		DATE 18 May 20		TIME 13:06		ACFT HRS 5993.3	
												ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS PMD DUE								ACTION COMPLETED									
												PID		CAT		HRS	
												Bender, T.		F		1.0	
ACFT HRS 5993.3				WHEN DISC O		HOW REC G		MAL EFF 2									
DELAY				WUC 00				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 25		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION					
STATUS —		SYS A	DATE 19 May 20	NO 1	TIME 00:01	PID Generated, Cor	DATE 19 May 20	TIME 07:30	ACFT HRS 5993.3		
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 21 MAY 2020 REFERENCE: TM 1-1520-237-23&P						ACTION completed					
ACFT HRS 5993.3						WHEN DISC O	HOW REC O	MAL EFF 1			
DELAY						WUC 00			TI MANHOURS		
STATUS /		SYS A	DATE 19 May 20	NO 2	TIME 07:31	PID DUNHAM, NICH	DATE 03 Jun 20	TIME 07:38	ACFT HRS 5994.8		
FAULTS/REMARKS Radar ALT analog and digital side is all the way to the high side when press to test they both go back to 1000 and then back to the high side. During power change over Radar ALT began to work properly again for a minute or two then bouncing between full high to low again until finally staying on the high side again.						ACTION REPLACED RIGHT (TRANSMITTING) P682R COAX CONNECTOR. MOC OK					
ACFT HRS 5993.3						WHEN DISC M	HOW REC G	MAL EFF 2			
DELAY Radar alt's work over water, but nothing						WUC 19E05			TI MANHOURS		
STATUS ⊗		SYS A	DATE 19 May 20	NO 3	TIME 07:36	PID DUNHAM, NICH	DATE 23 Jun 20	TIME 07:26	ACFT HRS 6002.3		
FAULTS/REMARKS Radar ALT analog and digital side is all the way to the high side when press to test they both go back to 1000 and then back to the high side. During power change over Radar ALT began to work properly again for a minute or two then bouncing between full high to low again until finally staying on the high side again. ACFT restricted from night and NVG operations						ACTION REPLACED RIGHT (TRANSMITTING) P682R COAX CONNECTOR. MOC OK					
ACFT HRS 5993.3						WHEN DISC M	HOW REC G	MAL EFF 2			
DELAY w/o requested 3jun20						WUC 19E05			TI MANHOURS 0.1		




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 26				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 19 May 20	NO 4	TIME 07:38	PID DUNHAM, NICH		DATE 19 May 20	TIME 15:36	ACFT HRS 5993.3						
FAULTS/REMARKS # 2 Converter light came on multiple times in flight kicking trim fps and stab out of the auto mode light would go off on its own and only had a #2 generator failure twice during the 5 times. The generator was able to be reset and came back on line. No change in flight changed when it would come on.								ACTION REPLACED NO 2 CONVERTER per CONTROL EXCHANGE # 20-15								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bartlett, C.	F	2.0						
ACFT HRS 5993.3		WHEN DISC M	HOW REC G	MAL EFF 3												
DELAY				WUC 09B01C				TIPIID OILER, KENNETH				TI MANHOURS 0.2				
STATUS X		SYS A	DATE 19 May 20	NO 5	TIME 07:40	PID DUNHAM, NICH		DATE 19 May 20	TIME 12:20	ACFT HRS 5993.3						
FAULTS/REMARKS Tail wheel lock pin would not lock and unlock with the actuator								ACTION CLEANED AND ADJUSTED HDWR, MOC OK								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bender, T.	F	0.5						
ACFT HRS 5993.3		WHEN DISC M	HOW REC G	MAL EFF 3												
DELAY				WUC 03B04A				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				
STATUS X		SYS A	DATE 19 May 20	NO 6	TIME 11:07	PID Bartlett, Christo		DATE 19 May 20	TIME 15:44	ACFT HRS 5993.3						
FAULTS/REMARKS #2 CONVERTER POWER SUPPLY SN 1294 INSTALLED ON AIRCRAFT 428 PER CONTROL EXCHANGED #20-15								ACTION REPLACED SN 476 WITH SN 1294 NO. 2 CONVERTOR								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bartlett, C.	F	0.2						
ACFT HRS 5993.3		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 12A07				TIPIID OILER, KENNETH				TI MANHOURS 0.2				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 27		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION					
STATUS —	 SYS A	DATE 20 May 20	NO 1	TIME 08:34	PID Generated, Cor	DATE 20 May 20	TIME 08:34	ACFT HRS WUC 00		ROUNDS ACTION CODE 3	
FAULTS/REMARKS PMD Due						ACTION COMPLETED					
ACFT HRS 5993.3						WHEN DISC O	HOW REC O	MAL EFF 1			
DELAY						WUC 00			TI MANHOURS		
STATUS ×	 SYS A	DATE 21 May 20	NO 1	TIME 07:46	PID DUNHAM, NICH	DATE 28 May 20	TIME 14:25	ACFT HRS 5993.3		ROUNDS ACTION CODE A	
FAULTS/REMARKS # 2 Converter light came on multiple times in flight kicking trim fps and stab out of the auto mode light would go off on its own and only had a #2 generator failure twice during the 5 times. The generator was able to be reset and came back on line. No change in flight changed when it would come on.						ACTION REPLACED #2 GENERATOR SN:7 W/ GENERATOR SN: 4217810 AND REPAIRED CANNON PLUG P250					
ACFT HRS 5993.3						WHEN DISC L	HOW REC G	MAL EFF 2			
DELAY						WUC 09A01			TI MANHOURS 0.2		
STATUS ×	 SYS A	DATE 21 May 20	NO 1	TIME 07:46	PID DUNHAM, NICH	DATE 09 Jun 20	TIME 07:41	ACFT HRS		ROUNDS ACTION CODE	
FAULTS/REMARKS # 2 Converter light came on multiple times in flight kicking trim fps and stab out of the auto mode light would go off on its own and only had a #2 generator failure twice during the 5 times. The generator was able to be reset and came back on line. No change in flight changed when it would come on.						ACTION CLOSED IN ERROR BY DUNHAM, NICHOLAS CW3 Entry made in error.					
ACFT HRS 1608.3						WHEN DISC L	HOW REC G	MAL EFF 2			
DELAY						WUC 09A01			TI MANHOURS 0.1		

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 28			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	E CLOSED	SYS A	DATE 28 May 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 28 May 20	TIME 13:03	ACFT HRS 5993.3					
								ROUNDS	ACTION CODE J	WUC 00					
FAULTS/REMARKS INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 JUN 2020 REFERENCE: TM 11-6140-203-23 P								ACTION complete							
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1											
DELAY				WUC 00				TIPIID ,				TI MANHOURS			
STATUS —	E CLOSED	SYS E	DATE 28 May 20	NO 1	TIME 00:01	PID Generated, Com		DATE 03 Jun 20	TIME 12:40	ACFT HRS 5994.8					
								ROUNDS	ACTION CODE G	WUC 00					
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 JUN 2020 REFERENCE: TM 11-5821-357-12P								ACTION complete							
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1											
DELAY				WUC 00				TIPIID ,				TI MANHOURS			
STATUS —	E CLOSED	SYS E	DATE 28 May 20	NO 2	TIME 00:01	PID Generated, Com		DATE 03 Jun 20	TIME 08:38	ACFT HRS 5994.8					
								ROUNDS	ACTION CODE J	WUC 00					
FAULTS/REMARKS INSP E220 EMERGENCY LOCATOR TRANSMITTER SELF-TEST (AS REQUIRED) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6117.3 AIRCRAFT HOURS OR 03 JUN 2020 REFERENCE: AWR 1516 R12								ACTION complete							
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1											
DELAY				WUC 00				TIPIID ,				TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 29				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 28 May 20	NO 2	TIME 11:04	PID Belyeu, Christop		DATE 28 May 20	TIME 14:29	ACFT HRS 5993.3						
FAULTS/REMARKS #2 GENERATOR AND OIL TUBES REQUIRE PROSEAL AFTER COMPLETION OF MOC'S								ACTION PROSEAL APPLIED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.3						
ACFT HRS 5993.3		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 28 May 20	NO 3	TIME 11:05	PID Hale, Nathaniel		DATE 01 Jun 20	TIME 10:41	ACFT HRS 5994.8						
FAULTS/REMARKS MOC OF AC ELECTRIC SYSTEM REQUIRED FOR REPLACEMENT OF #2 MIAN GENERATOR								ACTION MOC OK								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CURTIS, A.	F	1.0						
ACFT HRS 5993.3		WHEN DISC K	HOW REC M	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 28 May 20	NO 4	TIME 11:06	PID Hale, Nathaniel		DATE 01 Jun 20	TIME 10:48	ACFT HRS 5994.8						
FAULTS/REMARKS MOC OF IVHMS SYSTEM REQUIRED FOR REMOVAL AND REINSTALLATION OF #2 GEN IVHMS SENSOR								ACTION IVHMS failed MOC. #2 eng TGT incorrect during HIT								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CURTIS, A.	F	1.0						
ACFT HRS 5993.3		WHEN DISC K	HOW REC M	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 30				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	E Closed	SYS A	DATE 28 May 20	NO 5	TIME 13:00	PID Generated, Cor		DATE 28 May 20	TIME 15:05	ACFT HRS 5993.3						
								ROUNDS	ACTION CODE 3	WUC 00						
FAULTS/REMARKS PMD Due								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				
STATUS —	E Closed	SYS A	DATE 28 May 20	NO 6	TIME 13:01	PID Generated, Com		DATE 28 May 20	TIME 13:02	ACFT HRS 5993.3						
								ROUNDS	ACTION CODE G	WUC 00						
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 28 MAY 2020. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6001.7 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				
STATUS —	E Closed	SYS A	DATE 28 May 20	NO 7	TIME 13:01	PID Generated, Com		DATE 28 May 20	TIME 14:59	ACFT HRS 5993.3						
								ROUNDS	ACTION CODE 3	WUC 00						
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R8 DATED 15 MAY 18, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R5 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 5993.3		WHEN DISC X	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 31																				
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION																							
STATUS —		SYS A	DATE 28 May 20	NO 8	TIME 13:01	PID Generated, Cor	DATE 28 May 20	TIME 14:53	ACFT HRS 5993.3																				
FAULTS/REMARKS PMD DUE						ACTION complete																							
						<table border="1"> <thead> <tr> <th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th> </tr> </thead> <tbody> <tr> <td>EISENHAU</td><td>F</td><td>1.0</td><td>Bender, T.</td><td>F</td><td>1.0</td><td></td><td></td><td></td> </tr> </tbody> </table>						PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	EISENHAU	F	1.0	Bender, T.	F	1.0			
PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS																					
EISENHAU	F	1.0	Bender, T.	F	1.0																								
ACFT HRS 5993.3		WHEN DISC O	HOW REC G	MAL EFF 2																									
DELAY			WUC 00			TIPIID ,			TI MANHOURS																				
STATUS ⊗		SYS A	DATE 28 May 20	NO 9	TIME 13:20	PID CURTIS, ANDREI	DATE 01 Jul 20	TIME 12:37	ACFT HRS 6011.1																				
FAULTS/REMARKS OPERATE IN ACCORDANCE WITH AWR 2120 R3 DATED 27 SEP 2019 (GeTac Computer), AWR 1956 R3 DATED 31 OCT 2018 (APR-39), AWR 1913 R4 DATED 17 JAN 2020 (ACN LOGBOOK), AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C), AWR 1800 R9 DATED 18 JUL 2019 (EDM/BFT), AWR 1753 R9 DATED 17 APR 20(128D GPS), AWR 1738 R6 DATED 18 JAN 2019 (APX-118), AWR 1694 R7 DATED 29 JAN 2020 (DSC),AWR 1682 R25 DATED 01 AUG 2019 (701D TDI), AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU), AWR 1566 R7 DATED 05 FEB 2019 (HPH CABLE GUARD), AWR 1516 R12 DATED 07 FEB 2019 (ELT EBC-406HM), AWR 1513 R13 19 APR 2019						ACTION updated																							
						<table border="1"> <thead> <tr> <th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th> </tr> </thead> <tbody> <tr> <td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td> </tr> </tbody> </table>						PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS									
PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS																					
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1																									
DELAY			WUC 00			TIPIID CURTIS, ANDREW			TI MANHOURS 0.1																				
STATUS ⊗		SYS A	DATE 28 May 20	NO 10	TIME 13:20	PID CURTIS, ANDREI	DATE 01 Jul 20	TIME 12:37	ACFT HRS 6011.1																				
FAULTS/REMARKS OPERATE IAW THE FOLLOWING AWR'S IF APPLICABLE - AWR 1965 R9 DATED 18 MAR 2020 (APPLE IPAD DEVICES), AWR 1930 R13 08 APR 2020 (PMI), AWR 1784 R4 DATED 31 JUL 2019 (SHIP BOARD OPS), AWR 1632 R7 DATED 05 OCT 2018 (ALP LASER POINTER), AWR 1466 R9 DATED 23 AUG 2019 (GARMIN GPS), AWR 1453 R7 DATED 06 JUN 2019 (MCS), AWR 1407 R5 DATED 31 MAY 2018 (DAY HUD), AWR 1309 R12 DATED 30 JUL 2019 (OREGON SEAT CUSHION), AWR 1308 R13 DATED 24 APR 2019 (IRH R5), AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN DRS REMOVED), AWR 1270 R12 DATED 5 SEP 2018 (EIBF), AWR 1127 R9 DATED 11 SEP 2018 (ELL),						ACTION updated																							
						<table border="1"> <thead> <tr> <th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th> </tr> </thead> <tbody> <tr> <td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td> </tr> </tbody> </table>						PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS									
PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS																					
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1																									
DELAY			WUC 00			TIPIID CURTIS, ANDREW			TI MANHOURS 0.1																				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 32				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 28 May 20	NO 11	TIME 14:36	PID EISENHAUER, JE		DATE 03 Jun 20	TIME 12:36	ACFT HRS 5994.8						
FAULTS/REMARKS work deck left and right of hyd deck needs new non-skid								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Leone, M.	F	1.0						
ACFT HRS 5993.3		WHEN DISC V		HOW REC G		MAL EFF 2										
DELAY				WUC 02				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 28 May 20	NO 12	TIME 15:07	PID Generated, Com		DATE 28 May 20	TIME 15:07	ACFT HRS						
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	2.0						
ACFT HRS 5993.3		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS X		SYS A	DATE 28 May 20	NO 13	TIME 15:10	PID EISENHAUER, JE		DATE 28 May 20	TIME 14:11	ACFT HRS 5993.3						
FAULTS/REMARKS L/H GUNNER SEAT RESTRAINT FRAYED								ACTION REPLACED RETRAINT ASSEMBLY								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bender, T.	F	0.5						
ACFT HRS 5993.3		WHEN DISC B		HOW REC G		MAL EFF 1										
DELAY				WUC 02A04				TIPIID CHADBOURNE, SCOTT				TI MANHOURS 0.1				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 33				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —		SYS A	DATE 30 May 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 17 Jun 20	TIME 17:29	ACFT HRS 5994.8						
FAULTS/REMARKS INSP A177 90 DAY REVIEW/UPDATE OF 365-4 ENTRIES FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 17 JUN 2020 REFERENCE: AR 95-1								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								HICKEY, L	F	0.5						
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS E	DATE 31 May 20	NO 1	TIME 00:01	PID Generated, Com		DATE 03 Jun 20	TIME 12:43	ACFT HRS 5994.8						
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 JUN 2020 REFERENCE: TM 11-5810-262-23								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.3						
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 01 Jun 20	NO 1	TIME 00:00	PID Generated, Com		DATE 08 Jun 20	TIME 00:00	ACFT HRS 5994.8						
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6036.3 AIRCRAFT HOURS OR 07 JUN 2020 REFERENCE: TM 1-1520-237-23&P								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JUN 8 2020 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 34					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A	DATE 01 Jun 20	NO 2	TIME 00:00	PID Generated, Cor		DATE 08 Jun 20	TIME 00:00	ACFT HRS 5994.8		ROUNDS		ACTION CODE		WUC 00	
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 07 JUN 2020 REFERENCE: TM 1-1500-344-23								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JUN 8 2020 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT									
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A	DATE 01 Jun 20	NO 3	TIME 00:00	PID Generated, Com		DATE 01 Jun 20	TIME 10:40	ACFT HRS 5994.8		ROUNDS		ACTION CODE 6		WUC 00	
FAULTS/REMARKS INSP A532 COMPASS SWING / RMI FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 31 JUL 2020 REFERENCE: TM 1-1500-204-23-4								ACTION complete									
ACFT HRS 5993.3		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A	DATE 01 Jun 20	NO 4	TIME 10:40	PID Generated, Com		DATE 20 Jun 20	TIME 16:37	ACFT HRS 6002.3		ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS INSP A295 STABILATOR ACTUATOR ASSY LUBE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6003.8 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-23&P								ACTION CLEANED AND LUBRICATED.									
ACFT HRS 5994.8		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 35			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —		SYS A	DATE 01 Jun 20	NO 5	TIME 10:40	PID Generated, Cor		DATE 03 Jun 20	TIME 10:49	ACFT HRS 5994.8					
FAULTS/REMARKS INSP A110 PMS 40 HOUR INSPECTION FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 5998.8 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMS								ACTION complete							
ACFT HRS 5994.8								WHEN DISC	O	HOW REC	O	MAL EFF		1	
DELAY				WUC 00				TIPIID ,				TI MANHOURS			
STATUS —		SYS A	DATE 01 Jun 20	NO 6	TIME 10:40	PID Generated, Com		DATE 20 Jun 20	TIME 17:44	ACFT HRS 6002.3					
FAULTS/REMARKS INSP A296 INSPECT STABILATOR ATTACH FITTINGS FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6003.9 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-23_P								ACTION INSP OK.							
ACFT HRS 5994.8								WHEN DISC	O	HOW REC	O	MAL EFF		1	
DELAY				WUC 00				TIPIID ,				TI MANHOURS			
STATUS /		SYS A	DATE 01 Jun 20	NO 7	TIME 10:46	PID CURTIS, ANDRE		DATE 05 Aug 20	TIME 10:16	ACFT HRS 6012.1					
FAULTS/REMARKS IVHMS #2 Eng TGT incorrect during HIT check. Manual HIT passes. Data menu displays correct #2 eng TGT, but IVHMS HIT TGT is about 150 degrees low.								ACTION HIT CHECK COMPLETED ON NO 2 ENGINE WITH A PASS. IVHMS TGT, ACFT TGT AND DAY HUD TGT ALL COMPARE WITHIN LIMITS. CAL VALUE OF 150 DID NOT WORK. RESET CAL VALUE AT 000 WITH SUCCESSFUL RESULTS							
ACFT HRS 5994.8								WHEN DISC	L	HOW REC	G	MAL EFF		2	
DELAY w/o requested				WUC 00				TIPIID ,				TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 36				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS E	DATE 01 Jun 20	NO 1	TIME 10:49	PID CURTIS, ANDRE		DATE 12 Jun 20	TIME 09:50	ACFT HRS 5994.8						
FAULTS/REMARKS #1 FM Radio display was either all 8's or blank during flight.								ACTION REPLACED FM 1 R/T SN 00941A WITH SN4565 AND REPLACED COAXIAL CONNECTOR P1029 TO FM 1 R/T. MOC OK.								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								TARBOX, C	F	0.2						
ACFT HRS 5994.8		WHEN DISC G		HOW REC G		MAL EFF 2										
DELAY w/o requested 3 jun20				WUC 19C04A				TIPID OILER, KENNETH				TI MANHOURS 0.2				
STATUS —		SYS A	DATE 02 Jun 20	NO 1	TIME 00:01	PID Generated, Com		DATE 02 Jun 20	TIME 14:07	ACFT HRS 5994.8						
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 04 JUN 2020 REFERENCE: TM 1-1520-237-23&P								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 5994.8		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPID ,				TI MANHOURS				
STATUS —		SYS A	DATE 02 Jun 20	NO 2	TIME 14:08	PID Generated, Com		DATE 03 Jun 20	TIME 08:36	ACFT HRS 5994.8						
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 02 JUN 2020. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6004.3 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 5994.8		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 37							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —		SYS A		DATE 03 Jun 20		NO 1		TIME 07:45		PID Bartlett, Christo		DATE 21 Jun 20		TIME 09:46		ACFT HRS 6002.3			
												ROUNDS		ACTION CODE 4		WUC 00			
FAULTS/REMARKS IN FLIGHT CHECK ON RADAR ALTIMETER SYSTEM DUE FOR REPLACEMENT OF COAX CONNECTORS GOING TO AND FROM ANTENNA TO CO PILOTS RADAR ALTIMETER.										ACTION complete									
												PID		CAT		HRS			
												BELL, A.		F		0.1			
ACFT HRS 5994.8				WHEN DISC K				HOW REC G				MAL EFF 1							
DELAY								WUC 00				TIPIID ,				TI MANHOURS			
STATUS —		SYS A		DATE 03 Jun 20		NO 2		TIME 08:54		PID Generated, Com		DATE 03 Jun 20		TIME 14:16		ACFT HRS 5994.8			
												ROUNDS		ACTION CODE J		WUC 00			
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 03 JUN 2020. INSP A806 REMOVE AND PERFORM FUNCTIONAL CHECK OF ENGINE CHIP DETECTOR FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6039.1 AIRCRAFT HOURS REFERENCE: 1-2840-248-23										ACTION complete									
												PID		CAT		HRS			
												Leone, M.		F		0.5			
ACFT HRS 5994.8				WHEN DISC O				HOW REC O				MAL EFF 1							
DELAY								WUC 00				TIPIID ,				TI MANHOURS			
STATUS —		SYS A		DATE 03 Jun 20		NO 3		TIME 09:41		PID Generated, Com		DATE 03 Jun 20		TIME 09:57		ACFT HRS 5994.8			
												ROUNDS		ACTION CODE 3		WUC 00			
FAULTS/REMARKS PMD DUE										ACTION complete									
												PID		CAT		HRS			
												EISENHAU		F		1.0			
												Belyeu, C.		F		1.0			
												Leone, M.		F		1.0			
ACFT HRS 5994.8				WHEN DISC O				HOW REC G				MAL EFF 2							
DELAY								WUC 00				TIPIID ,				TI MANHOURS			

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 38				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	E CLOSED	SYS A	DATE 03 Jun 20	NO 4	TIME 09:41	PID Generated, Cor		DATE 03 Jun 20	TIME 10:00	ACFT HRS 5994.8						
								ROUNDS	ACTION CODE 3	WUC 00						
FAULTS/REMARKS PMD Due								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 5994.8		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				
STATUS —	E CLOSED	SYS A	DATE 03 Jun 20	NO 5	TIME 09:42	PID Generated, Com		DATE 03 Jun 20	TIME 09:51	ACFT HRS 5994.8						
								ROUNDS	ACTION CODE 3	WUC 00						
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R9 DATED 20 MAY 2020, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R5 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 5994.8		WHEN DISC X	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				
STATUS —	E CLOSED	SYS A	DATE 03 Jun 20	NO 6	TIME 10:00	PID Generated, Com		DATE 03 Jun 20	TIME 10:00	ACFT HRS						
								ROUNDS	ACTION CODE 3	WUC 00						
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	3.0						
ACFT HRS 5994.8		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 39					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS X		SYS A	DATE 03 Jun 20	NO 7	TIME 11:51	PID EISENHAUER, JE		DATE 03 Jun 20	TIME 13:00	ACFT HRS 5994.8		ROUNDS		ACTION CODE A	WUC 00		
FAULTS/REMARKS black o/b mr damper failed 120 hr tq check								ACTION replaced black outboard damper h/w									
ACFT HRS 5994.8		WHEN DISC O	HOW REC G	MAL EFF 2		PID Belyeu, C.		CAT F	HRS 0.2	PID		CAT	HRS		PID	CAT	HRS
DELAY				WUC 05A01Z				TIPID DUFFY, JOSHUA				TI MANHOURS 0.1					
STATUS —		SYS A	DATE 03 Jun 20	NO 8	TIME 11:58	PID EISENHAUER, JE		DATE 24 Jun 20	TIME 08:45	ACFT HRS 6004.0		ROUNDS		ACTION CODE F	WUC 05A01Z		
FAULTS/REMARKS 9-11 hr tq check required on o/b black mr damper hdwr between 6003.8-6005.8 acft hrs								ACTION COMPLETED INSPECTION OF M/R BLACK DAMPER - TQ DID NOT STABILIZE									
ACFT HRS 5994.8		WHEN DISC X	HOW REC G	MAL EFF 2		PID CRONK, B.		CAT F	HRS 0.1	PID		CAT	HRS		PID	CAT	HRS
DELAY				WUC 05A01Z				TIPID ,				TI MANHOURS					
STATUS /		SYS A	DATE 03 Jun 20	NO 9	TIME 12:06	PID EISENHAUER, JE		DATE 13 Jun 20	TIME 12:56	ACFT HRS 5994.8		ROUNDS		ACTION CODE S	WUC 00		
FAULTS/REMARKS MACHINE GUN MOUNT GUN ARM (M240) L/H AND R/H RMVD FROM A/C AT 48 LBS MOMENT 13.44 CHART C ENTRY NOT COMPLETED, MUST BE COMPLETED N/L/T 01sept20								ACTION installed									
ACFT HRS 5994.8		WHEN DISC K	HOW REC G	MAL EFF 1		PID EISENHAUER		CAT F	HRS 0.1	PID		CAT	HRS		PID	CAT	HRS
DELAY				WUC 02				TIPID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 40				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 03 Jun 20	NO 10	TIME 14:02	PID EISENHAUER, JE		DATE 18 Sep 20	TIME 09:31	ACFT HRS 6026.3						
FAULTS/REMARKS black outboard m/r damper requires proseal after completion of 9-11 hr tq checks								ACTION complete				ROUNDS				
								ACTION CODE E				WUC 00				
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.1						
ACFT HRS 5994.8		WHEN DISC K		HOW REC G		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS /		SYS A	DATE 03 Jun 20	NO 11	TIME 14:16	PID EISENHAUER, JE		DATE 10 Aug 20	TIME 10:03	ACFT HRS 6012.1						
FAULTS/REMARKS h bar has working rivet on center section								ACTION replaced bad rivets				ROUNDS				
								ACTION CODE C				WUC 00				
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 5994.8		WHEN DISC X		HOW REC G		MAL EFF 2										
DELAY hold for major maint				WUC 02				TIPIID ,				TI MANHOURS				
STATUS /		SYS A	DATE 03 Jun 20	NO 12	TIME 14:18	PID EISENHAUER, JE		DATE 03 Jun 20	TIME 15:01	ACFT HRS 5994.8						
FAULTS/REMARKS h bar has working rivet on center section								ACTION duplicate write up				ROUNDS				
								ACTION CODE K				WUC 00				
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.2						
ACFT HRS 5994.8		WHEN DISC X		HOW REC G		MAL EFF 2										
DELAY hold for major maint				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 41				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 08 Jun 20	NO 1	TIME 00:00	PID Generated, Cor		DATE 10 Jun 20	TIME 10:58	ACFT HRS 5994.8						
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 07 JUN 2020 REFERENCE: TM 1-1500-344-23								ACTION completed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	1.0						
ACFT HRS 5994.8		WHEN DISC O	HOW REC O	MAL EFF 1				TIPID EISENHAEUER, JEFFREY		TI MANHOURS 0.1						
DELAY	WUC 00							DATE 10 Jun 20		TIME 09:39	ACFT HRS 5994.8					
STATUS X		SYS A	DATE 08 Jun 20	NO 2	TIME 00:00	PID Generated, Com		ROUNDS	ACTION CODE E	WUC 02						
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 6036.3 AIRCRAFT HOURS OR 07 JUN 2020 REFERENCE: TM 1-1520-237-23&P								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.1						
ACFT HRS 5994.8		WHEN DISC O	HOW REC O	MAL EFF 1				TIPID EISENHAEUER, JEFFREY		TI MANHOURS 0.1						
DELAY	WUC 00							DATE 01 Jul 20		TIME 14:49	ACFT HRS 6011.1					
STATUS —		SYS A	DATE 09 Jun 20	NO 1	TIME 08:20	PID Generated, Com		ROUNDS	ACTION CODE 1	WUC 02						
FAULTS/REMARKS SAFETY MESSAGE NUMBER: GEN-20-AMAM-06 DESCRIPTION: ARC-231 KEEP ALIVE BATTERY (KAB) PACK INSPECTION. IS DUE: 30 DEC 2020 CALENDAR								ACTION Insp. Completed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUFFY, J.	F	1.0						
ACFT HRS 5994.8		WHEN DISC O	HOW REC O	MAL EFF 1				TIPID HICKEY, LOUIS		TI MANHOURS 0.1						
DELAY	WUC 00							DATE 01 Jul 20		TIME 14:49	ACFT HRS 6011.1					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 42				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS ⊗		SYS A	DATE 09 Jun 20	NO 2	TIME 08:47	PID Belyeu, Christop		DATE 10 Jun 20	TIME 09:32	ACFT HRS 5994.8						
FAULTS/REMARKS aircraft restricted to ground runs due to installation of inlet run screens								ACTION screens removed								
ACFT HRS 5994.8								WHEN DISC O	HOW REC G	MAL EFF 1						
DELAY								WUC 00				TIPID OILER, KENNETH				TI MANHOURS 0.2
STATUS —		SYS A	DATE 09 Jun 20	NO 3	TIME 08:49	PID Belyeu, Christop		DATE 10 Jun 20	TIME 09:31	ACFT HRS 5994.8						
FAULTS/REMARKS idle speed leakage check required on #1 and #2 engines for completion of chip detector function check								ACTION complete								
ACFT HRS 5994.8								WHEN DISC O	HOW REC M	MAL EFF 1						
DELAY								WUC 00				TIPID ,				TI MANHOURS
STATUS X		SYS A	DATE 09 Jun 20	NO 4	TIME 10:43	PID CURTIS, ANDREI		DATE 09 Jun 20	TIME 10:45	ACFT HRS 5994.8						
FAULTS/REMARKS Copilots shoulder harness inertia reel lock will not unlock.								ACTION Adjusted inertia lock								
ACFT HRS 5994.8								WHEN DISC X	HOW REC K	MAL EFF 2						
DELAY								WUC 02A03A03				TIPID CURTIS, ANDREW				TI MANHOURS 0.1




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 43					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A	DATE 10 Jun 20	NO 1	TIME 09:33	PID Generated, Cor		DATE 10 Jun 20	TIME 09:38	ACFT HRS 5994.8		ROUNDS		ACTION CODE E		WUC 02	
FAULTS/REMARKS INSP A115 - LUBE REQUIRMENTS .								ACTION complete									
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
ACFT HRS 5994.8								WHEN DISC O		HOW REC G		MAL EFF 2					
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS ×		SYS A	DATE 10 Jun 20	NO 2	TIME 11:00	PID Bartlett, Christo		DATE 12 Jun 20	TIME 09:47	ACFT HRS 5994.8		ROUNDS		ACTION CODE A		WUC 19C02B	
FAULTS/REMARKS #1 FM Radio display was either all 8's or blank during flight. - TROUBLESHOOTING IN PROGRESS								ACTION REPLACED FM 1 R/T SN 00941A WITH SN4565 AND REPLACED COAXIAL CONNECTOR P1029 TO FM 1 R/T. MOC OK.									
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
ACFT HRS 5994.8								WHEN DISC K		HOW REC G		MAL EFF 2					
DELAY				WUC 19C02B				TIPIID OILER, KENNETH				TI MANHOURS 0.2					
STATUS —		SYS A	DATE 10 Jun 20	NO 3	TIME 15:52	PID Bender, Thomas		DATE 24 Jun 20	TIME 08:07	ACFT HRS 6004.0		ROUNDS		ACTION CODE F		WUC 06H09	
FAULTS/REMARKS 2nd 9-11 hr trq check on Sec 3 drive shaft both ends due at 6003.8-6005.8 aircraft hours								ACTION inspection completed - TQ not stabilized.									
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
ACFT HRS 5994.8								WHEN DISC B		HOW REC G		MAL EFF 1					
DELAY				WUC 06				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 44			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 11 Jun 20	NO 1	TIME 00:00	PID Generated, Cor			DATE 15 Jun 20	TIME 13:25	ACFT HRS 5994.8					
FAULTS/REMARKS INSP A100 LH/RH ENGINE HISTORY RECORDER READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 17 JUN 2020 REFERENCE: DA PAM 738-751								ROUNDS	ACTION CODE 5		WUC 00		ACTION completed		
ACFT HRS 5994.8				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS		
DELAY				WUC 00				TIPIID ,			TI MANHOURS				
STATUS —	 SYS A	DATE 12 Jun 20	NO 1	TIME 00:00	PID Generated, Com			DATE 15 Jun 20	TIME 13:24	ACFT HRS 5994.8					
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 JUN 2020 REFERENCE: TM 1-1520-237-23								ROUNDS	ACTION CODE 5		WUC 00		ACTION completed		
ACFT HRS 5994.8				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS		
DELAY				WUC 00				TIPIID ,			TI MANHOURS				
STATUS /	 SYS A	DATE 13 Jun 20	NO 1	TIME 09:56	PID EISENHAUER, JE			DATE 13 Jun 20	TIME 10:00	ACFT HRS 5994.8					
FAULTS/REMARKS l/h and r/h machine gun mounts require installation								ROUNDS	ACTION CODE S		WUC 02		ACTION complete		
ACFT HRS 5994.8				WHEN DISC X	HOW REC G	MAL EFF 2		PID	CAT	HRS	PID	CAT	HRS		
DELAY				WUC 02				TIPIID ,			TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 45			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 14 Jun 20	NO 1	TIME 00:00	PID Generated, Cor			DATE 17 Jun 20	TIME 00:00	ACFT HRS 5994.8					
		WHEN DISC O	HOW REC O	MAL EFF 1	ROUNDS		ACTION CODE		WUC 00						
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 16 JUN 2020 REFERENCE: TM 1-1520-237-23&P								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JUN 17 2020 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT							
ACFT HRS 5994.8		WHEN DISC O		HOW REC O		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS		
DELAY				WUC 00				TIPIID ,				TI MANHOURS			
STATUS —	 SYS A	DATE 16 Jun 20	NO 1	TIME 11:01	PID Generated, Com			DATE 16 Jun 20	TIME 11:36	ACFT HRS 5994.8					
		WHEN DISC O	HOW REC G	MAL EFF 2	ROUNDS		ACTION CODE 3		WUC 00						
FAULTS/REMARKS PMD DUE								ACTION complete							
ACFT HRS 5994.8		WHEN DISC O		HOW REC G		MAL EFF 2		Hale, N.	F	0.3					
DELAY				WUC 00				TIPIID ,				TI MANHOURS			
STATUS —	 SYS A	DATE 16 Jun 20	NO 2	TIME 11:01	PID Generated, Com			DATE 16 Jun 20	TIME 11:37	ACFT HRS 5994.8					
		WHEN DISC O	HOW REC O	MAL EFF 1	ROUNDS		ACTION CODE 3		WUC 00						
FAULTS/REMARKS PMD Due								ACTION complete							
ACFT HRS 5994.8		WHEN DISC O		HOW REC O		MAL EFF 1		NEWTON,	F	1.0	Hale, N.	F	1.0		
DELAY				WUC 00				TIPIID ,				TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 46			
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION						
STATUS —		SYS A	DATE 16 Jun 20	NO 3	TIME 11:02	PID Generated, Cor	DATE 16 Jun 20	TIME 11:10	ACFT HRS 5994.8			
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R9 DATED 20 MAY 2020, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R5 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ACTION complete						
ACFT HRS 5994.8			WHEN DISC X	HOW REC G	MAL EFF 1		PID EISENHAU	CAT F	HRS 1.0	PID	CAT	HRS
DELAY			WUC 00			TIPID ,			TI MANHOURS			
STATUS —		SYS A	DATE 16 Jun 20	NO 4	TIME 11:38	PID Generated, Com	DATE 16 Jun 20	TIME 11:38	ACFT HRS			
FAULTS/REMARKS PMD Due						ACTION COMPLETED						
ACFT HRS 5994.8			WHEN DISC O	HOW REC O	MAL EFF 1		PID EISENHAU	CAT F	HRS 2.0	PID	CAT	HRS
DELAY			WUC 00			TIPID ,			TI MANHOURS			
STATUS X		SYS A	DATE 16 Jun 20	NO 5	TIME 11:38	PID EISENHAUER, JE	DATE 17 Jun 20	TIME 11:01	ACFT HRS 5994.8			
FAULTS/REMARKS t/r hyd lines rubbing						ACTION BLENDED OUT DAMAGE ON RETURN HOSE 1ST STAGE TAIL ROTOR SERVO CONNECTER FITTING, AND ADJUSTED ANGLE OF HOSE ELBOWS TO PREVENT FURTHER CHAFING.						
ACFT HRS 5994.8			WHEN DISC X	HOW REC G	MAL EFF 5		PID JACKSON,	CAT F	HRS 1.0	PID Leone, M.	CAT F	HRS 1.0
DELAY			WUC 00			TIPID HICKEY, LOUIS			TI MANHOURS 0.1			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 47				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 17 Jun 20	NO 1	TIME 00:00	PID Generated, Cor		DATE 18 Jun 20	TIME 09:48	ACFT HRS 5994.8						
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 16 JUN 2020 REFERENCE: TM 1-1520-237-23&P								ACTION RUN UP COMPLT								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CEPELAK,	F	0.1						
ACFT HRS 5994.8		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID LECLAIR, JOSEPH				TI MANHOURS 0.2				
STATUS —		SYS A	DATE 17 Jun 20	NO 2	TIME 13:51	PID JACKSON, NATH		DATE 17 Jun 20	TIME 13:54	ACFT HRS 5994.8						
FAULTS/REMARKS LEAK CHECK OF TAIL ROTOR SERVO 1ST STAGE CONNECTOR PRESSURE AND RETURN HOSES REQUIRED FOR REMOVAL OF HOSES.								ACTION COMPLETED. NO LEAKS DETECTED.								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								JACKSON,	F	0.2						
ACFT HRS 5994.8		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 17 Jun 20	NO 3	TIME 13:54	PID JACKSON, NATH		DATE 17 Jun 20	TIME 13:55	ACFT HRS 5994.8						
FAULTS/REMARKS BLEEDING OF HYDRAULIC SYSTEM REQUIRED FOR REMOVAL OF TAIL ROTOR SERVO 1ST STAGE PRESSURE AND RETURN HOSES.								ACTION COMPLETED.								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								JACKSON,	F	0.5						
ACFT HRS 5994.8		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 48				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 18 Jun 20	NO 1	TIME 15:19	PID CEPELAK, CORY		DATE 20 Jun 20	TIME 15:54	ACFT HRS 6002.3						
FAULTS/REMARKS FM1 WEAK TRANSMIT AND RECIEVE, EXCESSIVE STATIC								ROUNDS				ACTION CODE J		WUC 19C02		
ACTION RESEATED COAX CABLE ON FM1 RT MOC OK																
ACFT HRS 5997.1		WHEN DISC G	HOW REC G	MAL EFF 2				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY		WUC 00				TIPIID ,				TI MANHOURS						
STATUS /		SYS A	DATE 18 Jun 20	NO 2	TIME 15:20	PID CEPELAK, CORY		DATE 20 Jun 20	TIME 15:51	ACFT HRS 6002.3						
FAULTS/REMARKS L/H GUNNERS ICS WILL NOT TRANSMIT								ROUNDS				ACTION CODE C		WUC 19A		
ACTION repaired lh gunners ics cord																
ACFT HRS 5997.1		WHEN DISC G	HOW REC G	MAL EFF 2				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY w/o requested		WUC 00				TIPIID ,				TI MANHOURS						
STATUS —		SYS A	DATE 18 Jun 20	NO 3	TIME 15:47	PID Generated, Com		DATE 19 Jun 20	TIME 08:24	ACFT HRS 5998.8						
FAULTS/REMARKS PMD Due								ROUNDS				ACTION CODE 3		WUC 00		
ACTION PMD COMPLT																
ACFT HRS 5998.8		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY		WUC 00				TIPIID ,				TI MANHOURS						

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 49					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A		DATE 18 Jun 20		NO 4		TIME 15:50		PID Generated, Cor		DATE 18 Jun 20		TIME 16:08		ACFT HRS 5998.8	
												ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS PMD DUE								ACTION complete									
												PID		CAT		HRS	
												CEPELAK, F				0.1	
ACFT HRS 5998.8				WHEN DISC O				HOW REC G				MAL EFF 2					
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A		DATE 18 Jun 20		NO 5		TIME 15:50		PID Generated, Com		DATE 18 Jun 20		TIME 16:03		ACFT HRS 5998.8	
												ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R9 DATED 20 MAY 2020, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R5 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION complete									
												PID		CAT		HRS	
												CEPELAK, F				1.0	
ACFT HRS 5998.8				WHEN DISC X				HOW REC G				MAL EFF 1					
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A		DATE 18 Jun 20		NO 6		TIME 15:52		PID Generated, Com		DATE 18 Jun 20		TIME 16:04		ACFT HRS 5998.8	
												ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 18 JUN 2020. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6005.8 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ACTION complete									
												PID		CAT		HRS	
												CEPELAK, F				0.1	
ACFT HRS 5998.8				WHEN DISC O				HOW REC O				MAL EFF 1					
DELAY				WUC 00				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 50				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 19 Jun 20	NO 1	TIME 14:20	PID LECLAIR, JOSEPH		DATE 25 Jun 20	TIME 13:50	ACFT HRS 6004.0						
FAULTS/REMARKS CoPi clock intermittent operation								ACTION TREATED AND RESET CONNECTOR. MOC OK.								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								TARBOX, C	F	0.3						
ACFT HRS 6000.6		WHEN DISC G		HOW REC G		MAL EFF 2										
DELAY w/o submitted 23jun2020				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS E	DATE 20 Jun 20	NO 1	TIME 07:48	PID Generated, Com		DATE 20 Jun 20	TIME 07:50	ACFT HRS 6002.3						
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 20 JUN 2020. INSP E145 AN/ ARC-201A(V) SINGARS HUB BATT REPL FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 30 SEP 2020 REFERENCE: TM 11-5821-333-12								ACTION REPLACED BATTERY								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								BARTLETT,	F	0.3						
ACFT HRS 6002.3		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS E	DATE 20 Jun 20	NO 2	TIME 07:48	PID Generated, Com		DATE 20 Jun 20	TIME 07:51	ACFT HRS 6002.3						
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 20 JUN 2020. INSP E801 REPLACEMENT OF AN/ARC-201 (V) BATTERIES (BATTERY BOX) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 30 SEP 2020 REFERENCE: TM11-5821-333-13&P-1								ACTION REPLACED BATTERY								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								BARTLETT,	F	0.5						
ACFT HRS 6002.3		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 51			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	E CLOSED	SYS E	DATE 20 Jun 20	NO 3	TIME 07:48	PID Generated, Cor		DATE 20 Jun 20	TIME 07:51	ACFT HRS 6002.3					
							ROUNDS	ACTION CODE A		WUC 00					
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 20 JUN 2020. INSP E135 AN/ ARC-201(V) SINCGARS RADIO HUB BATT REPL FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 30 SEP 2020 REFERENCE: TM 11-5821-333-12								ACTION REPLACED BATTERY							
		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS					
		Bartlett, C.	F	0.3											
ACFT HRS 6002.3		WHEN DISC O	HOW REC O	MAL EFF 1											
DELAY				WUC 00				TI MANHOURS							
STATUS —	H CLOSED	SYS A	DATE 20 Jun 20	NO 1	TIME 16:14	PID Generated, Com		DATE 20 Jun 20	TIME 16:33	ACFT HRS 6002.3					
							ROUNDS	ACTION CODE G		WUC 00					
FAULTS/REMARKS PMD DUE								ACTION COMPLETED.							
		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS					
		CRONK, B.	F	0.7	TRACY, J.	F	0.7	JACKSON,	F	0.7					
ACFT HRS 6002.3		WHEN DISC O	HOW REC G	MAL EFF 2											
DELAY				WUC 00				TI MANHOURS							
STATUS —	J CLOSED	SYS A	DATE 20 Jun 20	NO 2	TIME 16:15	PID Generated, Com		DATE 20 Jun 20	TIME 16:35	ACFT HRS 6002.3					
							ROUNDS	ACTION CODE G		WUC 00					
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R9 DATED 20 MAY 2020, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R5 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION COMPLETED.							
		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS					
		JACKSON,	F	0.2											
ACFT HRS 6002.3		WHEN DISC X	HOW REC G	MAL EFF 1											
DELAY				WUC 00				TI MANHOURS							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 52				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —		SYS A	DATE 20 Jun 20		NO 3	TIME 16:34		PID Generated, Cor			DATE 20 Jun 20		TIME 16:35		ACFT HRS 6002.3	
								ROUNDS		ACTION CODE G			WUC 00			
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 20 JUN 2020. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6009.8 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ACTION INSP OK.								
ACFT HRS 6002.3		WHEN DISC O		HOW REC O		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TI PID ,				TI MANHOURS				
STATUS —		SYS A	DATE 20 Jun 20		NO 4	TIME 16:49		PID Generated, Com			DATE 20 Jun 20		TIME 16:49		ACFT HRS	
								ROUNDS		ACTION CODE 3			WUC 00			
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
ACFT HRS 6002.3		WHEN DISC O		HOW REC O		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TI PID ,				TI MANHOURS				
STATUS /		SYS A	DATE 20 Jun 20		NO 5	TIME 18:03		PID JACKSON, NATH			DATE 22 Jun 20		TIME 11:25		ACFT HRS 6002.3	
								ROUNDS		ACTION CODE C			WUC 76A			
FAULTS/REMARKS APR 39 CONNECTOR (J4) BROKEN								ACTION repaired connector								
ACFT HRS 6002.3		WHEN DISC K		HOW REC G		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TI PID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 53			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS ⊗		SYS A	DATE 20 Jun 20	NO 6	TIME 18:05	PID JACKSON, NATI	DATE 22 Jun 20			TIME 11:27			ACFT HRS 6002.3		
							ROUNDS			ACTION CODE C			WUC 76A		
FAULTS/REMARKS AIRCRAFT NOT FMC. APR-39 INOP.							ACTION restored apr-39 system by repairing connector to j4 on aft receiver								
							PID TARBOX, C	CAT F	HRS 1.0	PID BARTLETT, F	CAT F	HRS 1.0	PID	CAT	HRS
ACFT HRS 6002.3		WHEN DISC K	HOW REC G	MAL EFF 2											
DELAY				WUC 00				TIPIID HICKEY, LOUIS				TI MANHOURS 0.1			
STATUS /		SYS E	DATE 20 Jun 20	NO 4	TIME 18:17	PID TARBOX, CHARL	DATE 22 Jun 20			TIME 12:41			ACFT HRS 6002.3		
							ROUNDS			ACTION CODE C			WUC 76A		
FAULTS/REMARKS RADAR DET CIRCUIT BREAKER ON NO.1 DC PRIMARY BUS LOCKED OUT TO DISABLE APR-39 SYSTEM UNTIL REPAIR CAN BE MADE TO BROKEN CONNECTOR.							ACTION apr-39 system restored by repairing connector on j4 of aft receiver								
							PID BARTLETT, F	CAT F	HRS 1.0	PID TARBOX, C	CAT F	HRS 1.0	PID	CAT	HRS
ACFT HRS 6002.3		WHEN DISC K	HOW REC G	MAL EFF 2											
DELAY				WUC 76A				TIPIID ,				TI MANHOURS			
STATUS —		SYS A	DATE 21 Jun 20	NO 1	TIME 00:01	PID Generated, Com	DATE 01 Jul 20			TIME 15:11			ACFT HRS 6011.1		
							ROUNDS			ACTION CODE 6			WUC 00		
FAULTS/REMARKS INSP A230 INSPECT BATTERY COMPARTMENT FOR CORROSION (SLAB) FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 JUL 2020 REFERENCE: MWO 1-1520-237-50-77							ACTION INSP. OK								
							PID Belyeu, C.	CAT F	HRS 0.2	PID	CAT	HRS	PID	CAT	HRS
ACFT HRS 6002.3		WHEN DISC O	HOW REC O	MAL EFF 1											
DELAY				WUC 00				TIPIID ,				TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 54				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 22 Jun 20	NO 1	TIME 17:51	PID Bartlett, Christo		DATE 23 Jun 20	TIME 07:21	ACFT HRS 6002.3						
FAULTS/REMARKS RADAR ALTIMETERS DIGITAL READOUT 3 FEET OFF GROUND.								ACTION ADJUSTED DIGITAL READOUT. MOC OK								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bartlett, C.	F	0.5						
ACFT HRS 6002.3		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS E	DATE 23 Jun 20	NO 1	TIME 00:00	PID Generated, Com		DATE 25 Jun 20	TIME 13:43	ACFT HRS 6004.0						
FAULTS/REMARKS INSP E015 ASN 128D DOPPLER GPS BATTERY REPLACEMENT FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 29 JUL 2020 REFERENCE: MWO 1-1520-237-50-92								ACTION REPLACED BATTERY								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								TARBOX, C	F	0.2						
ACFT HRS 6002.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS E	DATE 23 Jun 20	NO 2	TIME 00:00	PID Generated, Com		DATE 25 Jun 20	TIME 13:44	ACFT HRS 6004.0						
FAULTS/REMARKS INSP E155 KY-58 BATTERY REPLACEMENT FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 29 JUL 2020 REFERENCE: TM 11-5810-262-23								ACTION REPLACED BATTERIES								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								TARBOX, C	F	0.3						
ACFT HRS 6002.3		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 55				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 23 Jun 20	NO 1	TIME 21:53	PID GLEASON, ABEL		DATE 24 Jun 20	TIME 09:30	ACFT HRS 6004.0						
FAULTS/REMARKS co-pilots inertia reel stuck in locked position.								ACTION OPERATOR ERROR								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								RAND, B.	F	0.3						
ACFT HRS 6004		WHEN DISC G	HOW REC G	MAL EFF 1												
DELAY				WUC 02A03A				TIPID HICKEY, LOUIS				TI MANHOURS 0.1				
STATUS /		SYS A	DATE 23 Jun 20	NO 2	TIME 22:05	PID GLEASON, ABEL		DATE 24 Jun 20	TIME 08:08	ACFT HRS 6004.0						
FAULTS/REMARKS F/M 2 no side tone								ACTION Could Not Duplicate; Turn AMP Switch to off to transmit on FM 2								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								ANDERSON	F	0.5						
ACFT HRS 6004		WHEN DISC G	HOW REC G	MAL EFF 1												
DELAY				WUC 19C02				TIPID ,				TI MANHOURS				
STATUS —		SYS A	DATE 24 Jun 20	NO 1	TIME 08:12	PID CRONK, BRIAN		DATE 26 Jun 20	TIME 07:41	ACFT HRS 6007.7						
FAULTS/REMARKS 3rd 9-11 TQ check on Tail Rotor Drive Shaft #3								ACTION 9-11 hr tq check was not input correctly								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								TRACY, J.	F	1.0						
ACFT HRS 6004		WHEN DISC B	HOW REC G	MAL EFF 1												
DELAY between hours 6006.0 - 6008.0				WUC 06				TIPID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 56					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A		DATE 24 Jun 20		NO 2		TIME 08:20		PID Generated, Cor		DATE 24 Jun 20		TIME 11:20		ACFT HRS	
												ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS PMD Due								ACTION COMPLETED									
												PID		CAT		HRS	
								RAND, B.		F		1.0					
ACFT HRS 6004				WHEN DISC O		HOW REC O		MAL EFF 1									
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A		DATE 24 Jun 20		NO 3		TIME 08:32		PID Generated, Com		DATE 24 Jun 20		TIME 13:29		ACFT HRS 6004.0	
												ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS PMD DUE								ACTION PMD COMPLETED									
												PID		CAT		HRS	
								RAND, B.		F		0.3		CRONK, B.		F	
ACFT HRS 6004				WHEN DISC O		HOW REC G		MAL EFF 2									
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A		DATE 24 Jun 20		NO 4		TIME 08:48		PID CRONK, BRIAN		DATE 24 Jun 20		TIME 13:22		ACFT HRS 6004.0	
												ROUNDS		ACTION CODE A		WUC 02	
FAULTS/REMARKS 2ND M/R BLACK OUTBOARD DAMPER BOLT TQ CHECK BETWEEN 6006.0 - 6008.0								ACTION ENTERED IN ERROR									
												PID		CAT		HRS	
								RAND, B.		F		0.1					
ACFT HRS 6004				WHEN DISC B		HOW REC G		MAL EFF 1									
DELAY				WUC 05A01Z				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 57																					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION																									
STATUS X		SYS A	DATE 24 Jun 20	NO 5	TIME 09:34	PID RAND, BUDDY		DATE 24 Jun 20	TIME 11:34	ACFT HRS 6004.0																							
								ROUNDS	ACTION CODE A	WUC 02																							
FAULTS/REMARKS #1 SIDE REAR CREW SEAT INERTIA REAL DOES NOT RETRACT COMPLETELY								ACTION REPLACED INERTIA REEL																									
								<table border="1"> <thead> <tr> <th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th> </tr> </thead> <tbody> <tr> <td>RAND, B.</td><td>F</td><td>1.0</td><td></td><td></td><td></td><td></td><td></td><td></td> </tr> </tbody> </table>								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	RAND, B.	F	1.0						
PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS																									
RAND, B.	F	1.0																															
ACFT HRS 6004		WHEN DISC X	HOW REC G	MAL EFF 2																													
DELAY				WUC 02A04				TIPID HICKEY, LOUIS				TI MANHOURS 0.1																					
STATUS —		SYS A	DATE 24 Jun 20	NO 6	TIME 10:35	PID CRONK, BRIAN		DATE 24 Jun 20	TIME 10:39	ACFT HRS 6004.0																							
								ROUNDS	ACTION CODE F	WUC 05A01Z																							
FAULTS/REMARKS 9-11 hr tq check required on o/b black mr damper hdwr between 6003.8-6005.8 acft hrs								ACTION COMPLETED INSPECTION - TQ DID NOT STABILIZE																									
								<table border="1"> <thead> <tr> <th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th> </tr> </thead> <tbody> <tr> <td>CRONK, B.</td><td>F</td><td>0.1</td><td></td><td></td><td></td><td></td><td></td><td></td> </tr> </tbody> </table>								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	CRONK, B.	F	0.1						
PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS																									
CRONK, B.	F	0.1																															
ACFT HRS 6004		WHEN DISC B	HOW REC G	MAL EFF 2																													
DELAY				WUC 06				TIPID ,				TI MANHOURS																					
STATUS —		SYS A	DATE 24 Jun 20	NO 7	TIME 13:19	PID RAND, BUDDY		DATE 21 Aug 20	TIME 11:13	ACFT HRS 6014.0																							
								ROUNDS	ACTION CODE G	WUC 05A01Z																							
FAULTS/REMARKS 3rd 9-11 T/Q due on M/R BLACK OUTBOARD DAMPER BOLT between 6013.0 - 6015.0 ACFT hours								ACTION TRQ STABILIZED AT 1320 INCH LBS																									
								<table border="1"> <thead> <tr> <th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th> </tr> </thead> <tbody> <tr> <td>Bender, T.</td><td>F</td><td>0.2</td><td></td><td></td><td></td><td></td><td></td><td></td> </tr> </tbody> </table>								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	Bender, T.	F	0.2						
PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS																									
Bender, T.	F	0.2																															
ACFT HRS 6004		WHEN DISC O	HOW REC G	MAL EFF 2																													
DELAY				WUC 02				TIPID ,				TI MANHOURS																					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 58			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —		SYS A	DATE 24 Jun 20	NO 8	TIME 13:27	PID Generated, Cor		DATE 24 Jun 20	TIME 13:27	ACFT HRS 6004.0					
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 24 JUN 2020. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6013.3 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ROUNDS		ACTION CODE 3		WUC 02			
ACTION INSP OK								PID		CAT		HRS			
ACFT HRS 6004								WHEN DISC O		HOW REC O		MAL EFF 1			
DELAY								WUC 00		TIPIID ,		TI MANHOURS			
STATUS X		SYS A	DATE 25 Jun 20	NO 1	TIME 13:44	PID THIBODEAU, TH		DATE 25 Jun 20	TIME 14:47	ACFT HRS 6004.0					
FAULTS/REMARKS Aircraft Grounded for lost tool. Orange snap on flashlight								ROUNDS		ACTION CODE L		WUC 00			
ACTION AIRCRAFT RELEASED FOR FLIGHT, FOD CHECK COMPLETED, LOST TOOL NOT FOUND								PID		CAT		HRS			
ACFT HRS 6004								WHEN DISC X		HOW REC G		MAL EFF 1			
DELAY								WUC 00		TIPIID HICKEY, LOUIS		TI MANHOURS 0.1			
STATUS —		SYS A	DATE 25 Jun 20	NO 2	TIME 15:27	PID Generated, Com		DATE 25 Jun 20	TIME 18:44	ACFT HRS 6004.0					
FAULTS/REMARKS FOR REPLACEMENT OF ICE DETECTOR AND CONNECTOR P326								ROUNDS		ACTION CODE 4		WUC 00			
ACTION MOC COMPLT OK								PID		CAT		HRS			
ACFT HRS 6004								WHEN DISC O		HOW REC O		MAL EFF 1			
DELAY								WUC 12E		TIPIID ,		TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 59					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS /		SYS A	DATE 26 Jun 20	NO 1	TIME 00:24	PID CEPELAK, CORY		DATE 26 Jun 20	TIME 08:26	ACFT HRS 6007.7		ROUNDS		ACTION CODE A		WUC 19	
FAULTS/REMARKS FM1 WONT ACCEPT FREQUENCY								ACTION Replaced FM 1 Control Head, MOC Ok, Holds Fills									
ACFT HRS 6005.8		WHEN DISC G		HOW REC G		MAL EFF 2		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00		TIPID ,		TI MANHOURS		ANDERSON	F	0.5							
STATUS /		SYS A	DATE 26 Jun 20	NO 2	TIME 00:25	PID CEPELAK, CORY		DATE 26 Jun 20	TIME 08:21	ACFT HRS 6007.7		ROUNDS		ACTION CODE J		WUC 19	
FAULTS/REMARKS FM2 HAS NO SIDE TONE								ACTION Could Not Duplicate, MOC Ok. Turn FM 2 Control Head Amp Switch to Off to Transmit on FM 2									
ACFT HRS 6005.8		WHEN DISC G		HOW REC G		MAL EFF 2		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00		TIPID ,		TI MANHOURS		ANDERSON	F	0.5							
STATUS —		SYS A	DATE 26 Jun 20	NO 3	TIME 08:00	PID TRACY, JOSHUA		DATE 21 Aug 20	TIME 11:15	ACFT HRS 6014.0		ROUNDS		ACTION CODE G		WUC 06H09	
FAULTS/REMARKS 3rd 9-11 T/Q DUE ON SEC 3 T/R D/S DUE AT 6013.0 - 6015.0 ACFT HOURS								ACTION TRQ STABILIZED, TRQ CHECK COMPLETED									
ACFT HRS 6004		WHEN DISC B		HOW REC G		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00		TIPID ,		TI MANHOURS		Bender, T.	F	0.3							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 60				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —		SYS A	DATE 26 Jun 20	NO 4	TIME 08:04	PID Generated, Cor		DATE 26 Jun 20	TIME 08:58	ACFT HRS 6007.7						
							ROUNDS	ACTION CODE G		WUC 00						
FAULTS/REMARKS PMD DUE								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CRONK, B.	F	0.5	RAND, B.	F	0.5	JACKSON,	F	0.5
ACFT HRS 6007.7			WHEN DISC O	HOW REC G	MAL EFF 2		Leone, M.	F	0.5							
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 26 Jun 20	NO 5	TIME 08:08	PID Generated, Com		DATE 26 Jun 20	TIME 09:01	ACFT HRS						
							ROUNDS	ACTION CODE 3		WUC 00						
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								JACKSON,	F	2.0						
ACFT HRS 6007.7			WHEN DISC O	HOW REC O	MAL EFF 1											
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS /		SYS A	DATE 26 Jun 20	NO 6	TIME 08:50	PID JACKSON, NATH		DATE 29 Jun 20	TIME 08:17	ACFT HRS 6011.1						
							ROUNDS	ACTION CODE G		WUC 00						
FAULTS/REMARKS CRACK ON FWD SECTION II DRIVESHAFT BETWEEN 3RD AND 4TH TURNLOCK.								ACTION FAULT ENTERED IN ERROR. (DRIVESHAFT COVER NOT DRIVESHAFT)								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								JACKSON,	F	0.1						
ACFT HRS 6007.7			WHEN DISC X	HOW REC G	MAL EFF 1											
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 61					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A	DATE 26 Jun 20	NO 7	TIME 09:00	PID Generated, Cor		DATE 26 Jun 20	TIME 09:00	ACFT HRS 6007.7		ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 26 JUN 2020. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6015.0 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ACTION INSPECTED OK.									
ACFT HRS 6007.7		WHEN DISC O	HOW REC O	MAL EFF 1		PID JACKSON,		CAT F	HRS 0.2	PID		CAT	HRS	PID		CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS E	DATE 27 Jun 20	NO 1	TIME 00:00	PID Generated, Com		DATE 01 Jul 20	TIME 15:11	ACFT HRS 6011.1		ROUNDS		ACTION CODE 6		WUC 00	
FAULTS/REMARKS INSP E220 EMERGENCY LOCATOR TRANSMITTER SELF-TEST (AS REQUIRED) FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 JUL 2020 OR 6119.8 AIRCRAFT HOURS REFERENCE: AWR 1516 R12								ACTION INSP. OK									
ACFT HRS 6011.1		WHEN DISC O	HOW REC O	MAL EFF 1		PID Belyeu, C.		CAT F	HRS 0.2	PID		CAT	HRS	PID		CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A	DATE 27 Jun 20	NO 1	TIME 00:00	PID Generated, Com		DATE 01 Jul 20	TIME 15:09	ACFT HRS 6011.1		ROUNDS		ACTION CODE 6		WUC 00	
FAULTS/REMARKS INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 JUL 2020 REFERENCE: TM 11-6140-203-23 P								ACTION INSP. OK									
ACFT HRS 6011.1		WHEN DISC O	HOW REC O	MAL EFF 1		PID Belyeu, C.		CAT F	HRS 0.2	PID		CAT	HRS	PID		CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 62					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —	 SYS E	DATE 27 Jun 20	NO 2	TIME 00:00	PID Generated, Cor			DATE 02 Jul 20	TIME 07:47	ACFT HRS 6011.1							
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 JUL 2020 REFERENCE: TM 11-5821-357-12P								ROUNDS	ACTION CODE 6		WUC 00						
ACFT HRS 6011.1								WHEN DISC O	HOW REC O	MAL EFF 1							
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —	 SYS E	DATE 28 Jun 20	NO 1	TIME 00:01	PID Generated, Com			DATE 04 Aug 20	TIME 00:01	ACFT HRS 6012.1							
FAULTS/REMARKS INSP E331 UNDER WATER ACOUSTIC BEACON TEST AND CLEAN FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 AUG 2020 OR 6475.2 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-23_P								ROUNDS	ACTION CODE		WUC 00						
ACFT HRS 6011.1								WHEN DISC O	HOW REC O	MAL EFF 1							
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —	 SYS A	DATE 28 Jun 20	NO 1	TIME 00:01	PID Generated, Com			DATE 09 Jul 20	TIME 09:58	ACFT HRS 6011.1							
FAULTS/REMARKS INSP A501 MAIN ROTOR BLADE SPAR PRESSURE CHECK FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 AUG 2020 REFERENCE: TM 1-1520-237-23&P								ROUNDS	ACTION CODE 6		WUC 05A02						
ACFT HRS 6011.1								WHEN DISC O	HOW REC O	MAL EFF 1							
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
ACFT HRS 6011.1								WHEN DISC O	HOW REC O	MAL EFF 1							
DELAY				WUC 00				TIPIID ,				TI MANHOURS					

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 63			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS X	G CLOSED	SYS A	DATE 29 Jun 20	NO 1	TIME 09:42	PID Belyeu, Christop		DATE 08 Jul 20	TIME 09:51	ACFT HRS 6011.1					
FAULTS/REMARKS REMOVAL OF #1 ENGINE S/N- GE-E-763486 REQ'D PER CONTROL EXCHANGE							ROUNDS	ACTION CODE A		WUC 04A					
ACFT HRS 6011.1							WHEN DISC K	HOW REC G	MAL EFF 1						
DELAY				WUC 04A				TIPIID GATHRIGHT, ANTHONY			TI MANHOURS 0.1				
STATUS X	G CLOSED	SYS A	DATE 29 Jun 20	NO 2	TIME 09:44	PID Belyeu, Christop		DATE 08 Jul 20	TIME 09:54	ACFT HRS 6011.1					
FAULTS/REMARKS REMOVAL OF #2 ENGINE S/N- GE-E-762962 REQ'D PER CONTROL EXCHANGE							ROUNDS	ACTION CODE A		WUC 04					
ACFT HRS 6011.1							WHEN DISC K	HOW REC G	MAL EFF 1						
DELAY				WUC 04A				TIPIID GATHRIGHT, ANTHONY			TI MANHOURS 0.1				
STATUS —	B CLOSED	SYS A	DATE 29 Jun 20	NO 3	TIME 09:46	PID Belyeu, Christop		DATE 08 Jul 20	TIME 09:45	ACFT HRS 6011.1					
FAULTS/REMARKS BALANCING OF THE #1 ENGINE HSS REQ'D FOR REPLACEMENT OF ENGINE							ROUNDS	ACTION CODE L		WUC 02B13					
ACFT HRS 6011.1							WHEN DISC K	HOW REC G	MAL EFF 1						
DELAY				WUC 04A				TIPIID ,			TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 64			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 29 Jun 20	NO 4	TIME 09:48	PID Belyeu, Christop			DATE 08 Jul 20	TIME 09:51	ACFT HRS 6011.1					
		WHEN DISC K	HOW REC G	MAL EFF 1	ROUNDS		ACTION CODE 6		WUC 00						
FAULTS/REMARKS BALANCING OF THE #2 ENGINE HSS REQ'D FOR REPLACEMENT OF ENGINE								ACTION COMPLETED							
ACFT HRS 6011.1		WHEN DISC K		HOW REC G		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 04A		TIPID ,		TI MANHOURS									
STATUS —	 SYS A	DATE 29 Jun 20	NO 5	TIME 15:00	PID Belyeu, Christop			DATE 08 Sep 20	TIME 11:07	ACFT HRS 6022.6					
		WHEN DISC K	HOW REC G	MAL EFF 2	ROUNDS		ACTION CODE G		WUC 04A01G						
FAULTS/REMARKS TQ CHECK OF THE #1 AND #2 HSS ATTACHING HDWR DUE BETWEEN 6014.1- 6024.1 A/C HOURS FOR REPLACEMENT OF ENGINES								ACTION TRQ STABILIZED, TRQ CHECK COMPLETE							
ACFT HRS 6011.1		WHEN DISC K		HOW REC G		MAL EFF 2		PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 04A		TIPID ,		TI MANHOURS									
STATUS —	 SYS A	DATE 29 Jun 20	NO 6	TIME 15:02	PID Belyeu, Christop			DATE 08 Jul 20	TIME 08:42	ACFT HRS 6011.1					
		WHEN DISC K	HOW REC G	MAL EFF 2	ROUNDS		ACTION CODE 6		WUC 00						
FAULTS/REMARKS IDLE SPEED LEAK CHECK REQ'D ON THE #1 AND #2 ENGINES FOR REMOVAL AND REPLACEMENT OF ENGINES								ACTION insp. ok							
ACFT HRS 6011.1		WHEN DISC K		HOW REC G		MAL EFF 2		PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 04A		TIPID ,		TI MANHOURS									

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 65				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	C CLOSED	SYS A	DATE 29 Jun 20	NO 7	TIME 15:03	PID Belyeu, Christop		DATE 13 Jul 20	TIME 14:56	ACFT HRS 6012.1						
							ROUNDS	ACTION CODE 4	WUC 00							
FAULTS/REMARKS MTF REQ'D FOR REMOVAL AND REPLACEMENT OF THE #1 AND #2 ENGINE								ACTION MTF Complete, aircraft released for flight								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CURTIS, A.	F	2.0						
ACFT HRS 6011.1		WHEN DISC K	HOW REC G	MAL EFF 2												
DELAY				WUC 04A				TIPIID ,				TI MANHOURS				
STATUS —	B CLOSED	SYS A	DATE 29 Jun 20	NO 8	TIME 15:05	PID Belyeu, Christop		DATE 08 Jul 20	TIME 08:41	ACFT HRS 6011.1						
							ROUNDS	ACTION CODE 6	WUC 00							
FAULTS/REMARKS TQ CHECK OF THE #1 AND #2 ENG DESWIRL DUCT V-BANK CLAMPS REQ'D AFTER ATLEAST 10 MIN ENGINE RUN WITH A MINIMUM OF 1 HOUR COOL DOWN								ACTION retorques complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.2						
ACFT HRS 6011.1		WHEN DISC K	HOW REC G	MAL EFF 2												
DELAY				WUC 04A				TIPIID ,				TI MANHOURS				
STATUS ⊗	G CLOSED	SYS A	DATE 29 Jun 20	NO 9	TIME 15:07	PID Belyeu, Christop		DATE 08 Jul 20	TIME 14:34	ACFT HRS 6011.1						
							ROUNDS	ACTION CODE R	WUC 00							
FAULTS/REMARKS A/C RESTRICTED TO GROUND RUNS ONLY DUE TO INSTALLATION OF HSS CAMERAS, INLET BLEED AIR TUBE PLUGS, AND ENGINE RUN SCREENS FOR BALANCING OF THE #1 AND #2 ENGINES HSS'S								ACTION run screens, tube plugs, and hss camera removed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.2						
ACFT HRS 6011.1		WHEN DISC K	HOW REC G	MAL EFF 2												
DELAY				WUC 04A				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A			3. DATE			4. PAGE 66		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION						
STATUS —	 C SYS A	DATE 29 Jun 20	NO 10	TIME 15:10	PID Belyeu, Christop	DATE 13 Jul 20	TIME 14:55	ACFT HRS 6012.1				
FAULTS/REMARKS ENGINE CHECKOUTS REQ'D ON THE #1 AND #2 ENGINES IAW TM 1-2840-248-23&P WP 0117 TABLE 1 FOR REMOVAL AND REPLACEMENT OF ENGINES						ACTION Complete						
ACFT HRS 6011.1						WHEN DISC K	HOW REC G	MAL EFF 2				
DELAY						WUC 04A			TI MANHOURS			
STATUS —	 C SYS O	DATE 30 Jun 20	NO 1	TIME 00:01	PID Generated, Com	DATE 07 Jul 20	TIME 00:00	ACFT HRS 6011.1				
FAULTS/REMARKS INSP O800 LOGBOOK RECON DUE FOR HCPTUR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 JUL 2020 REFERENCE: AASF SOP						ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JUL 7 2020 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT						
ACFT HRS 6011.1						WHEN DISC O	HOW REC O	MAL EFF 1				
DELAY						WUC 00			TI MANHOURS			
STATUS —	 C SYS E	DATE 30 Jun 20	NO 1	TIME 00:01	PID Generated, Com	DATE 07 Jul 20	TIME 00:00	ACFT HRS 6011.1				
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTUR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 JUL 2020 REFERENCE: TM 11-5810-262-23						ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JUL 7 2020 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT						
ACFT HRS 6011.1						WHEN DISC O	HOW REC O	MAL EFF 1				
DELAY						WUC 00			TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 67					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS X		SYS A	DATE 30 Jun 20	NO 1	TIME 10:54	PID Pacheco, Jason		DATE 30 Jun 20	TIME 12:39	ACFT HRS 6011.1		ROUNDS		ACTION CODE A		WUC 04A	
FAULTS/REMARKS BROKEN RIVET FOUND ON #1 ENGINE FORWARD SUPPORT TUBE								ACTION replaced frwd support tube									
ACFT HRS 6011.1		WHEN DISC K		HOW REC G		MAL EFF 1		PID Pacheco, J	CAT F	HRS 0.5	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 04A				TIPID GATHRIGHT, ANTHONY				TI MANHOURS 0.1					
STATUS —		SYS A	DATE 01 Jul 20	NO 1	TIME 00:01	PID Generated, Com		DATE 02 Jul 20	TIME 10:58	ACFT HRS 6011.1		ROUNDS		ACTION CODE B		WUC 02	
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 JUL 2020 REFERENCE: TM 1-1520-237-23&P								ACTION UPDATED, LAST FLOWN ON 26JUN2020									
ACFT HRS 6011.1		WHEN DISC O		HOW REC O		MAL EFF 1		PID DUFFY, J.	CAT F	HRS 0.1	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPID ,				TI MANHOURS					
STATUS ⊗		SYS A	DATE 01 Jul 20	NO 2	TIME 12:36	PID CURTIS, ANDRE		DATE 19 Nov 20	TIME 13:54	ACFT HRS 6055.4		ROUNDS		ACTION CODE 6		WUC 00	
FAULTS/REMARKS OPERATE IN ACCORDANCE WITH AWR 2120 R3 DATED 27 SEP 2019 (GeTac Computer), AWR 1956 R3 DATED 31 OCT 2018 (APR-39), AWR 1913 R4 DATED 17 JAN 2020 (ACN LOGBOOK), AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C), AWR 1800 R9 DATED 18 JUL 2019 (EDM/BFT), AWR 1753 R9 DATED 17 APR 20(128D GPS), AWR 1738 R6 DATED 18 JAN 2019 (APX-118), AWR 1694 R7 DATED 29 JAN 2020 (DSC),AWR 1682 R25 DATED 01 AUG 2019 (701D TDI), AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/ PDU), AWR 1566 R7 DATED 05 FEB 2019 (HPH CABLE GUARD), AWR 1516 R12 DATED 07 FEB 2019 (ELT EBC-406HM), AWR 1513 R13 19 APR 2019								ACTION Updated									
ACFT HRS 6011.1		WHEN DISC O		HOW REC O		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPID CURTIS, ANDREW				TI MANHOURS 0.1					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 68			
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION						
STATUS ⊗		SYS A	DATE 01 Jul 20	NO 3	TIME 12:36	PID CURTIS, ANDRE	DATE 19 Nov 20	TIME 13:54	ACFT HRS 6055.4			
FAULTS/REMARKS OPERATE IAW THE FOLLOWING AWR'S IF APPLICABLE - AWR 1965 R9 DATED 18 MAR 2020 (APPLE IPAD DEVICES), AWR 1930 R13 08 APR 2020 (PMI), AWR 1784 R4 DATED 31 JUL 2019 (SHIP BOARD OPS), AWR 1632 R7 DATED 05 OCT 2018 (ALP LASER POINTER), AWR 1466 R9 DATED 23 AUG 2019 (GARMIN GPS), AWR 1453 R7 DATED 06 JUN 2019 (MCS), AWR 1407 R6 DATED 28 MAY 2020 (DAY HUD), AWR 1309 R12 DATED 30 JUL 2019 (OREGON SEAT CUSHION), AWR 1308 R13 DATED 24 APR 2019 (IRH R5), AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN DRS REMOVED), AWR 1270 R12 DATED 5 SEP 2018 (EIBF), AWR 1127 R9 DATED 11 SEP 2018 (ELL),						ACTION Updated						
ACFT HRS 6011.1			WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS
DELAY			WUC 00			TIPID CURTIS, ANDREW			TI MANHOURS 0.1			
STATUS —		SYS A	DATE 02 Jul 20	NO 1	TIME 10:16	PID Generated, Com	DATE 02 Jul 20	TIME 13:34	ACFT HRS 6011.1			
FAULTS/REMARKS PMD DUE						ACTION complete						
ACFT HRS 6011.1			WHEN DISC O	HOW REC G	MAL EFF 2		PID	CAT	HRS	PID	CAT	HRS
DELAY			WUC 00			TIPID ,			TI MANHOURS			
STATUS —		SYS A	DATE 02 Jul 20	NO 2	TIME 10:17	PID Generated, Com	DATE 02 Jul 20	TIME 10:51	ACFT HRS 6011.1			
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ACTION COMPLETED						
ACFT HRS 6011.1			WHEN DISC X	HOW REC G	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS
DELAY			WUC 00			TIPID ,			TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 69					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A	DATE 02 Jul 20	NO 3	TIME 10:51	PID Generated, Cor		DATE 02 Jul 20	TIME 10:59	ACFT HRS 6011.1		ROUNDS		ACTION CODE 3		WUC 02	
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 02 JUL 2020. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6018.7 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ACTION COMPLETED, INSP. OK									
ACFT HRS 6011.1		WHEN DISC O	HOW REC O	MAL EFF 1		PID DUFFY, J.		CAT F	HRS 0.5	PID		CAT	HRS	PID		CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A	DATE 02 Jul 20	NO 4	TIME 13:19	PID Generated, Com		DATE 02 Jul 20	TIME 13:19	ACFT HRS		ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS PMD Due								ACTION COMPLETED									
ACFT HRS 6011.1		WHEN DISC O	HOW REC O	MAL EFF 1		PID DUFFY, J.		CAT F	HRS 2.0	PID		CAT	HRS	PID		CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A	DATE 07 Jul 20	NO 1	TIME 00:00	PID Generated, Com		DATE 14 Jul 20	TIME 00:01	ACFT HRS 6012.1		ROUNDS		ACTION CODE		WUC 00	
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 13 JUL 2020 OR 6038.8 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-23&P								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JUL 14 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT									
ACFT HRS 6011.1		WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID		CAT	HRS	PID		CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 70							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS X		SYS E	DATE 07 Jul 20	NO 1	TIME 00:00	PID Generated, Cor		DATE 13 Jul 20	TIME 14:54	ACFT HRS 6012.1									
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 06 JUL 2020 REFERENCE: TM 11-5810-262-23								ACTION complete						ROUNDS		ACTION CODE 6		WUC 00	
ACFT HRS 6011.1				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPID CURTIS, ANDREW				TI MANHOURS 0.1							
STATUS X		SYS O	DATE 07 Jul 20	NO 1	TIME 00:00	PID Generated, Com		DATE 31 Dec 20	TIME 09:19	ACFT HRS 6068.0									
FAULTS/REMARKS INSP O800 LOGBOOK RECON DUE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 06 JUL 2020 REFERENCE: AASF SOP								ACTION Complete						ROUNDS		ACTION CODE 6		WUC 00	
ACFT HRS 6011.1				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPID CURTIS, ANDREW				TI MANHOURS 0.1							
STATUS —		SYS A	DATE 07 Jul 20	NO 2	TIME 00:00	PID Generated, Com		DATE 08 Jul 20	TIME 14:33	ACFT HRS 6011.1									
FAULTS/REMARKS INSP A496 CF3BR FIRE EXTINGUISHER WEIGHT TEST INSPECTION FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 12 AUG 2020 REFERENCE: TM 1-1520-237-23&P								ACTION 2 ea insp. ok						ROUNDS		ACTION CODE 6		WUC 00	
ACFT HRS 6011.1				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPID ,				TI MANHOURS							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 71		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION					
STATUS —	 SYS A	DATE 07 Jul 20	NO 3	TIME 00:00	PID Generated, Cor	DATE 14 Jul 20	TIME 00:01	ACFT HRS 6012.1			
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 13 JUL 2020 REFERENCE: TM 1-1500-344-23						ROUNDS	ACTION CODE	WUC 00			
ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JUL 14 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT											
ACFT HRS 6011.1						WHEN DISC O	HOW REC O	MAL EFF 1			
DELAY						WUC 00			TI MANHOURS		
STATUS —	 SYS A	DATE 08 Jul 20	NO 1	TIME 10:07	PID Generated, Com	DATE 08 Jul 20	TIME 14:40	ACFT HRS 6011.1			
FAULTS/REMARKS PMD DUE						ROUNDS	ACTION CODE 3	WUC 00			
ACTION COMPLETE											
ACFT HRS 6011.1						WHEN DISC O	HOW REC G	MAL EFF 2			
DELAY						WUC 00			TI MANHOURS		
STATUS —	 SYS A	DATE 08 Jul 20	NO 2	TIME 10:08	PID Generated, Com	DATE 08 Jul 20	TIME 10:16	ACFT HRS 6011.1			
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ROUNDS	ACTION CODE 3	WUC 00			
ACTION INSP. OK											
ACFT HRS 6011.1						WHEN DISC X	HOW REC G	MAL EFF 1			
DELAY						WUC 00			TI MANHOURS		
ACFT HRS 6011.1						WHEN DISC O	HOW REC O	MAL EFF 1			
DELAY						WUC 00			TI MANHOURS		




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 72				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 08 Jul 20	NO 3	TIME 10:40	PID Belyeu, Christop		DATE 08 Jul 20	TIME 14:33	ACFT HRS 6011.1						
FAULTS/REMARKS #1 FUEL SELECTOR VALVE H/W SAFETY INCORRECT								ACTION replaced safeties 2ea								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.3						
ACFT HRS 6011.1		WHEN DISC X	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				
STATUS —		SYS A	DATE 08 Jul 20	NO 4	TIME 14:13	PID Generated, Com		DATE 08 Jul 20	TIME 14:21	ACFT HRS 6011.1						
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION DUPLICATE ENTRY								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Leone, M.	F	0.2						
ACFT HRS 6011.1		WHEN DISC X	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				
STATUS —		SYS A	DATE 08 Jul 20	NO 5	TIME 14:42	PID Generated, Com		DATE 08 Jul 20	TIME 14:42	ACFT HRS						
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	1.0						
ACFT HRS 6011.1		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 73			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	E Closed	SYS A	DATE 09 Jul 20	NO 1	TIME 00:00	PID Generated, Cor		DATE 09 Jul 20	TIME 13:00	ACFT HRS 6011.1					
								ROUNDS	ACTION CODE E	WUC 00					
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 11 JUL 2020 REFERENCE: TM 1-1520-237-23&P								ACTION COMPLETED							
ACFT HRS 6011.1		WHEN DISC O	HOW REC O	MAL EFF 1		PID Belyeu, C.		CAT F	HRS 0.5	PID		CAT	HRS		
DELAY				WUC 00				TIPID ,				TI MANHOURS			
STATUS /	E Closed	SYS A	DATE 09 Jul 20	NO 2	TIME 14:50	PID EISENHAUER, JE		DATE 05 Oct 20	TIME 13:02	ACFT HRS 6035.4					
								ROUNDS	ACTION CODE E	WUC 00					
FAULTS/REMARKS MACHINE GUN MOUNT GUN ARM (M240) L/H AND R/H RMVD FROM A/C AT 48 LBS MOMENT 13.44 CHART C ENTRY NOT COMPLETED, MUST BE COMPLETED N/L/T 07OCT20								ACTION rewrote fault							
ACFT HRS 6011.1		WHEN DISC S	HOW REC G	MAL EFF 1		PID EISENHAU		CAT F	HRS 0.1	PID		CAT	HRS		
DELAY				WUC 00				TIPID ,				TI MANHOURS			
STATUS —	B Closed	SYS A	DATE 11 Jul 20	NO 1	TIME 00:01	PID Generated, Com		DATE 15 Jul 20	TIME 10:41	ACFT HRS 6012.1					
								ROUNDS	ACTION CODE B	WUC 00					
FAULTS/REMARKS INSP A100 LH/RH ENGINE HISTORY RECORDER READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 17 JUL 2020 REFERENCE: DA PAM 738-751								ACTION complete- #1 eng lcf1 1494, lcf210549, index17918, hrs 3416 eng#2 lcf1 730, lcf2 2760, index 3821, hrs 1920							
ACFT HRS 6011.1		WHEN DISC O	HOW REC O	MAL EFF 1		PID EISENHAU		CAT F	HRS 0.1	PID		CAT	HRS		
DELAY				WUC 00				TIPID ,				TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 74			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 12 Jul 20	NO 1	TIME 00:01	PID Generated, Cor			DATE 15 Jul 20	TIME 10:39	ACFT HRS 6012.1					
		ROUNDS				ACTION CODE B			WUC 00						
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 JUL 2020 REFERENCE: TM 1-1520-237-23								ACTION complete- hrs 668, events 4194							
ACFT HRS 6011.1		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00				TIPIID ,			TI MANHOURS						
STATUS ×	 SYS A	DATE 14 Jul 20	NO 1	TIME 00:01	PID Generated, Com			DATE 14 Jul 20	TIME 10:46	ACFT HRS 6012.1					
		ROUNDS				ACTION CODE E			WUC 00						
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 13 JUL 2020 REFERENCE: TM 1-1500-344-23								ACTION complete							
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00				TIPIID EISENHAUER, JEFFREY			TI MANHOURS 0.1						
STATUS ×	 SYS A	DATE 14 Jul 20	NO 2	TIME 00:01	PID Generated, Com			DATE 14 Jul 20	TIME 14:51	ACFT HRS 6012.1					
		ROUNDS				ACTION CODE E			WUC 00						
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 6038.8 AIRCRAFT HOURS OR 13 JUL 2020 REFERENCE: TM 1-1520-237-23&P								ACTION complete							
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00				TIPIID EISENHAUER, JEFFREY			TI MANHOURS 0.1						
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00				TIPIID EISENHAUER, JEFFREY			TI MANHOURS 0.1						

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 75				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	G CLOSED	SYS A	DATE 14 Jul 20	NO 3	TIME 08:11	PID Generated, Cor		DATE 14 Jul 20	TIME 10:32	ACFT HRS 6012.1						
								ROUNDS	ACTION CODE G	WUC 04A						
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-SOF-03 DESCRIPTION: COMPLY WITH H-60-20-SOF-03, T700 SERIES ENGINE POWER TURBINE MODULE NOZZLE SEAL RE-INSPECTION, PRIOR TO NEXT FLIGHT, BUT NOT TO EXCEED 16JUL20. IS DUE: 16 JUL 2020 CALENDAR								ACTION COMPLIED WITH								
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY		WUC 00						TI PID GATHRIGHT, ANTHONY			TI MANHOURS 0.1					
STATUS —	G CLOSED	SYS A	DATE 14 Jul 20	NO 1	TIME 09:26	PID Generated, Com		DATE 14 Jul 20	TIME 10:31	ACFT HRS 5886.0						
								ROUNDS	ACTION CODE G	WUC 04A						
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-SOF-03 DESCRIPTION: COMPLY WITH H-60-20-SOF-03, T700 SERIES ENGINE POWER TURBINE MODULE NOZZLE SEAL RE-INSPECTION, PRIOR TO NEXT FLIGHT, BUT NOT TO EXCEED 16JUL20 FOR POWER TURBINE MODULE CAGE: 99207 PN: 6071T26G02 NSN: 2840015031700 SN: GEL007656C IS DUE: 16 JUL 2020 CALENDAR								ACTION COMPLIED WITH								
ACFT HRS 5886		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY		WUC 04A03						TI PID GATHRIGHT, ANTHONY			TI MANHOURS 0.1					
STATUS —	G CLOSED	SYS A	DATE 14 Jul 20	NO 1	TIME 09:26	PID Generated, Com		DATE 14 Jul 20	TIME 10:30	ACFT HRS 4642.0						
								ROUNDS	ACTION CODE G	WUC 04A						
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-SOF-03 DESCRIPTION: COMPLY WITH H-60-20-SOF-03, T700 SERIES ENGINE POWER TURBINE MODULE NOZZLE SEAL RE-INSPECTION, PRIOR TO NEXT FLIGHT, BUT NOT TO EXCEED 16JUL20 FOR POWER TURBINE MODULE CAGE: 99207 PN: 6071T26G02 NSN: 2840015031700 SN: GEL002615C IS DUE: 16 JUL 2020 CALENDAR								ACTION COMPLIED WITH								
ACFT HRS 4642		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY		WUC 04A03						TI PID GATHRIGHT, ANTHONY			TI MANHOURS 0.1					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 76			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 14 Jul 20	NO 4	TIME 11:01	PID Generated, Cor			DATE 14 Jul 20	TIME 15:04	ACFT HRS 6012.1					
		WHEN DISC O	HOW REC O	MAL EFF 1	ROUNDS		ACTION CODE 3		WUC 00						
FAULTS/REMARKS PMD Due								ACTION complete							
ACFT HRS 6012.1		WHEN DISC O		HOW REC O		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00		TIPID ,		TI MANHOURS									
STATUS —	 SYS A	DATE 14 Jul 20	NO 5	TIME 11:02	PID Generated, Com			DATE 14 Jul 20	TIME 11:03	ACFT HRS 6012.1					
		WHEN DISC O	HOW REC O	MAL EFF 1	ROUNDS		ACTION CODE G		WUC 00						
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 14 JUL 2020. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6022.1 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ACTION complete							
ACFT HRS 6012.1		WHEN DISC O		HOW REC O		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00		TIPID ,		TI MANHOURS									
STATUS —	 SYS A	DATE 14 Jul 20	NO 6	TIME 11:02	PID Generated, Com			DATE 14 Jul 20	TIME 14:54	ACFT HRS 6012.1					
		WHEN DISC O	HOW REC G	MAL EFF 2	ROUNDS		ACTION CODE 3		WUC 00						
FAULTS/REMARKS PMD DUE								ACTION insp. ok							
ACFT HRS 6012.1		WHEN DISC O		HOW REC G		MAL EFF 2		PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00		TIPID ,		TI MANHOURS									

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 77				
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION						
STATUS —	B Closed	SYS A	DATE 14 Jul 20	NO 7	TIME 11:02	PID Generated, Cor		DATE 14 Jul 20	TIME 11:09	ACFT HRS 6012.1		
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ACTION complete						
ACFT HRS 6012.1		WHEN DISC X	HOW REC G	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS
DELAY		WUC 00			TIPID ,			TI MANHOURS				
STATUS —	B Closed	SYS A	DATE 14 Jul 20	NO 8	TIME 11:02	PID Generated, Com		DATE 14 Jul 20	TIME 14:53	ACFT HRS 6012.1		
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 14 JUL 2020. INSP A160 90 DAY CORROSION INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 AUG 2020 REFERENCE: TM 1-1520-237-23&P						ACTION complete						
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS
DELAY		WUC 00			TIPID ,			TI MANHOURS				
STATUS —	B Closed	SYS A	DATE 14 Jul 20	NO 9	TIME 15:05	PID Generated, Com		DATE 14 Jul 20	TIME 15:05	ACFT HRS		
FAULTS/REMARKS PMD Due						ACTION COMPLETED						
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS
DELAY		WUC 00			TIPID ,			TI MANHOURS				
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS
DELAY		WUC 00			TIPID ,			TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 78				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 15 Jul 20	NO 1	TIME 07:33	PID Generated, Cor		DATE 16 Jul 20	TIME 13:09	ACFT HRS 6012.1						
FAULTS/REMARKS DEPANELED AIRCRAFT FOR ACE INCEPTION								ACTION ACE inspection completed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								BISHOP, J.	F	4.0						
ACFT HRS 6012.1		WHEN DISC O		HOW REC G		MAL EFF 2										
DELAY				WUC 00				TIPIID DUFFY, JOSHUA				TI MANHOURS 1.0				
STATUS /		SYS A	DATE 16 Jul 20	NO 3	TIME 13:08	PID DUFFY, JOSHUA		DATE 10 Aug 20	TIME 00:00	ACFT HRS 6012.1						
FAULTS/REMARKS fwd lh corner of soundproofing fwd of main transmission has bad nutplate								ACTION INSTALLED NUTPLATE								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Fraser, C.	F	0.5						
ACFT HRS 6012.1		WHEN DISC K		HOW REC G		MAL EFF 1										
DELAY w/o sm01610002				WUC 02				TIPIID ,				TI MANHOURS				
STATUS —		SYS O	DATE 17 Jul 20	NO 1	TIME 00:01	PID Generated, Com		DATE 24 Jul 20	TIME 00:00	ACFT HRS 6012.1						
FAULTS/REMARKS INSP O801 128D DAFIF AND WAYPOINT UPDATE REQUIRED FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 23 JUL 2020 REFERENCE: AASF SOP								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JUL 24 2020 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
ACFT HRS 6012.1		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 79					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS X	 SYS A	DATE 19 Jul 20	NO 1	TIME 11:52	PID HODGDON, BEI			DATE 21 Jul 20	TIME 12:45	ACFT HRS 6012.1							
		ROUNDS	ACTION CODE J			WUC 00											
FAULTS/REMARKS Eng #1 failed HIT								ACTION Manual HIT passes. IVHMS was reading TGT ~35 degrees high. Aircraft is restricted to manual HIT checks.									
ACFT HRS 6012.1		WHEN DISC G	HOW REC D	MAL EFF 5				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 02				TIPID DUNHAM, NICHOLAS				TI MANHOURS 0.2							
STATUS /	 SYS A	DATE 21 Jul 20	NO 1	TIME 12:51	PID CURTIS, ANDREI			DATE 05 Aug 20	TIME 10:13	ACFT HRS 6012.1							
		ROUNDS	ACTION CODE B			WUC 00											
FAULTS/REMARKS TGT is incorrect in IVHMS for #1 eng during HIT. Use manual HIT procedures until fault is corrected.								ACTION HIT CHECK COMPLETED ON NO 1 ENGINE WITH A PASS. IVHMS TGT, ACFT TGT AND DAY HUD TGT ALL COMPARE WITHIN LIMITS. CAL VALUES FOR TGT VERIFIED TO BE AT 000.									
ACFT HRS 6012.1		WHEN DISC K	HOW REC C	MAL EFF 2				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WO SUBMITTED 05AUG20				WUC 00				TIPID ,				TI MANHOURS			
STATUS X	 SYS A	DATE 23 Jul 20	NO 1	TIME 08:20	PID CEPELAK, CORY			DATE 23 Jul 20	TIME 10:49	ACFT HRS 6012.1							
		ROUNDS	ACTION CODE A			WUC 02											
FAULTS/REMARKS OIL OBSERVED POOLING AT #2 ENG DESWIRL DUCT								ACTION Replaced B-Sump Check Valve									
ACFT HRS 6012.1		WHEN DISC K	HOW REC G	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 02				TIPID HICKEY, LOUIS				TI MANHOURS 0.1							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 80				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 23 Jul 20	NO 2	TIME 09:57	PID HIGGINS, PHILIP		DATE 01 Aug 20	TIME 12:58	ACFT HRS 6012.1						
FAULTS/REMARKS STABILATOR HAS EXCESSIVE PLAY								ACTION REPLACED R/H STABILATOR TO PYLON ATTACHMENT FAIRING BEARINGS 2 EA								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Ellis, Z.	F	4.0	WALKER, A	F	4.0			
ACFT HRS 6012.1		WHEN DISC X	HOW REC G	MAL EFF 1												
DELAY				WUC 02C15B				TIPID OILER, KENNETH				TI MANHOURS 1.5				
STATUS —		SYS A	DATE 23 Jul 20	NO 3	TIME 10:15	PID CEPELAK, CORY		DATE 02 Aug 20	TIME 14:52	ACFT HRS 6012.1						
FAULTS/REMARKS perform #2 eng check out procedures in accordance with WP 0118 for replacement of B-Sump check valve.								ACTION FAULT NARITIVE ENTERED IN ERROR. REFER TO 2408-13-1 DATED 2 AUG 2020								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Pacheco, J.	F	0.1						
ACFT HRS 6012.1		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 04A08				TIPID ,				TI MANHOURS				
STATUS —		SYS A	DATE 23 Jul 20	NO 4	TIME 14:18	PID Generated, Com		DATE 23 Jul 20	TIME 14:20	ACFT HRS						
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								HIGGINS, P	F	1.0						
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 81							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —		P CLOSED		SYS A		DATE 23 Jul 20		NO 5		TIME 14:21		PID Generated, Cor		DATE 01 Aug 20		TIME 15:05		ACFT HRS 6012.1	
FAULTS/REMARKS PMD DUE								ACTION DAILY INSP COMPLETED WALKER, ASTON SECTION 1,2,&3 DESJARDINS,MARCUS SECTION 4 ELLIS, ZACHARY SECTION 5 & 6											
ACFT HRS 6012.1		WHEN DISC O		HOW REC G		MAL EFF 2		PID Ellis, Z.		CAT F		HRS 1.0		PID DESJARDIN		CAT F		HRS 1.0	
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS —		H CLOSED		SYS A		DATE 23 Jul 20		NO 6		TIME 14:23		PID Generated, Com		DATE 23 Jul 20		TIME 14:32		ACFT HRS 6012.1	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION insp complt											
ACFT HRS 6012.1		WHEN DISC X		HOW REC G		MAL EFF 1		PID CEPELAK, C		CAT F		HRS 0.4		PID		CAT		HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS X		D CLOSED		SYS O		DATE 24 Jul 20		NO 1		TIME 00:00		PID Generated, Com		DATE 03 Aug 20		TIME 16:41		ACFT HRS 6012.1	
FAULTS/REMARKS INSP O801 128D DAFIF AND WAYPOINT UPDATE REQUIRED FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 23 JUL 2020 REFERENCE: AASF SOP								ACTION updated											
ACFT HRS 6012.1		WHEN DISC O		HOW REC O		MAL EFF 1		PID DUNHAM, N		CAT F		HRS 0.2		PID		CAT		HRS	
DELAY				WUC 00				TIPIID DUNHAM, NICHOLAS				TI MANHOURS 0.2							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 82				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 24 Jul 20	NO 1	TIME 09:54	PID HIGGINS, PHILIP		DATE 31 Jul 20	TIME 12:38	ACFT HRS 6012.1						
FAULTS/REMARKS R/H TAIL PYLON STAB HINGE FITTING SPHERICAL BEARINGS WORN BEYOND LIMITS								ACTION REPLACED BEARINGS								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								HIGGINS, P	F	0.2						
ACFT HRS 6012.1		WHEN DISC X	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				
STATUS X		SYS E	DATE 24 Jul 20	NO 1	TIME 12:29	PID Ellis, Zakary		DATE 29 Jul 20	TIME 14:51	ACFT HRS 6012.1						
FAULTS/REMARKS APR39 REAR RECIEVER ELECTRICAL CONNECTOR J4 BROKEN								ACTION REPLACED COAXIAL CONNECTOR. SEE BELOW FOR MOC.								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								TARBOX, C	F	1.0						
ACFT HRS 6012.1		WHEN DISC K	HOW REC G	MAL EFF 2												
DELAY				WUC 02				TIPIID OILER, KENNETH				TI MANHOURS 0.2				
STATUS —		SYS E	DATE 26 Jul 20	NO 1	TIME 00:00	PID Generated, Com		DATE 03 Aug 20	TIME 16:41	ACFT HRS 6012.1						
FAULTS/REMARKS INSP E040 APR-39 RADAR/LASER WARNING OPNL CHECK, 5841-01-236-8951 FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 13 AUG 2020 REFERENCE: TM 11-5841-294-12								ACTION completed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUNHAM, F	F	0.2						
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 83					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A	DATE 26 Jul 20	NO 1	TIME 00:00	PID Generated, Cor		DATE 29 Jul 20	TIME 00:00	ACFT HRS 6012.1		ROUNDS		ACTION CODE		WUC 00	
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 28 JUL 2020 REFERENCE: TM 1-1520-237-23&P								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JUL 29 2020 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT									
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS E	DATE 26 Jul 20	NO 2	TIME 00:00	PID Generated, Com		DATE 03 Aug 20	TIME 16:40	ACFT HRS 6012.1		ROUNDS		ACTION CODE 4		WUC 19H	
FAULTS/REMARKS INSP E125 KY-58 PMCS/OPNL CHECK FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 13 AUG 2020 REFERENCE: TM 11-5810-262-23								ACTION completed									
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS E	DATE 27 Jul 20	NO 1	TIME 00:00	PID Generated, Com		DATE 03 Aug 20	TIME 00:01	ACFT HRS 6012.1		ROUNDS		ACTION CODE		WUC 00	
FAULTS/REMARKS INSP E220 EMERGENCY LOCATOR TRANSMITTER SELF-TEST (AS REQUIRED) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6136.1 AIRCRAFT HOURS OR 02 AUG 2020 REFERENCE: AWR 1516 R12								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON AUG 3 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT									
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 84							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —		SYS A	DATE 27 Jul 20	NO 1	TIME 00:00	PID Generated, Cor		DATE 01 Aug 20	TIME 15:22	ACFT HRS 6012.1									
FAULTS/REMARKS INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 02 AUG 2020 REFERENCE: TM 11-6140-203-23 P								ACTION COMPLETED					ROUNDS			ACTION CODE G		WUC 02	
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1				PID Pacheco, J	CAT F	HRS 0.2	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS —		SYS E	DATE 27 Jul 20	NO 2	TIME 00:00	PID Generated, Com		DATE 01 Aug 20	TIME 15:29	ACFT HRS 6012.1									
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 02 AUG 2020 REFERENCE: TM 11-5821-357-12P								ACTION INSPECTED OK					ROUNDS			ACTION CODE G		WUC 02	
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1				PID Ellis, Z.	CAT F	HRS 0.5	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS —		SYS A	DATE 29 Jul 20	NO 1	TIME 00:00	PID Generated, Com		DATE 28 Sep 20	TIME 00:00	ACFT HRS 6029.9									
FAULTS/REMARKS INSP A633 RESERVE FIRE BOTTLE #1, CARTRIDGE, DODIC MH92 FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 27 SEP 2020 REFERENCE: TB 9-1300-385 CHG 22								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON SEP 28 2020 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT					ROUNDS			ACTION CODE		WUC 00	
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID ,				TI MANHOURS							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 85				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —		SYS A	DATE 29 Jul 20	NO 2	TIME 00:00	PID Generated, Cor		DATE 28 Sep 20	TIME 00:00	ACFT HRS 6029.9		ROUNDS		ACTION CODE		WUC 00
FAULTS/REMARKS INSP A638 RESERVE FIRE BOTTLE #2, CARTRIDGE DODIC MH92 FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 27 SEP 2020 REFERENCE: TB 9-1300-385 CHG 22								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON SEP 28 2020 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS X		SYS A	DATE 29 Jul 20	NO 3	TIME 00:00	PID Generated, Com		DATE 03 Aug 20	TIME 16:39	ACFT HRS 6012.1		ROUNDS		ACTION CODE 4		WUC 00
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 28 JUL 2020 REFERENCE: TM 1-1520-237-23&P								ACTION completed								
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID DUNHAM, NICHOLAS				TI MANHOURS 0.2				
STATUS —		SYS E	DATE 29 Jul 20	NO 1	TIME 14:52	PID TARBOX, CHARL		DATE 03 Aug 20	TIME 16:38	ACFT HRS 6012.1		ROUNDS		ACTION CODE 4		WUC 00
FAULTS/REMARKS MOC OF APR-39 SYSTEM REQUIRED FOR REPLACEMENT OF AFT RECEIVER CONNECTOR TO J4.								ACTION completed								
ACFT HRS 6012.1		WHEN DISC K	HOW REC G	MAL EFF 2				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 76A				TIPIID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 86				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	D CLOSED	SYS A	DATE 01 Aug 20		NO 1	TIME 13:00		PID Ellis, Zakary			DATE 03 Aug 20		TIME 16:38		ACFT HRS 6012.1	
FAULTS/REMARKS OPERATIONAL CHECK OF RADAR WARNING SYSTEM, APR-39 DUE TO REMOVAL OF TAIL ROTOR LOWER PYLON FAIRING								ACTION completed								
ACFT HRS 6012.1	WHEN DISC K		HOW REC O		MAL EFF 2		PID DUNHAM,	CAT F	HRS 0.2	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 02				TIPID ,				TI MANHOURS				
STATUS —	H CLOSED	SYS A	DATE 01 Aug 20		NO 2	TIME 13:45		PID Generated, Com			DATE 01 Aug 20		TIME 14:38		ACFT HRS 6012.1	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION completed								
ACFT HRS 6012.1	WHEN DISC X		HOW REC G		MAL EFF 1		PID DESJARDIN	CAT F	HRS 0.5	PID LYNCH, J.	CAT F	HRS 0.5	PID MCGRAW,	CAT F	HRS 0.5	
DELAY				WUC 00				TIPID ,				TI MANHOURS				
STATUS —	P CLOSED	SYS A	DATE 01 Aug 20		NO 3	TIME 13:46		PID Generated, Com			DATE 01 Aug 20		TIME 14:49		ACFT HRS 6012.1	
FAULTS/REMARKS PMD Due								ACTION DAILY INSP COMPLETED WALKER,ASHTON SEC 1,2,& 3 DESJARDINS, MARCUS SEC 4 ELLIS, ZACHARY SEC 5 & 6								
ACFT HRS 6012.1	WHEN DISC O		HOW REC O		MAL EFF 1		PID DESJARDIN	CAT F	HRS 1.0	PID WALKER, A	CAT F	HRS 1.0	PID Ellis, Z.	CAT F	HRS 1.0	
DELAY				WUC 00				TIPID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 87				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /	B CLOSED	SYS A	DATE 01 Aug 20	NO 4	TIME 15:13	PID Pacheco, Jason		DATE 07 Oct 20	TIME 08:30	ACFT HRS 6035.4						
FAULTS/REMARKS TAIL DRAIN HOLE CAP NOT INSTALLED								ACTION replaced								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.2						
ACFT HRS 6012.1		WHEN DISC B		HOW REC G		MAL EFF 1										
DELAY Part on order				WUC 02				TIPIID ,				TI MANHOURS				
STATUS —	D CLOSED	SYS A	DATE 01 Aug 20	NO 5	TIME 15:27	PID Generated, Com		DATE 01 Aug 20	TIME 15:27	ACFT HRS						
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Pacheco, J	F	2.0						
ACFT HRS 6012.1		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	D CLOSED	SYS A	DATE 02 Aug 20	NO 1	TIME 14:48	PID LYNCH, JARED		DATE 03 Aug 20	TIME 16:37	ACFT HRS 6012.1						
FAULTS/REMARKS IDLE SPEED LEAK CHECK OF THE #2 ENGINE REQ'D FOR THE REPLACEMENT OF THE B-SUMP CHECK VALVE								ACTION completed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUNHAM,	F	0.2						
ACFT HRS 6012.1		WHEN DISC K		HOW REC G		MAL EFF 2										
DELAY				WUC 04A				TIPIID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 88							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —		D CLOSED		SYS A		DATE 02 Aug 20		NO 2		TIME 14:50		PID Pacheco, Jason		DATE 03 Aug 20		TIME 16:36		ACFT HRS 6012.1	
FAULTS/REMARKS ENGINE CHECKOUTS REQ'D ON THE #2 ENGINE IAW TM 2840-248-23&P WP 0118 TABLE ONE FOR REMOVAL AND REPLACEMENT OF THE #2 B-SUMP CHECK VALVE								ACTION completed											
ACFT HRS 6012.1		WHEN DISC K		HOW REC G		MAL EFF 2		PID DUNHAM,		CAT F		HRS 0.2		PID		CAT		HRS	
DELAY				WUC 04A				TIPID ,				TI MANHOURS							
STATUS X		C CLOSED		SYS E		DATE 03 Aug 20		NO 1		TIME 00:01		PID Generated, Com		DATE 04 Aug 20		TIME 09:37		ACFT HRS 6012.1	
FAULTS/REMARKS INSP E220 EMERGENCY LOCATOR TRANSMITTER SELF-TEST (AS REQUIRED) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 6136.1 AIRCRAFT HOURS OR 02 AUG 2020 REFERENCE: AWR 1516 R12								ACTION TESTED											
ACFT HRS 6012.1		WHEN DISC O		HOW REC O		MAL EFF 1		PID Bartlett, C.		CAT F		HRS 0.3		PID		CAT		HRS	
DELAY				WUC 00				TIPID CHADBOURNE, SCOTT				TI MANHOURS 0.1							
STATUS X		C CLOSED		SYS E		DATE 04 Aug 20		NO 1		TIME 00:01		PID Generated, Com		DATE 04 Aug 20		TIME 09:36		ACFT HRS 6012.1	
FAULTS/REMARKS INSP E331 UNDER WATER ACOUSTIC BEACON TEST AND CLEAN FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 6475.2 AIRCRAFT HOURS OR 03 AUG 2020 REFERENCE: TM 1-1520-237-23_P								ACTION TESTED.											
ACFT HRS 6012.1		WHEN DISC O		HOW REC O		MAL EFF 1		PID Bartlett, C.		CAT F		HRS 0.5		PID		CAT		HRS	
DELAY				WUC 00				TIPID CHADBOURNE, SCOTT				TI MANHOURS 0.1							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 89				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 05 Aug 20	NO 1	TIME 12:08	PID Leone, Michael		DATE 05 Aug 20	TIME 12:12	ACFT HRS 6012.1						
FAULTS/REMARKS APU NITROGEN CHARGE LEVEL TO LOW								ACTION SERVICED APU ACCUMULATOR.								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								MEADE, D	F	0.3						
ACFT HRS 6012.1		WHEN DISC X		HOW REC G		MAL EFF 2										
DELAY				WUC 15B				TIPIID ,				TI MANHOURS				
STATUS —		SYS E	DATE 06 Aug 20	NO 1	TIME 00:01	PID Generated, Com		DATE 06 Aug 20	TIME 12:26	ACFT HRS 6012.1						
FAULTS/REMARKS INSP E351 REPLACE APX-118 TRANSPONDER BATTERY FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 11 SEP 2020 REFERENCE: TM 11-5895-1841-13P								ACTION REPLACED BATTERY								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								TARBOX, C	F	0.3						
ACFT HRS 6012.1		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS E	DATE 09 Aug 20	NO 1	TIME 00:01	PID Generated, Com		DATE 10 Aug 20	TIME 07:50	ACFT HRS 6012.1						
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 AUG 2020 REFERENCE: TM 11-5810-262-23								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 6012.1		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 90				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	E CLOSED	SYS A	DATE 10 Aug 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 11 Aug 20	TIME 08:23	ACFT HRS 6012.1						
								ROUNDS	ACTION CODE E	WUC 00						
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6056.1 AIRCRAFT HOURS OR 16 AUG 2020 REFERENCE: TM 1-1520-237-23&P								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								MEADE, D	F	0.5						
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	E CLOSED	SYS A	DATE 10 Aug 20	NO 2	TIME 00:01	PID Generated, Com		DATE 11 Aug 20	TIME 07:57	ACFT HRS 6012.1						
								ROUNDS	ACTION CODE E	WUC 00						
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 16 AUG 2020 REFERENCE: TM 1-1500-344-23								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								MEADE, D	F	0.5	EISENHAU	F	0.5			
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	E CLOSED	SYS A	DATE 10 Aug 20	NO 3	TIME 10:31	PID Generated, Com		DATE 10 Aug 20	TIME 12:30	ACFT HRS 6012.1						
								ROUNDS	ACTION CODE 3	WUC 00						
FAULTS/REMARKS PMD Due								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 91		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION				
STATUS —		SYS A	DATE 10 Aug 20	NO 4	TIME 10:32	PID Generated, Cor	DATE 10 Aug 20	TIME 10:48	ACFT HRS 6012.1	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ACTION complete				
ACFT HRS 6012.1		WHEN DISC X	HOW REC G	MAL EFF 1						
DELAY			WUC 00			TIPID ,		TI MANHOURS		
STATUS —		SYS A	DATE 10 Aug 20	NO 5	TIME 10:32	PID Generated, Com	DATE 10 Aug 20	TIME 12:29	ACFT HRS 6012.1	
FAULTS/REMARKS PMD DUE						ACTION complete				
ACFT HRS 6012.1		WHEN DISC O	HOW REC G	MAL EFF 2						
DELAY			WUC 00			TIPID ,		TI MANHOURS		
STATUS —		SYS A	DATE 10 Aug 20	NO 6	TIME 12:31	PID Generated, Com	DATE 10 Aug 20	TIME 12:31	ACFT HRS	
FAULTS/REMARKS PMD Due						ACTION COMPLETED				
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1						
DELAY			WUC 00			TIPID ,		TI MANHOURS		
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1						
DELAY			WUC 00			TIPID ,		TI MANHOURS		




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 92					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS /		SYS A	DATE 10 Aug 20	NO 7	TIME 14:03	PID Fraser, Connor		DATE 10 Aug 20	TIME 14:19	ACFT HRS 6012.1		ROUNDS		ACTION CODE A		WUC 02	
FAULTS/REMARKS worn turnlock receptical on trgb fairing								ACTION replaced turnlock receptical									
ACFT HRS 6012.1		WHEN DISC K		HOW REC G		MAL EFF 2		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 02		TIPID ,		TI MANHOURS		Fraser, C.		F	0.3						
STATUS —		SYS A	DATE 12 Aug 20	NO 1	TIME 00:00	PID Generated, Com		DATE 16 Aug 20	TIME 00:00	ACFT HRS 6012.1		ROUNDS		ACTION CODE		WUC 00	
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 AUG 2020 REFERENCE: TM 1-1520-237-23								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON AUG 16 2020 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT									
ACFT HRS 6012.1		WHEN DISC O		HOW REC O		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00		TIPID ,		TI MANHOURS											
STATUS —		SYS A	DATE 12 Aug 20	NO 2	TIME 00:00	PID Generated, Com		DATE 15 Aug 20	TIME 14:27	ACFT HRS 6012.1		ROUNDS		ACTION CODE G		WUC 02	
FAULTS/REMARKS INSP A100 LH/RH ENGINE HISTORY RECORDER READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 18 AUG 2020 REFERENCE: DA PAM 738-751								ACTION inspection complete									
ACFT HRS 6012.1		WHEN DISC O		HOW REC O		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00		TIPID ,		TI MANHOURS		MILLIKEN, F		0.5							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 93			
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION						
STATUS X		SYS A	DATE 16 Aug 20	NO 1	TIME 00:00	PID Generated, Cor	DATE 16 Aug 20	TIME 14:26	ACFT HRS 6012.1			
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 15 AUG 2020 REFERENCE: TM 1-1520-237-23						ACTION inspection complete						
ACFT HRS 6012.1						WHEN DISC O	HOW REC O	MAL EFF 1				
DELAY						WUC 00			TIPIID OILER, KENNETH			TI MANHOURS 0.2
STATUS —		SYS A	DATE 18 Aug 20	NO 1	TIME 00:00	PID Generated, Com	DATE 20 Aug 20	TIME 20:09	ACFT HRS 6012.1			
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 20 AUG 2020 REFERENCE: TM 1-1520-237-23&P						ACTION completed						
ACFT HRS 6012.1						WHEN DISC O	HOW REC O	MAL EFF 1				
DELAY						WUC 00			TIPIID ,			TI MANHOURS
STATUS —		SYS A	DATE 18 Aug 20	NO 2	TIME 13:04	PID Generated, Com	DATE 18 Aug 20	TIME 13:07	ACFT HRS 6012.1			
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ACTION inspection complete						
ACFT HRS 6012.1						WHEN DISC X	HOW REC G	MAL EFF 1				
DELAY						WUC 00			TIPIID ,			TI MANHOURS




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 94				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	 SYS A	DATE 18 Aug 20	NO 3	TIME 13:04	PID Generated, Cor			DATE 18 Aug 20	TIME 14:43	ACFT HRS						
		ROUNDS	ACTION CODE 3			WUC 00										
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								MILLIKEN,	F	2.0						
ACFT HRS 6012.1		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 SYS A	DATE 18 Aug 20	NO 4	TIME 13:04	PID Generated, Com			DATE 18 Aug 20	TIME 14:41	ACFT HRS 6012.1						
		ROUNDS	ACTION CODE 3			WUC 00										
FAULTS/REMARKS PMD DUE								ACTION pmd complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								MILLIKEN,	F	2.0						
ACFT HRS 6012.1		WHEN DISC O	HOW REC G	MAL EFF 2												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS X	 SYS A	DATE 18 Aug 20	NO 5	TIME 14:10	PID MILLIKEN, JEREM			DATE 18 Aug 20	TIME 14:13	ACFT HRS 6012.1						
		ROUNDS	ACTION CODE L			WUC 00										
FAULTS/REMARKS Removed KY58 RCU heads (2EA) for serial number verification.								ACTION Reinstalled.								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Leone, M.	F	0.2						
ACFT HRS 6012.1		WHEN DISC Z	HOW REC G	MAL EFF 2												
DELAY				WUC 00				TIPIID OILER, KENNETH				TI MANHOURS 0.2				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 95			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 20 Aug 20	NO 1	TIME 13:47	PID Generated, Cor			DATE 26 Aug 20	TIME 14:53	ACFT HRS 6017.2					
		WHEN DISC O	HOW REC O	MAL EFF 1	ROUNDS		ACTION CODE T		WUC 00						
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-AMAM-07 DESCRIPTION: COMPLY WITH H-60-20-AMAM-07, UPDATED ENGINE INLET BARRIER FILTER INSPECTION PROCEDURES, BY 14 FEB 21. IS DUE: 14 FEB 2021 CALENDAR								ACTION complied with							
ACFT HRS 6012.1		WHEN DISC O		HOW REC O		MAL EFF 1		PID DUNHAM,	CAT F	HRS 0.2	PID	CAT	HRS		
DELAY				WUC 00				TIPIID DUNHAM, NICHOLAS				TI MANHOURS 0.2			
STATUS /	 SYS A	DATE 20 Aug 20	NO 2	TIME 22:29	PID CHADBOURNE,			DATE 16 Dec 20	TIME 15:20	ACFT HRS 6061.3					
		WHEN DISC O	HOW REC G	MAL EFF 2	ROUNDS		ACTION CODE 6		WUC 00						
FAULTS/REMARKS IVHMS HIT CHECK UPPER LIMIT ON BOTH NUMBER 1 AND NUMBER 2 ENG SET -20* TO + 20*								ACTION HIT baseline re-entered							
ACFT HRS 6014		WHEN DISC G		HOW REC G		MAL EFF 2		PID CURTIS, A.	CAT F	HRS 0.2	PID	CAT	HRS		
DELAY monitor next flight, sign off if ok. ivhms				WUC 00				TIPIID ,				TI MANHOURS			
STATUS —	 SYS A	DATE 21 Aug 20	NO 1	TIME 11:14	PID Generated, Com			DATE 21 Aug 20	TIME 11:27	ACFT HRS 6014.0					
		WHEN DISC O	HOW REC G	MAL EFF 2	ROUNDS		ACTION CODE 3		WUC 00						
FAULTS/REMARKS PMD DUE								ACTION COMPLETED							
ACFT HRS 6014		WHEN DISC O		HOW REC G		MAL EFF 2		PID Bender, T.	CAT F	HRS 2.0	PID	CAT	HRS		
DELAY				WUC 00				TIPIID ,				TI MANHOURS			

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 96					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A		DATE 21 Aug 20		NO 2		TIME 11:27		PID Generated, Cor		DATE 21 Aug 20		TIME 11:28		ACFT HRS	
												ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS PMD Due								ACTION COMPLETED									
												PID		CAT		HRS	
												Bender, T.		F		2.0	
ACFT HRS 6014				WHEN DISC O		HOW REC O		MAL EFF 1									
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A		DATE 21 Aug 20		NO 3		TIME 12:18		PID Generated, Com		DATE 21 Aug 20		TIME 12:21		ACFT HRS 6014.0	
												ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION INSP COMPLETED									
												PID		CAT		HRS	
												Bender, T.		F		1.0	
ACFT HRS 6014				WHEN DISC X		HOW REC G		MAL EFF 1									
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A		DATE 24 Aug 20		NO 1		TIME 10:58		PID Generated, Com		DATE 24 Aug 20		TIME 13:52		ACFT HRS 6017.2	
												ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS PMD DUE								ACTION complete									
												PID		CAT		HRS	
												HIGGINS, F		F		1.0	
ACFT HRS 6017.2				WHEN DISC O		HOW REC G		MAL EFF 2									
DELAY				WUC 00				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 97		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION				
STATUS —		SYS A	DATE 24 Aug 20	NO 2	TIME 10:58	PID Generated, Cor	DATE 24 Aug 20	TIME 11:15	ACFT HRS 6017.2	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ACTION complete				
ACFT HRS 6017.2						WHEN DISC X	HOW REC G	MAL EFF 1		
DELAY						WUC 00		TIPIID ,		TI MANHOURS
STATUS —		SYS A	DATE 24 Aug 20	NO 3	TIME 13:49	PID Generated, Com	DATE 24 Aug 20	TIME 13:49	ACFT HRS	
FAULTS/REMARKS PMD Due						ACTION COMPLETED				
ACFT HRS 6017.2						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 00		TIPIID ,		TI MANHOURS
STATUS —		SYS E	DATE 25 Aug 20	NO 1	TIME 00:00	PID Generated, Com	DATE 15 Sep 20	TIME 08:26	ACFT HRS 6022.6	
FAULTS/REMARKS INSP E802 KY-100 BATTERY REPLACEMENT FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 30 SEP 2020 REFERENCE: TM 11-5810-398-10						ACTION swstem not used batt not installed				
ACFT HRS 6017.2						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 00		TIPIID ,		TI MANHOURS
ACFT HRS 6017.2						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 00		TIPIID ,		TI MANHOURS
ACFT HRS 6017.2						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 00		TIPIID ,		TI MANHOURS




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 98					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —	 SYS E	DATE 26 Aug 20	NO 1	TIME 00:00	PID Generated, Cor			DATE 02 Sep 20	TIME 00:01	ACFT HRS 6017.2							
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 01 SEP 2020 REFERENCE: TM 11-5821-357-12P								ROUNDS			ACTION CODE			WUC 00			
ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON SEP 2 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
ACFT HRS 6017.2								WHEN DISC O	HOW REC O	MAL EFF 1							
DELAY								WUC 00			TIPIID ,			TI MANHOURS			
STATUS —	 SYS A	DATE 26 Aug 20	NO 1	TIME 00:00	PID Generated, Com			DATE 02 Sep 20	TIME 00:01	ACFT HRS 6017.2							
FAULTS/REMARKS INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 01 SEP 2020 REFERENCE: TM 11-6140-203-23 P								ROUNDS			ACTION CODE			WUC 00			
ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON SEP 2 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
ACFT HRS 6017.2								WHEN DISC O	HOW REC O	MAL EFF 1							
DELAY								WUC 00			TIPIID ,			TI MANHOURS			
STATUS —	 SYS A	DATE 26 Aug 20	NO 2	TIME 14:33	PID Generated, Com			DATE 16 Sep 20	TIME 15:54	ACFT HRS 6022.6							
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-AMAM-09 DESCRIPTION: ATTITUDE HEADING REFERENCE UNIT (AHRU) REPLACEMENT. IS DUE: 24 SEP 2020 CALENDAR								ROUNDS			ACTION CODE F			WUC 19E06A			
ACTION NOT APPLICABLE WITH THIS MDS								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
ACFT HRS 6017.2								WHEN DISC O	HOW REC O	MAL EFF 1							
DELAY								WUC 00			TIPIID HICKEY, LOUIS			TI MANHOURS 0.1			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 99						
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION										
STATUS —		SYS A	DATE 28 Aug 20	NO 1	TIME 00:00	PID Generated, Cor		DATE 15 Sep 20	TIME 09:41	ACFT HRS 6022.6								
FAULTS/REMARKS INSP A177 90 DAY REVIEW/UPDATE OF 365-4 ENTRIES FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 SEP 2020 REFERENCE: AR 95-1								ACTION Completed					ROUNDS			ACTION CODE G		WUC 00
ACFT HRS 6017.2		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00						TIPIID ,			TI MANHOURS							
STATUS —		SYS O	DATE 28 Aug 20	NO 1	TIME 00:00	PID Generated, Com		DATE 04 Sep 20	TIME 00:01	ACFT HRS 6022.6								
FAULTS/REMARKS INSP O801 128D DAFIF AND WAYPOINT UPDATE REQUIRED FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 SEP 2020 REFERENCE: AASF SOP								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON SEP 4 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT										
ACFT HRS 6017.2		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00						TIPIID ,			TI MANHOURS							
STATUS —		SYS A	DATE 29 Aug 20	NO 1	TIME 00:00	PID Generated, Com		DATE 23 Oct 20	TIME 11:35	ACFT HRS 6039.6								
FAULTS/REMARKS INSP A533 PITOT STATIC SYSTEM INSPECTION FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 28 OCT 2020 REFERENCE: TM 1-1520-237-23&P								ACTION INSPECTION OK										
ACFT HRS 6017.2		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00						TIPIID ,			TI MANHOURS							
ACFT HRS 6017.2		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00						TIPIID ,			TI MANHOURS							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 100				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —		SYS E	DATE 31 Aug 20	NO 1	TIME 00:00	PID Generated, Cor		DATE 04 Sep 20	TIME 13:54	ACFT HRS 6022.6						
FAULTS/REMARKS INSP E220 EMERGENCY LOCATOR TRANSMITTER SELF-TEST (AS REQUIRED) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 SEP 2020 OR 6137.1 AIRCRAFT HOURS REFERENCE: AWR 1516 R12								ROUNDS			ACTION CODE G			WUC 00		
ACTION INSP OK																
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bender, T.	F	0.3						
ACFT HRS 6017.2		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 01 Sep 20	NO 1	TIME 00:00	PID Generated, Com		DATE 03 Sep 20	TIME 10:30	ACFT HRS 6021.0						
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 SEP 2020 REFERENCE: TM 1-1520-237-23&P								ROUNDS			ACTION CODE 6			WUC 00		
ACTION Engine runs and flight completed																
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								RAYCHARD	F	0.2	ROXBY, M.	F	0.2			
ACFT HRS 6017.2		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 01 Sep 20	NO 2	TIME 09:11	PID Generated, Com		DATE 02 Sep 20	TIME 09:32	ACFT HRS 6017.2						
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-09 DESCRIPTION: COMPLY WITH H-60-20-ASAM-09 NON-CONFORMING TAIL ROTOR PUSHROD CLEVIS ROD END, BY 06 SEPT 20. IS DUE: 06 SEP 2020 CALENDAR								ROUNDS			ACTION CODE 6			WUC 00		
ACTION COMPLIED WITH																
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								HIGGINS, F	F	0.2						
ACFT HRS 6017.2		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 101		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION					
STATUS —	 SYS A	DATE 01 Sep 20	NO 3	TIME 10:28	PID Generated, Cor	DATE 01 Sep 20	TIME 12:26	ACFT HRS			
		ROUNDS	ACTION CODE 3		WUC 00						
FAULTS/REMARKS PMD Due						ACTION COMPLETED					
						PID	CAT	HRS	PID	CAT	HRS
						MCGRAW,	F	2.0			
ACFT HRS 6017.2		WHEN DISC O	HOW REC O	MAL EFF 1							
DELAY			WUC 00			TIPIID ,			TI MANHOURS		
STATUS —	 SYS A	DATE 01 Sep 20	NO 4	TIME 10:29	PID Generated, Com	DATE 01 Sep 20	TIME 11:00	ACFT HRS 6017.2			
		ROUNDS	ACTION CODE G		WUC 00						
FAULTS/REMARKS PMD DUE						ACTION complete					
						PID	CAT	HRS	PID	CAT	HRS
						MCGRAW,	F	2.0	Gonzalez,	F	2.0
ACFT HRS 6017.2		WHEN DISC O	HOW REC G	MAL EFF 2							
DELAY			WUC 00			TIPIID ,			TI MANHOURS		
STATUS —	 SYS A	DATE 01 Sep 20	NO 5	TIME 10:29	PID Generated, Com	DATE 01 Sep 20	TIME 12:24	ACFT HRS 6017.2			
		ROUNDS	ACTION CODE G		WUC 02						
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ACTION complete					
						PID	CAT	HRS	PID	CAT	HRS
						Gonzalez,	F	2.0	MCGRAW,	F	2.0
ACFT HRS 6017.2		WHEN DISC X	HOW REC G	MAL EFF 1							
DELAY			WUC 00			TIPIID ,			TI MANHOURS		




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 102				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 01 Sep 20	NO 6	TIME 12:31	PID MCGRAW, ALEX		DATE 01 Sep 20	TIME 12:33	ACFT HRS 6017.2						
FAULTS/REMARKS tail wheel requires servicing								ACTION serviced to 120 psi								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								MCGRAW,	F	0.4	Gonzalez, F	F	0.4			
ACFT HRS 6017.2		WHEN DISC X		HOW REC G		MAL EFF 1										
DELAY				WUC 03B03				TIPIID ,				TI MANHOURS				
STATUS X		SYS A	DATE 02 Sep 20	NO 1	TIME 00:01	PID Generated, Com		DATE 02 Sep 20	TIME 10:05	ACFT HRS 6017.2						
FAULTS/REMARKS INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 01 SEP 2020 REFERENCE: TM 11-6140-203-23 P								ACTION COMPLETE								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								MCGRAW,	F	0.2						
ACFT HRS 6017.2		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID WILLIAMS, NEIL				TI MANHOURS 0.1				
STATUS X		SYS E	DATE 02 Sep 20	NO 1	TIME 00:01	PID Generated, Com		DATE 04 Sep 20	TIME 13:55	ACFT HRS 6022.6						
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 01 SEP 2020 REFERENCE: TM 11-5821-357-12P								ACTION INSP OK								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bender, T.	F	0.3						
ACFT HRS 6017.2		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 103				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 03 Sep 20	NO 1	TIME 15:49	PID ROXBY, MICHEL		DATE 16 Dec 20	TIME 15:24	ACFT HRS 6061.3						
FAULTS/REMARKS During hit check on #1 Eng, indicated TGT was displayed as 595 by IVHMS. Actual TGT was 638. IVHMS displayed the hit check as a fail, but manual hit check passed. #2 Eng TGT was accurate.								ACTION Re-flashed RDC and updated software. TGT displays accurately on IVHMs.								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								TARBOX, C	F	2.0						
ACFT HRS 6021		WHEN DISC T		HOW REC G		MAL EFF 4										
DELAY uatc12000049				WUC 08F01				TIPIID ,				TI MANHOURS				
STATUS -		SYS A	DATE 03 Sep 20	NO 2	TIME 21:14	PID Generated, Com		DATE 15 Sep 20	TIME 09:54	ACFT HRS 6022.6						
FAULTS/REMARKS INSP A801 PERFORM 40 HOUR VISUAL INSPECTION AS REQUIRED BY AWR 1939 (M-4) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6029.9 AIRCRAFT HOURS REFERENCE: AWR 1939 (M-4)								ACTION insp. ok								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.2						
ACFT HRS 6022.6		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS /		SYS A	DATE 03 Sep 20	NO 3	TIME 21:15	PID DUFFY, JOSHUA		DATE 17 Sep 20	TIME 18:48	ACFT HRS 6024.6						
FAULTS/REMARKS AIRCRAFT REQUIRES FUEL								ACTION AIRCRAFT FUELED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Black, A.	F	0.3						
ACFT HRS 6022.6		WHEN DISC G		HOW REC G		MAL EFF 2										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 104			
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION						
STATUS X		SYS O	DATE 04 Sep 20	NO 1	TIME 00:01	PID Generated, Cor	DATE 17 Sep 20	TIME 18:49	ACFT HRS 6024.6			
FAULTS/REMARKS INSP O801 128D DAFIF AND WAYPOINT UPDATE REQUIRED FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 03 SEP 2020 REFERENCE: AASF SOP						ACTION DAFFIF AND WAYPOINTS UPDATED						
ACFT HRS 6022.6						WHEN DISC O	HOW REC O	MAL EFF 1				
DELAY						WUC 00			TIPIID GATHRIGHT, ANTHONY			TI MANHOURS 0.1
STATUS —		SYS A	DATE 04 Sep 20	NO 1	TIME 11:19	PID Generated, Com	DATE 04 Sep 20	TIME 13:51	ACFT HRS 6022.6			
FAULTS/REMARKS PMD DUE						ACTION COMPLETED						
ACFT HRS 6022.6						WHEN DISC O	HOW REC G	MAL EFF 2				
DELAY						WUC 00			TIPIID ,			TI MANHOURS
STATUS —		SYS A	DATE 04 Sep 20	NO 2	TIME 11:20	PID Generated, Com	DATE 04 Sep 20	TIME 11:24	ACFT HRS 6022.6			
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ACTION INSPECTION COMPLETE						
ACFT HRS 6022.6						WHEN DISC X	HOW REC G	MAL EFF 1				
DELAY						WUC 00			TIPIID ,			TI MANHOURS




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 105																					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION																									
STATUS /		SYS A	DATE 04 Sep 20	NO 3	TIME 12:27	PID Bender, Thomas		DATE 04 Sep 20	TIME 12:30	ACFT HRS 6022.6		ROUNDS		ACTION CODE A		WUC 02B02E																	
FAULTS/REMARKS R/H INBOARD CARGO DOOR HANDLE WILL NOT OPEN DOOR								ACTION REPLACED INNER DOOR HANDLE, MOC OK																									
								<table border="1"> <thead> <tr> <th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th> </tr> </thead> <tbody> <tr> <td>Bender, T.</td><td>F</td><td>1.0</td><td></td><td></td><td></td><td></td><td></td><td></td> </tr> </tbody> </table>								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	Bender, T.	F	1.0						
PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS																									
Bender, T.	F	1.0																															
ACFT HRS 6022.6		WHEN DISC B		HOW REC G		MAL EFF 1																											
DELAY				WUC 02B02E				TIPIID ,				TI MANHOURS																					
STATUS —		SYS E	DATE 08 Sep 20	NO 1	TIME 00:01	PID Generated, Com		DATE 15 Sep 20	TIME 00:01	ACFT HRS 6022.6		ROUNDS		ACTION CODE		WUC 00																	
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 14 SEP 2020 REFERENCE: TM 11-5810-262-23								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON SEP 15 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT																									
								<table border="1"> <thead> <tr> <th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th> </tr> </thead> <tbody> <tr> <td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td> </tr> </tbody> </table>								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS									
PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS																									
ACFT HRS 6022.6		WHEN DISC O		HOW REC O		MAL EFF 1																											
DELAY				WUC 00				TIPIID ,				TI MANHOURS																					
STATUS —		SYS A	DATE 08 Sep 20	NO 1	TIME 08:11	PID Generated, Com		DATE 08 Sep 20	TIME 08:12	ACFT HRS		ROUNDS		ACTION CODE 3		WUC 00																	
FAULTS/REMARKS PMD Due								ACTION COMPLETED																									
								<table border="1"> <thead> <tr> <th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th><th>PID</th><th>CAT</th><th>HRS</th> </tr> </thead> <tbody> <tr> <td>Bender, T.</td><td>F</td><td>2.0</td><td></td><td></td><td></td><td></td><td></td><td></td> </tr> </tbody> </table>								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	Bender, T.	F	2.0						
PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS																									
Bender, T.	F	2.0																															
ACFT HRS 6022.6		WHEN DISC O		HOW REC O		MAL EFF 1																											
DELAY				WUC 00				TIPIID ,				TI MANHOURS																					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 106			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 09 Sep 20	NO 1	TIME 00:01	PID Generated, Cor			DATE 15 Sep 20	TIME 09:54	ACFT HRS 6022.6					
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 SEP 2020 OR 6056.1 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-23&P								ROUNDS	ACTION CODE 5		WUC 00				
ACFT HRS 6022.6								WHEN DISC	O	HOW REC	O	MAL EFF		1	
DELAY				WUC 00				TIPID ,				TI MANHOURS			
STATUS —	 SYS A	DATE 09 Sep 20	NO 2	TIME 00:01	PID Generated, Com			DATE 15 Sep 20	TIME 09:53	ACFT HRS 6022.6					
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 SEP 2020 REFERENCE: TM 1-1500-344-23								ROUNDS	ACTION CODE 5		WUC 00				
ACFT HRS 6022.6								WHEN DISC	O	HOW REC	O	MAL EFF		1	
DELAY				WUC 00				TIPID ,				TI MANHOURS			
STATUS —	 SYS A	DATE 11 Sep 20	NO 1	TIME 00:01	PID Generated, Com			DATE 16 Sep 20	TIME 09:53	ACFT HRS 6022.6					
FAULTS/REMARKS INSP A100 LH/RH ENGINE HISTORY RECORDER READINGS DUE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 17 SEP 2020 REFERENCE: DA PAM 738-751								ROUNDS	ACTION CODE E		WUC 00				
ACFT HRS 6022.6								WHEN DISC	O	HOW REC	O	MAL EFF		1	
DELAY				WUC 00				TIPID ,				TI MANHOURS			
ACFT HRS 6022.6								WHEN DISC	O	HOW REC	O	MAL EFF		1	
DELAY				WUC 00				TIPID ,				TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 107				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —		SYS A	DATE 12 Sep 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 16 Sep 20	TIME 00:01	ACFT HRS 6022.6		ROUNDS		ACTION CODE		WUC 00
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 SEP 2020 REFERENCE: TM 1-1520-237-23								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON SEP 16 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
ACFT HRS 6022.6		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 15 Sep 20	NO 1	TIME 00:01	PID Generated, Com		DATE 17 Sep 20	TIME 18:47	ACFT HRS 6024.6		ROUNDS		ACTION CODE G		WUC 00
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 17 SEP 2020 REFERENCE: TM 1-1520-237-23&P								ACTION INSP OK								
ACFT HRS 6022.6		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS X		SYS E	DATE 15 Sep 20	NO 1	TIME 00:01	PID Generated, Com		DATE 15 Sep 20	TIME 08:48	ACFT HRS 6022.6		ROUNDS		ACTION CODE 6		WUC 00
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 14 SEP 2020 REFERENCE: TM 11-5810-262-23								ACTION INSPECTION COMPLETE								
ACFT HRS 6022.6		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 108							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —		SYS A		DATE 15 Sep 20		NO 2		TIME 08:17		PID Generated, Cor		DATE 15 Sep 20		TIME 08:33		ACFT HRS 6022.6			
												ROUNDS		ACTION CODE 3		WUC 00			
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.										ACTION insp. ok									
ACFT HRS 6022.6		WHEN DISC X		HOW REC G		MAL EFF 1		PID Belyeu, C.		CAT F		HRS 0.2		PID		CAT		HRS	
DELAY				WUC 00				TIPID ,				TI MANHOURS							
STATUS —		SYS A		DATE 15 Sep 20		NO 3		TIME 08:17		PID Generated, Com		DATE 15 Sep 20		TIME 08:45		ACFT HRS 6022.6			
												ROUNDS		ACTION CODE 3		WUC 00			
FAULTS/REMARKS PMD DUE										ACTION COMPLETE									
ACFT HRS 6022.6		WHEN DISC O		HOW REC G		MAL EFF 2		PID JACKSON,		CAT F		HRS 0.5		PID MILLIKEN,		CAT F		HRS 0.5	
DELAY				WUC 00				TIPID ,				TI MANHOURS							
STATUS —		SYS A		DATE 15 Sep 20		NO 4		TIME 10:09		PID Generated, Com		DATE 15 Sep 20		TIME 10:09		ACFT HRS			
												ROUNDS		ACTION CODE 3		WUC 00			
FAULTS/REMARKS PMD Due										ACTION COMPLETED									
ACFT HRS 6022.6		WHEN DISC O		HOW REC O		MAL EFF 1		PID Belyeu, C.		CAT F		HRS 1.0		PID		CAT		HRS	
DELAY				WUC 00				TIPID ,				TI MANHOURS							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 109							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS X		SYS A	DATE 16 Sep 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 16 Sep 20	TIME 09:51	ACFT HRS 6022.6		ROUNDS		ACTION CODE E		WUC 00			
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 15 SEP 2020 REFERENCE: TM 1-1520-237-23								ACTION hrs 671, events 4213											
ACFT HRS 6022.6		WHEN DISC O	HOW REC O	MAL EFF 1		PID DUFFY, J.		CAT F	HRS 0.1	PID		CAT	HRS		PID		CAT	HRS	
DELAY				WUC 00				TIPIID EISENHAUER, JEFFREY				TI MANHOURS 0.1							
STATUS X		SYS A	DATE 17 Sep 20	NO 1	TIME 22:27	PID Black, Alex		DATE 18 Sep 20	TIME 07:47	ACFT HRS 6026.3		ROUNDS		ACTION CODE G		WUC 00			
FAULTS/REMARKS BIRD STRIKE								ACTION inspected a/c, no fod or damage found											
ACFT HRS 6026.3		WHEN DISC B	HOW REC G	MAL EFF 1		PID Belyeu, C.		CAT F	HRS 0.3	PID		CAT	HRS		PID		CAT	HRS	
DELAY				UPPER SIDE OF COPLOTS WINDSHIELD, WUC 00				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1							
STATUS —		SYS A	DATE 18 Sep 20	NO 1	TIME 07:27	PID Generated, Com		DATE 18 Sep 20	TIME 08:03	ACFT HRS 6026.3		ROUNDS		ACTION CODE 3		WUC 00			
FAULTS/REMARKS PMD Due								ACTION complete											
ACFT HRS 6026.3		WHEN DISC O	HOW REC O	MAL EFF 1		PID Vaillancourt		CAT F	HRS 0.8	PID Belyeu, C.		CAT F	HRS 0.8	PID EISENHAU		CAT F	HRS 0.8		
DELAY				WUC 00				TIPIID ,				TI MANHOURS							

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 110							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —		E CLOSED		SYS A		DATE 18 Sep 20		NO 2		TIME 07:28		PID Generated, Cor		DATE 18 Sep 20		TIME 08:02		ACFT HRS 6026.3	
FAULTS/REMARKS PMD DUE								ACTION complete											
ACFT HRS 6026.3		WHEN DISC O		HOW REC G		MAL EFF 2		PID Belyeu, C.		CAT F		HRS 0.3		PID		CAT		HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS —		E CLOSED		SYS A		DATE 18 Sep 20		NO 3		TIME 07:28		PID Generated, Com		DATE 18 Sep 20		TIME 07:44		ACFT HRS 6026.3	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION complete											
ACFT HRS 6026.3		WHEN DISC X		HOW REC G		MAL EFF 1		PID EISENHAU		CAT F		HRS 0.1		PID		CAT		HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS —		E CLOSED		SYS A		DATE 18 Sep 20		NO 4		TIME 07:30		PID Generated, Com		DATE 18 Sep 20		TIME 07:30		ACFT HRS 6026.3	
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 18 SEP 2020. INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 01 OCT 2020 REFERENCE: TM 1-1520-237-23&P								ACTION complete											
ACFT HRS 6026.3		WHEN DISC O		HOW REC O		MAL EFF 1		PID EISENHAU		CAT F		HRS 0.1		PID		CAT		HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 111							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —		SYS A	DATE 18 Sep 20	NO 5	TIME 07:30	PID Generated, Cor		DATE 18 Sep 20	TIME 07:31	ACFT HRS 6026.3									
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 18 SEP 2020. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6033.6 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ACTION complete					ROUNDS			ACTION CODE G		WUC 00	
ACFT HRS 6026.3				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPID ,				TI MANHOURS							
STATUS —		SYS A	DATE 18 Sep 20	NO 6	TIME 08:43	PID Generated, Com		DATE 18 Sep 20	TIME 08:44	ACFT HRS									
FAULTS/REMARKS PMD Due								ACTION COMPLETED					ROUNDS			ACTION CODE 3		WUC 00	
ACFT HRS 6026.3				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPID ,				TI MANHOURS							
STATUS —		SYS A	DATE 24 Sep 20	NO 1	TIME 12:54	PID Generated, Com		DATE 24 Sep 20	TIME 21:09	ACFT HRS 6026.3									
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-AMAM-10 DESCRIPTION: EXTERNAL/ INTERNAL HOIST AND PENDANT CONTROL DA FORM 2410 TRACKING. IS DUE: 22 OCT 2020 CALENDAR								ACTION COMPLIED WITH					ROUNDS			ACTION CODE G		WUC 14	
ACFT HRS 6026.3				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPID HICKEY, LOUIS				TI MANHOURS 0.1							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 112		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION				
STATUS —	 SYS A	DATE 26 Sep 20	NO 1	TIME 08:00	PID Generated, Cor	DATE 26 Sep 20	TIME 09:14	ACFT HRS		
FAULTS/REMARKS PMD Due						ROUNDS	ACTION CODE 3	WUC 00		
						ACTION COMPLETED				
						PID MILLIKEN,	CAT F	HRS 2.0	PID	CAT
ACFT HRS 6029.9	WHEN DISC O	HOW REC O	MAL EFF 1							
DELAY			WUC 00			TIPIID ,		TI MANHOURS		
STATUS —	 SYS A	DATE 26 Sep 20	NO 2	TIME 08:00	PID Generated, Com	DATE 26 Sep 20	TIME 08:02	ACFT HRS 6029.9		
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ROUNDS	ACTION CODE 3	WUC 00		
						ACTION inspect ok				
						PID MILLIKEN,	CAT F	HRS 0.1	PID	CAT
ACFT HRS 6029.9	WHEN DISC X	HOW REC G	MAL EFF 1							
DELAY			WUC 00			TIPIID ,		TI MANHOURS		
STATUS —	 SYS A	DATE 26 Sep 20	NO 3	TIME 08:00	PID Generated, Com	DATE 26 Sep 20	TIME 09:12	ACFT HRS 6029.9		
FAULTS/REMARKS PMD DUE						ROUNDS	ACTION CODE 3	WUC 00		
						ACTION inspection complete				
						PID MILLIKEN,	CAT F	HRS 1.0	PID CEPELAK, C	CAT F
ACFT HRS 6029.9	WHEN DISC O	HOW REC G	MAL EFF 2							
DELAY			WUC 00			TIPIID ,		TI MANHOURS		

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 113			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS X	G CLOSED	SYS A	DATE 26 Sep 20	NO 4	TIME 11:35	PID MILLIKEN, JEREI		DATE 29 Sep 20	TIME 14:07	ACFT HRS 6029.9					
							ROUNDS	ACTION CODE C		WUC 06A					
FAULTS/REMARKS gouge on main mod behind oil level dip stick								ACTION repaired							
ACFT HRS 6029.9		WHEN DISC X	HOW REC G	MAL EFF 1				PID MILLIKEN,	CAT F	HRS 6.0	PID	CAT	HRS		
DELAY				WUC 06A				TIPIID GATHRIGHT, ANTHONY			TI MANHOURS 0.1				
STATUS X	G CLOSED	SYS A	DATE 28 Sep 20	NO 1	TIME 00:00	PID Generated, Com		DATE 01 Oct 20	TIME 14:44	ACFT HRS 6029.9					
							ROUNDS	ACTION CODE A		WUC 00					
FAULTS/REMARKS INSP A638 RESERVE FIRE BOTTLE #2, CARTRIDGE DODIC MH92 FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 27 SEP 2020 REFERENCE: TB 9-1300-385 CHG 22								ACTION REPLACED WITH S/N 027147							
ACFT HRS 6029.9		WHEN DISC O	HOW REC O	MAL EFF 1				PID HIGGINS, F	CAT F	HRS 2.0	PID	CAT	HRS		
DELAY				WUC 00				TIPIID GATHRIGHT, ANTHONY			TI MANHOURS 0.1				
STATUS X	G CLOSED	SYS A	DATE 28 Sep 20	NO 2	TIME 00:00	PID Generated, Com		DATE 01 Oct 20	TIME 14:43	ACFT HRS 6029.9					
							ROUNDS	ACTION CODE A		WUC 00					
FAULTS/REMARKS INSP A633 RESERVE FIRE BOTTLE #1, CARTRIDGE, DODIC MH92 FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 27 SEP 2020 REFERENCE: TB 9-1300-385 CHG 22								ACTION REPLACED WITH S/N 027131							
ACFT HRS 6029.9		WHEN DISC O	HOW REC O	MAL EFF 1				PID HIGGINS, F	CAT F	HRS 2.0	PID	CAT	HRS		
DELAY				WUC 00				TIPIID GATHRIGHT, ANTHONY			TI MANHOURS 0.1				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 114				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 29 Sep 20	NO 1	TIME 14:08	PID MILLIKEN, JEREI		DATE 01 Oct 20	TIME 14:32	ACFT HRS 6029.9						
FAULTS/REMARKS groove worn in aft right hand breather port on main mod								ACTION REPAIRED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								HIGGINS, P	F	6.0						
ACFT HRS 6029.9		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 06A				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				
STATUS X		SYS A	DATE 29 Sep 20	NO 2	TIME 16:48	PID HIGGINS, PHILIP		DATE 01 Oct 20	TIME 14:34	ACFT HRS 6029.9						
FAULTS/REMARKS ACFT GROUNDED UNTIL CLEARED FOR MISSING TOOL								ACTION ACFT CLEARED TOOL RECOVERED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								HIGGINS, P	F	0.2						
ACFT HRS 6029.9		WHEN DISC X	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID CHADBOURNE, SCOTT				TI MANHOURS 0.1				
STATUS —		SYS E	DATE 30 Sep 20	NO 1	TIME 00:00	PID Generated, Com		DATE 05 Oct 20	TIME 12:27	ACFT HRS 6035.4						
FAULTS/REMARKS INSP E220 EMERGENCY LOCATOR TRANSMITTER SELF-TEST (AS REQUIRED) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 OCT 2020 OR 6147.6 AIRCRAFT HOURS REFERENCE: AWR 1516 R12								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 6029.9		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 115				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —		SYS A	DATE 30 Sep 20	NO 1	TIME 00:00	PID Generated, Cor		DATE 03 Oct 20	TIME 09:05	ACFT HRS 6032.0						
FAULTS/REMARKS INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 OCT 2020 REFERENCE: TM 11-6140-203-23 P								ACTION insp ok								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CEPELAK,	F	0.1						
ACFT HRS 6029.9		WHEN DISC	O	HOW REC	O	MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS X		SYS A	DATE 30 Sep 20	NO 2	TIME 00:00	PID Generated, Com		DATE 01 Oct 20	TIME 14:42	ACFT HRS 6029.9						
FAULTS/REMARKS ACTUATED DEVICE SERVICE LIFE EXCEEDED ON 30 SEP 2020 FOR CTG AIRCRAFT FIRE EXT CAGE: 30003 PN: 1512AS105 SN: 312 LOT NUMBER: ESD08E020-001								ACTION REPLACED 29 SEPT 2020								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								HIGGINS,	F	0.2						
ACFT HRS 6029.9		WHEN DISC	O	HOW REC	O	MAL EFF 1										
DELAY				WUC MH92				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				
STATUS X		SYS A	DATE 30 Sep 20	NO 3	TIME 00:00	PID Generated, Com		DATE 01 Oct 20	TIME 14:36	ACFT HRS 6029.9						
FAULTS/REMARKS ACTUATED DEVICE SERVICE LIFE EXCEEDED ON 30 SEP 2020 FOR CTG AIRCRAFT FIRE EXT CAGE: 30003 PN: 1512AS105 SN: 313 LOT NUMBER: ESD08E020-001								ACTION REPLACED SEE RELATED 2408-13-1 FOR RELATED MAINT								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								HIGGINS,	F	0.2						
ACFT HRS 6029.9		WHEN DISC	O	HOW REC	O	MAL EFF 1										
DELAY				WUC MH92				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 116				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	E CLOSED	SYS E	DATE 01 Oct 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 05 Oct 20	TIME 12:35	ACFT HRS 6035.4						
							ROUNDS	ACTION CODE G		WUC 00						
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 07 OCT 2020 REFERENCE: TM 11-5821-357-12P								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Vaillancou	F	0.1						
ACFT HRS 6029.9		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	H CLOSED	SYS A	DATE 01 Oct 20	NO 1	TIME 14:22	PID HIGGINS, PHILIP		DATE 01 Oct 20	TIME 14:44	ACFT HRS 6029.9						
							ROUNDS	ACTION CODE 5		WUC 00						
FAULTS/REMARKS MOC REQ OF FIRE EXTINGUISHING SYSTEM DUE TO REPLACEMENT OF RESERVE CARTRIDGES								ACTION MOC OK								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								HIGGINS, P	F	0.2						
ACFT HRS 6029.9		WHEN DISC X	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	B CLOSED	SYS A	DATE 03 Oct 20	NO 1	TIME 00:01	PID Generated, Com		DATE 14 Oct 20	TIME 12:45	ACFT HRS 6035.4						
							ROUNDS	ACTION CODE I		WUC 00						
FAULTS/REMARKS INSP A160 90 DAY CORROSION INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 21 OCT 2020 REFERENCE: TM 1-1520-237-23&P								ACTION insp completed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	2.0						
ACFT HRS 6032		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 117							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —		SYS A	DATE 03 Oct 20	NO 2	TIME 07:55	PID Generated, Cor		DATE 03 Oct 20	TIME 07:55	ACFT HRS		ROUNDS		ACTION CODE 3		WUC 00			
FAULTS/REMARKS PMD Due								ACTION COMPLETED											
ACFT HRS 6032								WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS	
DELAY								WUC 00				TIPIID ,				TI MANHOURS			
STATUS —		SYS A	DATE 03 Oct 20	NO 3	TIME 07:58	PID Generated, Com		DATE 03 Oct 20	TIME 08:13	ACFT HRS 6032.0		ROUNDS		ACTION CODE 6		WUC 00			
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION INSP COMPLT											
ACFT HRS 6032								WHEN DISC X	HOW REC G	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS	
DELAY								WUC 00				TIPIID ,				TI MANHOURS			
STATUS —		SYS A	DATE 03 Oct 20	NO 4	TIME 07:59	PID Generated, Com		DATE 03 Oct 20	TIME 08:14	ACFT HRS 6032.0		ROUNDS		ACTION CODE 3		WUC 00			
FAULTS/REMARKS PMD DUE								ACTION INSP COMPLT											
ACFT HRS 6032								WHEN DISC O	HOW REC G	MAL EFF 2		PID		CAT	HRS	PID	CAT	HRS	
DELAY								WUC 00				TIPIID ,				TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 118							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —		SYS A	DATE 03 Oct 20	NO 5	TIME 08:02	PID Generated, Cor		DATE 03 Oct 20	TIME 08:03	ACFT HRS 6032.0									
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 03 OCT 2020. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6040.9 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ACTION INSP COMPLT						ROUNDS		ACTION CODE 3		WUC 00	
ACFT HRS 6032								WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS	
DELAY								WUC 00		TIPIID ,				TI MANHOURS					
STATUS —		SYS A	DATE 04 Oct 20	NO 2	TIME 15:55	PID Generated, Com		DATE 06 Oct 20	TIME 10:22	ACFT HRS 6035.4									
FAULTS/REMARKS INSP A110 PMS 40 HOUR INSPECTION FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6038.8 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMS								ACTION complete						ROUNDS		ACTION CODE 3		WUC 00	
ACFT HRS 6035.4								WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS	
DELAY								WUC 00		TIPIID ,				TI MANHOURS					
STATUS /		SYS A	DATE 04 Oct 20	NO 3	TIME 15:56	PID Mower, Hope		DATE 06 Oct 20	TIME 12:41	ACFT HRS 6035.4									
FAULTS/REMARKS PILOT AND CO-PILOT WINDSHIELD ANTI-ICE INOP.								ACTION DUPLICATED FAULT. FURTHER TROUBLESHOOTING REQUIRED DURING EXTENDED DOWN TIME. SEE BELOW FOR NEW 13-1.						ROUNDS		ACTION CODE J		WUC 12A08	
ACFT HRS 6035.4								WHEN DISC G	HOW REC K	MAL EFF 2		PID		CAT	HRS	PID	CAT	HRS	
DELAY								WUC 00		TIPIID ,				TI MANHOURS					

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 119					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —	E Closed	SYS A	DATE 05 Oct 20	NO 1	TIME 12:19	PID Generated, Cor		DATE 05 Oct 20	TIME 13:00	ACFT HRS 6035.4		ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS PMD Due								ACTION complete									
ACFT HRS 6035.4		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00						TIPIID ,				TI MANHOURS					
STATUS —	E Closed	SYS A	DATE 05 Oct 20	NO 2	TIME 12:19	PID Generated, Com		DATE 05 Oct 20	TIME 12:20	ACFT HRS 6035.4		ROUNDS		ACTION CODE E		WUC 00	
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 05 OCT 2020. INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 17 OCT 2020 REFERENCE: TM 1-1520-237-23&P								ACTION complete									
ACFT HRS 6035.4		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00						TIPIID ,				TI MANHOURS					
STATUS —	E Closed	SYS A	DATE 05 Oct 20	NO 3	TIME 12:19	PID Generated, Com		DATE 05 Oct 20	TIME 12:19	ACFT HRS 6035.4		ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 05 OCT 2020. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6043.0 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ACTION complete									
ACFT HRS 6035.4		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00						TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 120			
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION					
STATUS —		SYS A	DATE 05 Oct 20	NO 4	TIME 12:23	PID Generated, Cor		DATE 05 Oct 20	TIME 12:59	ACFT HRS 6035.4	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ACTION complete					
ACFT HRS 6035.4		WHEN DISC X	HOW REC G	MAL EFF 1		PID EISENHAU	CAT F	HRS 1.0	PID	CAT	HRS
DELAY		WUC 00			TIPIID ,			TI MANHOURS			
STATUS —		SYS A	DATE 05 Oct 20	NO 5	TIME 12:23	PID Generated, Com		DATE 05 Oct 20	TIME 12:52	ACFT HRS 6035.4	
FAULTS/REMARKS PMD DUE						ACTION complete					
ACFT HRS 6035.4		WHEN DISC O	HOW REC G	MAL EFF 2		PID EISENHAU	CAT F	HRS 1.0	Vaillancour	F	1.0
DELAY		WUC 00			TIPIID ,			TI MANHOURS			
STATUS /		SYS A	DATE 05 Oct 20	NO 6	TIME 12:23	PID EISENHAUER, JE		DATE 05 Oct 20	TIME 12:26	ACFT HRS 6035.4	
FAULTS/REMARKS a/c nose screen change required from summer to winter						ACTION changed cover plate					
ACFT HRS 6035.4		WHEN DISC X	HOW REC G	MAL EFF 1		PID EISENHAU	CAT F	HRS 0.1	PID	CAT	HRS
DELAY		WUC 02			TIPIID ,			TI MANHOURS			

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 121							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —		SYS A		DATE 05 Oct 20		NO 7		TIME 13:01		PID Generated, Cor		DATE 05 Oct 20		TIME 13:02		ACFT HRS			
												ROUNDS		ACTION CODE 3		WUC 00			
FAULTS/REMARKS PMD Due								ACTION COMPLETED											
ACFT HRS 6035.4		WHEN DISC O		HOW REC O		MAL EFF 1		PID EISENHAU		CAT F		HRS 2.0		PID		CAT		HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS /		SYS A		DATE 05 Oct 20		NO 8		TIME 13:03		PID EISENHAUER, JE		DATE 11 Jan 21		TIME 11:05		ACFT HRS 6075.0			
												ROUNDS		ACTION CODE 6		WUC 00			
FAULTS/REMARKS MACHINE GUN MOUNT GUN ARM (M240) L/H AND R/H RMVD FROM A/C AT 48 LBS MOMENT 13.44 CHART C ENTRY NOT COMPLETED, MUST BE COMPLETED N/L/T 02jan21								ACTION rewritten up updated date											
ACFT HRS 6035.4		WHEN DISC X		HOW REC G		MAL EFF 1		PID Belyeu, C.		CAT F		HRS 0.2		PID		CAT		HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS /		SYS A		DATE 06 Oct 20		NO 1		TIME 12:44		PID TARBOX, CHARL		DATE 10 Nov 20		TIME 13:02		ACFT HRS 6039.6			
												ROUNDS		ACTION CODE A		WUC 02			
FAULTS/REMARKS PILOT AND COPILOT WINDSHIELD DE-ICE INOP. CENTER WINDSHIELD FUNCTIONS NORMALLY.								ACTION relay replaced.											
ACFT HRS 6035.4		WHEN DISC K		HOW REC K		MAL EFF 2		PID Rezentes, J		CAT F		HRS 1.0		PID TARBOX, C		CAT F		HRS 2.0	
DELAY work order submitted 23OCT2020				WUC 12A08				TIPIID ,				TI MANHOURS							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 122		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION				
STATUS —	 SYS A	DATE 07 Oct 20	NO 1	TIME 10:32	PID Generated, Cor	DATE 07 Oct 20	TIME 11:00	ACFT HRS 2381.4		
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR M/R SPINDLE NUT CAGE: 78286 PN: 70102-08105-102 NSN: 5310011269444 SN: C479-11261 IS DUE: 15 OCT 2020 CALENDAR						ACTION COMPLETED				
ACFT HRS 2381.4						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 05A01104		TIPIID GATHRIGHT, ANTHONY		TI MANHOURS 0.1
STATUS —	 SYS A	DATE 07 Oct 20	NO 1	TIME 10:32	PID Generated, Com	DATE 07 Oct 20	TIME 10:58	ACFT HRS 2381.4		
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR M/R SPINDLE NUT CAGE: 78286 PN: 70102-08105-102 NSN: 5310011269444 SN: C479-10981 IS DUE: 15 OCT 2020 CALENDAR						ACTION COMPLETED				
ACFT HRS 2381.4						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 05A01104		TIPIID GATHRIGHT, ANTHONY		TI MANHOURS 0.1
STATUS —	 SYS A	DATE 07 Oct 20	NO 1	TIME 10:32	PID Generated, Com	DATE 07 Oct 20	TIME 11:01	ACFT HRS 2381.4		
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR M/R SPINDLE NUT CAGE: 78286 PN: 70102-08105-102 NSN: 5310011269444 SN: C479-10917 IS DUE: 15 OCT 2020 CALENDAR						ACTION COMPLETED				
ACFT HRS 2381.4						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 05A01104		TIPIID GATHRIGHT, ANTHONY		TI MANHOURS 0.1




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 123			
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION					
STATUS —		SYS A	DATE 07 Oct 20	NO 1	TIME 10:33	PID Generated, Cor	DATE 07 Oct 20	TIME 10:49	ACFT HRS 2381.4		
							ROUNDS	ACTION CODE G	WUC 00		
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR MAIN ROTOR SPINDLE ASSY CAGE: 78286 PN: 70102-08200-069 NSN: 1615014426926 SN: A001-04830 IS DUE: 15 OCT 2020 CALENDAR						ACTION COMPLETED					
						PID	CAT	HRS	PID	CAT	HRS
						GATHRIGH	F	0.2			
ACFT HRS 2381.4	WHEN DISC O	HOW REC O	MAL EFF 1								
DELAY			WUC 05A011			TIPIID GATHRIGHT, ANTHONY			TI MANHOURS 0.1		
STATUS —		SYS A	DATE 07 Oct 20	NO 1	TIME 10:33	PID Generated, Com	DATE 07 Oct 20	TIME 10:52	ACFT HRS 2381.4		
							ROUNDS	ACTION CODE G	WUC 00		
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR M/R SPINDLE NUT CAGE: 78286 PN: 70102-08105-102 NSN: 5310011269444 SN: C479-11332 IS DUE: 15 OCT 2020 CALENDAR						ACTION COMPLETED					
						PID	CAT	HRS	PID	CAT	HRS
						GATHRIGH	F	0.2			
ACFT HRS 2381.4	WHEN DISC O	HOW REC O	MAL EFF 1								
DELAY			WUC 05A01104			TIPIID GATHRIGHT, ANTHONY			TI MANHOURS 0.1		
STATUS —		SYS A	DATE 07 Oct 20	NO 1	TIME 10:33	PID Generated, Com	DATE 07 Oct 20	TIME 10:55	ACFT HRS 2381.4		
							ROUNDS	ACTION CODE G	WUC 00		
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR CONTROL HORN ASSY CAGE: 78286 PN: 70102-08111-047 NSN: 1615012149140 SN: A241-15649 IS DUE: 15 OCT 2020 CALENDAR						ACTION COMPLETED					
						PID	CAT	HRS	PID	CAT	HRS
						GATHRIGH	F	0.2			
ACFT HRS 2381.4	WHEN DISC O	HOW REC O	MAL EFF 1								
DELAY			WUC 05A01107			TIPIID GATHRIGHT, ANTHONY			TI MANHOURS 0.1		




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 124		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION					
STATUS —		SYS A	DATE 07 Oct 20	NO 1	TIME 10:33	PID Generated, Cor	DATE 07 Oct 20	TIME 10:56	ACFT HRS 2381.4		
						ROUNDS	ACTION CODE G		WUC 00		
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR MAIN ROTOR SPINDLE ASSY CAGE: 78286 PN: 70102-08200-069 NSN: 1615014426926 SN: A001-04815 IS DUE: 15 OCT 2020 CALENDAR						ACTION COMPLETED					
						PID	CAT	HRS	PID	CAT	HRS
						GATHRIGH	F	0.2			
ACFT HRS 2381.4		WHEN DISC O	HOW REC O	MAL EFF 1							
DELAY			WUC 05A011			TIPID GATHRIGHT, ANTHONY			TI MANHOURS 0.1		
STATUS —		SYS A	DATE 07 Oct 20	NO 1	TIME 10:33	PID Generated, Com	DATE 07 Oct 20	TIME 10:51	ACFT HRS 2381.4		
						ROUNDS	ACTION CODE G		WUC 00		
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR CONTROL HORN ASSY CAGE: 78286 PN: 70102-08111-047 NSN: 1615012149140 SN: A241-15503 IS DUE: 15 OCT 2020 CALENDAR						ACTION COMPLETED					
						PID	CAT	HRS	PID	CAT	HRS
						GATHRIGH	F	0.2			
ACFT HRS 2381.4		WHEN DISC O	HOW REC O	MAL EFF 1							
DELAY			WUC 05A01107			TIPID GATHRIGHT, ANTHONY			TI MANHOURS 0.1		
STATUS —		SYS A	DATE 07 Oct 20	NO 1	TIME 10:33	PID Generated, Com	DATE 07 Oct 20	TIME 10:57	ACFT HRS 2381.4		
						ROUNDS	ACTION CODE G		WUC 00		
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR CONTROL HORN ASSY CAGE: 78286 PN: 70102-08111-047 NSN: 1615012149140 SN: A241-15103 IS DUE: 15 OCT 2020 CALENDAR						ACTION COMPLETED					
						PID	CAT	HRS	PID	CAT	HRS
						GATHRIGH	F	0.2			
ACFT HRS 2381.4		WHEN DISC O	HOW REC O	MAL EFF 1							
DELAY			WUC 05A01107			TIPID GATHRIGHT, ANTHONY			TI MANHOURS 0.1		

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 125					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A		DATE 07 Oct 20		NO 1		TIME 10:33		PID Generated, Cor		DATE 07 Oct 20		TIME 10:54		ACFT HRS 2381.4	
												ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR CONTROL HORN ASSY CAGE: 78286 PN: 70102-08111-047 NSN: 1615012149140 SN: A241-15322 IS DUE: 15 OCT 2020 CALENDAR										ACTION COMPLETED							
												PID		CAT		HRS	
												GATHRIGH		F		0.2	
ACFT HRS 2381.4				WHEN DISC O		HOW REC O		MAL EFF 1									
DELAY				WUC 05A01107				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1					
STATUS —		SYS A		DATE 07 Oct 20		NO 1		TIME 10:33		PID Generated, Com		DATE 07 Oct 20		TIME 10:50		ACFT HRS 2381.4	
												ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR MAIN ROTOR SPINDLE ASSY CAGE: 78286 PN: 70102-08200-069 NSN: 1615014426926 SN: A001-04704 IS DUE: 15 OCT 2020 CALENDAR										ACTION COMPLETED							
												PID		CAT		HRS	
												GATHRIGH		F		0.2	
ACFT HRS 2381.4				WHEN DISC O		HOW REC O		MAL EFF 1									
DELAY				WUC 05A011				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.2					
STATUS —		SYS A		DATE 07 Oct 20		NO 1		TIME 10:34		PID Generated, Com		DATE 07 Oct 20		TIME 10:40		ACFT HRS 754.4	
												ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR BIFILAR, M/R ROTOR ASSY CAGE: 8L513 PN: 70107-08400-046 NSN: 1615011277388 SN: AIM00285 IS DUE: 15 OCT 2020 CALENDAR										ACTION COMPLETED							
												PID		CAT		HRS	
												GATHRIGH		F		0.2	
ACFT HRS 754.4				WHEN DISC O		HOW REC O		MAL EFF 1									
DELAY				WUC 05A01T				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 126				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —		SYS A	DATE 07 Oct 20	NO 1	TIME 10:34	PID Generated, Cor		DATE 07 Oct 20	TIME 10:47	ACFT HRS 754.4						
								ROUNDS	ACTION CODE G	WUC 00						
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR LEFT TIE ROD ASSY CAGE: 78286 PN: 70400-08115-046 NSN: 1560012892697 SN: F344-01441 IS DUE: 15 OCT 2020 CALENDAR								ACTION COMPLETED								
ACFT HRS 754.4		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY		WUC 11D13						TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				
STATUS —		SYS A	DATE 07 Oct 20	NO 1	TIME 10:34	PID Generated, Com		DATE 07 Oct 20	TIME 10:38	ACFT HRS 754.4						
								ROUNDS	ACTION CODE G	WUC 00						
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR AFT BELLCRANK CAGE: 65780 PN: 70400-08102-045 NSN: 1680011589685 SN: 34501756 IS DUE: 15 OCT 2020 CALENDAR								ACTION COMPLETED								
ACFT HRS 754.4		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY		WUC 11D04						TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				
STATUS —		SYS A	DATE 07 Oct 20	NO 1	TIME 10:34	PID Generated, Com		DATE 07 Oct 20	TIME 10:42	ACFT HRS 754.4						
								ROUNDS	ACTION CODE G	WUC 00						
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR LATERAL SWASHPLATE LINK CAGE: 15152 PN: 70400-08151-061 NSN: 3040012872438 SN: 15152-04010 IS DUE: 15 OCT 2020 CALENDAR								ACTION COMPLETED								
ACFT HRS 754.4		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY		WUC 11D08						TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 127					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A		DATE 07 Oct 20		NO 1		TIME 10:34		PID Generated, Cor		DATE 07 Oct 20		TIME 10:44		ACFT HRS 2381.4	
												ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR FWD BELLCRANK SPT ASSY CAGE: 78286 PN: 70400-08162-042 NSN: 1560012212619 SN: B367-03890 IS DUE: 15 OCT 2020 CALENDAR										ACTION COMPLETED							
												PID		CAT		HRS	
												GATHRIGH		F		0.2	
ACFT HRS 2381.4				WHEN DISC O		HOW REC O		MAL EFF 1									
DELAY				WUC 11D16				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1					
STATUS —		SYS A		DATE 07 Oct 20		NO 1		TIME 10:34		PID Generated, Com		DATE 07 Oct 20		TIME 10:46		ACFT HRS 4459.4	
												ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR FORWARD BELLCRANK CAGE: 78286 PN: 70400-08101-046 NSN: 1680011589652 SN: J35500130 IS DUE: 15 OCT 2020 CALENDAR										ACTION COMPLETED							
												PID		CAT		HRS	
												GATHRIGH		F		0.2	
ACFT HRS 4459.4				WHEN DISC O		HOW REC O		MAL EFF 1									
DELAY				WUC 11D15				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1					
STATUS —		SYS A		DATE 07 Oct 20		NO 1		TIME 10:34		PID Generated, Com		DATE 07 Oct 20		TIME 10:45		ACFT HRS 2381.4	
												ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR LATERAL SERVO BELLCRANK CAGE: 78286 PN: 70400-08166-041 NSN: 1680012212863 SN: F337-02086 IS DUE: 15 OCT 2020 CALENDAR										ACTION COMPLETED							
												PID		CAT		HRS	
												GATHRIGH		F		0.2	
ACFT HRS 2381.4				WHEN DISC O		HOW REC O		MAL EFF 1									
DELAY				WUC 11D09				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1					

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 128					
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION								
STATUS —	G CLOSED	SYS A	DATE 07 Oct 20	NO 1	TIME 10:34	PID Generated, Cor	DATE 07 Oct 20	TIME 10:41	ACFT HRS 2381.4					
							ROUNDS	ACTION CODE G	WUC 00					
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-20-ASAM-10 DESCRIPTION: COMPLY WITH H-60-20-ASAM-10, HONTEK COMPONENT TIME SINCE NEW LIFE ADJUSTMENT, AT THE NEXT LOGBOOK RECONCILIATION, NOT TO EXCEED 15 OCT 20 FOR MAIN ROTOR SPINDLE ASSY CAGE: 78286 PN: 70102-08200-069 NSN: 1615014426926 SN: A001-05236 IS DUE: 15 OCT 2020 CALENDAR						ACTION COMPLETED								
						PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
						GATHRIGH	F	0.2						
ACFT HRS 2381.4	WHEN DISC O	HOW REC O	MAL EFF 1											
DELAY			WUC 05A011			TIPIID GATHRIGHT, ANTHONY			TI MANHOURS 0.1					
STATUS —	B CLOSED	SYS A	DATE 09 Oct 20	NO 1	TIME 00:01	PID Generated, Com	DATE 14 Oct 20	TIME 11:03	ACFT HRS 6035.4					
							ROUNDS	ACTION CODE 5	WUC 00					
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6066.6 AIRCRAFT HOURS OR 15 OCT 2020 REFERENCE: TM 1-1520-237-23&P						ACTION completed								
						PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
						MILLIKEN,	F	1.0	Belyeu, C.	F	1.0			
ACFT HRS 6035.4	WHEN DISC O	HOW REC O	MAL EFF 1											
DELAY			WUC 00			TIPIID ,			TI MANHOURS					
STATUS —	B CLOSED	SYS A	DATE 09 Oct 20	NO 2	TIME 00:01	PID Generated, Com	DATE 14 Oct 20	TIME 11:26	ACFT HRS 6035.4					
							ROUNDS	ACTION CODE I	WUC 00					
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 OCT 2020 REFERENCE: TM 1-1500-344-23						ACTION Wash completed								
						PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
						Belyeu, C.	F	2.0						
ACFT HRS 6035.4	WHEN DISC O	HOW REC O	MAL EFF 1											
DELAY			WUC 00			TIPIID ,			TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 129			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —		SYS A	DATE 11 Oct 20	NO 1	TIME 00:00	PID Generated, Cor		DATE 16 Oct 20	TIME 08:00	ACFT HRS 6035.4					
FAULTS/REMARKS INSP A100 LH/RH ENGINE HISTORY RECORDER READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 17 OCT 2020 REFERENCE: DA PAM 738-751								ACTION complete							
ACFT HRS 6035.4		WHEN DISC O	HOW REC O	MAL EFF 1				PIID		CAT	HRS	PIID	CAT	HRS	
DELAY		WUC 00						TIID ,			TI MANHOURS				
STATUS —		SYS A	DATE 12 Oct 20	NO 1	TIME 00:01	PID Generated, Com		DATE 16 Oct 20	TIME 00:01	ACFT HRS 6035.4					
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 OCT 2020 REFERENCE: TM 1-1520-237-23								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON OCT 16 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT							
ACFT HRS 6035.4		WHEN DISC O	HOW REC O	MAL EFF 1				PIID		CAT	HRS	PIID	CAT	HRS	
DELAY		WUC 00						TIID ,			TI MANHOURS				
STATUS —		SYS E	DATE 12 Oct 20	NO 1	TIME 00:01	PID Generated, Com		DATE 19 Oct 20	TIME 00:01	ACFT HRS 6035.4					
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 18 OCT 2020 REFERENCE: TM 11-5810-262-23								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON OCT 19 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT							
ACFT HRS 6035.4		WHEN DISC O	HOW REC O	MAL EFF 1				PIID		CAT	HRS	PIID	CAT	HRS	
DELAY		WUC 00						TIID ,			TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 130		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION					
STATUS —	 SYS O	DATE 13 Oct 20	NO 1	TIME 00:01	PID Generated, Cor	DATE 20 Oct 20	TIME 00:01	ACFT HRS 6035.4			
FAULTS/REMARKS INSP O801 128D DAFIF AND WAYPOINT UPDATE REQUIRED FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 19 OCT 2020 REFERENCE: AASF SOP						ROUNDS	ACTION CODE	WUC 00			
ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON OCT 20 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT											
ACFT HRS 6035.4						WHEN DISC O	HOW REC O	MAL EFF 1			
DELAY						WUC 00			TI MANHOURS		
STATUS —	 SYS A	DATE 13 Oct 20	NO 1	TIME 13:32	PID Generated, Com	DATE 13 Oct 20	TIME 14:36	ACFT HRS 6035.4			
FAULTS/REMARKS PMD DUE						ROUNDS	ACTION CODE 3	WUC 00			
ACTION insp ok											
ACFT HRS 6035.4						WHEN DISC O	HOW REC G	MAL EFF 2			
DELAY						WUC 00			TI MANHOURS		
STATUS —	 SYS A	DATE 13 Oct 20	NO 2	TIME 13:32	PID Generated, Com	DATE 13 Oct 20	TIME 13:33	ACFT HRS 6035.4			
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ROUNDS	ACTION CODE 3	WUC 00			
ACTION completed											
ACFT HRS 6035.4						WHEN DISC X	HOW REC G	MAL EFF 1			
DELAY						WUC 00			TI MANHOURS		
ACFT HRS 6035.4						WHEN DISC X	HOW REC G	MAL EFF 1			
DELAY						WUC 00			TI MANHOURS		




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 131				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 13 Oct 20	NO 3	TIME 14:44	PID BISHOP, JEFFER		DATE 19 Oct 20	TIME 15:46	ACFT HRS 6035.4						
FAULTS/REMARKS Red TRB boot torn near outboard zip tie								ACTION replaced								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	1.0	MILLIKEN, F	F	1.0			
ACFT HRS 6035.4		WHEN DISC K		HOW REC G		MAL EFF 1										
DELAY				WUC 05B02				TIPIID CHADBOURNE, SCOTT				TI MANHOURS 0.1				
STATUS —		SYS A	DATE 13 Oct 20	NO 4	TIME 14:58	PID Generated, Com		DATE 13 Oct 20	TIME 14:58	ACFT HRS						
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								BISHOP, J.	F	2.0						
ACFT HRS 6035.4		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS /		SYS A	DATE 14 Oct 20	NO 1	TIME 10:44	PID MILLIKEN, JEREM		DATE 04 Nov 20	TIME 11:33	ACFT HRS 6039.6						
FAULTS/REMARKS Troop commanders ICS box aft RH resilient mount torn								ACTION replaced torn mount								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								BISHOP, J.	F	1.0						
ACFT HRS 6035.4		WHEN DISC Z		HOW REC G		MAL EFF 1										
DELAY w/o submitted 14 oct 2020				WUC 02				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 132						
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION										
STATUS X		SYS A	DATE 16 Oct 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 16 Oct 20	TIME 08:00	ACFT HRS 6035.4		ROUNDS		ACTION CODE E		WUC 00		
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 15 OCT 2020 REFERENCE: TM 1-1520-237-23								ACTION complete										
ACFT HRS 6035.4		WHEN DISC O	HOW REC O	MAL EFF 1		PID HIGGINS, F		CAT F	HRS 0.1	PID		CAT	HRS		PID		CAT	HRS
DELAY				WUC 00				TIPIID EISENHAEUER, JEFFREY				TI MANHOURS 0.1						
STATUS —		SYS A	DATE 17 Oct 20	NO 1	TIME 00:01	PID Generated, Com		DATE 20 Oct 20	TIME 00:01	ACFT HRS 6035.4		ROUNDS		ACTION CODE		WUC 00		
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 19 OCT 2020 REFERENCE: TM 1-1520-237-23&P								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON OCT 20 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT										
ACFT HRS 6035.4		WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID		CAT	HRS		PID		CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS						
STATUS X		SYS E	DATE 19 Oct 20	NO 1	TIME 00:01	PID Generated, Com		DATE 21 Oct 20	TIME 10:34	ACFT HRS 6035.4		ROUNDS		ACTION CODE J		WUC 00		
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 18 OCT 2020 REFERENCE: TM 11-5810-262-23								ACTION completed insp. ok										
ACFT HRS 6035.4		WHEN DISC O	HOW REC O	MAL EFF 1		PID MILLIKEN, F		CAT F	HRS 0.2	PID		CAT	HRS		PID		CAT	HRS
DELAY				WUC 00				TIPIID THIBODEAU, THOMAS				TI MANHOURS 0.2						




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 133			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 19 Oct 20	NO 1	TIME 00:01	PID Generated, Cor			DATE 04 Nov 20	TIME 09:35	ACFT HRS 6039.6					
		ROUNDS	ACTION CODE G			WUC 00									
FAULTS/REMARKS INSP A230 INSPECT BATTERY COMPARTMENT FOR CORROSION (SLAB) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 12 NOV 2020 REFERENCE: MWO 1-1520-237-50-77								ACTION insp ok							
ACFT HRS 6035.4		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00				TIPID ,			TI MANHOURS						
STATUS —	 SYS A	DATE 19 Oct 20	NO 2	TIME 15:04	PID Belyeu, Christop			DATE 22 Oct 20	TIME 14:10	ACFT HRS 6035.4					
		ROUNDS	ACTION CODE J			WUC 00									
FAULTS/REMARKS tail rotor balance check required for replacement of red t/r boot per wp 0818								ACTION completed insp. ok							
ACFT HRS 6035.4		WHEN DISC B	HOW REC G	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00				TIPID ,			TI MANHOURS						
STATUS X	 SYS A	DATE 20 Oct 20	NO 1	TIME 00:01	PID Generated, Com			DATE 22 Oct 20	TIME 14:09	ACFT HRS 6035.4					
		ROUNDS	ACTION CODE E			WUC 00									
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 19 OCT 2020 REFERENCE: TM 1-1520-237-23&P								ACTION completed							
ACFT HRS 6035.4		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00				TIPID GATHRIGHT, ANTHONY			TI MANHOURS 0.1						




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 134				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS O	DATE 20 Oct 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 22 Oct 20	TIME 17:42	ACFT HRS 6035.4						
FAULTS/REMARKS INSP O801 128D DAFIF AND WAYPOINT UPDATE REQUIRED FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 19 OCT 2020 REFERENCE: AASF SOP								ACTION dafif updated								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Mower, H.	F	0.2						
ACFT HRS 6035.4		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID LECLAIR, JOSEPH			TI MANHOURS 0.1					
STATUS —		SYS A	DATE 21 Oct 20	NO 1	TIME 00:01	PID Generated, Com		DATE 21 Oct 20	TIME 10:30	ACFT HRS 6035.4						
FAULTS/REMARKS INSP A502 INSPECT AND TEST GROUND RECEPTACLE IAW TM 1-1500-204-23 FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 26 NOV 2020 REFERENCE: TM 1-1520-237-23&P								ACTION insp. ok								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.2						
ACFT HRS 6035.4		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID ,			TI MANHOURS					
STATUS —		SYS A	DATE 21 Oct 20	NO 2	TIME 07:28	PID Generated, Com		DATE 21 Oct 20	TIME 08:05	ACFT HRS 6035.4						
FAULTS/REMARKS PMD DUE								ACTION insp. ok								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.2						
ACFT HRS 6035.4		WHEN DISC O	HOW REC G	MAL EFF 2												
DELAY				WUC 00				TIPID ,			TI MANHOURS					

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 135		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION					
STATUS —	B CLOSED	SYS A	DATE 21 Oct 20	NO 3	TIME 07:28	PID Generated, Cor			DATE 21 Oct 20	TIME 07:39	ACFT HRS 6035.4
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ACTION insp. ok					
ACFT HRS 6035.4			WHEN DISC X	HOW REC G	MAL EFF 1	PID	CAT	HRS	PID	CAT	HRS
DELAY			WUC 00			TIPIID ,			TI MANHOURS		
STATUS —	C CLOSED	SYS A	DATE 21 Oct 20	NO 4	TIME 10:35	PID Generated, Com			DATE 21 Oct 20	TIME 10:36	ACFT HRS
FAULTS/REMARKS PMD Due						ACTION COMPLETED					
ACFT HRS 6035.4			WHEN DISC O	HOW REC O	MAL EFF 1	PID	CAT	HRS	PID	CAT	HRS
DELAY			WUC 00			TIPIID ,			TI MANHOURS		
STATUS —	C CLOSED	SYS A	DATE 21 Oct 20	NO 5	TIME 13:21	PID Generated, Com			DATE 21 Oct 20	TIME 13:21	ACFT HRS
FAULTS/REMARKS PMD Due						ACTION COMPLETED					
ACFT HRS 6035.4			WHEN DISC O	HOW REC O	MAL EFF 1	PID	CAT	HRS	PID	CAT	HRS
DELAY			WUC 00			TIPIID ,			TI MANHOURS		




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 136				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —		SYS E	DATE 24 Oct 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 12 Nov 20	TIME 00:01	ACFT HRS 6039.6		ROUNDS		ACTION CODE		WUC 00
FAULTS/REMARKS INSP E040 APR-39 RADAR/LASER WARNING OPNL CHECK, 5841-01-236-8951 FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 11 NOV 2020 REFERENCE: TM 11-5841-294-12								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON NOV 12 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
ACFT HRS 6039.6		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 27 Oct 20	NO 1	TIME 07:48	PID Generated, Com		DATE 27 Oct 20	TIME 09:40	ACFT HRS		ROUNDS		ACTION CODE 3		WUC 00
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
ACFT HRS 6039.6		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 27 Oct 20	NO 2	TIME 07:49	PID Generated, Com		DATE 27 Oct 20	TIME 07:59	ACFT HRS 6039.6		ROUNDS		ACTION CODE 3		WUC 00
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION insp. ok								
ACFT HRS 6039.6		WHEN DISC X	HOW REC G	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 137					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A		DATE 27 Oct 20		NO 3		TIME 07:49		PID Generated, Cor		DATE 27 Oct 20		TIME 09:41		ACFT HRS 6039.6	
												ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS PMD DUE								ACTION insp. ok									
												PID		CAT		HRS	
												Belyeu, C.		F		1.5	
ACFT HRS 6039.6				WHEN DISC O				HOW REC G				MAL EFF 2					
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS E		DATE 30 Oct 20		NO 1		TIME 00:00		PID Generated, Com		DATE 04 Nov 20		TIME 09:36		ACFT HRS 6039.6	
												ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS INSP E220 EMERGENCY LOCATOR TRANSMITTER SELF-TEST (AS REQUIRED) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6160.4 AIRCRAFT HOURS OR 05 NOV 2020 REFERENCE: AWR 1516 R12								ACTION insp ok									
												PID		CAT		HRS	
												BISHOP, J.		F		0.3	
ACFT HRS 6039.6				WHEN DISC O				HOW REC O				MAL EFF 1					
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A		DATE 30 Oct 20		NO 1		TIME 00:00		PID Generated, Com		DATE 04 Nov 20		TIME 09:34		ACFT HRS 6039.6	
												ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 05 NOV 2020 REFERENCE: TM 11-6140-203-23 P								ACTION insp ok									
												PID		CAT		HRS	
												BISHOP, J.		F		0.2	
ACFT HRS 6039.6				WHEN DISC O				HOW REC O				MAL EFF 1					
DELAY				WUC 00				TIPIID ,				TI MANHOURS					





DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 138						
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION								
STATUS —	 SYS E	DATE 31 Oct 20	NO 1	TIME 00:00	PID Generated, Cor	DATE 04 Nov 20	TIME 09:57	ACFT HRS 6039.6						
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 NOV 2020 REFERENCE: TM 11-5821-357-12P						ACTION insp ok								
ACFT HRS 6039.6						WHEN DISC O	HOW REC O	MAL EFF 1						
DELAY						WUC 00								
STATUS —						 SYS A	DATE 04 Nov 20	NO 1	TIME 00:00	PID Generated, Com	DATE 07 Nov 20	TIME 00:01	ACFT HRS 6039.6	
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 NOV 2020 REFERENCE: TM 1-1520-237-23&P						ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON NOV 7 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
ACFT HRS 6039.6						WHEN DISC O	HOW REC O	MAL EFF 1						
DELAY						WUC 00								
STATUS —						 SYS A	DATE 04 Nov 20	NO 2	TIME 09:21	PID Generated, Com	DATE 04 Nov 20	TIME 09:42	ACFT HRS 6039.6	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ACTION insp ok								
ACFT HRS 6039.6						WHEN DISC X	HOW REC G	MAL EFF 1						
DELAY						WUC 00								
STATUS —						 SYS A	DATE 04 Nov 20	NO 2	TIME 09:21	PID Generated, Com	DATE 04 Nov 20	TIME 09:42	ACFT HRS 6039.6	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ACTION insp ok								
ACFT HRS 6039.6						WHEN DISC X	HOW REC G	MAL EFF 1						
DELAY						WUC 00								

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 139					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A	DATE 04 Nov 20		NO 3	TIME 09:21		PID Generated, Cor			DATE 04 Nov 20		TIME 09:58		ACFT HRS 6039.6		
B Closed											ROUNDS		ACTION CODE 3		WUC 00		
FAULTS/REMARKS PMD DUE								ACTION insp ok									
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
								BISHOP, J.	F	2.0							
ACFT HRS 6039.6			WHEN DISC O		HOW REC G		MAL EFF 2										
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A	DATE 04 Nov 20		NO 4	TIME 10:51		PID Generated, Com			DATE 04 Nov 20		TIME 10:51		ACFT HRS		
C Closed											ROUNDS		ACTION CODE 3		WUC 00		
FAULTS/REMARKS PMD Due								ACTION COMPLETED									
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
								BISHOP, J.	F	2.0							
ACFT HRS 6039.6			WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A	DATE 05 Nov 20		NO 1	TIME 00:00		PID Generated, Com			DATE 05 Jan 21		TIME 00:01		ACFT HRS 6068.0		
C Closed											ROUNDS		ACTION CODE		WUC 00		
FAULTS/REMARKS INSP A550 REPLACE IVHMU AA LITHIUM BATTERY FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 04 JAN 2021 REFERENCE: AWR1346R25/AWR1823R6								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JAN 5 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT									
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
ACFT HRS 6039.6			WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 140					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS X		SYS A	DATE 07 Nov 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 13 Nov 20	TIME 13:51	ACFT HRS 6039.6		ROUNDS		ACTION CODE G		WUC 04	
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 06 NOV 2020 REFERENCE: TM 1-1520-237-23&P								ACTION completed									
ACFT HRS 6039.6		WHEN DISC O	HOW REC O	MAL EFF 1				PID BISHOP, J.	CAT F	HRS 0.1	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID THIBODEAU, THOMAS				TI MANHOURS 0.2					
STATUS —		SYS A	DATE 08 Nov 20	NO 1	TIME 00:01	PID Generated, Com		DATE 15 Nov 20	TIME 00:01	ACFT HRS 6041.6		ROUNDS		ACTION CODE		WUC 00	
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 14 NOV 2020 REFERENCE: TM 1-1500-344-23								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON NOV 15 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT									
ACFT HRS 6039.6		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A	DATE 08 Nov 20	NO 2	TIME 00:01	PID Generated, Com		DATE 15 Nov 20	TIME 00:01	ACFT HRS 6041.6		ROUNDS		ACTION CODE		WUC 00	
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6079.4 AIRCRAFT HOURS OR 14 NOV 2020 REFERENCE: TM 1-1520-237-23&P								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON NOV 15 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT									
ACFT HRS 6039.6		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 141					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A	DATE 10 Nov 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 16 Nov 20	TIME 07:25	ACFT HRS 6045.6		ROUNDS		ACTION CODE E		WUC 00	
FAULTS/REMARKS INSP A100 LH/RH ENGINE HISTORY RECORDER READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 16 NOV 2020 REFERENCE: DA PAM 738-751								ACTION complete									
ACFT HRS 6039.6		WHEN DISC O	HOW REC O	MAL EFF 1				PID EISENHAU	CAT F	HRS 0.2	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPID ,				TI MANHOURS					
STATUS —		SYS A	DATE 12 Nov 20	NO 1	TIME 00:01	PID Generated, Com		DATE 16 Nov 20	TIME 00:01	ACFT HRS 6045.6		ROUNDS		ACTION CODE		WUC 00	
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 NOV 2020 REFERENCE: TM 1-1520-237-23								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON NOV 16 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT									
ACFT HRS 6039.6		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPID ,				TI MANHOURS					
STATUS X		SYS E	DATE 12 Nov 20	NO 1	TIME 00:01	PID Generated, Com		DATE 12 Nov 20	TIME 08:25	ACFT HRS 6039.6		ROUNDS		ACTION CODE J		WUC 00	
FAULTS/REMARKS INSP E040 APR-39 RADAR/LASER WARNING OPNL CHECK, 5841-01-236-8951 FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 11 NOV 2020 REFERENCE: TM 11-5841-294-12								ACTION insp. ok									
ACFT HRS 6039.6		WHEN DISC O	HOW REC O	MAL EFF 1				PID Belyeu, C.	CAT F	HRS 0.1	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPID GATHRIGHT, ANTHONY				TI MANHOURS 0.1					

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 142				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	B CLOSED	SYS A	DATE 12 Nov 20		NO 2	TIME 07:36		PID Generated, Cor			DATE 12 Nov 20		TIME 08:47		ACFT HRS 6039.6	
FAULTS/REMARKS PMD DUE								ACTION insp. ok								
								MILLIKEN,	F	1.0	Belyeu, C.	F	1.0			
ACFT HRS 6039.6		WHEN DISC O		HOW REC G		MAL EFF 2										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	B CLOSED	SYS A	DATE 12 Nov 20		NO 3	TIME 07:36		PID Generated, Com			DATE 12 Nov 20		TIME 08:40		ACFT HRS	
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								Belyeu, C.	F	1.0						
ACFT HRS 6039.6		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	B CLOSED	SYS A	DATE 12 Nov 20		NO 4	TIME 07:37		PID Generated, Com			DATE 12 Nov 20		TIME 07:53		ACFT HRS 6039.6	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION insp. ok								
								Belyeu, C.	F	0.1						
ACFT HRS 6039.6		WHEN DISC X		HOW REC G		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 143				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 13 Nov 20	NO 1	TIME 15:38	PID BISHOP, JEFFER		DATE 16 Dec 20	TIME 15:19	ACFT HRS 6061.3						
FAULTS/REMARKS #1 engine hit check within 5 of upper limit								ACTION HIT's more than 5 from upper limit last 5 HIT checks								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CURTIS, A.	F	1.0						
ACFT HRS 6039.6		WHEN DISC G		HOW REC G		MAL EFF 1										
DELAY monitor next 5 flights				WUC 04				TIPID ,				TI MANHOURS				
STATUS /		SYS E	DATE 14 Nov 20	NO 1	TIME 13:21	PID JAMES, JONATH		DATE 16 Nov 20	TIME 08:05	ACFT HRS 6045.6						
FAULTS/REMARKS IVHMS DTU ERROR								ACTION replaced ivhms card, moc ok								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 6041.6		WHEN DISC G		HOW REC C		MAL EFF 1										
DELAY REPLACED CARD MONITOR NEXT FLIGHT				WUC 00				TIPID ,				TI MANHOURS				
STATUS X		SYS A	DATE 15 Nov 20	NO 1	TIME 00:01	PID Generated, Com		DATE 15 Nov 20	TIME 08:37	ACFT HRS 6041.6						
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 6079.4 AIRCRAFT HOURS OR 14 NOV 2020 REFERENCE: TM 1-1520-237-23&P								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								JACKSON,	F	0.5						
ACFT HRS 6041.6		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPID EISENHAUER, JEFFREY				TI MANHOURS 0.1				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 144					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS X	E CLOSED	SYS A	DATE 15 Nov 20	NO 2	TIME 00:01	PID Generated, Cor		DATE 15 Nov 20	TIME 08:41	ACFT HRS 6041.6		ROUNDS		ACTION CODE E		WUC 00	
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 14 NOV 2020 REFERENCE: TM 1-1500-344-23								ACTION complete									
ACFT HRS 6041.6	WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS				
DELAY				WUC 00				TIPID EISENHAUER, JEFFREY				TI MANHOURS 0.1					
STATUS —	E CLOSED	SYS A	DATE 15 Nov 20	NO 3	TIME 07:15	PID Generated, Com		DATE 15 Nov 20	TIME 07:38	ACFT HRS 6041.6		ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS PMD Due								ACTION COMPLETE									
ACFT HRS 6041.6	WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS				
DELAY				WUC 00				TIPID ,				TI MANHOURS					
STATUS —	E CLOSED	SYS A	DATE 15 Nov 20	NO 4	TIME 07:16	PID Generated, Com		DATE 15 Nov 20	TIME 08:32	ACFT HRS 6041.6		ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS PMD DUE								ACTION complete									
ACFT HRS 6041.6	WHEN DISC O	HOW REC G	MAL EFF 2		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS				
DELAY				WUC 00				TIPID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 145			
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION					
STATUS —	 E CLOSED	SYS A	DATE 15 Nov 20	NO 5	TIME 07:16	PID Generated, Cor	DATE 15 Nov 20	TIME 07:23	ACFT HRS 6041.6		
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.						ACTION COMPLETE					
ACFT HRS 6041.6						WHEN DISC X	HOW REC G	MAL EFF 1			
DELAY						WUC 00		TI MANHOURS		TIPID ,	
STATUS —	 I CLOSED	SYS A	DATE 15 Nov 20	NO 7	TIME 08:44	PID Generated, Com	DATE 15 Nov 20	TIME 08:44	ACFT HRS		
FAULTS/REMARKS PMD Due						ACTION COMPLETED					
ACFT HRS 6041.6						WHEN DISC O	HOW REC O	MAL EFF 1			
DELAY						WUC 00		TI MANHOURS		TIPID ,	
STATUS /	 I CLOSED	SYS A	DATE 15 Nov 20	NO 8	TIME 15:19	PID HOBBS, JOHN	DATE 29 Dec 20	TIME 14:26	ACFT HRS 6064.5		
FAULTS/REMARKS #2 bearing pointer failed preflight check						ACTION #2 couldnt duplicate					
ACFT HRS 6045.6						WHEN DISC G	HOW REC G	MAL EFF 1			
DELAY w/o submitted 17nov20						WUC 00		TI MANHOURS		TIPID ,	
						PID	CAT	HRS	PID	CAT	HRS
						EISENHAU	F	1.0			
						PID	CAT	HRS	PID	CAT	HRS
						EISENHAU	F	2.0			
						PID	CAT	HRS	PID	CAT	HRS
						IRISH, T.	F	0.2			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 146					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS X		SYS A	DATE 16 Nov 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 16 Nov 20	TIME 07:26	ACFT HRS 6045.6		ROUNDS		ACTION CODE E		WUC 00	
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 15 NOV 2020 REFERENCE: TM 1-1520-237-23								ACTION complete									
ACFT HRS 6045.6		WHEN DISC O		HOW REC O		MAL EFF 1		PID EISENHAU	CAT F	HRS 0.1	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPID CURTIS, ANDREW				TI MANHOURS 0.1					
STATUS /		SYS A	DATE 16 Nov 20	NO 3	TIME 06:31	PID EISENHAUER, JE		DATE 16 Nov 20	TIME 07:49	ACFT HRS 6045.6		ROUNDS		ACTION CODE E		WUC 00	
FAULTS/REMARKS BLUE M/R DAMPER INDICATOR CLOSE TO LIMITS								ACTION service when needed									
ACFT HRS 6045.6		WHEN DISC X		HOW REC G		MAL EFF 2		PID EISENHAU	CAT F	HRS 0.1	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPID ,				TI MANHOURS					
STATUS —		SYS A	DATE 16 Nov 20	NO 4	TIME 07:23	PID Generated, Com		DATE 16 Nov 20	TIME 07:27	ACFT HRS 6045.6		ROUNDS		ACTION CODE G		WUC 00	
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 16 NOV 2020. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6050.6 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ACTION complete									
ACFT HRS 6045.6		WHEN DISC O		HOW REC O		MAL EFF 1		PID BISHOP, J.	CAT F	HRS 0.1	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPID ,				TI MANHOURS					

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 147			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	E Closed	SYS A	DATE 16 Nov 20	NO 5	TIME 07:43	PID Generated, Cor		DATE 16 Nov 20	TIME 08:02	ACFT HRS 6045.6					
								ROUNDS	ACTION CODE 3	WUC 00					
FAULTS/REMARKS PMD DUE								ACTION COMPLETE							
ACFT HRS 6045.6		WHEN DISC O	HOW REC G	MAL EFF 2											
DELAY				WUC 00				TIPIID ,				TI MANHOURS			
STATUS —	E Closed	SYS A	DATE 16 Nov 20	NO 6	TIME 07:43	PID Generated, Com		DATE 16 Nov 20	TIME 08:08	ACFT HRS 6045.6					
								ROUNDS	ACTION CODE 3	WUC 00					
FAULTS/REMARKS PMD Due								ACTION COMPLETE							
ACFT HRS 6045.6		WHEN DISC O	HOW REC O	MAL EFF 1											
DELAY				WUC 00				TIPIID ,				TI MANHOURS			
STATUS —	E Closed	SYS A	DATE 16 Nov 20	NO 7	TIME 07:44	PID Generated, Com		DATE 16 Nov 20	TIME 07:57	ACFT HRS 6045.6					
								ROUNDS	ACTION CODE G	WUC 00					
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION COMPLETE							
ACFT HRS 6045.6		WHEN DISC X	HOW REC G	MAL EFF 1											
DELAY				WUC 00				TIPIID ,				TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 148				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	 SYS A	DATE 16 Nov 20	NO 8	TIME 08:09	PID Generated, Cor			DATE 16 Nov 20	TIME 08:09	ACFT HRS						
		ROUNDS	ACTION CODE 3			WUC 00										
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	2.0						
ACFT HRS 6045.6		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS X	 SYS A	DATE 17 Nov 20	NO 1	TIME 07:07	PID Belyeu, Christop			DATE 17 Nov 20	TIME 10:11	ACFT HRS 6047.7						
		ROUNDS	ACTION CODE 2			WUC 00										
FAULTS/REMARKS blue m/r damper assembly requires servicing								ACTION serviced								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.5						
ACFT HRS 6047.7		WHEN DISC X	HOW REC G	MAL EFF 2												
DELAY				WUC 05A01Z				TIPIID CHADBOURNE, SCOTT				TI MANHOURS 0.1				
STATUS —	 SYS A	DATE 17 Nov 20	NO 2	TIME 07:26	PID Generated, Com			DATE 17 Nov 20	TIME 07:31	ACFT HRS 6047.7						
		ROUNDS	ACTION CODE 3			WUC 00										
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2.								ACTION insp. ok								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	1.0						
ACFT HRS 6047.7		WHEN DISC X	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 149				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	 SYS A	DATE 17 Nov 20	NO 3	TIME 07:26	PID Generated, Cor			DATE 17 Nov 20	TIME 08:07	ACFT HRS						
		WHEN DISC O	HOW REC O	MAL EFF 1				ROUNDS	ACTION CODE 3	WUC 00						
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	1.0						
ACFT HRS 6047.7		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 SYS A	DATE 17 Nov 20	NO 4	TIME 07:26	PID Generated, Com			DATE 17 Nov 20	TIME 08:06	ACFT HRS 6047.7						
		WHEN DISC O	HOW REC G	MAL EFF 2				ROUNDS	ACTION CODE 3	WUC 00						
FAULTS/REMARKS PMD DUE								ACTION insp. complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	1.0	MILLIKEN,	F	1.0			
ACFT HRS 6047.7		WHEN DISC O	HOW REC G	MAL EFF 2												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS /	 SYS A	DATE 17 Nov 20	NO 5	TIME 09:21	PID Belyeu, Christop			DATE 17 Nov 20	TIME 10:35	ACFT HRS 6047.7						
		WHEN DISC B	HOW REC F	MAL EFF 1				ROUNDS	ACTION CODE A	WUC 00						
FAULTS/REMARKS engine air inlet plugs worn								ACTION replaced								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.2						
ACFT HRS 6047.7		WHEN DISC B	HOW REC F	MAL EFF 1												
DELAY				WUC 82				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 150			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS / 		SYS A		DATE 18 Nov 20		NO 1		TIME 16:47		PID Nelson, Rachyl					
FAULTS/REMARKS Copilots ICS floor switch sticks causing a hot mike								DATE 02 Dec 20		TIME 08:43		ACFT HRS 6055.4			
								ROUNDS		ACTION CODE E		WUC 00			
ACFT HRS 6055.4								WHEN DISC G		HOW REC K		MAL EFF 1			
								DELAY		WUC 00		TIPIID ,		TI MANHOURS	
STATUS 		SYS A		DATE 19 Nov 20		NO 1		TIME 13:54		PID CURTIS, ANDREI					
FAULTS/REMARKS OPERATE IN ACCORDANCE WITH AWR 2120 R3 DATED 27 SEP 2019 (GeTac Computer), AWR 1956 R4 DATED 04 AUG 2020 (APR-39), AWR 1913 R4 DATED 17 JAN 2020 (ACN LOGBOOK), AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C), AWR 1800 R9 DATED 18 JUL 2019 (EDM/BFT), AWR 1753 R9 DATED 17 APR 20(128D GPS), AWR 1738 R6 DATED 18 JAN 2019 (APX-118), AWR 1694 R7 DATED 29 JAN 2020 (DSC),AWR 1682 R25 DATED 01 AUG 2019 (701D TDI), AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/ PDU), AWR 1566 R7 DATED 05 FEB 2019 (HPH CABLE GUARD), AWR 1516 R13 DATED 13 OCT 2020 (ELT EBC-406HM), AWR 1513 R16 DATED 03 NOV								DATE 22 Feb 21		TIME 10:56		ACFT HRS 6098.7			
								ROUNDS		ACTION CODE 6		WUC 00			
ACFT HRS 6055.4								WHEN DISC O		HOW REC O		MAL EFF 1			
								DELAY		WUC 00		TIPIID CURTIS, ANDREW		TI MANHOURS 0.1	
STATUS 		SYS A		DATE 19 Nov 20		NO 2		TIME 13:54		PID CURTIS, ANDREI					
FAULTS/REMARKS OPERATE IAW THE FOLLOWING AWR'S IF APPLICABLE - AWR 1965 R9 DATED 18 MAR 2020 (APPLE IPAD DEVICES), AWR 1930 R12 DATED 17 JAN 2020 (PMI), AWR 1784 R4 DATED 31 JUL 2019 (SHIP BOARD OPS), AWR 1632 R8 DATED 20 JUL 20(ALP LASER POINTER), AWR 1466 R9 DATED 23 AUG 2019 (GARMIN GPS), AWR 1453 R7 DATED 06 JUN 2019 (MCS), AWR 1407 R6 DATED 28 MAY 2020 (DAY HUD), AWR 1309 R13 DATED 30 SEP 2020 (OREGON SEAT CUSHION), AWR 1308 R13 DATED 24 APR 2019 (IRH R5), AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN DRS REMOVED), AWR 1270 R13 DATED 31 AUG 2020(EIBF), AWR 1127 R10 DATED 01 SEP 2020								DATE 22 Feb 21		TIME 10:56		ACFT HRS 6098.7			
								ROUNDS		ACTION CODE 6		WUC 00			
ACFT HRS 6055.4								WHEN DISC O		HOW REC O		MAL EFF 1			
								DELAY		WUC 00		TIPIID CURTIS, ANDREW		TI MANHOURS 0.1	

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 151				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	G CLOSED	SYS A	DATE 26 Nov 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 11 Dec 20	TIME 14:11	ACFT HRS 6060.7						
							ROUNDS	ACTION CODE G		WUC 00						
FAULTS/REMARKS INSP A177 90 DAY REVIEW/UPDATE OF 365-4 ENTRIES FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 14 DEC 2020 REFERENCE: AR 95-1								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								GATHRIGH	F	1.0						
ACFT HRS 6055.4		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	B CLOSED	SYS E	DATE 29 Nov 20	NO 1	TIME 00:00	PID Generated, Com		DATE 02 Dec 20	TIME 08:26	ACFT HRS 6055.4						
							ROUNDS	ACTION CODE J		WUC 00						
FAULTS/REMARKS INSP E220 EMERGENCY LOCATOR TRANSMITTER SELF-TEST (AS REQUIRED) FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6164.6 AIRCRAFT HOURS OR 05 DEC 2020 REFERENCE: AWR 1516 R12								ACTION insp. ok								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.2						
ACFT HRS 6055.4		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	B CLOSED	SYS A	DATE 29 Nov 20	NO 1	TIME 00:00	PID Generated, Com		DATE 02 Dec 20	TIME 08:25	ACFT HRS 6055.4						
							ROUNDS	ACTION CODE J		WUC 00						
FAULTS/REMARKS INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 05 DEC 2020 REFERENCE: TM 11-6140-203-23 P								ACTION insp. ok								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.2						
ACFT HRS 6055.4		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 152				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —		SYS O	DATE 30 Nov 20	NO 1	TIME 00:00	PID Generated, Cor		DATE 03 Dec 20	TIME 13:47	ACFT HRS 6059.2						
FAULTS/REMARKS INSP O801 128D DAFIF AND WAYPOINT UPDATE REQUIRED FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 DEC 2020 REFERENCE: AASF SOP								ACTION DAFIF updated								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								IRISH, T.	F	0.1						
ACFT HRS 6055.4		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS E	DATE 30 Nov 20	NO 1	TIME 00:00	PID Generated, Com		DATE 02 Dec 20	TIME 11:10	ACFT HRS 6055.4						
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 DEC 2020 REFERENCE: TM 11-5821-357-12P								ACTION replaced batteries 5ea								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.3						
ACFT HRS 6055.4		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 01 Dec 20	NO 1	TIME 00:00	PID Generated, Com		DATE 03 Dec 20	TIME 07:47	ACFT HRS 6055.4						
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 DEC 2020 REFERENCE: TM 1-1520-237-23&P								ACTION completed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								COUTURE,	F	0.2						
ACFT HRS 6055.4		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 153			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 01 Dec 20	NO 2	TIME 00:00	PID Generated, Cor			DATE 31 Dec 20	TIME 07:43	ACFT HRS 6068.0					
		ROUNDS	ACTION CODE A			WUC 00									
FAULTS/REMARKS INSP A642 CARGO HOOK CARTRIDGE REPLACEMENT DODIC MJ21 FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 30 JAN 2021 REFERENCE: TB 9-1300-385								ACTION replaced with thruster sn:0931 and squib 0399							
ACFT HRS 6055.4		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00						TIPIID ,			TI MANHOURS				
STATUS —	 SYS E	DATE 02 Dec 20	NO 1	TIME 00:00	PID Generated, Com			DATE 05 Jan 21	TIME 10:50	ACFT HRS 6068.0					
		ROUNDS	ACTION CODE A			WUC 00									
FAULTS/REMARKS INSP E135 AN/ARC-201(V) SINGGARS RADIO HUB BATT REPL FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 07 JAN 2021 REFERENCE: TM 11-5821-333-12								ACTION replaced battery							
ACFT HRS 6055.4		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00						TIPIID ,			TI MANHOURS				
STATUS —	 SYS E	DATE 02 Dec 20	NO 2	TIME 00:00	PID Generated, Com			DATE 05 Jan 21	TIME 10:36	ACFT HRS 6068.0					
		ROUNDS	ACTION CODE L			WUC 00									
FAULTS/REMARKS INSP E801 REPLACEMENT OF AN/ARC-201 (V) BATTERIES (BATTERY BOX) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 07 JAN 2021 REFERENCE: TM11-5821-333-13&P-1								ACTION reinstalled							
ACFT HRS 6055.4		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00						TIPIID ,			TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 154				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	E CLOSED	SYS E	DATE 02 Dec 20	NO 3	TIME 00:00	PID Generated, Cor		DATE 05 Jan 21	TIME 10:46	ACFT HRS 6068.0						
							ROUNDS	ACTION CODE A		WUC 00						
FAULTS/REMARKS INSP E145 AN/ARC-201A(V) SINGGARS HUB BATT REPL FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 07 JAN 2021 REFERENCE: TM 11-5821-333-12								ACTION COMPLETE								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Shaw, M.	F	0.5						
ACFT HRS 6055.4		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY			WUC 00					TIPIID ,			TI MANHOURS					
STATUS —	B CLOSED	SYS A	DATE 02 Dec 20	NO 1	TIME 07:33	PID Generated, Com		DATE 02 Dec 20	TIME 11:08	ACFT HRS 6055.4						
							ROUNDS	ACTION CODE 3		WUC 00						
FAULTS/REMARKS PMD DUE								ACTION insp. complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.2						
ACFT HRS 6055.4		WHEN DISC O	HOW REC G	MAL EFF 2												
DELAY			WUC 00					TIPIID ,			TI MANHOURS					
STATUS —	CLOSED	SYS A	DATE 02 Dec 20	NO 2	TIME 07:33	PID Generated, Com		DATE 02 Dec 20	TIME 08:37	ACFT HRS						
							ROUNDS	ACTION CODE 3		WUC 00						
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	1.0						
ACFT HRS 6055.4		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY			WUC 00					TIPIID ,			TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 155			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 02 Dec 20	NO 3	TIME 07:33	PID Generated, Cor			DATE 02 Dec 20	TIME 08:18	ACFT HRS 6055.4					
		ROUNDS	ACTION CODE 3			WUC 00									
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2								ACTION insp. ok							
ACFT HRS 6055.4	WHEN DISC X	HOW REC G	MAL EFF 1			PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS			
STATUS X	 SYS A	DATE 02 Dec 20	NO 4	TIME 10:30	PID Belyeu, Christop			DATE 02 Dec 20	TIME 10:57	ACFT HRS 6055.4					
		ROUNDS	ACTION CODE E			WUC 00									
FAULTS/REMARKS APU ACCUMULATOR REQUIRES NITROGEN SERVICING								ACTION serviced nitrogen precharge to 1350psi							
ACFT HRS 6055.4	WHEN DISC X	HOW REC G	MAL EFF 1			PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1			
STATUS /	 SYS A	DATE 03 Dec 20	NO 1	TIME 13:44	PID IRISH, TIMOTHY			DATE 04 Dec 20	TIME 10:54	ACFT HRS 6059.2					
		ROUNDS	ACTION CODE A			WUC 19A									
FAULTS/REMARKS Copilots floor mic sticking down when pressed.								ACTION replaced floor switch							
ACFT HRS 6057.2	WHEN DISC G	HOW REC B	MAL EFF 3			PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 156					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —			SYS A	DATE 04 Dec 20		NO 1	TIME 08:30		PID Generated, Cor			DATE 04 Dec 20		TIME 09:28		ACFT HRS 6059.2	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2								ACTION insp. ok									
ACFT HRS 6059.2		WHEN DISC X		HOW REC G		MAL EFF 1		PID Belyeu, C.	CAT F	HRS 0.2	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —			SYS A	DATE 04 Dec 20		NO 2	TIME 08:30		PID Generated, Com			DATE 04 Dec 20		TIME 09:29		ACFT HRS	
FAULTS/REMARKS PMD Due								ACTION COMPLETED									
ACFT HRS 6059.2		WHEN DISC O		HOW REC O		MAL EFF 1		PID Belyeu, C.	CAT F	HRS 1.0	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —			SYS A	DATE 04 Dec 20		NO 3	TIME 08:30		PID Generated, Com			DATE 04 Dec 20		TIME 09:23		ACFT HRS 6059.2	
FAULTS/REMARKS PMD DUE								ACTION insp. ok									
ACFT HRS 6059.2		WHEN DISC O		HOW REC G		MAL EFF 2		PID Belyeu, C.	CAT F	HRS 2.0	PID	CAT	HRS	PID	CAT	HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 157				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	 SYS A	DATE 04 Dec 20	NO 4	TIME 10:55	PID Belyeu, Christop			DATE 04 Dec 20	TIME 10:56	ACFT HRS 6059.2						
		ROUNDS	ACTION CODE J			WUC 19A										
FAULTS/REMARKS moc of co-pilots ics required due to replacement of floor switch								ACTION insp. ok								
ACFT HRS 6059.2		WHEN DISC B	HOW REC M	MAL EFF 1				PID Belyeu, C.	CAT F	HRS 0.2	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 19A				TIPIID ,				TI MANHOURS				
STATUS /	 SYS A	DATE 04 Dec 20	NO 5	TIME 10:57	PID Belyeu, Christop			DATE 11 Jan 21	TIME 13:40	ACFT HRS 6075.0						
		ROUNDS	ACTION CODE E			WUC 00										
FAULTS/REMARKS #2 engine hit check within 5 of upper limit. continue to monitor for next 5 flights								ACTION cleaned white cable connectors rewrote up fault to continue monitor								
ACFT HRS 6059.2		WHEN DISC X	HOW REC G	MAL EFF 1				PID Belyeu, C.	CAT F	HRS 0.3	PID	CAT	HRS	PID	CAT	HRS
DELAY Monitor next 5 flights				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 SYS E	DATE 09 Dec 20	NO 1	TIME 00:01	PID Generated, Com			DATE 16 Dec 20	TIME 00:01	ACFT HRS 6060.7						
		ROUNDS	ACTION CODE			WUC 00										
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 DEC 2020 REFERENCE: TM 11-5810-262-23								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON DEC 16 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
ACFT HRS 6060.7		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 158			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 09 Dec 20	NO 1	TIME 07:39	PID Generated, Cor			DATE 09 Dec 20	TIME 10:45	ACFT HRS					
								ROUNDS	ACTION CODE 3	WUC 00					
FAULTS/REMARKS PMD Due								ACTION COMPLETED							
ACFT HRS 6060.7				WHEN DISC O	HOW REC O	MAL EFF 1									
DELAY				WUC 00				TIPIID ,				TI MANHOURS			
STATUS —	 SYS A	DATE 09 Dec 20	NO 2	TIME 07:40	PID Generated, Com			DATE 09 Dec 20	TIME 10:43	ACFT HRS 6060.7					
								ROUNDS	ACTION CODE 3	WUC 00					
FAULTS/REMARKS PMD DUE								ACTION insp. complete							
ACFT HRS 6060.7				WHEN DISC O	HOW REC G	MAL EFF 2									
DELAY				WUC 00				TIPIID ,				TI MANHOURS			
STATUS —	 SYS A	DATE 09 Dec 20	NO 3	TIME 07:40	PID Generated, Com			DATE 09 Dec 20	TIME 08:59	ACFT HRS 6060.7					
								ROUNDS	ACTION CODE 3	WUC 00					
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2								ACTION insp. ok							
ACFT HRS 6060.7				WHEN DISC X	HOW REC G	MAL EFF 1									
DELAY				WUC 00				TIPIID ,				TI MANHOURS			

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A			3. DATE			4. PAGE 159		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION						
STATUS /	B CLOSED	SYS A	DATE 09 Dec 20	NO 4	TIME 09:02	PID Belyeu, Christop	DATE 09 Dec 20	TIME 11:09	ACFT HRS 6060.7			
FAULTS/REMARKS yellow m/r damper requires servicing						ACTION serviced						
						PID	CAT	HRS	PID	CAT	HRS	
						Belyeu, C.	F	0.2				
ACFT HRS 6060.7		WHEN DISC X	HOW REC G	MAL EFF 1								
DELAY			WUC 00			TIPIID ,			TI MANHOURS			
STATUS X	B CLOSED	SYS A	DATE 09 Dec 20	NO 5	TIME 10:38	PID Belyeu, Christop	DATE 09 Dec 20	TIME 10:47	ACFT HRS 6060.7			
FAULTS/REMARKS tail landing gear lower strutrequires nitrogen servicing						ACTION serviced						
						PID	CAT	HRS	PID	CAT	HRS	
						Belyeu, C.	F	1.0				
ACFT HRS 6060.7		WHEN DISC X	HOW REC G	MAL EFF 1								
DELAY			WUC 00			TIPIID Bender, Thomas			TI MANHOURS 0.2			
STATUS —	B CLOSED	SYS A	DATE 11 Dec 20	NO 1	TIME 00:01	PID Generated, Com	DATE 10 Feb 21	TIME 00:01	ACFT HRS 6098.7			
FAULTS/REMARKS INSP A541 REPLACE DIGITAL CLOCK BATTERY FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 09 FEB 2021 REFERENCE: TM 1-1520-237-23&P						ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON FEB 10 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT						
						PID	CAT	HRS	PID	CAT	HRS	
ACFT HRS 6060.7		WHEN DISC O	HOW REC O	MAL EFF 1								
DELAY			WUC 00			TIPIID ,			TI MANHOURS			

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 160			
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION						
STATUS /	B CLOSED	SYS A	DATE 11 Dec 20	NO 2	TIME 08:32	PID ROXBY, MICHEL			DATE 15 Dec 20	TIME 10:19	ACFT HRS 6060.7	
FAULTS/REMARKS Excessive hydraulic leak from #2 transfer module and lateral primary servos. Hydraulic fluid pooling on deck and present on aft main cabin floor.						ACTION replaced #2 transfer module quick disconnects. Primary servo leaking from scraper seal. See 2408-13-1 fault dated 15 dec 20						
ACFT HRS 6060.7						WHEN DISC T	HOW REC G	MAL EFF 1	PID	CAT	HRS	
DELAY						WUC 07			TIPID ,	TI MANHOURS		
STATUS —	C CLOSED	SYS A	DATE 12 Dec 20	NO 1	TIME 00:01	PID Generated, Com			DATE 16 Dec 20	TIME 00:01	ACFT HRS 6060.7	
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 DEC 2020 REFERENCE: TM 1-1520-237-23						ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON DEC 16 2020 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT						
ACFT HRS 6060.7						WHEN DISC O	HOW REC O	MAL EFF 1	PID	CAT	HRS	
DELAY						WUC 00			TIPID ,	TI MANHOURS		
STATUS —	G CLOSED	SYS A	DATE 12 Dec 20	NO 2	TIME 00:01	PID Generated, Com			DATE 16 Dec 20	TIME 10:28	ACFT HRS 6060.7	
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 18 DEC 2020 REFERENCE: TM 1-1500-344-23						ACTION entered in error						
ACFT HRS 6060.7						WHEN DISC O	HOW REC O	MAL EFF 1	PID	CAT	HRS	
DELAY						WUC 00			TIPID ,	TI MANHOURS		
ACFT HRS 6060.7						WHEN DISC O	HOW REC O	MAL EFF 1	PID	CAT	HRS	
DELAY						WUC 00			TIPID ,	TI MANHOURS		




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 161			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 12 Dec 20	NO 3	TIME 00:01	PID Generated, Cor			DATE 11 Jan 21	TIME 11:55	ACFT HRS 6075.0					
									ROUNDS	ACTION CODE J	WUC 00				
FAULTS/REMARKS INSP A538 FAT/OAT GAUGE INSPECTION/TEST FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 10 FEB 2021 REFERENCE: TM 1-1520-237-23&P								ACTION insp. ok							
ACFT HRS 6060.7		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00				TIPIID ,			TI MANHOURS						
STATUS —	 SYS A	DATE 12 Dec 20	NO 4	TIME 00:01	PID Generated, Com			DATE 16 Dec 20	TIME 10:28	ACFT HRS 6060.7					
									ROUNDS	ACTION CODE G	WUC 00				
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 18 DEC 2020 OR 6085.6 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-23&P								ACTION entered in error							
ACFT HRS 6060.7		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00				TIPIID ,			TI MANHOURS						
STATUS —	 SYS A	DATE 12 Dec 20	NO 5	TIME 00:01	PID Generated, Com			DATE 16 Dec 20	TIME 10:48	ACFT HRS 6060.7					
									ROUNDS	ACTION CODE 3	WUC 00				
FAULTS/REMARKS INSP A100 LH/RH ENGINE HISTORY RECORDER READINGS DUE FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 18 DEC 2020 REFERENCE: DA PAM 738-751								ACTION complete							
ACFT HRS 6060.7		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00				TIPIID ,			TI MANHOURS						




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 162			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 13 Dec 20	NO 1	TIME 00:01	PID Generated, Cor			DATE 12 Jan 21	TIME 13:52	ACFT HRS 6075.0					
		ROUNDS	ACTION CODE G			WUC 00									
FAULTS/REMARKS INSP A530 AIRCRAFT EQUIPMENT INVENTORY (DA FORM 2408-17) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 11 FEB 2021 REFERENCE: DA PAM 738-751								ACTION COMPLETED							
ACFT HRS 6060.7		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00						TIPIID ,			TI MANHOURS				
STATUS X	 SYS A	DATE 15 Dec 20	NO 1	TIME 10:15	PID BISHOP, JEFFERY			DATE 15 Dec 20	TIME 15:25	ACFT HRS 6060.7					
		ROUNDS	ACTION CODE A			WUC 11D01									
FAULTS/REMARKS Lateral primary servo leaking from aft scraper seals.								ACTION replaced lateral servo s/n B303-01146B with new servo s/n B303-04898							
ACFT HRS 6060.7		WHEN DISC K	HOW REC G	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 11D01						TIPIID GATHRIGHT, ANTHONY			TI MANHOURS 0.1				
STATUS —	 SYS A	DATE 15 Dec 20	NO 2	TIME 16:09	PID Generated, Com			DATE 16 Dec 20	TIME 10:38	ACFT HRS 6060.7					
		ROUNDS	ACTION CODE G			WUC 00									
FAULTS/REMARKS Bleed required on #2 and Backup hydraulic systems after replacement of #2 transfer module QDs								ACTION completed							
ACFT HRS 6060.7		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 07						TIPIID ,			TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 163			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 15 Dec 20	NO 3	TIME 16:09	PID Generated, Cor			DATE 16 Dec 20	TIME 10:01	ACFT HRS 6060.7					
		WHEN DISC O	HOW REC O	MAL EFF 1	ROUNDS		ACTION CODE J		WUC 07						
FAULTS/REMARKS Ground run/leak check required for replacment of #2 hydraulic transfer module QDs								ACTION leak check completed with ground hydraulic unit.							
ACFT HRS 6060.7		WHEN DISC O		HOW REC O		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 07		TIPID ,		TI MANHOURS									
STATUS —	 SYS A	DATE 15 Dec 20	NO 4	TIME 16:24	PID Generated, Com			DATE 16 Dec 20	TIME 10:01	ACFT HRS 6060.7					
		WHEN DISC O	HOW REC O	MAL EFF 1	ROUNDS		ACTION CODE J		WUC 07						
FAULTS/REMARKS Full hyd system bleed required for replacement of lateral primary servo								ACTION bleed and service complete							
ACFT HRS 6060.7		WHEN DISC O		HOW REC O		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 11D01		TIPID ,		TI MANHOURS									
STATUS —	 SYS A	DATE 15 Dec 20	NO 5	TIME 16:24	PID Generated, Com			DATE 16 Dec 20	TIME 15:18	ACFT HRS 6061.3					
		WHEN DISC O	HOW REC O	MAL EFF 1	ROUNDS		ACTION CODE 4		WUC 00						
FAULTS/REMARKS MTF required for replacement of lateral primary servo								ACTION MTF complete. Aircraft released for flight							
ACFT HRS 6060.7		WHEN DISC O		HOW REC O		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 11D01		TIPID ,		TI MANHOURS									




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 164			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS X		SYS A	DATE 16 Dec 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 16 Dec 20	TIME 10:48	ACFT HRS 6060.7					
								ROUNDS	ACTION CODE 3	WUC 00					
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 15 DEC 2020 REFERENCE: TM 1-1520-237-23								ACTION complete							
		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS					
		HIGGINS, F		0.2											
ACFT HRS 6060.7	WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID DUFFY, JOSHUA				TI MANHOURS 0.1			
STATUS X		SYS E	DATE 16 Dec 20	NO 1	TIME 00:01	PID Generated, Com		DATE 16 Dec 20	TIME 10:00	ACFT HRS 6060.7					
								ROUNDS	ACTION CODE G	WUC 00					
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 15 DEC 2020 REFERENCE: TM 11-5810-262-23								ACTION insp ok							
		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS					
		BISHOP, J.	F	0.2											
ACFT HRS 6060.7	WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1			
STATUS /		SYS A	DATE 16 Dec 20	NO 2	TIME 08:58	PID BISHOP, JEFFERY		DATE 16 Dec 20	TIME 09:59	ACFT HRS 6060.7					
								ROUNDS	ACTION CODE A	WUC 07					
FAULTS/REMARKS backup pump drain hose on bleed port dry rotted and cracked								ACTION replaced drain hose							
		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS					
		BISHOP, J.	F	0.4											
ACFT HRS 6060.7	WHEN DISC K	HOW REC G	MAL EFF 2												
DELAY				WUC 07				TIPIID ,				TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 165				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	 SYS A	DATE 16 Dec 20	NO 3	TIME 10:05	PID Generated, Cor			DATE 16 Dec 20	TIME 10:24	ACFT HRS 6060.7						
FAULTS/REMARKS PMD DUE								ROUNDS	ACTION CODE G		WUC 00					
								ACTION entered in error								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								BISHOP, J.	F	0.1						
ACFT HRS 6060.7		WHEN DISC O	HOW REC G	MAL EFF 2												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 SYS A	DATE 16 Dec 20	NO 4	TIME 10:05	PID Generated, Com			DATE 16 Dec 20	TIME 10:22	ACFT HRS 6060.7						
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2								ROUNDS	ACTION CODE G		WUC 00					
								ACTION entered in error								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								BISHOP, J.	F	0.1						
ACFT HRS 6060.7		WHEN DISC X	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 SYS A	DATE 16 Dec 20	NO 5	TIME 10:36	PID Generated, Com			DATE 16 Dec 20	TIME 16:07	ACFT HRS 6061.3						
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 18 DEC 2020 REFERENCE: TM 1-1500-344-23								ROUNDS	ACTION CODE G		WUC 00					
								ACTION completed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bender, T.	F	1.0						
ACFT HRS 6060.7		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 166			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 16 Dec 20	NO 6	TIME 10:37	PID Generated, Cor			DATE 16 Dec 20	TIME 10:41	ACFT HRS 6060.7					
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6064.7 AIRCRAFT HOURS OR 18 DEC 2020 REFERENCE: TM 1-1520-237-23&P								ROUNDS	ACTION CODE G		WUC 00				
ACFT HRS 6060.7								WHEN DISC O	HOW REC O	MAL EFF 1					
DELAY				WUC 00				TIPIID ,				TI MANHOURS			
STATUS —	 SYS A	DATE 16 Dec 20	NO 7	TIME 10:43	PID Generated, Com			DATE 17 Dec 20	TIME 15:37	ACFT HRS 6061.3					
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6085.6 AIRCRAFT HOURS OR 18 DEC 2020 REFERENCE: TM 1-1520-237-23&P								ROUNDS	ACTION CODE 5		WUC 00				
ACFT HRS 6060.7								WHEN DISC O	HOW REC O	MAL EFF 1					
DELAY				WUC 00				TIPIID ,				TI MANHOURS			
STATUS —	 SYS A	DATE 17 Dec 20	NO 1	TIME 14:24	PID Generated, Com			DATE 18 Dec 20	TIME 07:53	ACFT HRS 6061.3					
FAULTS/REMARKS PMD DUE								ROUNDS	ACTION CODE 3		WUC 00				
ACFT HRS 6061.3								WHEN DISC O	HOW REC G	MAL EFF 2					
DELAY				WUC 00				TIPIID ,				TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 167		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION				
STATUS —	 B CLOSED	SYS A	DATE 17 Dec 20	NO 2	TIME 14:24	PID Generated, Cor	DATE 17 Dec 20	TIME 15:32	ACFT HRS 6061.3	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2						ACTION completed				
ACFT HRS 6061.3						WHEN DISC X	HOW REC G	MAL EFF 1		
DELAY						WUC 00		TIPIID ,		TI MANHOURS
STATUS —	 C CLOSED	SYS A	DATE 18 Dec 20	NO 1	TIME 07:52	PID Generated, Com	DATE 18 Dec 20	TIME 07:52	ACFT HRS	
FAULTS/REMARKS PMD Due						ACTION COMPLETED				
ACFT HRS 6061.3						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 00		TIPIID ,		TI MANHOURS
STATUS —	 E CLOSED	SYS E	DATE 20 Dec 20	NO 1	TIME 00:00	PID Generated, Com	DATE 05 Jan 21	TIME 08:50	ACFT HRS 6068.0	
FAULTS/REMARKS INSP E155 KY-58 BATTERY REPLACEMENT FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 25 JAN 2021 REFERENCE: TM 11-5810-262-23						ACTION COMPLETE				
ACFT HRS 6061.3						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 00		TIPIID ,		TI MANHOURS
ACFT HRS 6061.3						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 00		TIPIID ,		TI MANHOURS




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 168							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —		SYS E	DATE 20 Dec 20	NO 2	TIME 00:00	PID Generated, Cor		DATE 12 Jan 21	TIME 10:51	ACFT HRS 6075.0									
FAULTS/REMARKS INSP E015 ASN 128D DOPPLER GPS BATTERY REPLACEMENT FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 25 JAN 2021 REFERENCE: MWO 1-1520-237-50-92								ACTION replaced battery					ROUNDS			ACTION CODE A		WUC 00	
ACFT HRS 6061.3				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS —		SYS O	DATE 28 Dec 20	NO 1	TIME 00:00	PID Generated, Com		DATE 04 Jan 21	TIME 00:01	ACFT HRS 6068.0									
FAULTS/REMARKS INSP O801 128D DAFIF AND WAYPOINT UPDATE REQUIRED FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 JAN 2021 REFERENCE: AASF SOP								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JAN 4 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT					ROUNDS			ACTION CODE		WUC 00	
ACFT HRS 6061.3				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS —		SYS A	DATE 28 Dec 20	NO 1	TIME 08:29	PID Generated, Com		DATE 28 Dec 20	TIME 10:38	ACFT HRS 6061.3									
FAULTS/REMARKS PMD DUE								ACTION insp ok					ROUNDS			ACTION CODE 3		WUC 00	
ACFT HRS 6061.3				WHEN DISC O	HOW REC G	MAL EFF 2		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID ,				TI MANHOURS							

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 169				
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION						
STATUS —	B CLOSED	SYS A	DATE 28 Dec 20	NO 2	TIME 08:29	PID Generated, Cor		DATE 28 Dec 20	TIME 10:01	ACFT HRS 6061.3		
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2						ACTION completed						
ACFT HRS 6061.3		WHEN DISC X	HOW REC G	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS
DELAY		WUC 00		TIPIID ,			TI MANHOURS					
STATUS X	D CLOSED	SYS A	DATE 28 Dec 20	NO 3	TIME 10:04	PID BISHOP, JEFFERY		DATE 28 Dec 20	TIME 10:16	ACFT HRS 6061.3		
FAULTS/REMARKS TR gear box oil over serviced						ACTION deserviced to proper level						
ACFT HRS 6061.3		WHEN DISC K	HOW REC G	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS
DELAY		WUC 06G01		TIPIID DUFFY, JOSHUA			TI MANHOURS 0.1					
STATUS —	C CLOSED	SYS A	DATE 28 Dec 20	NO 4	TIME 10:36	PID Generated, Com		DATE 28 Dec 20	TIME 10:36	ACFT HRS		
FAULTS/REMARKS PMD Due						ACTION COMPLETED						
ACFT HRS 6061.3		WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS
DELAY		WUC 00		TIPIID ,			TI MANHOURS					

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 170							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —	B CLOSED	SYS A	DATE 29 Dec 20	NO 1	TIME 00:00	PID Generated, Cor		DATE 11 Jan 21	TIME 13:07	ACFT HRS 6075.0									
FAULTS/REMARKS INSP A501 MAIN ROTOR BLADE SPAR PRESSURE CHECK FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 FEB 2021 REFERENCE: TM 1-1520-237-23&P								ACTION insp. ok					ROUNDS			ACTION CODE J		WUC 00	
ACFT HRS 6061.3		WHEN DISC O	HOW REC O	MAL EFF 1		PID Belyeu, C.		CAT F	HRS 0.2	PID	CAT	HRS	PID	CAT	HRS				
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS —	C CLOSED	SYS E	DATE 29 Dec 20	NO 1	TIME 00:00	PID Generated, Com		DATE 05 Jan 21	TIME 00:01	ACFT HRS 6068.0									
FAULTS/REMARKS INSP E220 EMERGENCY LOCATOR TRANSMITTER SELF-TEST (AS REQUIRED) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6180.4 AIRCRAFT HOURS OR 04 JAN 2021 REFERENCE: AWR 1516 R12								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JAN 5 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT					ROUNDS			ACTION CODE		WUC 00	
ACFT HRS 6061.3		WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS	PID	CAT	HRS				
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS —	B CLOSED	SYS A	DATE 29 Dec 20	NO 2	TIME 00:00	PID Generated, Com		DATE 29 Dec 20	TIME 20:36	ACFT HRS 6066.4									
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 31 DEC 2020 REFERENCE: TM 1-1520-237-23&P								ACTION completed					ROUNDS			ACTION CODE G		WUC 00	
ACFT HRS 6061.3		WHEN DISC O	HOW REC O	MAL EFF 1		PID BISHOP, J.		CAT F	HRS 0.1	PID	CAT	HRS	PID	CAT	HRS				
DELAY				WUC 00				TIPIID ,				TI MANHOURS							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 171							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —		SYS A	DATE 29 Dec 20	NO 3	TIME 00:00	PID Generated, Cor		DATE 05 Jan 21	TIME 00:01	ACFT HRS 6068.0									
FAULTS/REMARKS INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 04 JAN 2021 REFERENCE: TM 11-6140-203-23 P								ROUNDS			ACTION CODE			WUC 00					
ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JAN 5 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								PID		CAT		HRS		PID		CAT		HRS	
ACFT HRS 6061.3								WHEN DISC O		HOW REC O		MAL EFF 1							
DELAY								WUC 00				TI MANHOURS							
STATUS —		SYS E	DATE 30 Dec 20	NO 1	TIME 00:00	PID Generated, Com		DATE 05 Jan 21	TIME 08:53	ACFT HRS 6068.0									
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 05 JAN 2021 REFERENCE: TM 11-5821-357-12P								ROUNDS			ACTION CODE A			WUC 00					
ACTION COMPLETE								PID		CAT		HRS		PID		CAT		HRS	
ACFT HRS 6066.4								WHEN DISC O		HOW REC O		MAL EFF 1							
DELAY								WUC 00				TI MANHOURS							
STATUS —		SYS E	DATE 30 Dec 20	NO 2	TIME 00:00	PID Generated, Com		DATE 01 Mar 21	TIME 00:01	ACFT HRS 6098.7									
FAULTS/REMARKS INSP E320 EMERGENCY LOCATOR TRANSMITTER G-SWITCH (EBC-406HM) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 28 FEB 2021 REFERENCE: AWR 1516 R12								ROUNDS			ACTION CODE			WUC 00					
ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON MAR 1 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								PID		CAT		HRS		PID		CAT		HRS	
ACFT HRS 6066.4								WHEN DISC O		HOW REC O		MAL EFF 1							
DELAY								WUC 00				TI MANHOURS							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 172					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS X		SYS A	DATE 31 Dec 20	NO 1	TIME 00:01	PID Generated, Cor		DATE 31 Dec 20	TIME 13:00	ACFT HRS 6068.0		ROUNDS		ACTION CODE A		WUC 00	
FAULTS/REMARKS ACTUATED DEVICE SERVICE LIFE EXCEEDED ON 31 DEC 2020 FOR CTG IMPULSE CAGE: 30003 PN: 1512AS121 SN: 6886 LOT NUMBER: ESD03F003-001								ACTION replaced with thruster sn:0931 and squib sn:0399									
ACFT HRS 6068		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 16A01A						TIPID GATHRIGHT, ANTHONY				TI MANHOURS 0.1					
STATUS —		SYS A	DATE 01 Jan 21	NO 1	TIME 00:01	PID Generated, Com		DATE 11 Jan 21	TIME 12:01	ACFT HRS 6075.0		ROUNDS		ACTION CODE E		WUC 00	
FAULTS/REMARKS INSP A160 90 DAY CORROSION INSPECTION FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 19 JAN 2021 REFERENCE: TM 1-1520-237-23&P								ACTION completed in conjunction with 40hr insp. ok									
ACFT HRS 6068		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00						TIPID ,				TI MANHOURS					
STATUS X		SYS O	DATE 04 Jan 21	NO 1	TIME 00:01	PID Generated, Com		DATE 07 Jan 21	TIME 21:59	ACFT HRS 6071.8		ROUNDS		ACTION CODE 6		WUC 00	
FAULTS/REMARKS INSP O801 128D DAFIF AND WAYPOINT UPDATE REQUIRED FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 03 JAN 2021 REFERENCE: AASF SOP								ACTION completed									
ACFT HRS 6068		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00						TIPID CHADBOURNE, SCOTT				TI MANHOURS 0.1					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 173							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS X		SYS A	DATE 05 Jan 21	NO 1	TIME 00:01	PID Generated, Cor		DATE 05 Jan 21	TIME 10:55	ACFT HRS 6068.0									
FAULTS/REMARKS INSP A550 REPLACE IVHMU AA LITHIUM BATTERY FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 04 JAN 2021 REFERENCE: AWR1346R25/AWR1823R6								ACTION replaced battery					ROUNDS			ACTION CODE A		WUC 00	
ACFT HRS 6068				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPID EISENHAEUER, JEFFREY				TI MANHOURS 0.1							
STATUS X		SYS E	DATE 05 Jan 21	NO 1	TIME 00:01	PID Generated, Com		DATE 05 Jan 21	TIME 08:34	ACFT HRS 6068.0									
FAULTS/REMARKS INSP E220 EMERGENCY LOCATOR TRANSMITTER SELF-TEST (AS REQUIRED) FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 6180.4 AIRCRAFT HOURS OR 04 JAN 2021 REFERENCE: AWR 1516 R12								ACTION COMPLETE					ROUNDS			ACTION CODE J		WUC 00	
ACFT HRS 6068				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPID EISENHAEUER, JEFFREY				TI MANHOURS 0.1							
STATUS X		SYS A	DATE 05 Jan 21	NO 2	TIME 00:01	PID Generated, Com		DATE 05 Jan 21	TIME 08:33	ACFT HRS 6068.0									
FAULTS/REMARKS INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 04 JAN 2021 REFERENCE: TM 11-6140-203-23 P								ACTION COMPLETE					ROUNDS			ACTION CODE J		WUC 00	
ACFT HRS 6068				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPID EISENHAEUER, JEFFREY				TI MANHOURS 0.1							

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 174					
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION								
STATUS —	E CLOSED	SYS A	DATE 05 Jan 21	NO 3	TIME 07:51	PID Generated, Cor	DATE 05 Jan 21	TIME 10:30	ACFT HRS 6068.0					
							ROUNDS	ACTION CODE 3	WUC 00					
FAULTS/REMARKS PMD Due						ACTION COMPLETE								
						PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
						EISENHAU	F	1.0	Shaw, M.	F	1.0			
ACFT HRS 6068		WHEN DISC O	HOW REC O	MAL EFF 1										
DELAY			WUC 00			TIPIID ,			TI MANHOURS					
STATUS —	E CLOSED	SYS A	DATE 05 Jan 21	NO 4	TIME 07:51	PID Generated, Com	DATE 05 Jan 21	TIME 10:28	ACFT HRS 6068.0					
							ROUNDS	ACTION CODE 3	WUC 00					
FAULTS/REMARKS PMD DUE						ACTION COMPLETE								
						PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
						Shaw, M.	F	0.5						
ACFT HRS 6068		WHEN DISC O	HOW REC G	MAL EFF 2										
DELAY			WUC 00			TIPIID ,			TI MANHOURS					
STATUS —	E CLOSED	SYS A	DATE 05 Jan 21	NO 5	TIME 07:51	PID Generated, Com	DATE 05 Jan 21	TIME 08:03	ACFT HRS 6068.0					
							ROUNDS	ACTION CODE G	WUC 00					
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2						ACTION COMPLETE								
						PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
						EISENHAU	F	1.0						
ACFT HRS 6068		WHEN DISC X	HOW REC G	MAL EFF 1										
DELAY			WUC 00			TIPIID ,			TI MANHOURS					

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 175							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —		E CLOSED SYS A		DATE 05 Jan 21		NO 6		TIME 08:51		PID Generated, Cor		DATE 05 Jan 21		TIME 10:29		ACFT HRS 6068.0			
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 05 JAN 2021. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6072.3 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ACTION COMPLETE											
ACFT HRS 6068		WHEN DISC O		HOW REC O		MAL EFF 1		PID EISENHAU		CAT F		HRS 0.1		PID		CAT		HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS —		E CLOSED SYS A		DATE 05 Jan 21		NO 7		TIME 08:52		PID Generated, Com		DATE 05 Jan 21		TIME 11:06		ACFT HRS 6068.0			
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 05 JAN 2021. INSP A496 CF3BR FIRE EXTINGUISHER WEIGHT TEST INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 12 FEB 2021 REFERENCE: TM 1-1520-237-23&P								ACTION COMPLETE											
ACFT HRS 6068		WHEN DISC O		HOW REC O		MAL EFF 1		PID EISENHAU		CAT F		HRS 0.2		PID		CAT		HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS —		E CLOSED SYS A		DATE 05 Jan 21		NO 8		TIME 10:28		PID Generated, Com		DATE 05 Jan 21		TIME 10:28		ACFT HRS			
FAULTS/REMARKS PMD Due								ACTION COMPLETED											
ACFT HRS 6068		WHEN DISC O		HOW REC O		MAL EFF 1		PID EISENHAU		CAT F		HRS 2.0		PID		CAT		HRS	
DELAY				WUC 00				TIPIID ,				TI MANHOURS							

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 176				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /	B CLOSED	SYS A	DATE 07 Jan 21	NO 1	TIME 11:29	PID Belyeu, Christop		DATE 07 Jan 21	TIME 11:33	ACFT HRS 6068.0						
FAULTS/REMARKS apu accumulator requires precharge servicing backup pump would not shut off								ACTION service nitrogen precharge to 1350psi								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	1.0	Shaw, M.	F	1.0			
ACFT HRS 6068		WHEN DISC G	HOW REC C	MAL EFF 5												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	E CLOSED	SYS A	DATE 07 Jan 21	NO 2	TIME 15:40	PID Generated, Com		DATE 07 Jan 21	TIME 16:07	ACFT HRS 6070.6						
FAULTS/REMARKS PMD Due								ACTION COMPLETE								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.1						
ACFT HRS 6070.6		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	E CLOSED	SYS A	DATE 07 Jan 21	NO 3	TIME 15:41	PID Generated, Com		DATE 07 Jan 21	TIME 16:03	ACFT HRS 6070.6						
FAULTS/REMARKS PMD DUE								ACTION COMPLETE								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	1.0	BISHOP, J.	F	1.0			
ACFT HRS 6070.6		WHEN DISC O	HOW REC G	MAL EFF 2												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 177		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION				
STATUS —		SYS A	DATE 07 Jan 21	NO 4	TIME 15:41	PID Generated, Cor	DATE 07 Jan 21	TIME 15:55	ACFT HRS 6070.6	
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2						ACTION COMPLETE				
ACFT HRS 6070.6		WHEN DISC X	HOW REC G	MAL EFF 1						
DELAY			WUC 00			TIPID ,		TI MANHOURS		
STATUS —		SYS A	DATE 07 Jan 21	NO 5	TIME 15:42	PID Generated, Com	DATE 07 Jan 21	TIME 15:45	ACFT HRS 6070.6	
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 07 JAN 2021. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6079.0 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD						ACTION COMPLETE				
ACFT HRS 6070.6		WHEN DISC O	HOW REC O	MAL EFF 1						
DELAY			WUC 00			TIPID ,		TI MANHOURS		
STATUS —		SYS A	DATE 07 Jan 21	NO 6	TIME 15:42	PID Generated, Com	DATE 07 Jan 21	TIME 15:44	ACFT HRS 6070.6	
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 07 JAN 2021. INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 14 JAN 2021 REFERENCE: TM 1-1520-237-23&P						ACTION COMPLETE				
ACFT HRS 6070.6		WHEN DISC O	HOW REC O	MAL EFF 1						
DELAY			WUC 00			TIPID ,		TI MANHOURS		




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 178				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 07 Jan 21	NO 7	TIME 15:56	PID EISENHAUER, JE		DATE 08 Jan 21	TIME 13:01	ACFT HRS 6070.6						
FAULTS/REMARKS TAIL YOKE LWR WASHER DISBONDED								ACTION replaced washer								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	1.0						
ACFT HRS 6070.6		WHEN DISC X	HOW REC G	MAL EFF 2												
DELAY				WUC 00				TIPID CHADBOURNE, SCOTT			TI MANHOURS 0.1					
STATUS —		SYS A	DATE 07 Jan 21	NO 8	TIME 16:06	PID Generated, Com		DATE 07 Jan 21	TIME 16:06	ACFT HRS						
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	2.0						
ACFT HRS 6070.6		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID ,			TI MANHOURS					
STATUS X		SYS A	DATE 08 Jan 21	NO 1	TIME 10:41	PID EISENHAUER, JE		DATE 08 Jan 21	TIME 12:57	ACFT HRS 6070.6						
FAULTS/REMARKS tail fork bushing elongated								ACTION replaced								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								EISENHAU	F	0.5						
ACFT HRS 6070.6		WHEN DISC X	HOW REC G	MAL EFF 2												
DELAY				WUC 00				TIPID CHADBOURNE, SCOTT			TI MANHOURS 0.1					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 179		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION					
STATUS —		SYS A	DATE 08 Jan 21	NO 3	TIME 21:12	PID Generated, Cor	DATE 08 Jan 21	TIME 21:14	ACFT HRS 6071.8		
FAULTS/REMARKS PMD Due						ACTION generated in error					
ACFT HRS 6071.8						WHEN DISC O	HOW REC O	MAL EFF 1			
DELAY						WUC 00			TI MANHOURS		
STATUS —		SYS A	DATE 08 Jan 21	NO 4	TIME 21:13	PID Generated, Com	DATE 08 Jan 21	TIME 21:49	ACFT HRS 6071.8		
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2						ACTION completed					
ACFT HRS 6071.8						WHEN DISC X	HOW REC G	MAL EFF 1			
DELAY						WUC 00			TI MANHOURS		
STATUS —		SYS A	DATE 08 Jan 21	NO 5	TIME 21:14	PID Generated, Com	DATE 08 Jan 21	TIME 21:35	ACFT HRS 6071.8		
FAULTS/REMARKS PMD DUE						ACTION Completed					
ACFT HRS 6071.8						WHEN DISC O	HOW REC G	MAL EFF 2			
DELAY						WUC 00			TI MANHOURS		




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 180				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	 SYS A	DATE 08 Jan 21	NO 6	TIME 21:58	PID Generated, Cor			DATE 08 Jan 21	TIME 21:58	ACFT HRS						
								ROUNDS	ACTION CODE 3	WUC 00						
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CHADBOU	F	2.0						
ACFT HRS 6071.8		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 SYS A	DATE 09 Jan 21	NO 1	TIME 21:40	PID DURGIN, MIA			DATE 10 Mar 21	TIME 08:11	ACFT HRS 6098.7						
								ROUNDS	ACTION CODE J	WUC 00						
FAULTS/REMARKS There is a light on the ICS box (left side) that is not compatible with NVGS.								ACTION status symbol entered in error								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bartlett, C.	F	0.2						
ACFT HRS 6071.8		WHEN DISC G	HOW REC C	MAL EFF 1												
DELAY w/o submitted 12jan21				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 SYS A	DATE 09 Jan 21	NO 2	TIME 21:47	PID Generated, Com			DATE 11 Jan 21	TIME 11:58	ACFT HRS 6075.0						
								ROUNDS	ACTION CODE 3	WUC 00						
FAULTS/REMARKS INSP A110 PMS 40 HOUR INSPECTION FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6078.8 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMS								ACTION insp. ok								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	1.0						
ACFT HRS 6075		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 181				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	 SYS A	DATE 11 Jan 21	NO 1	TIME 00:00	PID Generated, Cor			DATE 11 Jan 21	TIME 11:59	ACFT HRS 6075.0						
		WHEN DISC O	HOW REC O	MAL EFF 1				ROUNDS	ACTION CODE E	WUC 00						
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 17 JAN 2021 OR 6105.3 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-23&P								ACTION completed in conjunction with 40hr								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	1.0						
ACFT HRS 6075		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 SYS E	DATE 11 Jan 21	NO 1	TIME 00:00	PID Generated, Com			DATE 12 Jan 21	TIME 10:52	ACFT HRS 6075.0						
		WHEN DISC O	HOW REC O	MAL EFF 1				ROUNDS	ACTION CODE J	WUC 00						
FAULTS/REMARKS INSP E125 KY-58 PMCS/OPNL CHECK FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 29 JAN 2021 REFERENCE: TM 11-5810-262-23								ACTION completed insp. ok								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.2						
ACFT HRS 6075		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 SYS A	DATE 11 Jan 21	NO 2	TIME 00:00	PID Generated, Com			DATE 12 Jan 21	TIME 10:52	ACFT HRS 6075.0						
		WHEN DISC O	HOW REC O	MAL EFF 1				ROUNDS	ACTION CODE E	WUC 00						
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 17 JAN 2021 REFERENCE: TM 1-1500-344-23								ACTION completed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	0.5						
ACFT HRS 6075		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 182		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION				
STATUS —	B CLOSED	SYS A	DATE 11 Jan 21	NO 3	TIME 08:05	PID Generated, Cor		DATE 11 Jan 21	TIME 14:24	ACFT HRS 6075.0
FAULTS/REMARKS PMD Due						ACTION insp. ok				
ACFT HRS 6075						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 00		TIPIID ,		TI MANHOURS
STATUS —	B CLOSED	SYS A	DATE 11 Jan 21	NO 4	TIME 08:05	PID Generated, Com		DATE 11 Jan 21	TIME 14:23	ACFT HRS 6075.0
FAULTS/REMARKS PMD DUE						ACTION insp. ok				
ACFT HRS 6075						WHEN DISC O	HOW REC G	MAL EFF 2		
DELAY						WUC 00		TIPIID ,		TI MANHOURS
STATUS —	B CLOSED	SYS A	DATE 11 Jan 21	NO 5	TIME 08:05	PID Generated, Com		DATE 11 Jan 21	TIME 11:53	ACFT HRS 6075.0
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2						ACTION insp. ok				
ACFT HRS 6075						WHEN DISC X	HOW REC G	MAL EFF 1		
DELAY						WUC 00		TIPIID ,		TI MANHOURS
PID						CAT	HRS	HRS		
Belyeu, C.						F	1.0			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 183				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 11 Jan 21	NO 6	TIME 11:03	PID Belyeu, Christop		DATE 16 Mar 21	TIME 16:14	ACFT HRS 6099.2						
FAULTS/REMARKS MACHINE GUN MOUNT GUN ARM (M240) L/H AND R/H RMVD FROM A/C AT 48 LBS MOMENT 13.44 CHART C ENTRY NOT COMPLETED, MUST BE COMPLETED N/L/T 11apr21								ACTION reinstalled								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								HIGGINS, F		0.2						
ACFT HRS 6075		WHEN DISC B		HOW REC G		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 11 Jan 21	NO 8	TIME 15:17	PID Generated, Com		DATE 11 Jan 21	TIME 15:17	ACFT HRS						
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Belyeu, C.	F	2.0						
ACFT HRS 6075		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 12 Jan 21	NO 1	TIME 00:01	PID Generated, Com		DATE 19 Jan 21	TIME 00:00	ACFT HRS 6082.9						
FAULTS/REMARKS INSP A100 LH/RH ENGINE HISTORY RECORDER READINGS DUE FOR HCPTRE UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 18 JAN 2021 REFERENCE: DA PAM 738-751								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JAN 19 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
ACFT HRS 6075		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 184			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS E	DATE 12 Jan 21	NO 1	TIME 00:01	PID Generated, Cor			DATE 12 Jan 21	TIME 10:16	ACFT HRS 6075.0					
		ROUNDS	ACTION CODE J			WUC 00									
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 18 JAN 2021 REFERENCE: TM 11-5810-262-23								ACTION completed insp. ok							
ACFT HRS 6075		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00				TIPIID ,			TI MANHOURS						
STATUS —	 SYS A	DATE 12 Jan 21	NO 2	TIME 00:01	PID Generated, Com			DATE 16 Jan 21	TIME 00:01	ACFT HRS 6082.9					
		ROUNDS	ACTION CODE			WUC 00									
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 JAN 2021 REFERENCE: TM 1-1520-237-23								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON JAN 16 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT							
ACFT HRS 6075		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00				TIPIID ,			TI MANHOURS						
STATUS /	 SYS A	DATE 15 Jan 21	NO 1	TIME 01:51	PID DUNHAM, NICH			DATE 10 Mar 21	TIME 07:52	ACFT HRS 6098.7					
		ROUNDS	ACTION CODE R			WUC 00									
FAULTS/REMARKS Sensor Data Quality Fail. Sensor Status: Caution, IGB Output, Low Freq Intercept -3.04 IGB Output sensor fails data quality. Inspect sensor wiring for connectivity, corrosion, etc. Check accel torque. Replace sensor as last resort.								ACTION IVHMS removed for aircraft turn in							
ACFT HRS 6086.6		WHEN DISC O	HOW REC G	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00				TIPIID ,			TI MANHOURS						




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 185				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 16 Jan 21	NO 1	TIME 00:01	PID Generated, Cor		DATE 19 Jan 21	TIME 11:31	ACFT HRS 6082.9						
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 15 JAN 2021 REFERENCE: TM 1-1520-237-23								ACTION COMPLETED HOURS 682 EVENTS 4287								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								BISHOP, J.	F	0.2						
ACFT HRS 6082.9		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				
STATUS —		SYS E	DATE 17 Jan 21	NO 1	TIME 00:01	PID Generated, Com		DATE 23 Feb 21	TIME 00:00	ACFT HRS 6098.7						
FAULTS/REMARKS INSP E331 UNDER WATER ACOUSTIC BEACON TEST AND CLEAN FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 22 FEB 2021 OR 6497.1 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-23_P								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON FEB 23 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
ACFT HRS 6082.9		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				
STATUS X		SYS A	DATE 19 Jan 21	NO 1	TIME 00:00	PID Generated, Com		DATE 19 Jan 21	TIME 11:28	ACFT HRS 6082.9						
FAULTS/REMARKS INSP A100 LH/RH ENGINE HISTORY RECORDER READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 18 JAN 2021 REFERENCE: DA PAM 738-751								ACTION COMPLETED #1 ENG LCF1 1509 LCF2 10569 INDEX 17918 HOURS 03493 #2 ENG LCF1 744 LCF2 2778 INDEX 3821 HOURS 1996								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								BISHOP, J.	F	0.1						
ACFT HRS 6082.9		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 186		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION					
STATUS —	 SYS A	DATE 19 Jan 21	NO 2	TIME 13:59	PID Generated, Cor	DATE 19 Jan 21	TIME 14:33	ACFT HRS			
							ROUNDS	ACTION CODE 3	WUC 00		
FAULTS/REMARKS PMD Due						ACTION COMPLETED					
						PID	CAT	HRS	PID	CAT	HRS
						Bender, T.	F	2.0			
ACFT HRS 6082.9		WHEN DISC O	HOW REC O	MAL EFF 1							
DELAY			WUC 00			TIPIID ,			TI MANHOURS		
STATUS —	 SYS A	DATE 19 Jan 21	NO 3	TIME 14:00	PID Generated, Com	DATE 19 Jan 21	TIME 15:01	ACFT HRS 6082.9			
							ROUNDS	ACTION CODE 3	WUC 00		
FAULTS/REMARKS PMD DUE						ACTION COMPLETED					
						PID	CAT	HRS	PID	CAT	HRS
						Shaw, M.	F	2.0	Bender, T.	F	2.0
ACFT HRS 6082.9		WHEN DISC O	HOW REC G	MAL EFF 2							
DELAY			WUC 00			TIPIID ,			TI MANHOURS		
STATUS —	 SYS A	DATE 19 Jan 21	NO 4	TIME 14:00	PID Generated, Com	DATE 19 Jan 21	TIME 15:00	ACFT HRS 6082.9			
							ROUNDS	ACTION CODE 3	WUC 00		
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2						ACTION COMPLETED					
						PID	CAT	HRS	PID	CAT	HRS
						Bender, T.	F	1.0	Shaw, M.	F	1.0
ACFT HRS 6082.9		WHEN DISC X	HOW REC G	MAL EFF 1							
DELAY			WUC 00			TIPIID ,			TI MANHOURS		




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 187			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS —	 SYS A	DATE 19 Jan 21	NO 5	TIME 14:43	PID Generated, Cor			DATE 20 Jan 21	TIME 07:40	ACFT HRS 6082.9					
		WHEN DISC O	HOW REC O	MAL EFF 1	ROUNDS		ACTION CODE G		WUC 00						
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-21-ASAM-02 DESCRIPTION: COMPLY WITH H-60-21-ASAM-02, BREEZE EASTERN HOIST PENDANT ASSEMBLY SHOULDER SCREW, BY 04 MARCH 2021. IS DUE: 04 MAR 2021 CALENDAR								ACTION COMPLETED							
ACFT HRS 6082.9		WHEN DISC O		HOW REC O		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00		TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1							
STATUS /	 SYS A	DATE 19 Jan 21	NO 6	TIME 14:49	PID Bender, Thomas			DATE 19 Jan 21	TIME 14:54	ACFT HRS 6082.9					
		WHEN DISC B	HOW REC G	MAL EFF 1	ROUNDS		ACTION CODE A		WUC 00						
FAULTS/REMARKS #1 hydraulic pump drain hose torn and requires replacment								ACTION REPLACED DRAIN LINE							
ACFT HRS 6082.9		WHEN DISC B		HOW REC G		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 07A01		TIPIID ,				TI MANHOURS							
STATUS —	 SYS A	DATE 20 Jan 21	NO 1	TIME 00:00	PID Generated, Com			DATE 22 Mar 21	TIME 00:00	ACFT HRS 6099.2					
		WHEN DISC O	HOW REC O	MAL EFF 1	ROUNDS		ACTION CODE		WUC 00						
FAULTS/REMARKS INSP A117 TAIL GEARBOX OIL SAMPLE FOR TAIL ROTOR GEARBOX ASSY CAGE: 78286 PN: 70358-06600-046 NSN: 1615013765089 SN: A00600437 IS DUE. STATUS WILL UPGRADE TO X ON: 21 MAR 2021 OR 6475.2 AIRCRAFT HOURS REFERENCE: H-60-10-AMAM-11								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON MAR 22 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT							
ACFT HRS 6082.9		WHEN DISC O		HOW REC O		MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS		
DELAY		WUC 00		TIPIID ,				TI MANHOURS							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 188				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —		SYS A	DATE 20 Jan 21	NO 2	TIME 00:00	PID Generated, Cor		DATE 22 Mar 21	TIME 00:00	ACFT HRS 6099.2		ROUNDS		ACTION CODE		WUC 00
FAULTS/REMARKS INSP A211 APU OIL SAMPLE FOR AUXILIARY POWER UNIT CAGE: 55820 PN: 116305-302 NSN: 2835013692818 SN: SPE041123 IS DUE. STATUS WILL UPGRADE TO X ON: 6475.2 AIRCRAFT HOURS OR 21 MAR 2021 REFERENCE: H-60-10-AMAM-11								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON MAR 22 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
ACFT HRS 6082.9	WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 20 Jan 21	NO 3	TIME 00:00	PID Generated, Com		DATE 22 Mar 21	TIME 00:00	ACFT HRS 6099.2		ROUNDS		ACTION CODE		WUC 00
FAULTS/REMARKS INSP A116 INTERMEDIATE GEARBOX OIL SAMPLE FOR INTERMEDIATE GEARBOX CAGE: 78286 PN: 70357-06300-042 NSN: 1680010745152 SN: A005-01881 IS DUE. STATUS WILL UPGRADE TO X ON: 6475.2 AIRCRAFT HOURS OR 21 MAR 2021 REFERENCE: H-60-10-AMAM-11								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON MAR 22 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
ACFT HRS 6082.9	WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 22 Jan 21	NO 1	TIME 07:59	PID Generated, Com		DATE 22 Jan 21	TIME 09:14	ACFT HRS		ROUNDS		ACTION CODE 3		WUC 00
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
ACFT HRS 6086.6	WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 189		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION					
STATUS —	 SYS A	DATE 22 Jan 21	NO 2	TIME 07:59	PID Generated, Cor	DATE 22 Jan 21	TIME 09:16	ACFT HRS 6086.6			
		ROUNDS	ACTION CODE 3			WUC 00					
FAULTS/REMARKS PMD DUE						ACTION insp. ok					
						PID	CAT	HRS	PID	CAT	HRS
						Belyeu, C.	F	0.5	Shaw, M.	F	0.5
ACFT HRS 6086.6		WHEN DISC O	HOW REC G	MAL EFF 2							
DELAY			WUC 00			TIPIID ,			TI MANHOURS		
STATUS —	 SYS A	DATE 22 Jan 21	NO 3	TIME 07:59	PID Generated, Com	DATE 22 Jan 21	TIME 08:24	ACFT HRS 6086.6			
		ROUNDS	ACTION CODE 3			WUC 00					
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2						ACTION insp. ok					
						PID	CAT	HRS	PID	CAT	HRS
						Shaw, M.	F	0.1			
ACFT HRS 6086.6		WHEN DISC X	HOW REC G	MAL EFF 1							
DELAY			WUC 00			TIPIID ,			TI MANHOURS		
STATUS X	 SYS A	DATE 23 Jan 21	NO 1	TIME 10:48	PID MACOMBER, WI	DATE 26 Jan 21	TIME 07:17	ACFT HRS 6086.6			
		ROUNDS	ACTION CODE J			WUC 00					
FAULTS/REMARKS Engine 1 Hit Check Fail. Bad reading.						ACTION IVHMS DATA QUALITY INACCURATE. REFER TO 2408-13-1 DATED 26JAN2021 REQUIRING MANUAL HIT CHECK.					
						PID	CAT	HRS	PID	CAT	HRS
						Belyeu, C.	F	0.2			
ACFT HRS 6086.6		WHEN DISC T	HOW REC G	MAL EFF 5							
DELAY			WUC 00			TIPIID DUNHAM, NICHOLAS			TI MANHOURS 0.2		




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 190				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 26 Jan 21	NO 1	TIME 08:16	PID Belyeu, Christop		DATE 10 Mar 21	TIME 13:59	ACFT HRS 6098.7						
FAULTS/REMARKS #1 ENGINE IVHMS HIT CHECK READINGS INACCURATE. MANUAL HIT CHECK REQUIRED								ACTION IVHMS Removed from aircraft for turn in.								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CURTIS, A.	F	0.1						
ACFT HRS 6086.6		WHEN DISC L		HOW REC D		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS /		SYS A	DATE 26 Jan 21	NO 2	TIME 20:57	PID CHADBOURNE,		DATE 28 Jan 21	TIME 08:29	ACFT HRS 6094.3						
FAULTS/REMARKS ACFT requires fuel before flight								ACTION Serviced								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								LECLAIR, J.	F	0.1						
ACFT HRS 6094.3		WHEN DISC E		HOW REC G		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 27 Jan 21	NO 1	TIME 11:20	PID Generated, Com		DATE 27 Jan 21	TIME 12:06	ACFT HRS 6094.3						
FAULTS/REMARKS PMD DUE								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bender, T.	F	2.0						
ACFT HRS 6094.3		WHEN DISC O		HOW REC G		MAL EFF 2										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A		3. DATE		4. PAGE 191	
PART I - FAULT INFORMATION				PART II - CORRECTING INFORMATION			
STATUS —	 SYS A	DATE 27 Jan 21	NO 2	TIME 11:21	PID Generated, Cor		ACFT HRS 6094.3
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R8 DATED 28 MAR 2019, AND AWR 1823 R9 DATED 22 NOV 2019 SEE DA FORM 2408-13-2				ACTION COMPLETED			
ACFT HRS 6094.3		WHEN DISC X	HOW REC G	MAL EFF 1			
DELAY		WUC 00		TIPID ,		TI MANHOURS	
STATUS —	 SYS A	DATE 27 Jan 21	NO 3	TIME 11:21	PID Generated, Com		ACFT HRS 6094.3
FAULTS/REMARKS PMD Due				ACTION COMPLETED			
ACFT HRS 6094.3		WHEN DISC O	HOW REC O	MAL EFF 1			
DELAY		WUC 00		TIPID ,		TI MANHOURS	
STATUS —	 SYS E	DATE 28 Jan 21	NO 1	TIME 00:00	PID Generated, Com		ACFT HRS 6099.2
FAULTS/REMARKS INSP E222 EMERGENCY LOCATOR TRANSMITTER (ELT) REGISTRATION UPDATE FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 29 MAR 2021 REFERENCE: GEN-16-AMAM-05				ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON MAR 30 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT			
ACFT HRS 6094.3		WHEN DISC O	HOW REC O	MAL EFF 1			
DELAY		WUC 00		TIPID ,		TI MANHOURS	




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 192				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —		SYS O	DATE 28 Jan 21	NO 1	TIME 00:00	PID Generated, Cor		DATE 04 Feb 21	TIME 00:01	ACFT HRS 6098.7						
FAULTS/REMARKS INSP O800 LOGBOOK RECON DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 FEB 2021 REFERENCE: AASF SOP								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON FEB 4 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT			ROUNDS		ACTION CODE		WUC 00	
ACFT HRS 6094.3								WHEN DISC	O	HOW REC	O	MAL EFF		1		
DELAY								WUC		00		TIPIID ,				TI MANHOURS
STATUS X		SYS A	DATE 28 Jan 21	NO 1	TIME 10:59	PID LECLAIR, JOSEPH		DATE 28 Jan 21	TIME 13:43	ACFT HRS 6094.3						
FAULTS/REMARKS APU accumulator would not recharge above 2600, Backup pump would not turn off and APU accum low light did not extinguish								ACTION serviced nitrogen precharge to 1450 psi per WP 212. accumulator charged to 300 psi and tape within range per figure 1 of WP			ROUNDS		ACTION CODE		WUC 07B11	
ACFT HRS 6094.3								WHEN DISC	G	HOW REC	G	MAL EFF		5		
DELAY Accumulator recharged to 2800 after 20 min								WUC		00		TIPIID EISENHAUER, JEFFREY				TI MANHOURS 0.1
STATUS —		SYS E	DATE 29 Jan 21	NO 1	TIME 00:00	PID Generated, Com		DATE 05 Feb 21	TIME 00:01	ACFT HRS 6098.7						
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 04 FEB 2021 REFERENCE: TM 11-5821-357-12P								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON FEB 5 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT			ROUNDS		ACTION CODE		WUC 00	
ACFT HRS 6094.3								WHEN DISC	O	HOW REC	O	MAL EFF		1		
DELAY								WUC		00		TIPIID ,				TI MANHOURS




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 193							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —	 C SYS A	DATE 30 Jan 21	NO 1	TIME 15:08	PID Generated, Cor			DATE 12 Apr 21	TIME 08:49	ACFT HRS 6099.2									
FAULTS/REMARKS INSP A801 PERFORM 40 HOUR VISUAL INSPECTION AS REQUIRED BY AWR 1939 (M-4) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6104.7 AIRCRAFT HOURS REFERENCE: AWR 1939 (M-4)								ACTION insp ok						ROUNDS		ACTION CODE 6		WUC 00	
ACFT HRS 6098.7				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS —	 C SYS E	DATE 01 Feb 21	NO 1	TIME 00:01	PID Generated, Com			DATE 08 Feb 21	TIME 00:01	ACFT HRS 6098.7									
FAULTS/REMARKS INSP E220 EMERGENCY LOCATOR TRANSMITTER SELF-TEST (AS REQUIRED) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6193.0 AIRCRAFT HOURS OR 07 FEB 2021 REFERENCE: AWR 1516 R12								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON FEB 8 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT						ROUNDS		ACTION CODE		WUC 00	
ACFT HRS 6098.7				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS —	 C SYS A	DATE 01 Feb 21	NO 1	TIME 00:01	PID Generated, Com			DATE 08 Feb 21	TIME 00:01	ACFT HRS 6098.7									
FAULTS/REMARKS INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 07 FEB 2021 REFERENCE: TM 11-6140-203-23 P								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON FEB 8 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT						ROUNDS		ACTION CODE		WUC 00	
ACFT HRS 6098.7				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID ,				TI MANHOURS							

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 194					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS E		DATE 01 Feb 21		NO 2		TIME 00:01		PID Generated, Cor		DATE 20 Feb 21		TIME 00:00		ACFT HRS 6098.7	
CLOSED												ROUNDS		ACTION CODE		WUC 00	
FAULTS/REMARKS INSP E040 APR-39 RADAR/LASER WARNING OPNL CHECK, 5841-01-236-8951 FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 19 FEB 2021 REFERENCE: TM 11-5841-294-12								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON FEB 20 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT									
ACFT HRS 6098.7		WHEN DISC O		HOW REC O		MAL EFF 1											
DELAY				WUC 00				TIPID ,				TI MANHOURS					
STATUS —		SYS O		DATE 02 Feb 21		NO 1		TIME 00:01		PID Generated, Com		DATE 09 Feb 21		TIME 00:01		ACFT HRS 6098.7	
CLOSED												ROUNDS		ACTION CODE		WUC 00	
FAULTS/REMARKS INSP O801 128D DAFIF AND WAYPOINT UPDATE REQUIRED FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 08 FEB 2021 REFERENCE: AASF SOP								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON FEB 9 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT									
ACFT HRS 6098.7		WHEN DISC O		HOW REC O		MAL EFF 1											
DELAY				WUC 00				TIPID ,				TI MANHOURS					
STATUS —		SYS A		DATE 03 Feb 21		NO 1		TIME 00:01		PID Generated, Com		DATE 06 Feb 21		TIME 00:01		ACFT HRS 6098.7	
CLOSED												ROUNDS		ACTION CODE		WUC 00	
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 05 FEB 2021 REFERENCE: TM 1-1520-237-23&P								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON FEB 6 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT									
ACFT HRS 6098.7		WHEN DISC O		HOW REC O		MAL EFF 1											
DELAY				WUC 00				TIPID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 195				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 03 Feb 21	NO 2	TIME 14:49	PID EISENHAUER, JE		DATE 11 Mar 21	TIME 09:32	ACFT HRS 6098.7						
FAULTS/REMARKS AUXILARY CABIN HEATER REMOVAL REQUIRED FOR BEST PROGRAM								ACTION removed aux cabin heater								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bartlett, C.	F	5.0						
ACFT HRS 6098.7		WHEN DISC S		HOW REC G		MAL EFF 2										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 04 Feb 21	NO 1	TIME 00:01	PID Generated, Com		DATE 16 Mar 21	TIME 16:05	ACFT HRS 6099.2						
FAULTS/REMARKS INSP A553 AIRCRAFT WEIGHING INVENTORY (365-1) FOR HCPTUR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 05 APR 2021 REFERENCE: AR 95-1								ACTION completed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUFFY, J.	F	0.1						
ACFT HRS 6098.7		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS X		SYS E	DATE 05 Feb 21	NO 1	TIME 00:01	PID Generated, Com		DATE 04 Mar 21	TIME 15:01	ACFT HRS 6098.7						
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTUR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 04 FEB 2021 REFERENCE: TM 11-5821-357-12P								ACTION system removed for best program								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bartlett, C.	F	0.2						
ACFT HRS 6098.7		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID OILER, KENNETH				TI MANHOURS 0.2				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 196				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —	 SYS A	DATE 05 Feb 21	NO 1	TIME 08:42	PID Generated, Cor			DATE 05 Feb 21	TIME 09:15	ACFT HRS 6098.7						
		ROUNDS	ACTION CODE G			WUC 00										
FAULTS/REMARKS SAFETY MESSAGE NUMBER: GEN-21-AMAM-01 DESCRIPTION: COMPLY WITH GEN-21-AMAM-04, AN/AAR 57 CMWS ECU, CMWS DCDU DA FORM 2410 TRACKING REQUIREMENTS BY 04 JUNE 2021. IS DUE: 04 JUN 2021 CALENDAR								ACTION complied with								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								GATHRIGH	F	0.1						
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				
STATUS X	 SYS A	DATE 06 Feb 21	NO 1	TIME 00:01	PID Generated, Com			DATE 11 Mar 21	TIME 09:23	ACFT HRS 6098.7						
		ROUNDS	ACTION CODE 6			WUC 00										
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 05 FEB 2021 REFERENCE: TM 1-1520-237-23P								ACTION Complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CURTIS, A.	F	0.1						
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID CURTIS, ANDREW				TI MANHOURS 0.1				
STATUS —	 SYS E	DATE 06 Feb 21	NO 1	TIME 00:01	PID Generated, Com			DATE 15 Mar 21	TIME 00:00	ACFT HRS 6099.2						
		ROUNDS	ACTION CODE			WUC 00										
FAULTS/REMARKS INSP E351 REPLACE APX-118 TRANSPONDER BATTERY FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 14 MAR 2021 REFERENCE: TM 11-5895-1841-13P								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON MAR 15 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 197				
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION							
STATUS X		SYS E	DATE 08 Feb 21	NO 1	TIME 00:01	PID Generated, Cor			DATE 07 Apr 21	TIME 15:33	ACFT HRS 6099.2		
FAULTS/REMARKS INSP E220 EMERGENCY LOCATOR TRANSMITTER SELF-TEST (AS REQUIRED) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 6193.0 AIRCRAFT HOURS OR 07 FEB 2021 REFERENCE: AWR 1516 R12						ACTION completed, insp ok							
ACFT HRS 6098.7			WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS
DELAY			WUC 00			TIPID CHADBOURNE, SCOTT			TI MANHOURS 0.1				
STATUS X		SYS A	DATE 08 Feb 21	NO 1	TIME 00:01	PID Generated, Com			DATE 10 Mar 21	TIME 13:24	ACFT HRS 6098.7		
FAULTS/REMARKS INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 07 FEB 2021 REFERENCE: TM 11-6140-203-23 P						ACTION COMPLETE INSP OK							
ACFT HRS 6098.7			WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS
DELAY			WUC 00			TIPID GATHRIGHT, ANTHONY			TI MANHOURS 0.2				
STATUS X		SYS O	DATE 09 Feb 21	NO 1	TIME 00:01	PID Generated, Com			DATE 07 Apr 21	TIME 16:53	ACFT HRS 6099.2		
FAULTS/REMARKS INSP O801 128D DAFIF AND WAYPOINT UPDATE REQUIRED FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 08 FEB 2021 REFERENCE: AASF SOP						ACTION updated							
ACFT HRS 6098.7			WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS
DELAY			WUC 00			TIPID COUTURE, ERIC			TI MANHOURS 0.1				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 198						
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION										
STATUS X		SYS A	DATE 10 Feb 21	NO 1	TIME 00:01	PID Generated, Cor		DATE 04 Mar 21	TIME 14:51	ACFT HRS 6098.7		ROUNDS		ACTION CODE A		WUC 08A05		
FAULTS/REMARKS INSP A541 REPLACE DIGITAL CLOCK BATTERY FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 09 FEB 2021 REFERENCE: TM 1-1520-237-23P								ACTION replaced										
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1		PID Bartlett, C.		CAT F	HRS 0.2	PID		CAT	HRS		PID		CAT	HRS
DELAY				WUC 00				TIPIID OILER, KENNETH				TI MANHOURS 0.2						
STATUS —		SYS A	DATE 10 Feb 21	NO 2	TIME 00:01	PID Generated, Com		DATE 17 Feb 21	TIME 00:00	ACFT HRS 6098.7		ROUNDS		ACTION CODE		WUC 00		
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 16 FEB 2021 REFERENCE: TM 1-1500-344-23								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON FEB 17 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT										
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID		CAT	HRS		PID		CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS						
STATUS —		SYS A	DATE 10 Feb 21	NO 3	TIME 00:01	PID Generated, Com		DATE 17 Feb 21	TIME 00:00	ACFT HRS 6098.7		ROUNDS		ACTION CODE		WUC 00		
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 16 FEB 2021 OR 6119.0 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-23P								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON FEB 17 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT										
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1		PID		CAT	HRS	PID		CAT	HRS		PID		CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS						




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 199					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —	 SYS E	DATE 11 Feb 21	NO 1	TIME 00:01	PID Generated, Cor			DATE 18 Feb 21	TIME 00:00	ACFT HRS 6098.7							
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 17 FEB 2021 REFERENCE: TM 11-5810-262-23								ROUNDS			ACTION CODE			WUC 00			
ACFT HRS 6098.7								WHEN DISC	O	HOW REC	O	MAL EFF		1			
DELAY				WUC 00				TIPID ,				TI MANHOURS					
STATUS —	 SYS A	DATE 11 Feb 21	NO 1	TIME 11:59	PID Generated, Com			DATE 11 Feb 21	TIME 12:47	ACFT HRS 6098.7							
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-21-AMAM-02 DESCRIPTION: COMPLY WITH H-60-21-AMAM-02, EXTERNAL HOIST CABLE SET SCREW INSTALL, BY 10 AUG 21. IS DUE: 10 AUG 2021 CALENDAR								ROUNDS			ACTION CODE G			WUC 02			
ACFT HRS 6098.7								WHEN DISC	O	HOW REC	O	MAL EFF		1			
DELAY				WUC 00				TIPID DUFFY, JOSHUA				TI MANHOURS 0.1					
STATUS —	 SYS A	DATE 12 Feb 21	NO 1	TIME 00:01	PID Generated, Com			DATE 17 Feb 21	TIME 10:48	ACFT HRS 6098.7							
FAULTS/REMARKS INSP A100 LH/RH ENGINE HISTORY RECORDER READINGS DUE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 18 FEB 2021 REFERENCE: DA PAM 738-751								ROUNDS			ACTION CODE 1			WUC 00			
ACFT HRS 6098.7								WHEN DISC	O	HOW REC	O	MAL EFF		1			
DELAY				WUC 00				TIPID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 200																					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION																									
STATUS —		SYS A	DATE 12 Feb 21	NO 2	TIME 00:01	PID Generated, Cor		DATE 16 Feb 21	TIME 00:00	ACFT HRS 6098.7		ROUNDS		ACTION CODE		WUC 00																	
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 FEB 2021 REFERENCE: TM 1-1520-237-23								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON FEB 16 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT																									
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1				TIPID ,		TI MANHOURS																							
DELAY	WUC 00							DATE 17 Feb 21		TIME 10:47	ACFT HRS 6098.7		ROUNDS		ACTION CODE 1		WUC 00																
STATUS X		SYS A	DATE 16 Feb 21	NO 1	TIME 00:00	PID Generated, Com		ACTION completed																									
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 15 FEB 2021 REFERENCE: TM 1-1520-237-23								<table border="1"> <thead> <tr> <th>PID</th> <th>CAT</th> <th>HRS</th> <th>PID</th> <th>CAT</th> <th>HRS</th> <th>PID</th> <th>CAT</th> <th>HRS</th> </tr> </thead> <tbody> <tr> <td>Bender, T.</td> <td>F</td> <td>0.2</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </tbody> </table>								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	Bender, T.	F	0.2						
PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS																									
Bender, T.	F	0.2																															
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1				TIPID DUFFY, JOSHUA		TI MANHOURS 0.1																							
DELAY	WUC 00							DATE 13 Mar 21		TIME 00:00	ACFT HRS 6099.2		ROUNDS		ACTION CODE		WUC 00																
STATUS —		SYS A	DATE 16 Feb 21	NO 2	TIME 00:00	PID Generated, Com		ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON MAR 13 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT																									
FAULTS/REMARKS INSP A230 INSPECT BATTERY COMPARTMENT FOR CORROSION (SLAB) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 12 MAR 2021 REFERENCE: MWO 1-1520-237-50-77								<table border="1"> <thead> <tr> <th>PID</th> <th>CAT</th> <th>HRS</th> <th>PID</th> <th>CAT</th> <th>HRS</th> <th>PID</th> <th>CAT</th> <th>HRS</th> </tr> </thead> <tbody> <tr> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </tbody> </table>								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS									
PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS																									
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1				TIPID ,		TI MANHOURS																							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 201				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 17 Feb 21	NO 1	TIME 00:00	PID Generated, Cor		DATE 10 Mar 21	TIME 11:07	ACFT HRS 6098.7						
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 16 FEB 2021 OR 6119.0 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-23P								ACTION COMPLETE								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								MCGRAW,	F	0.4	JACKSON,	F	0.4	GAGNE, A,	F	0.4
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID GATHRIGHT, ANTHONY				TI MANHOURS 0.2				
STATUS X		SYS A	DATE 17 Feb 21	NO 2	TIME 00:00	PID Generated, Com		DATE 10 Mar 21	TIME 11:04	ACFT HRS 6098.7						
FAULTS/REMARKS INSP A103 AIRCRAFT WASH DUE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 16 FEB 2021 REFERENCE: TM 1-1500-344-23								ACTION WASH COMPLETE								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								GAGNE, A,	F	0.5	JACKSON,	F	0.5	MCGRAW,	F	0.5
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID GATHRIGHT, ANTHONY				TI MANHOURS 0.2				
STATUS X		SYS E	DATE 18 Feb 21	NO 1	TIME 00:00	PID Generated, Com		DATE 04 Mar 21	TIME 14:52	ACFT HRS 6098.7						
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 17 FEB 2021 REFERENCE: TM 11-5810-262-23								ACTION removed from aircraft for best program								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bartlett, C,	F	0.1						
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID OILER, KENNETH				TI MANHOURS 0.2				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 202					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS X		SYS E	DATE 20 Feb 21	NO 1	TIME 00:00	PID Generated, Cor		DATE 04 Mar 21	TIME 00:00	ACFT HRS 6098.7		ROUNDS		ACTION CODE H		WUC 02	
FAULTS/REMARKS INSP E040 APR-39 RADAR/LASER WARNING OPNL CHECK, 5841-01-236-8951 FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 19 FEB 2021 REFERENCE: TM 11-5841-294-12								ACTION system removed from aircraft for best program									
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00						TIPIID CHADBOURNE, SCOTT				TI MANHOURS 0.1					
STATUS —		SYS E	DATE 22 Feb 21	NO 1	TIME 00:00	PID Generated, Com		DATE 31 Mar 21	TIME 00:01	ACFT HRS 6099.2		ROUNDS		ACTION CODE		WUC 00	
FAULTS/REMARKS INSP E802 KY-100 BATTERY REPLACEMENT FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 30 MAR 2021 REFERENCE: TM 11-5810-398-10								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON MAR 31 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT									
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00						TIPIID ,				TI MANHOURS					
STATUS X		SYS E	DATE 23 Feb 21	NO 1	TIME 00:00	PID Generated, Com		DATE 04 Mar 21	TIME 15:19	ACFT HRS 6098.7		ROUNDS		ACTION CODE R		WUC 08F01	
FAULTS/REMARKS INSP E331 UNDER WATER ACOUSTIC BEACON TEST AND CLEAN FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 22 FEB 2021 OR 6497.1 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-23_P								ACTION system removed for best program									
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00						TIPIID OILER, KENNETH				TI MANHOURS 0.2					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 203					
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 23 Feb 21	NO 1	TIME 15:35	PID Bartlett, Christo			DATE 04 Mar 21	TIME 15:14	ACFT HRS 6098.7			
FAULTS/REMARKS CONFIGURE AIRCRAFT FOR BEST PROGRAM						ACTION completed								
ACFT HRS 6098.7						WHEN DISC K	HOW REC G	MAL EFF 1	PID Bartlett, C.	CAT F	HRS 0.2	PID	CAT	HRS
DELAY						WUC 00			TIPID OILER, KENNETH			TI MANHOURS 0.2		
STATUS —		SYS A	DATE 24 Feb 21	NO 1	TIME 00:00	PID Generated, Com			DATE 15 Mar 21	TIME 00:00	ACFT HRS 6099.2			
FAULTS/REMARKS INSP A177 90 DAY REVIEW/UPDATE OF 365-4 ENTRIES FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 14 MAR 2021 REFERENCE: AR 95-1						ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON MAR 15 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
ACFT HRS 6098.7						WHEN DISC O	HOW REC O	MAL EFF 1	PID	CAT	HRS	PID	CAT	HRS
DELAY						WUC 00			TIPID ,			TI MANHOURS		
STATUS —		SYS A	DATE 25 Feb 21	NO 1	TIME 14:05	PID Generated, Com			DATE 25 Feb 21	TIME 16:58	ACFT HRS 6098.7			
FAULTS/REMARKS SAFETY MESSAGE NUMBER: GEN-21-AMAM-05 DESCRIPTION: COMPLY WITH GEN-21-AMAM-05, AN/AVR-2B LASER DETECTION SYSTEM DA FORM 2410 TRACKING REQUIREMENT, BY 23 JUNE 2021. IS DUE: 23 JUN 2021 CALENDAR						ACTION COMPLIED WITH, LDS COMPONENTS NOT INSTALLED AND/OR LISTED ON 2408-16 (AIRCRAFT COMPONENT HISTORICAL RECORD)								
ACFT HRS 6098.7						WHEN DISC O	HOW REC O	MAL EFF 1	PID DUFFY, J.	CAT F	HRS 0.1	PID	CAT	HRS
DELAY						WUC 00			TIPID DUFFY, JOSHUA			TI MANHOURS 0.1		




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 204				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 25 Feb 21	NO 2	TIME 19:05	PID Bartlett, Christo		DATE 16 Mar 21	TIME 16:01	ACFT HRS 6099.2						
FAULTS/REMARKS APR-39 SYSTEM TO INCLUDE PROCESSOR, 2 RECEIVERS, 5 ANT, RCU, AND DISPLAY UNIT RMVD FROM A/C AT 14.7 LBS MOMENT 4.24 CHART C ENTRY NOT COMPLETED								ACTION UPDATED CHART A, CHART C, AND FORM F's								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUFFY, J.	F	0.1						
ACFT HRS 6098.7		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS /		SYS A	DATE 25 Feb 21	NO 3	TIME 19:40	PID Bartlett, Christo		DATE 16 Mar 21	TIME 15:55	ACFT HRS 6099.2						
FAULTS/REMARKS ARC 220 SYSTEM TO INCLUDE HF AMP, RT-1749, AND CDU RMVD FROM A/C AT 33.4 LBS MOMENT 15.09 CHART C ENTRY NOT COMPLETED								ACTION UPDATED CHART A, CHART C, AND FORM F's								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUFFY, J.	F	0.1						
ACFT HRS 6098.7		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS X		SYS A	DATE 25 Feb 21	NO 4	TIME 19:44	PID Bartlett, Christo		DATE 25 Feb 21	TIME 19:48	ACFT HRS 6098.7						
FAULTS/REMARKS ARC 201 SINGARS SYSTEM TO INCLUDE (2) RT 1477, CONTROL HEAD, CDU, AND AM-7189A RMVD FROM A/C AT 28.6 LBS MOMENT 8.94. CHART C ENTRY NOT COMPLETED								ACTION ENTERED IN ERROR. WRONG STATUS SYMBOL								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bartlett, C.	F	0.1						
ACFT HRS 6098.7		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID OILER, KENNETH				TI MANHOURS 0.2				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 205				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 25 Feb 21	NO 5	TIME 19:49	PID Bartlett, Christo		DATE 16 Mar 21	TIME 15:55	ACFT HRS 6099.2						
FAULTS/REMARKS ARC 201 SINGARS SYSTEM TO INCLUDE (2) RT 1477, CONTROL HEAD, CDU, AND AM-7189A RMVD FROM A/C AT 28.6 LBS MOMENT 8.94. CHART C ENTRY NOT COMPLETED								ACTION UPDATED CHART A, CHART C, AND FORM F's								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUFFY, J.	F	0.1						
ACFT HRS 6098.7		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				
STATUS /		SYS A	DATE 25 Feb 21	NO 6	TIME 19:50	PID Bartlett, Christo		DATE 16 Mar 21	TIME 15:59	ACFT HRS 6099.2						
FAULTS/REMARKS BFT PALLET RMVD FROM A/C 24 LBS MOMENT 5.69. CHART C ENTRY NOT COMPLETED								ACTION UPDATED CHART A, CHART C, AND FORM F's								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUFFY, J.	F	0.1						
ACFT HRS 6098.7		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPID ,				TI MANHOURS				
STATUS X		SYS E	DATE 01 Mar 21	NO 1	TIME 00:01	PID Generated, Com		DATE 08 Apr 21	TIME 07:55	ACFT HRS 6099.2						
FAULTS/REMARKS INSP E320 EMERGENCY LOCATOR TRANSMITTER G-SWITCH (EBC-406HM) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 28 FEB 2021 REFERENCE: AWR 1516 R12								ACTION tested								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bartlett, C.	F	0.2						
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPID GATHRIGHT, ANTHONY				TI MANHOURS 0.1				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 206				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 02 Mar 21	NO 1	TIME 12:56	PID Bartlett, Christo		DATE 16 Mar 21	TIME 16:00	ACFT HRS 6099.2						
FAULTS/REMARKS KY-100 RMVD FROM A/C AT 6.0 LBS MOMENT 1.47 . CHART C ENTRY NOT COMPLETE								ACTION UPDATED CHART A, CHART C, AND FORM F's								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUFFY, J.	F	0.1						
ACFT HRS 6098.7		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TI MANHOURS								
STATUS /		SYS A	DATE 02 Mar 21	NO 2	TIME 12:59	PID Bartlett, Christo		DATE 16 Mar 21	TIME 16:02	ACFT HRS 6099.2						
FAULTS/REMARKS H.U.D. SYSTEM TO INCLUDE HUD SDC AND HUD RCU RMVD FROM A/C AT 15.7 LBS MOMENT 2.91 . CHART C ENTRY NOT COMPLETED								ACTION UPDATED CHART A, CHART C, AND FORM F's								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUFFY, J.	F	0.1						
ACFT HRS 6098.7		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TI MANHOURS								
STATUS /		SYS A	DATE 02 Mar 21	NO 3	TIME 13:09	PID Bartlett, Christo		DATE 02 Mar 21	TIME 13:11	ACFT HRS 6098.7						
FAULTS/REMARKS IVHMU SYSTEM TO INCLUDE RDC, DTU, CDU, AND DIGITAL COMPUTER								ACTION ENTERED IN ERROR								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bartlett, C.	F	0.2						
ACFT HRS 6098.7		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TI MANHOURS								




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A			3. DATE			4. PAGE 207		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION						
STATUS /		SYS A	DATE 02 Mar 21	NO 4	TIME 13:11	PID Bartlett, Christo	DATE 16 Mar 21	TIME 15:53	ACFT HRS 6099.2			
FAULTS/REMARKS IVHMU SYSTEM TO INCLUDE RDC, CDU, DTU AND DIGITAL COMPUTER RMVD FROM A/C AT 30.2 LBS MOMENT 11.64 . CHART C ENTRY NOT COMPLETED						ACTION UPDATED CHART A, CHART C, AND FORM F's						
ACFT HRS 6098.7						WHEN DISC K	HOW REC G	MAL EFF 1				
DELAY						WUC 00			TI MANHOURS			
STATUS /		SYS A	DATE 02 Mar 21	NO 6	TIME 13:17	PID Bartlett, Christo	DATE 16 Mar 21	TIME 15:58	ACFT HRS 6099.2			
FAULTS/REMARKS KY-58 SYSTEM TO INCLUDE 2 KY-58 RCUS, AND 2 KY-58 TSEC CONTROL HEADS RMVD FROM A/C AT 13.8 LBS MOMENT 2.76 . CHART C ENTRY NOT COMPLETED						ACTION UPDATED CHART A, CHART C, AND FORM F's						
ACFT HRS 6098.7						WHEN DISC K	HOW REC G	MAL EFF 1				
DELAY						WUC 00			TI MANHOURS			
STATUS /		SYS A	DATE 02 Mar 21	NO 7	TIME 13:25	PID Bartlett, Christo	DATE 16 Mar 21	TIME 15:56	ACFT HRS 6099.2			
FAULTS/REMARKS AHRU FOGS SYSTEM TO INCLUDE AHRU GYRO AND CONTROL UNIT RMVD FROM A/C 8.0 LBS MOMENT 1.49 . CHART C ENTRY NOT COMPLETED						ACTION UPDATED CHART A, CHART C, AND FORM F's						
ACFT HRS 6098.7						WHEN DISC K	HOW REC G	MAL EFF 1				
DELAY						WUC 00			TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 208				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS /		SYS A	DATE 02 Mar 21	NO 8	TIME 14:16	PID Bartlett, Christo		DATE 16 Mar 21	TIME 15:54	ACFT HRS 6099.2						
FAULTS/REMARKS CMWS SYSTEM TO INCLUDE CHAFF CONTROLLER, JETTISON PANEL, CONTROL HEAD AND #2 AND 3 CHAFF PAYLOAD MODULE RMVD FROM A/C AT 12.6 LBS MOMENT 4.98. CHART C ENTRY NOT COMPLETED								ACTION UPDATED CHART A, CHART C, AND FORM F's								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUFFY, J.	F	0.1						
ACFT HRS 6098.7		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS /		SYS A	DATE 02 Mar 21	NO 9	TIME 14:23	PID Bartlett, Christo		DATE 16 Mar 21	TIME 15:58	ACFT HRS 6099.2						
FAULTS/REMARKS LEGACY SYSTEM TO INCLUDE DISPLACEMENT GYRO, RATE GRYO, DIRECTIONAL GYRO AND COMPASS CONTROL INSTALLED TO A/C AT 15.1 LBS MOMENT 2.8. CHART C ENTRY NO COMPLETED								ACTION UPDATED CHART A, CHART C, AND FORM F's								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUFFY, J.	F	0.1						
ACFT HRS 6098.7		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS /		SYS A	DATE 02 Mar 21	NO 10	TIME 15:32	PID Bartlett, Christo		DATE 16 Mar 21	TIME 15:56	ACFT HRS 6099.2						
FAULTS/REMARKS AUX CABIN HEATER TO INCLUDE TEMP CONTROLLER, LH AND RH SIDEWALL HEATER DUCT, LH AND RH HEATER DUCT ELBOW, HEATER CROSS DUCT, HEATER Y DUCT, LH HEATER CEILING DUCT, LH AND RH SIDEWALL HEATER DUCT AND AUXILIARY CABIN HEATER ASSEMBLY RMV FROM A/C AT 128 LBS MOMENT 49.54 . CHART C ENTRY NOT COMPLETED								ACTION UPDATED CHART A, CHART C, AND FORM F's								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								DUFFY, J.	F	0.1						
ACFT HRS 6098.7		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 209				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS A	DATE 08 Mar 21	NO 1	TIME 09:32	PID MCGRAW, ALEX		DATE 09 Mar 21	TIME 07:56	ACFT HRS 6098.7						
FAULTS/REMARKS CENTER CABBIN FLOOR REQUIRES REMOVAL								ACTION reinstalled								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								MCGRAW,	F	1.5						
ACFT HRS 6098.7		WHEN DISC K		HOW REC G		MAL EFF 2										
DELAY				WUC 02B05				TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.2				
STATUS —		SYS A	DATE 09 Mar 21	NO 1	TIME 09:35	PID Generated, Com		DATE 09 Mar 21	TIME 13:34	ACFT HRS						
FAULTS/REMARKS PMD Due								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								MCGRAW,	F	2.0						
ACFT HRS 6098.7		WHEN DISC O		HOW REC O		MAL EFF 1										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS —		SYS A	DATE 09 Mar 21	NO 2	TIME 09:36	PID Generated, Com		DATE 09 Mar 21	TIME 14:15	ACFT HRS 6098.7						
FAULTS/REMARKS PMD DUE								ACTION complete								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								MCGRAW,	F	1.0						
ACFT HRS 6098.7		WHEN DISC O		HOW REC G		MAL EFF 2										
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 210				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS —		SYS A	DATE 09 Mar 21	NO 3	TIME 09:36	PID Generated, Cor		DATE 09 Mar 21	TIME 13:37	ACFT HRS 6098.7						
								ROUNDS	ACTION CODE 3	WUC 02						
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R12 DATED 14 JAN 20, AWR 1516 R14 DATED 19 FEB 21, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 20, AWR 1800 R8 DATED 28 MAR 19, AND AWR 1823 R9 DATED 22 NOV 19 SEE DA FORM 2408-13-2.								ACTION INSP COMPLETE								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								MCGRAW,	F	1.0						
ACFT HRS 6098.7		WHEN DISC X	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				
STATUS X		SYS A	DATE 09 Mar 21	NO 4	TIME 12:50	PID MCGRAW, ALEX		DATE 09 Mar 21	TIME 13:10	ACFT HRS 6098.7						
								ROUNDS	ACTION CODE A	WUC 02						
FAULTS/REMARKS ELETROSTATIC DISCHARGE CABLE ON L/H SIDE OF STABILATOR FOUND BROKEN								ACTION REPLACED STATIC DISCHARGE WIRE ASSY								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Pacheco, J	F	0.5						
ACFT HRS 6098.7		WHEN DISC B	HOW REC G	MAL EFF 1												
DELAY				WUC 02				TIPIID DUFFY, JOSHUA				TI MANHOURS 0.1				
STATUS —		SYS A	DATE 10 Mar 21	NO 2	TIME 07:47	PID CURTIS, ANDREI		DATE 11 Mar 21	TIME 13:16	ACFT HRS 6099.2						
								ROUNDS	ACTION CODE 4	WUC 00						
FAULTS/REMARKS Limited MTF required due to demodification back to legacy vertical gyros and ASN-43.								ACTION MTF Complete. Aircraft released for flight								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								CURTIS, A	F	3.0						
ACFT HRS 6098.7		WHEN DISC K	HOW REC G	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A		3. DATE		4. PAGE 211	
PART I - FAULT INFORMATION				PART II - CORRECTING INFORMATION			
STATUS —	 M SYS A	DATE 10 Mar 21	NO 4	TIME 10:26	PID Generated, Cor		ACFT HRS 6098.7
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 10 MAR 2021. INSP A160 90 DAY CORROSION INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 19 APR 2021 REFERENCE: TM 1-1520-237-23P		DATE 10 Mar 21		TIME 13:26		ACFT HRS 6098.7	
ACTION COMPLETE		ROUNDS		ACTION CODE G		WUC 02	
ACFT HRS 6098.7		WHEN DISC O	HOW REC O	MAL EFF 1			
DELAY		WUC 00		TIPIID ,		TI MANHOURS	
STATUS —	 C SYS A	DATE 12 Mar 21	NO 1	TIME 00:01	PID Generated, Com		ACFT HRS 6099.2
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 MAR 2021 REFERENCE: TM 1-1520-237-23		DATE 16 Mar 21		TIME 00:00		ACFT HRS 6099.2	
ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON MAR 16 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT		ROUNDS		ACTION CODE		WUC 00	
ACFT HRS 6099.2		WHEN DISC O	HOW REC O	MAL EFF 1			
DELAY		WUC 00		TIPIID ,		TI MANHOURS	
STATUS X	 C SYS A	DATE 13 Mar 21	NO 1	TIME 00:00	PID Generated, Com		ACFT HRS 6099.2
FAULTS/REMARKS INSP A230 INSPECT BATTERY COMPARTMENT FOR CORROSION (SLAB) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 12 MAR 2021 REFERENCE: MWO 1-1520-237-50-77		DATE 07 Apr 21		TIME 15:03		ACFT HRS 6099.2	
ACTION completed		ROUNDS		ACTION CODE 1		WUC 00	
ACFT HRS 6099.2		WHEN DISC O	HOW REC O	MAL EFF 1			
DELAY		WUC 00		TIPIID CHADBOURNE, SCOTT		TI MANHOURS 0.1	




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 212					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A	DATE 13 Mar 21	NO 2	TIME 00:00	PID Generated, Cor		DATE 15 Mar 21	TIME 11:28	ACFT HRS 6099.2		ROUNDS		ACTION CODE 1		WUC 00	
FAULTS/REMARKS INSP A100 LH/RH ENGINE HISTORY RECORDER READINGS DUE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 19 MAR 2021 REFERENCE: DA PAM 738-751								ACTION COMPLETED									
ACFT HRS 6099.2		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00						TIPIID ,				TI MANHOURS					
STATUS X		SYS E	DATE 15 Mar 21	NO 1	TIME 00:00	PID Generated, Com		DATE 08 Apr 21	TIME 07:56	ACFT HRS 6099.2		ROUNDS		ACTION CODE A		WUC 00	
FAULTS/REMARKS INSP E351 REPLACE APX-118 TRANSPONDER BATTERY FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 14 MAR 2021 REFERENCE: TM 11-5895-1841-13P								ACTION replaced battery									
ACFT HRS 6099.2		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00						TIPIID GATHRIGHT, ANTHONY				TI MANHOURS 0.1					
STATUS X		SYS A	DATE 15 Mar 21	NO 1	TIME 00:00	PID Generated, Com		DATE 16 Mar 21	TIME 15:52	ACFT HRS 6099.2		ROUNDS		ACTION CODE G		WUC 02	
FAULTS/REMARKS INSP A177 90 DAY REVIEW/UPDATE OF 365-4 ENTRIES FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 14 MAR 2021 REFERENCE: AR 95-1								ACTION COMPLETED									
ACFT HRS 6099.2		WHEN DISC O	HOW REC O	MAL EFF 1				PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS	
DELAY		WUC 00						TIPIID DUFFY, JOSHUA				TI MANHOURS 0.1					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 213			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS X		SYS A	DATE 16 Mar 21	NO 1	TIME 00:00	PID Generated, Cor	DATE 16 Mar 21			TIME 11:27			ACFT HRS 6099.2		
							ROUNDS			ACTION CODE 1			WUC 00		
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 15 MAR 2021 REFERENCE: TM 1-1520-237-23								ACTION COMPLETED							
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT
ACFT HRS 6099.2								WEN DISC	O	HOW REC	O	MAL EFF 1			
DELAY				WUC 00				TIPIID DUFFY, JOSHUA				TI MANHOURS 0.1			
STATUS X		SYS A	DATE 22 Mar 21	NO 1	TIME 00:00	PID Generated, Com	DATE 07 Apr 21			TIME 16:58			ACFT HRS 6099.2		
							ROUNDS			ACTION CODE 3			WUC 00		
FAULTS/REMARKS INSP A211 APU OIL SAMPLE FOR AUXILIARY POWER UNIT CAGE: 55820 PN: 116305-302 NSN: 2835013692818 SN: SPE041123 WAS DUE. STATUS UPGRADED TO X ON: 21 MAR 2021 OR 6475.2 AIRCRAFT HOURS REFERENCE: H-60-10-AMAM-11								ACTION completed							
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT
ACFT HRS 6099.2								WEN DISC	O	HOW REC	O	MAL EFF 1			
DELAY				WUC 00				TIPIID CHADBOURNE, SCOTT				TI MANHOURS 0.1			
STATUS X		SYS A	DATE 22 Mar 21	NO 2	TIME 00:00	PID Generated, Com	DATE 07 Apr 21			TIME 17:16			ACFT HRS 6099.2		
							ROUNDS			ACTION CODE 3			WUC 00		
FAULTS/REMARKS INSP A117 TAIL GEARBOX OIL SAMPLE FOR TAIL ROTOR GEARBOX ASSY CAGE: 78286 PN: 70358-06600-046 NSN: 1615013765089 SN: A00600437 WAS DUE. STATUS UPGRADED TO X ON: 21 MAR 2021 OR 6475.2 AIRCRAFT HOURS REFERENCE: H-60-10-AMAM-11								ACTION completed							
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT
ACFT HRS 6099.2								WEN DISC	O	HOW REC	O	MAL EFF 1			
DELAY				WUC 00				TIPIID CHADBOURNE, SCOTT				TI MANHOURS 0.1			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428			2. MODEL UH-60A			3. DATE			4. PAGE 214			
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION						
STATUS X		SYS A	DATE 22 Mar 21	NO 3	TIME 00:00	PID Generated, Cor			DATE 07 Apr 21	TIME 17:13	ACFT HRS 6099.2	
FAULTS/REMARKS INSP A116 INTERMEDIATE GEARBOX OIL SAMPLE FOR INTERMEDIATE GEARBOX CAGE: 78286 PN: 70357-06300-042 NSN: 1680010745152 SN: A005-01881 WAS DUE. STATUS UPGRADED TO X ON: 21 MAR 2021 OR 6475.2 AIRCRAFT HOURS REFERENCE: H-60-10-AMAM-11						ACTION Sample Collection Complete						
ACFT HRS 6099.2						WHEN DISC O	HOW REC O	MAL EFF 1	PID	CAT	HRS	
DELAY						WUC 00			TIPID CHADBOURNE, SCOTT	TI MANHOURS 0.1		
STATUS —		SYS A	DATE 24 Mar 21	NO 1	TIME 00:01	PID Generated, Com			DATE 27 Mar 21	TIME 00:01	ACFT HRS 6099.2	
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 26 MAR 2021 REFERENCE: TM 1-1520-237-23P						ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON MAR 27 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT						
ACFT HRS 6099.2						WHEN DISC O	HOW REC O	MAL EFF 1	PID	CAT	HRS	
DELAY						WUC 00			TIPID ,	TI MANHOURS		
STATUS X		SYS A	DATE 27 Mar 21	NO 1	TIME 00:01	PID Generated, Com			DATE 07 Apr 21	TIME 16:51	ACFT HRS 6099.2	
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 26 MAR 2021 REFERENCE: TM 1-1520-237-23P						ACTION completed						
ACFT HRS 6099.2						WHEN DISC O	HOW REC O	MAL EFF 1	PID	CAT	HRS	
DELAY						WUC 00			TIPID COUTURE, ERIC	TI MANHOURS 0.1		
ACFT HRS 6099.2						WHEN DISC O	HOW REC O	MAL EFF 1	PID	CAT	HRS	
DELAY						WUC 00			TIPID COUTURE, ERIC	TI MANHOURS 0.1		




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 215				
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION								
STATUS X		SYS E	DATE 30 Mar 21	NO 1	TIME 00:01	PID Generated, Cor		DATE 07 Apr 21	TIME 14:52	ACFT HRS 6099.2						
FAULTS/REMARKS INSP E222 EMERGENCY LOCATOR TRANSMITTER (ELT) REGISTRATION UPDATE FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 29 MAR 2021 REFERENCE: GEN-16-AMAM-05								ACTION COMPLETED								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bender, T.	F	0.2						
ACFT HRS 6099.2		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID CHADBOURNE, SCOTT				TI MANHOURS 0.1				
STATUS X		SYS E	DATE 31 Mar 21	NO 1	TIME 00:01	PID Generated, Com		DATE 07 Apr 21	TIME 15:31	ACFT HRS 6099.2						
FAULTS/REMARKS INSP E802 KY-100 BATTERY REPLACEMENT FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 30 MAR 2021 REFERENCE: TM 11-5810-398-10								ACTION ky-100 noy installed								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
								Bender, T.	F	0.1						
ACFT HRS 6099.2		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID CHADBOURNE, SCOTT				TI MANHOURS 0.1				
STATUS —		SYS E	DATE 31 Mar 21	NO 2	TIME 00:01	PID Generated, Com		DATE 07 Apr 21	TIME 00:01	ACFT HRS 6099.2						
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 APR 2021 REFERENCE: TM 11-5810-262-23								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON APR 7 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT								
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS
ACFT HRS 6099.2		WHEN DISC O	HOW REC O	MAL EFF 1												
DELAY				WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 216								
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION												
STATUS —	 CLOS SYS E	DATE 31 Mar 21	NO 3	TIME 00:01	PID Generated, Cor			DATE 07 Apr 21	TIME 00:01	ACFT HRS 6099.2										
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 APR 2021 REFERENCE: TM 11-5821-357-12P								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON APR 7 2021 12:01AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT					ROUNDS			ACTION CODE		WUC 00		
ACFT HRS 6099.2								WHEN DISC	O	HOW REC	O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS
DELAY								WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 B SYS A	DATE 05 Apr 21	NO 1	TIME 14:54	PID Generated, Com			DATE 05 Apr 21	TIME 14:58	ACFT HRS 6099.2										
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 05 APR 2021. INSP A103 AIRCRAFT WASH DUE FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 12 APR 2021 REFERENCE: TM 1-1500-344-23								ACTION compelted					ROUNDS			ACTION CODE 1		WUC 00		
ACFT HRS 6099.2								WHEN DISC	O	HOW REC	O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS
DELAY								WUC 00				TIPIID ,				TI MANHOURS				
STATUS —	 C SYS A	DATE 06 Apr 21	NO 1	TIME 00:01	PID Generated, Com			DATE 07 Apr 21	TIME 17:19	ACFT HRS 6099.2										
FAULTS/REMARKS INSP A115 LUBE REQUIRMENTS FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 12 APR 2021 OR 6142.7 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-23P								ACTION completed					ROUNDS			ACTION CODE 3		WUC 00		
ACFT HRS 6099.2								WHEN DISC	O	HOW REC	O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS
DELAY								WUC 00				TIPIID ,				TI MANHOURS				
ACFT HRS 6099.2								WHEN DISC	O	HOW REC	O	MAL EFF 1		PID		CAT	HRS	PID	CAT	HRS
DELAY								WUC 00				TIPIID ,				TI MANHOURS				




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 217							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —	 SYS A	DATE 06 Apr 21	NO 2	TIME 00:01	PID Generated, Cor			DATE 07 Apr 21	TIME 14:45	ACFT HRS 6099.2									
FAULTS/REMARKS INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 12 APR 2021 REFERENCE: TM 11-6140-203-23 P								ACTION INSP OK						ROUNDS		ACTION CODE 1		WUC 00	
ACFT HRS 6099.2				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID ,				TI MANHOURS							
STATUS X	 SYS E	DATE 07 Apr 21	NO 1	TIME 00:01	PID Generated, Com			DATE 07 Apr 21	TIME 15:28	ACFT HRS 6099.2									
FAULTS/REMARKS INSP E108 KY-58 PMCS/OPNL CHECK (STANDBY) FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 06 APR 2021 REFERENCE: TM 11-5810-262-23								ACTION KY-58 not installed						ROUNDS		ACTION CODE G		WUC 00	
ACFT HRS 6099.2				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID CHADBOURNE, SCOTT				TI MANHOURS 0.1							
STATUS X	 SYS E	DATE 07 Apr 21	NO 2	TIME 00:01	PID Generated, Com			DATE 07 Apr 21	TIME 14:59	ACFT HRS 6099.2									
FAULTS/REMARKS INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPT UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 06 APR 2021 REFERENCE: TM 11-5821-357-12P								ACTION insp ok						ROUNDS		ACTION CODE G		WUC 00	
ACFT HRS 6099.2				WHEN DISC O	HOW REC O	MAL EFF 1		PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
DELAY				WUC 00				TIPIID Bender, Thomas				TI MANHOURS 0.1							




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 218					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —	 SYS A	DATE 07 Apr 21	NO 1	TIME 14:53	PID Generated, Cor			DATE 07 Apr 21	TIME 14:54	ACFT HRS							
FAULTS/REMARKS PMD Due								ROUNDS	ACTION CODE 3		WUC 00						
ACFT HRS 6099.2								WHEN DISC O	HOW REC O	MAL EFF 1							
								DELAY			WUC 00			TIPIID ,			TI MANHOURS
STATUS —	 SYS A	DATE 07 Apr 21	NO 2	TIME 14:54	PID Generated, Com			DATE 07 Apr 21	TIME 15:47	ACFT HRS 6099.2							
FAULTS/REMARKS PMD DUE								ROUNDS	ACTION CODE 3		WUC 00						
ACFT HRS 6099.2								WHEN DISC O	HOW REC G	MAL EFF 2							
								DELAY			WUC 00			TIPIID ,			TI MANHOURS
STATUS —	 SYS A	DATE 07 Apr 21	NO 3	TIME 14:54	PID Generated, Com			DATE 07 Apr 21	TIME 15:55	ACFT HRS 6099.2							
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R12 DATED 14 JAN 20, AWR 1516 R14 DATED 19 FEB 21, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 20, AWR 1800 R8 DATED 28 MAR 19, AND AWR 1823 R9 DATED 22 NOV 19 SEE DA FORM 2408-13-2.								ROUNDS	ACTION CODE 3		WUC 00						
ACFT HRS 6099.2								WHEN DISC X	HOW REC G	MAL EFF 1							
								DELAY			WUC 00			TIPIID ,			TI MANHOURS




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 219			
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION							
STATUS X		SYS A	DATE 07 Apr 21	NO 4	TIME 15:41	PID CEPELAK, CORY		DATE 07 Apr 21	TIME 15:45	ACFT HRS 6099.2					
FAULTS/REMARKS Blue M/R damper requires servicing							ACTION Serviced Damper								
ACFT HRS 6099.2			WHEN DISC B	HOW REC G	MAL EFF 1		PID MILLIKEN,	CAT F	HRS 0.5	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 05A01Z				TIPIID Bender, Thomas				TI MANHOURS 0.3			
STATUS /		SYS A	DATE 08 Apr 21	NO 1	TIME 10:27	PID Black, Alex		DATE 08 Apr 21	TIME 10:29	ACFT HRS 6099.2					
FAULTS/REMARKS APU accumulator precharge low							ACTION serviced nitrogen precharge per WP 216.								
ACFT HRS 6099.2			WHEN DISC K	HOW REC G	MAL EFF 1		PID BISHOP, J.	CAT F	HRS 1.0	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 15				TIPIID ,				TI MANHOURS			
STATUS /		SYS A	DATE 09 Apr 21	NO 1	TIME 14:22	PID Belyeu, Christop		DATE 09 Apr 21	TIME 15:17	ACFT HRS 6099.2					
FAULTS/REMARKS #2 ENGINE IPS DUCT HAS OIL LEAKAGE							ACTION entered in error								
ACFT HRS 6099.2			WHEN DISC G	HOW REC G	MAL EFF 2		PID Mower, H.	CAT F	HRS 0.1	PID	CAT	HRS	PID	CAT	HRS
DELAY				WUC 00				TIPIID ,				TI MANHOURS			




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428		2. MODEL UH-60A			3. DATE			4. PAGE 220		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION				
STATUS —		SYS A	DATE 09 Apr 21	NO 1	TIME 14:30	PID Generated, Cor	DATE 09 Apr 21	TIME 15:12	ACFT HRS 7577.0	
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-21-SOF-01 DESCRIPTION: COMPLY WITH H-60-21-SOF-01, T700 SERIES ENGINE COMPRESSOR SPLIT LINE AND COMPRESSOR FORWARD AND AFT FLANGE INSPECTION PRIOR TO NEXT FLIGHT, BUT NOT TO EXCEED 12 APR 21 FOR COLD SECTION MODULE CAGE: 99207 PN: 6071T25G01 NSN: 2840012844013 SN: GEC001066 IS DUE: 12 APR 2021 CALENDAR						ACTION COMPLIED WITH . CSM S/N NOT LISTED IN ADDENDUM 1				
ACFT HRS 7577						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 04A01		TIPIID DUFFY, JOSHUA		TI MANHOURS 0.1
STATUS —		SYS A	DATE 09 Apr 21	NO 1	TIME 14:31	PID Generated, Com	DATE 09 Apr 21	TIME 15:13	ACFT HRS 4050.0	
FAULTS/REMARKS SAFETY MESSAGE NUMBER: H-60-21-SOF-01 DESCRIPTION: COMPLY WITH H-60-21-SOF-01, T700 SERIES ENGINE COMPRESSOR SPLIT LINE AND COMPRESSOR FORWARD AND AFT FLANGE INSPECTION PRIOR TO NEXT FLIGHT, BUT NOT TO EXCEED 12 APR 21 FOR COLD SECTION MODULE CAGE: 99207 PN: 6071T25G01 NSN: 2840012844013 SN: GEC003777 IS DUE: 12 APR 2021 CALENDAR						ACTION COMPLIED WITH . CSM S/N NOT LISTED IN ADDENDUM 1				
ACFT HRS 4050						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 04A01		TIPIID DUFFY, JOSHUA		TI MANHOURS 0.1
STATUS —		SYS A	DATE 12 Apr 21	NO 1	TIME 00:00	PID Generated, Com	DATE 16 Apr 21	TIME 00:00	ACFT HRS 6109.4	
FAULTS/REMARKS INSP A808 APU EVENTS/HRS READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 APR 2021 REFERENCE: TM 1-1520-237-23						ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON APR 16 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT				
ACFT HRS 6099.2						WHEN DISC O	HOW REC O	MAL EFF 1		
DELAY						WUC 00		TIPIID ,		TI MANHOURS

DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 221					
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION									
STATUS —		SYS A		DATE 12 Apr 21		NO 2		TIME 00:00		PID Generated, Cor		DATE 19 Apr 21		TIME 00:00		ACFT HRS 6109.4	
												ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS INSP A100 LH/RH ENGINE HISTORY RECORDER READINGS DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 18 APR 2021 REFERENCE: DA PAM 738-751								ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON APR 19 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT									
												PID		CAT		HRS	
												CEPELAK, F				0.2	
ACFT HRS 6099.2				WHEN DISC O		HOW REC O		MAL EFF 1									
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A		DATE 12 Apr 21		NO 3		TIME 08:39		PID Generated, Com		DATE 12 Apr 21		TIME 08:40		ACFT HRS 6099.2	
												ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 12 APR 2021. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6105.3 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ACTION Insp ok									
												PID		CAT		HRS	
												CEPELAK, F				0.2	
ACFT HRS 6099.2				WHEN DISC O		HOW REC O		MAL EFF 1									
DELAY				WUC 00				TIPIID ,				TI MANHOURS					
STATUS —		SYS A		DATE 13 Apr 21		NO 1		TIME 08:16		PID Generated, Com		DATE 13 Apr 21		TIME 08:16		ACFT HRS	
												ROUNDS		ACTION CODE 3		WUC 00	
FAULTS/REMARKS PMD Due								ACTION COMPLETED									
												PID		CAT		HRS	
												CEPELAK, F				1.0	
ACFT HRS 6104.5				WHEN DISC O		HOW REC O		MAL EFF 1									
DELAY				WUC 00				TIPIID ,				TI MANHOURS					




DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A				3. DATE				4. PAGE 222							
PART I - FAULT INFORMATION								PART II - CORRECTING INFORMATION											
STATUS —		SYS A	DATE 13 Apr 21	NO 2	TIME 08:17	PID Generated, Cor		DATE 13 Apr 21	TIME 09:24	ACFT HRS 6104.5		ROUNDS		ACTION CODE 3		WUC 00			
FAULTS/REMARKS PMD DUE								ACTION PMD COMPLETE OK											
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
ACFT HRS 6104.5								WHEN DISC	O	HOW REC	G	MAL EFF		2					
DELAY								WUC 00				TIPIID ,				TI MANHOURS			
STATUS —		SYS A	DATE 13 Apr 21	NO 3	TIME 08:18	PID Generated, Com		DATE 13 Apr 21	TIME 08:26	ACFT HRS 6104.5		ROUNDS		ACTION CODE 3		WUC 00			
FAULTS/REMARKS DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R12 DATED 14 JAN 20, AWR 1516 R14 DATED 19 FEB 21, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 20, AWR 1800 R8 DATED 28 MAR 19, AND AWR 1823 R9 DATED 22 NOV 19 SEE DA FORM 2408-13-2.								ACTION INSP COMPLT											
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
ACFT HRS 6104.5								WHEN DISC	X	HOW REC	G	MAL EFF		1					
DELAY								WUC 00				TIPIID ,				TI MANHOURS			
STATUS —		SYS A	DATE 13 Apr 21	NO 4	TIME 08:28	PID Generated, Com		DATE 13 Apr 21	TIME 08:28	ACFT HRS 6104.5		ROUNDS		ACTION CODE 6		WUC 00			
FAULTS/REMARKS INSPECTION MANUALLY GENERATED ON 13 APR 2021. INSP A020 PERFORM M/R SPINDLE LUGS, M/R CUFF, TIP CAPS INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6110.2 AIRCRAFT HOURS REFERENCE: TM 1-1520-237-PMD								ACTION INSP OK											
								PID	CAT	HRS	PID	CAT	HRS	PID	CAT	HRS			
ACFT HRS 6104.5								WHEN DISC	O	HOW REC	O	MAL EFF		1					
DELAY								WUC 00				TIPIID ,				TI MANHOURS			



DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD

For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. AIRCRAFT SERIAL NUMBER 8023428				2. MODEL UH-60A			3. DATE			4. PAGE 223		
PART I - FAULT INFORMATION						PART II - CORRECTING INFORMATION						
STATUS /	 SYS A	DATE 16 Apr 21	NO 2	TIME 08:20	PID GATHRIGHT, AN	DATE 16 Apr 21	TIME 08:22	ACFT HRS 6109.4				
FAULTS/REMARKS DOPPLER GPS SDC AND CONTROL HEAD REMOVAL REQUIRED FOR BEST TURN IN						ACTION REMOVED SDC AND CONTROL HEAD						
						PID	CAT	HRS	PID	CAT	HRS	
						GATHRIGHT	F	1.0				
ACFT HRS 6109.4		WHEN DISC B	HOW REC G	MAL EFF 1								
DELAY			WUC 19E18			TIPIID ,			TI MANHOURS			
STATUS —	 SYS A	DATE 20 Apr 21	NO 1	TIME 00:01	PID Generated, Com	DATE 22 Apr 21	TIME 00:00	ACFT HRS 6109.4				
FAULTS/REMARKS INSP A022 14 DAY FLYABLE STORAGE ENGINE RUN UP FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 21 APR 2021 REFERENCE: TM 1-1520-237-23P						ACTION STATUS SYMBOL UPGRADED TO X SEE FAULT ON APR 22 2021 12:00AM. ALL 2408-13-2 WRITE-UPS WERE TRANSCRIBED TO NEW FAULT						
						PID	CAT	HRS	PID	CAT	HRS	
ACFT HRS 6109.4		WHEN DISC O	HOW REC O	MAL EFF 1								
DELAY			WUC 00			TIPIID ,			TI MANHOURS			
STATUS	SYS	DATE	NO	TIME	PID	DATE	TIME	ACFT HRS				
						ROUNDS	ACTION CODE	WUC				
FAULTS/REMARKS						ACTION						
						PID	CAT	HRS	PID	CAT	HRS	
ACFT HRS		WHEN DISC	HOW REC	MAL EFF								
DELAY			WUC			TIPIID			TI MANHOURS			



DA FORM 2408-13-1-SG, OCT 1997

DA FORM 2408-13-1, OCT 91, MAY BE USED

AIRCRAFT INSPECTION AND MAINTENANCE RECORD


For use of this form, see DA PAM 738-751; the proponent agency is DCSLOG

APD PE v3.00

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:43	
		5. FAULT DATE 28 Jun 19		6. FAULT NUMBER 2			
7. FAULT RECEPTICAL LEFT OF CENTER ON SOUNDPROOFING AFT OF DRIP PAN REQUIRES REPAIR							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION		11. PID	12. CAT	13. MMH	
X	 lowered soundproofing	reinstalled		MEADE, D.	F	0.1	
X	 RMVD NUTPLATE	REPLACED		Fraser, C.	F	0.5	








DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:46		
	5. FAULT DATE 09 Oct 19	6. FAULT NUMBER 10			
7. FAULT 40 HR TQ CHECK REQUIRED ON TAIL PYLON ATTACHING BOLTS DUE AT 6020.2 ACFT HRS FOR FOLDING TAIL					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	RMVD L/H AND R/H TAIL ACCESS PANELS	REINSTALLED	Bender, T.	F	0.5


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:34	
		5. FAULT DATE 21 Nov 19		6. FAULT NUMBER 5			
7. FAULT female end zues fastener top l/h tgb cover over output shaft broken							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 removed fwd tgb cover	reinstalled	MEADE, D.	F	0.1		
×	 removed aft tgb cover	reinstalled	MEADE, D.	F	0.4		
×	 removed bad recepticle	replaced	Bither, c.	F	0.5		
×	 removed light	reinstalled	MEADE, D.	F	0.1		
×	 disconnected 2 ea cannon plugs	reconnected	MEADE, D.	F	0.1		
×	 removed cover	fault written in error	EISENHAUEF	F	0.1		
×	 Rmvd Damage	Repaired and installed recepticle	Bither, c.	F	1.0		





DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 10:21
	5. FAULT DATE 07 Mar 20		6. FAULT NUMBER 3		
7. FAULT UHF radio inop. Could not receive or transmit.					
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT
× 	RMVD UHF CONTROL HEAD		REINSTALLED	Bartlett, C.	F














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 15:04	
		5. FAULT DATE 11 Mar 20		6. FAULT NUMBER 3			
7. FAULT copilot wiper arm req adjustment.							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 rmvd safety from copilot wiper arm hex screw	replaced	Belyeu, C.	F	0.2		
×	 broke tq on copilots wiper hex screw	tightend	Belyeu, C.	F	0.2		
×	 rmvd safety from wiper bolt	replaced	Belyeu, C.	F	0.2		
×	 broke tq on wiper arm bolt	tq'd	Belyeu, C.	F	0.2		

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG





1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 16:08		
	5. FAULT DATE 12 Mar 20	6. FAULT NUMBER 3			
7. FAULT #2 Converter failed in flight followed by #2 Gen failure. Was able to reset #2 gen twice, but the third time this happened the gen would not reset.					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 REMOVED RH AND LH FWD CEILING SOUNDPROOFING	reinstalled	EISENHAUEF	F	1.0
×	 DISCONNECTED P238 FROM NO.2 JUNCTION BOX	RECONNECTED	TARBOX, C.	F	0.2
×	 DISCONNECTED P904 FROM NO.2 DC CONVERTER	RECONNECTED	TARBOX, C.	F	0.2
×	 REMOVED RH DEFROST VENT	REINSTALLED	TARBOX, C.	F	0.2
×	 REMOVED H-BAR	reinstalled	BISHOP, J.	F	0.5
×	 LOWERED PILOTS CIRCUIT BREAKER PANEL	REINSTALLED	TARBOX, C.	F	0.2
×	 DISCONNECTED P216 FROM APU GCU	RECONNECTED	TARBOX, C.	F	0.2
×	 DISCONNECTED P202 FROM NO.2 JUNCTION BOX	RECONNECTED	TARBOX, C.	F	0.2
×	 REMOVED NO.1 AND NO.2 JUNCTION BOX COVERS	REINSTALLED	TARBOX, C.	F	0.3
×	 REMOVED NO.1 DC CONVERTER	REINSTALLED	TARBOX, C.	F	0.6
×	 DISCONNECTED P902, P243 AND P242 FROM LH RELAY PANEL	RECONNECTED	TARBOX, C.	F	0.2
×	 REMOVED LH AND RH CENTER H-BAR ATTATCH BRACKETS	reinstalled	EISENHAUEF	F	0.5
×	 LOWERED UPPER CONSOLE	REINSTALLED	TARBOX, C.	F	0.4

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED











RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 16:08		
5. FAULT DATE 12 Mar 20		6. FAULT NUMBER 3			
7. FAULT #2 Converter failed in flight followed by #2 Gen failure. Was able to reset #2 gen twice, but the third time this happened the gen would not reset.					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	DISCONNECTED P277 FROM NO.2 GENERATOR	RECONNECTED	TARBOX, C.	F	0.2
X 	REMOVED DAMAGED SECTION OF WIRE FROM P277 PIN 3 ON NO.2 GENERATOR TO SG214-2.	REPLACED	TARBOX, C.	F	2.0
X 	REMOVED K6 RELAY	REPLACED	TARBOX, C.	F	1.5
X 	REMOVED DAMAGED SECTION OF WIRE FROM P202 PIN G ON NO.2 JUNCTION BOX TO P216 PIN K ON	REPLACED	TARBOX, C.	F	2.0

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG











1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 16:10		
	5. FAULT DATE 12 Mar 20	6. FAULT NUMBER 4			
7. FAULT Uncommanded pitch inputs during flight. Happened intermittantly duing the entire flight					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 LOWERED SOUNDPROOFING FWD OF MAIN TRANSMISSION	reinstalled	MILLIKEN, J.	F	0.1
×	 DISCONNECTED P466 FROM PILOT ASSIST MODULE	RECONNECTED	TARBOX, C.	F	0.2
×	 DISCONNECTED P120, PILOTS CYCLIC STICK	RECONNECTED	TARBOX, C.	F	0.2
×	 DISCONNECTED P428R FROM AFCC	RECONNECTED	TARBOX, C.	F	0.2
×	 DISCONNECTED P421R FROM AFCC	RECONNECTED	TARBOX, C.	F	0.2
×	 DISCONNECTED P902, P242 AND P243 FROM LH RELAY PANEL	RECONNECTED	TARBOX, C.	F	0.2
×	 REMOVED LH RELAY PANEL	REINSTALLED	TARBOX, C.	F	0.4
×	 REMOVED TIE WRAPS 2EA SECURING MAIN BUNDLE TO INBOARD SIDE OF NO.1 JUNCTION BOX.	REPLACED	TARBOX, C.	F	0.3
×	 REMOVED FLIGHT CONTROL PANEL	REINSTALLED	TARBOX, C.	F	0.4
×	 DISCONNECTED P404R AND P405R FROM DSC	RECONNECTED	TARBOX, C.	F	0.2
×	 DISCONNECTED P428R FROM AFCC	RECONNECTED	TARBOX, C.	F	0.2
×	 DISCONNECTED P401 FROM AIRSPEED TRANSDUCER	RECONNECTED	TARBOX, C.	F	0.1
×	 DISCONNECTED P317 FROM NO.1 COLLECTIVE POSITION SENSOR	RECONNECTED	TARBOX, C.	F	0.2

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED








RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 16:10		
5. FAULT DATE 12 Mar 20		6. FAULT NUMBER 4			
7. FAULT Uncommanded pitch inputs during flight. Happened intermittantly duing the entire flight					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 LOWERED AFT SOUNDPROOFING	REINSTALLED	TARBOX, C.	F	0.3
×	 DISCONNECTED P464R FROM PITCH TRIM SERVO	RECONNECTED	Pacheco, J.	F	0.1
×	 DISCONNECTED P191R FROM PILOTS DISPLACEMENT GYRO	RECONNECTED	TARBOX, C.	F	0.1
×	 DISCONNECTED P193R FROM COPILOTS DISPLACEMENT GYRO	RECONNECTED	TARBOX, C.	F	0.1
×	 DISCONNECTED P423R FROM SAS AMPLIFIER	RECONNECTED	TARBOX, C.	F	0.2
×	 DISCONNECTED P425R FROM NO.1 LAT ACCEL	RECONNECTED	TARBOX, C.	F	0.1
×	 REMOVED DSC	REINSTALLED	TARBOX, C.	F	0.5
×	 REMOVED APU ESU	REINSTALLED	TARBOX, C.	F	0.4
×	 DISCONNECTED P460R FROM PITCH TRIM SERVO	RECONNECTED	Pacheco, J.	F	0.1
×	 DISCONNECTED P466R FROM PILOT ASSIST MODULE	RECONNECTED	TARBOX, C.	F	0.1












DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 16:12	
		5. FAULT DATE 12 Mar 20		6. FAULT NUMBER 5			
7. FAULT #1, #2 engine torque inaccurate in IVHMS. Could not compute HIT check using IVHMS.							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 REMOVED QUAD BAY ANTENNA	REINSTALLED	Bartlett, C.	F	0.5		
×	 DISCONNECTED P1330 FROM IVHMU RDC	RECONNECTED	TARBOX, C.	F	0.1		
×	 RMVD PILOT KICKPANEL WITH HRDW.	REINSTALLED	Bartlett, C.	F	0.5		
×	 DISCONNECTED 3 EA ELECTRICAL CONNECTORS ON #2 JUNCTION BOX	RECONNECTED	TARBOX, C.	F	0.2		
×	 RMVD HUD SDC	REINSTALLED	TARBOX, C.	F	0.3		
×	 REMOVED COPILOTS KICK PANEL	REINSTALLED	Bartlett, C.	F	0.5		
×	 REMOVED NO.1 AND NO.2 IVHMU JUNCTION BOXES	REINSTALLED	TARBOX, C.	F	0.5		




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 09:37		
5. FAULT DATE 28 Apr 20		6. FAULT NUMBER 2			
7. FAULT REMOVAL OF PITCH TRIM SERVO REQUIRED FOR TROUBLE SHOOTING PURPOSES					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 DISC HYDRAULIC LINE Q/D'S 2EA FROM #1 HYDRAULIC PUMP	RECONNECTED	Pacheco, J.	F	0.1
×	 DISC HYDRAULIC LINE Q/D'S 2EA FROM #2 HYDRAULIC PUMP	RECONNECTED	Pacheco, J.	F	0.1
×	 DISC HYDRAULIC LINE Q/D'S 2EA FROM BACKUP HYDRAULIC PUMP	RECONNECTED	Pacheco, J.	F	0.1
×	 DISC 2 EA CANNON PLUGS (P464R / P460R) FROM PITCH TRIM SERVO	RECONNECTED	Pacheco, J.	F	0.1
×	 RMVD 3 EA COTTER PINS PITCH TRIM SERVO INPUT CONTROL ROD ATTACHING HDWR	REPLACED	Pacheco, J.	F	0.3
×	 RMVD 3 EA COTTER PINS PITCH TRIM SERVO MIXER LINK ATTACHING HDWR	REPLACED	Pacheco, J.	F	0.3
×	 RMVD 3 EA PITCH TRIM SERVO INPUT CONTROL ROD ATTACHING HDWR	REINSTALLED SELF RETAINING BOLT TQ= 30-50 IN LBS, 2EA BUSHING	Pacheco, J.	F	0.3
×	 RMVD 3 EA PITCH TRIM SERVO MIXER LINK ATTACHING HDWR	REINSTALLED SELF RETAINING BOLT TQ= 30-50 IN LBS, 2EA BUSHING	Pacheco, J.	F	0.3
×	 BROKE 2 EA SAFETIES ON PITCH TRIM SERVO MOUNTING HDWR	REPLACED	Pacheco, J.	F	0.4
×	 RMVD 3 EA PITCH TRIM SERVO MOUNTING HDWR	REINSTALLED TQ= 194 IN LBS	Pacheco, J.	F	0.2
×	 RMVD PITCH TRIM SERVO S/N-B112-11272	REPLACED W/ S/N C112-06399	Pacheco, J.	F	0.2




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 09:46		
5. FAULT DATE 04 May 20		6. FAULT NUMBER 1			
7. FAULT fwd upper l/h cabin soundproofing has blown out fastener hole and tear on aft end					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	removed panel	Replaced	MEADE, D.	F	1.0
× 	Rmvd rivets securing damaged soundproofing panel	Replaced rivets	Bither, c.	F	2.0
× 	Rmvd damaged soundproofing panel	Replaced panel	Bither, c.	F	1.0














DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 13:13		
5. FAULT DATE 05 May 20		6. FAULT NUMBER 1			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	BISHOP, J.	F	0.1
× 	REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	BISHOP, J.	F	0.1
× 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded reviewed initialized reinstalled	BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 13:13		
5. FAULT DATE 05 May 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R8 DATED 15 MAY 18, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R5 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	Inspection good	BISHOP, J.	F	0.1
—	 PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	Not installed	BISHOP, J.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R8 DATED 15 MAY 18 (COCKPIT/CABIN DOORS	Complete	BISHOP, J.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	Complete	BISHOP, J.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	Complete	BISHOP, J.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	Complete	BISHOP, J.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R5 DATED 31 MAY 18 (EFW DAY FLIGHT PANEL	Complete	BISHOP, J.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	Complete	BISHOP, J.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	Complete	BISHOP, J.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	Complete	BISHOP, J.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	Complete	BISHOP, J.	F	0.1
—	 PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	Complete	BISHOP, J.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	Complete	BISHOP, J.	F	0.1





DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 13:13	
		5. FAULT DATE 05 May 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R8 DATED 15 MAY 18, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 31 NOV 17, AWR 1407 R6 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 18, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11							
8. STA —	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).			Complete	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).			Complete	BISHOP, J.	F	0.1



DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 15:43	
		5. FAULT DATE 05 May 20		6. FAULT NUMBER 4			
7. FAULT upper r/h fwd cabin soundproofing has 2 blown out fastener holes on aft end							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 removed h-bar mounts and hdwr	Reinstalled	MEADE, D.	F	1.0		
×	 removed soundproofing panel	Reinstalled	MEADE, D.	F	1.0		
×	 Rmvd rivets securing damaged soundproofing panel	Replaced rivets	Bither, c.	F	2.0		
×	 Rmvd damaged soundproofing panel	Replaced Panel	Bither, c.	F	1.0		




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:45		
5. FAULT DATE 05 May 20		6. FAULT NUMBER 5			
7. FAULT h bar has working rivet on center section					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	RMVD H-BAR AND ATTCH H/W	reinstalled	EISENHAUEF	F	0.1
× 	removed 2 ea h-bar mounts	reinstalled	EISENHAUEF	F	0.1




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 15:02
5. FAULT DATE 06 May 20		6. FAULT NUMBER 2			
7. FAULT Both radar alt wont come on					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 DISCONNECTED P675R FROM COPILOTS RAD ALT	reinstalled	Bartlett, C.	F	0.3
×	 DISCONNECTED P676R FROM PILOTS RAD ALT	reinstalled	Bartlett, C.	F	0.3
×	 rmvd co-pilots rad alt	reinstalled	Bartlett, C.	F	0.3














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE E		4. TIME 15:04	
	5. FAULT DATE 06 May 20	6. FAULT NUMBER 1			
7. FAULT Ice detected light constant flash on caution advisory panel through out entire flight and only came on solid for a few seconds with no ice in the area					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 REMOVED RH INLET UPPER, MIDDLE AND LOWER FAIRINGS	REINSTALLED	TARBOX, C.	F	0.4
×	 REMOVED ICE DETECTOR	REPLACED	TARBOX, C.	F	1.0
×	 REMOVED P326 FROM HARNESS FOR CORROSION AND PITTING	REPLACED	TARBOX, C.	F	1.0


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:08		
5. FAULT DATE 06 May 20		6. FAULT NUMBER 5			
7. FAULT # 2 Converter light came on multiple times in flight kicking trim fps and stab out of the auto mode light would go off on its own and only had a #2 generator failure twice during the 5 times. The generator was able to be reset and came back on line. No change in flight checked when it would come on					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X	 LOWERED RH AND LH FWD SOUNDPROOFING	REINSTALLED	Bartlett, C.	F	0.3
X	 REMOVED NO.1 JUNCTION BOX COVER	REINSTALLED	Bartlett, C.	F	0.2
X	 REMOVED NO.2 JUNCTION BOX COVER	REINSTALLED	Bartlett, C.	F	0.2
X	 DISCONNECTED TERMINALS 1, 2 AND 3 FROM NO.1 GENERATOR	REINSTALLED	Bartlett, C.	F	0.2
X	 DISCONNECTED P251 AND P278 FROM NO.1 GENERATOR	RECONNECTED	TARBOX, C.	F	0.2
X	 DISCONNECTED P215 FROM NO.1 GCU	RECONNECTED	TARBOX, C.	F	0.1
X	 DISCONNECTED P209 FROM NO.1 JUNCTION BOX	RECONNECTED	Bartlett, C.	F	0.1
X	 DISCONNECTED TERMINALS 1, 2 AND 3 FROM NO.2 GENERATOR	RECONNECTED	TARBOX, C.	F	0.2
X	 DISCONNECTED P250 AND P277 FROM NO.2 GENERATOR	RECONNECTED	TARBOX, C.	F	0.1
X	 DISCONNECTED P214 FROM NO.2 GCU	RECONNECTED	TARBOX, C.	F	0.1
X	 DISCONNECTED P201 FROM NO.2 JUNCTION BOX	RECONNECTED	TARBOX, C.	F	0.1
X	 REMOVED PFA FROM P215, NO.1 GCU	REINSTALLED	Bartlett, C.	F	0.2
X	 DEPINNED CONTACTS B AND C FROM P215, NO.1 GCU	SWAPPED POSITIONS AND REINSTALLED	Bartlett, C.	F	0.5





DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 15:14	
	5. FAULT DATE 06 May 20		6. FAULT NUMBER 6			
7. FAULT Pilots side right pedal heel has a recessed screw proud of the mounting surface. Pilots heel catches on the screw head.						
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION		11. PID	12. CAT	13. MMH
X 	RMVD PILOTS RIGHT SIDE PEDAL HEEL WITH HRDW.	REINSTALLED WITH CORRECT HRDW		Bartlett, C.	F	0.5














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:18		
5. FAULT DATE 06 May 20		6. FAULT NUMBER 7			
7. FAULT INSP A213 ENGINE COMPRESSOR CLEANING FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6002.5 AIRCRAFT HOURS					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	removed #1 eng ignitors 2 ea	reinstalled 2ea and tq'd	Belyeu, C.	F	0.2
X 	attached wash hose to #1 eng	rmvd	Belyeu, C.	F	0.2
X 	removed #2 eng ignitors, 2 ea	reinstalled and tq'd	HIGGINS, P.	F	0.2
X 	installed wash hose to #2 eng	rmvd	Belyeu, C.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG











1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:18		
	5. FAULT DATE 06 May 20	6. FAULT NUMBER 8			
7. FAULT INSP A210 120 HOUR INSPECTION REQUIREMENTS FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6002.5 AIRCRAFT HOURS					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 removed #1 inlet tear drop fairing	reinstalled	Belyeu, C.	F	0.1
×	 removed #1 inlet wash hose clamp	reinstalled	Belyeu, C.	F	0.1
×	 disconnected #1 inlet elec connector	reconnected	Belyeu, C.	F	0.1
×	 disconnected #1	fault written in error	Belyeu, C.	F	0.1
×	 disconnected #1 inlet fire suppression line	reinstalled	Belyeu, C.	F	0.1
×	 removed #1 inlet bleed air coupling	reinstalled, tq 45 in lbs	Belyeu, C.	F	0.1
×	 installed run plug in #1 inlet bleed air hose	removed	Belyeu, C.	F	0.1
×	 removed #1 inlet v-band clamp	reinstalled, tq 70 in lbs	Belyeu, C.	F	0.1
×	 removed #1 eng inlet	reinstalled	Belyeu, C.	F	0.1
×	 installed #1 inlet run screen	removed	Belyeu, C.	F	0.1
×	 removed #1 inlet crotch assy	REINSTALLED	HIGGINS, P.	F	0.2
×	 removed #2 inlet teardrop fairing	reinstalled	Belyeu, C.	F	0.1
×	 removed #2 inlet wash hose clamp	reinstalled	Belyeu, C.	F	0.1

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED









RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:18		
	5. FAULT DATE 06 May 20	6. FAULT NUMBER 8			
7. FAULT INSP A210 120 HOUR INSPECTION REQUIREMENTS FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6002.5 AIRCRAFT HOURS					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 disconnected 2 ea elec connectors from #2 inlet	reconnected	Belyeu, C.	F	0.1
×	 disconnected #2 inlet fire tube	reconnected	Belyeu, C.	F	0.1
×	 removed #2 inlet bleed air clamp	reinstalled, tq 45 in lbs	Belyeu, C.	F	0.1
×	 installed run plug in #2 inlet bleed air hose	removed	Belyeu, C.	F	0.1
×	 removed v-band clamp from #2 inlet	reinstalled, tq 70 in lbs	Belyeu, C.	F	0.1
×	 removed #2 inlet	reinstalled	Belyeu, C.	F	0.1
×	 installed run screen on #2 inlet	removed	Belyeu, C.	F	0.1
×	 removed #2 inlet crotch	REINSTALLED	HIGGINS, P.	F	0.2
×	 removed main mod drip pan	reinstalled	Leone, M.	F	0.1
×	 lowered upper soundproofing fwd and aft of main mod	reinstalled	Leone, M.	F	0.1


DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 10:53	
		5. FAULT DATE 08 May 20		6. FAULT NUMBER 1			
7. FAULT TAIL WHEEL LOCK PIN BENT.							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
×		RMVD COTTER PINS FROM LOCK MECHINISM 3EA		REPLACED	Bender, T.	F	0.2
×		RMVD CLEVIS BOLTS 2EA FROM LOCK		REINSTALLED	Bender, T.	F	0.5
×		RMVD ACTUATOR FROM YOKE		REINSTALLED	Bender, T.	F	0.3
×		RMVD DUST COVER AND SNAP RING FROM FORK		REINSTALLED	Bender, T.	F	0.3
×		RMVD FORK, WHEEL AND TIRE		REPLACED FORK, REINSTALLED WHEEL AND TIRE	Bender, T.	F	0.5
×		rmvd nut and lock washer from axle		REPLACED WASHER, REINSTALLED NUT	Bender, T.	F	0.3
×		RMVD BEARINGS, SPACERS AND CUPS		REINSTALLED	Bender, T.	F	0.3
×		DESERVICED TAIL WHEEL		SERVICED	Bender, T.	F	0.2













DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:00		
	5. FAULT DATE 13 May 20	6. FAULT NUMBER 1			
7. FAULT INSP A299 LUBRICATE SWASHPLATE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6434.2 AIRCRAFT HOURS OR 12 JUL 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	REMOVED 33 BOLTS/WASHERS SECURING INNER BEARING RETAINER RING TO SWASHPLATE ZE988426	REINSTALLED, TQ'D TO 194 INCH POUNDS	Ellis, Z.	F	2.0

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG


1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:00		
	5. FAULT DATE 13 May 20	6. FAULT NUMBER 2			
7. FAULT INSP A302 LUBRICATE MAIN LANDING GEAR WHEEL BEARINGS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6434.2 AIRCRAFT HOURS OR 12 JUL 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 RMVD YELLOW VALVE STEM CAP FROM L/H M/L/G TIRE	REINSTALLED	Belyeu, C.	F	0.2
×	 DESERVICED L/H M/L/G TIRE	SERVICED TO 140PSI	Belyeu, C.	F	0.1
×	 RMVD COTTER PIN FROM NUT SECURING L/H M/L/G WHEEL AND TIRE ASSY.	REPLACED	Belyeu, C.	F	0.2
×	 RMVD NUT AND WASHER SECURING L/H M/L/G WHEEL AND TIRE ASSY. TO AXLE	REINSTALLED TQ'D TO 83 FOOT POUNDS	Belyeu, C.	F	0.2
×	 RMVD SEALS 2EA FROM L/H M/L/G AXLE	REPLACED	Belyeu, C.	F	0.2
×	 RMVD BEARINGS 2EA FROM L/H M/L/G AXLE	REINSTALLED	Belyeu, C.	F	0.3
×	 RMVD L/H M/L/G WHEEL AND TIRE ASSY.	REINSTALLED	Belyeu, C.	F	0.2
×	 RMVD YELLOW VALVE STEM CAP FROM R/H M/L/G WHEEL AND TIRE ASSY.	REINSTALLED ZE988426	Ellis, Z.	F	0.1
×	 DE-SERVICED R/H M/L/G TIRE	SERVICED TO 140PSI ZE988426	Ellis, Z.	F	0.1
×	 RMVD COTTER PIN FROM NUT SECURING R/H M/L/G WHEEL AND TIRE ASSY.	REPLACED ZE988426	Ellis, Z.	F	0.1
×	 RMVD NUT AND WASHER SECURING R/H M/L/G WHEEL AND TIRE ASSY. TO AXLE	REINSTALLED TQ'D TO 83 FOOT POUNDS ZE988426	Ellis, Z.	F	0.1
×	 RMVD SEALS 2EA FROM R/H M/L/G AXLE	REPLACED ZE988426	Ellis, Z.	F	0.1
×	 RMVD BEARINGS 2EA FROM R/H M/L/G AXLE	REINSTALLED ZE988426	Ellis, Z.	F	0.1

DA FORM 2408-13-2-SG, OCT 97














DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:00		
5. FAULT DATE 13 May 20		6. FAULT NUMBER 2			
7. FAULT INSP A302 LUBRICATE MAIN LANDING GEAR WHEEL BEARINGS FOR HCPTUR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6434.2 AIRCRAFT HOURS OR 12 JUL 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	RMVD R/H M/L/G WHEEL AND TIRE ASSY.	REINSTALLED ZE988426	Ellis, Z.	F	0.1

DA FORM 2408-13-2-SG, OCT 97 **RELATED MAINTENANCE ACTIONS RECORD**
 DA FORM 2408-13-2, NOV 91, MAY BE USED For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 12:05		
5. FAULT DATE 18 May 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R8 DATED 15 MAY 18, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R5 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	NOT APPLICABLE THIS INSP	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	NOT INSTALLED	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R8 DATED 15 MAY 18 (COCKPIT/CABIN DOORS	NOT APPLICABLE THIS INSP	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	INSP OK	Leone, M.	F	0.2
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	INSP OK	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	INSP OK	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R5 DATED 31 MAY 18 (EFW DAY FLIGHT PANEL	INSP OK	Leone, M.	F	0.2
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	INSP OK	Bender, T.	F	0.2
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	NOT INSTALLED	Bender, T.	F	0.2
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	NOT INSTALLED	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	INSP OK	Bender, T.	F	0.2
—	 PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	INSP OK	Bender, T.	F	0.2
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	INSP OK	Bender, T.	F	0.2




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 12:05		
5. FAULT DATE 18 May 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R8 DATED 15 MAY 18, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 21 MAY 18, AWR 1445 R7 DATED 02 OCT 18, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	INSP OK	Bender, T.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	INSP OK	Bender, T.	F	0.3




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 12:05
	5. FAULT DATE 18 May 20		6. FAULT NUMBER 3		
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	REMOVED INTERMEDIATE GEARBOX COVER	REINSTALLED	Leone, M.	F	0.2
× 	REMOVED FWD TAIL ROTOR GEARBOX COVER	REINSTALLED	Leone, M.	F	0.3
× 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	DOWNLOADED, REVIEWED, INIALIZED AND REINSTALLED	Leone, M.	F	0.3

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG



1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:31		
5. FAULT DATE 19 May 20		6. FAULT NUMBER 2			
7. FAULT Radar ALT analog and digital side is all the way to the high side when press to test they both go back to 1000 and then back to the high side. During power change over Radar ALT began to work properly again for a minute or two then bouncing between full high to low again until finally returning to the high side again.					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	REMOVED LEFT (RECEIVING) RADAR ALTIMETER ANTENNA	REINSTALLED	Bartlett, C.	F	0.3
X 	REMOVED RIGHT (TRANSMITTING) RADAR ALTIMETER ANTENNA	REINSTALLED	Bartlett, C.	F	0.5
X 	DISCONNECTED TRANSMITTING COAX P680R	REPLACED COAX CONNECTOR	Bartlett, C.	F	0.5

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG














1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:40
	5. FAULT DATE 19 May 20	6. FAULT NUMBER 5	

7. FAULT
Tail wheel lock pin would not lock and unlock with the actuator

8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	rmvd cotter pin from clevis bolt on actuator	replaced	Bender, T.	F	0.3
X 	rmvd nut from lock arm	reinstalled and trq'd	Bender, T.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 11:07		
	5. FAULT DATE 19 May 20	6. FAULT NUMBER 6			
7. FAULT #2 CONVERTER POWER SUPPLY SN 1294 INSTALLED ON AIRCRAFT 428 PER CONTROL EXCHANGED #20-15					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 RMVD HBAR WITH HARDWARE.	REINSTALLED	Bartlett, C.	F	1.0
×	 RMVD 2 EA CREWCHEIF SEATS.	REINSTALLED	Bartlett, C.	F	0.5
×	 RMVD 1 EA TROOP COMMANDER SEAT	REINSTALLED	Bartlett, C.	F	0.3
×	 LOWERED PILOT SIDE UPPER SOUNDPROOFING	REINSTALLED	Bartlett, C.	F	0.3
×	 LOWERED UPPER MIDDLE CABIN SOUNDPROOFING	REINSTALLED	Bartlett, C.	F	0.3
×	 DISCONNECTED P904 FROM #2 CONVERTER	RECONNECTED	Bartlett, C.	F	0.3
×	 DISCONNECTED 2 EA TERMINAL AND HRDW FROM #2 CONVERTER	RECONNECTED	Bartlett, C.	F	0.5
×	 RMVD 4EA MOUNTING HRDW FROM #2 CONVERTER	REINSTALLED	Bartlett, C.	F	0.3
×	 RMVD CONVERTER SN 476	REPLACED #2 CONVERTER WITH SN 1294	Bartlett, C.	F	0.3
×	 LOWERED COPILOTS CIRCUIT BREAKER PANEL	REINSTALLED	Bartlett, C.	F	0.3
×	 LOWERED PILOTS CIRCUIT BREAKER PANEL	REINSTALLED	Bartlett, C.	F	0.3
×	 RMVD PILOTS DOOR HEATER DUCTING	REINSTALLED	Bartlett, C.	F	0.3
×	 RMVD CO-PILOTS DOOR HEATER DUCTING	REINSTALLED	Bartlett, C.	F	0.3

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED










RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:46		
5. FAULT DATE 21 May 20		6. FAULT NUMBER 1			
7. FAULT # 2 Converter light came on multiple times in flight kicking trim fps and stab out of the auto mode light would go off on its own and only had a #2 generator failure twice during the 5 times. The generator was able to be reset and came back on line. No change in flight checked when it would come on.					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	LOWERED FRWD R/H CABIN SOUND PROOFING	raised	Belyeu, C.	F	0.2
×	DISC CANNON PLUG FROM #2 GCU	RECONNECTED	TARBOX, C.	F	0.1
×	disconnected 2ea cannon plugs from #2 gen.	CONNECTED 2EA	Belyeu, C.	F	0.2
×	rmvd clamp and attch h/w from #2 gen wire harness	REINSTALLED	Belyeu, C.	F	0.2
×	disconnected terminals T3,T2,T1 and Ground from #2 gen.	CONNECTED ALL TERMINALS	Belyeu, C.	F	0.3
×	rmvd acceleromter and attch h/w from #2 gen.	REINSTALLED AND TQ'D	Belyeu, C.	F	0.2
×	rmvd 2ea packings from gen side of oil tubes	replaced 2ea	Belyeu, C.	F	0.2
×	rmvd #2 gen attch. h/w	REPLACED AND TQ'D	Belyeu, C.	F	0.2
×	rmvd #2 gen. sn: 7	REPLACED W/ SN:4217810	Belyeu, C.	F	2.0
×	RMVD O-RING FROM #2 GEN.	REPLACED	Belyeu, C.	F	0.2
×	REMOVED HEAT SHRINK FROM P250 ON NO.2 GENERATOR	REPLACED	TARBOX, C.	F	1.5
×	REMOVED BACKSHELL FROM P250	REINSTALLED	TARBOX, C.	F	0.1
×	REMOVED ELECTRICAL CONTACTS FROM P250	REINSTALLED. MOC OK.	TARBOX, C.	F	1.5



DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:46		
5. FAULT DATE 21 May 20		6. FAULT NUMBER 1			
7. FAULT # 2 Converter light came on multiple times in flight kicking trim fps and stab out of the auto mode light would go off on its own and only had a #2 generator failure twice during the 5 times. The generator was able to be reset and came back on line. No change in flight checked when it would come on					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 REMOVED CONTACT FROM WIRE X29A20 ON P250	REPLACED	TARBOX, C.	F	0.3
×	 rmvd #2 accessory mod/gen. spline adapter	replaced	Belyeu, C.	F	2.0
×	 REMOVED NO.2 GENERATOR CONTROL UNIT	REPLACED	TARBOX, C.	F	0.6
×	 RMVD LOCKRING FROM UPPER ACCESSORY MOD OIL TUBE	reinstalled	Belyeu, C.	F	0.2
×	 RMVD O-RING FROM UPPER ACCESSORY MOD OIL TUBE	REPLACED	Belyeu, C.	F	0.2
×	 RMVD LOCKRING FROM LOWER ACCESSORY MOD OIL TUBE	reinstalled	Belyeu, C.	F	0.2
×	 RMVD O-RING FROM LOWER ACCESSORY MOD OIL TUBE	REPLACED	Belyeu, C.	F	0.2
×	 RMVD UPPER OIL TUBE SCREEN	REINSTALLED	Belyeu, C.	F	0.2
×	 RMVD LOWER OIL TUBE SCREEN	REINSTALLED	Belyeu, C.	F	0.1














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE E		4. TIME 00:01	
		5. FAULT DATE 28 May 20		6. FAULT NUMBER 1			
7. FAULT INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 JUN 2020							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
X	 removed batt access panel	reinstalled	Leone, M.	F	0.1		
X	 removed batt box cover	reinstalled	Leone, M.	F	0.1		

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 13:01	
		5. FAULT DATE 28 May 20		6. FAULT NUMBER 7			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R8 DATED 15 MAY 18, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R5 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	not installed	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	not installed	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R8 DATED 15 MAY 18 (COCKPIT/CABIN DOORS	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R5 DATED 31 MAY 18 (EFW DAY FLIGHT PANEL	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	complete	EISENHAUEF	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	complete	EISENHAUEF	F	0.1		




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 13:01		
5. FAULT DATE 28 May 20		6. FAULT NUMBER 7			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R8 DATED 15 MAY 18, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 21 MAY 18, AWR 1445 R7 DATED 03 OCT 18, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	complete	EISENHAUEF	F	0.1











DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 13:01		
5. FAULT DATE 28 May 20		6. FAULT NUMBER 8			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	EISENHAUEF	F	0.1
× 	REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	EISENHAUEF	F	0.1
× 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded reviewed initialized reinstalled	EISENHAUEF	F	0.1














DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:40		
	5. FAULT DATE 01 Jun 20	6. FAULT NUMBER 5			
7. FAULT INSP A110 PMS 40 HOUR INSPECTION FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 5998.8 AIRCRAFT HOURS					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 RMVD TROOP SEATS 10EA	reinstalled	Leone, M.	F	0.5
×	 RMVD L/H AND R/H NCREW SEATS AND TROOP COMANDER SEAT	reinstalled	Leone, M.	F	0.1
×	 RMVD R/H AFT BULKHEAD PANEL	reinstalled	BISHOP, J.	F	0.1
×	 removed o/b stab insp panels	reinstalled	Leone, M.	F	0.1
×	 removed r/h fuel enclosure panel	reinstalled	BISHOP, J.	F	0.2
×	 removed apu fuel cont cover	reinstalled	Belyeu, C.	F	0.1
×	 removed oil cooler insp panel	reinstalled	Belyeu, C.	F	0.1
×	 removed l/h tailcone access panel	reinstalled	Leone, M.	F	0.1
×	 removed upper r/h mlg fairing	reinstalled	Leone, M.	F	0.1
×	 removed upper l/h mlg strut cover	reinstalled	Leone, M.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG








1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:40		
	5. FAULT DATE 01 Jun 20	6. FAULT NUMBER 6			
7. FAULT INSP A296 INSPECT STABILATOR ATTACH FITTINGS FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6003.9 AIRCRAFT HOURS					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 REMOVED L/H STABILATOR-PYLON FAIRING WITH ATTACHMENT HARDWARE.	REINSTALLED.	Leone, M.	F	0.3
×	 REMOVED R/H STABILATOR-PYLON FAIRING WITH ATTACHING HARDWARE.	REINSTALLED.	CRONK, B.	F	0.3
×	 REMOVED LOWER PYLON FAIRING WITH ATTACHING HARDWARE.	REINSTALLED.	JACKSON, N	F	0.4
×	 DISCONNECTED L/H FORMATION LIGHT ELECTRICAL CONNECTOR FROM PYLON.	REINSTALLED.	JACKSON, N	F	0.2
×	 DISCONNECTED R/H FORMATION LIGHT ELECTRICAL CONNECTOR FROM PYLON.	RECONNECTED.	JACKSON, N	F	0.2
×	 REMOVED COTTER PIN FROM LIMIT SWITCH ROD TO STABILATOR ATTACHMENT BOLT.	REPLACED.	Leone, M.	F	0.2
×	 REMOVED ATTACHMENT HARDWARE 1EA FROM LIMIT SWITCH ROD TO STABILATOR.	REPLACED HARDWARE. TORQUED TO 21 IN LBS. PROOF TORQUE	JACKSON, N	F	0.3
×	 REMOVED COTTER PIN FROM R/H STABILATOR ATTACHMENT BOLT.	REPLACED.	Leone, M.	F	0.4
×	 REMOVED COTTER PIN FROM L/H STABILATOR ATTACHMENT BOLT.	REPLACED.	Leone, M.	F	0.4
×	 REMOVED COTTER PIN FROM STABILATOR ACTUATOR TO STABILATOR ATTACHMENT BOLT.	REPLACED.	Leone, M.	F	0.2
×	 REMOVED STABILATOR ACTUATOR TO STABILATOR ATTACHMENT HARDWARE 1EA.	REINSTALLED WITH REPLACEMENT NUT. TORQUED TO 160 IN LBS.	JACKSON, N	F	0.1
×	 REMOVED R/H GROUND STRAP ATTACHMENT BOLT FROM PYLON.	REINSTALLED. TORQUED TO 70 IN LBS.	JACKSON, N	F	0.2
×	 REMOVED L/H GROUND STRAP BOLT FROM PYLON.	REINSTALLED. TORQUED TO 70 IN LBS.	JACKSON, N	F	0.2

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED









RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:40		
5. FAULT DATE 01 Jun 20		6. FAULT NUMBER 6			
7. FAULT INSP A296 INSPECT STABILATOR ATTACH FITTINGS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6003.9 AIRCRAFT HOURS					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	REMOVED R/H STABILATOR ATTACHMENT HARDWARE 1 EA.	REPLACED. TORQUED TO 25 IN LBS.	JACKSON, N	F	0.3
X 	REMOVED L/H STABILATOR ATTACHMENT HARDWARE 1EA.	REPLACED. TORQUED TO 400 IN LBS.	JACKSON, N	F	0.2
X 	REMOVED STABILATOR.	REINSTALLED.	JACKSON, N	F	0.2
X 	REMOVED R/H EOMS SENSOR COVER WITH ATTACHMENT HARDWARE.	REINSTALLED.	JACKSON, N	F	0.2
X 	REMOVED CAMBERED FAIRING WITH ATTACHMENT HARDWARE.	REINSTALLED.	JACKSON, N	F	0.2
X 	REMOVED L/H STABILATOR INSPECTION PANEL WITH ATTACHING HARDWARE.	REINSTALLED.	JACKSON, N	F	0.2
X 	REMOVED R/H STABILATOR INSPECTION PANEL WITH ATTACHMENT HARDWARE.	REINSTALLED.	JACKSON, N	F	0.2




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:54		
		5. FAULT DATE 03 Jun 20		6. FAULT NUMBER 2				
7. FAULT INSPECTION MANUALLY GENERATED ON 03 JUN 2020. INSP A806 REMOVE AND PERFORM FUNCTIONAL CHECK OF ENGINE CHIP DETECTOR FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON C-200-1 AIRCRAFT HOURS								
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH	
×		loosened bolts on #1 eng chip det			retorqued 45 in lbs	Leone, M.	F	0.1
×		removed #1 eng chip det			reinstalled	Leone, M.	F	0.1
×		removed #1 eng chip det screen			reinstalled	Leone, M.	F	0.1
×		removed o-ring on #1 eng chip det			replaced	Leone, M.	F	0.1
×		loosened bolts on #2 eng chip det			retorqued 45 in lbs	Leone, M.	F	0.1
×		removed #2 eng chip det			reinstalled	Leone, M.	F	0.1
×		removed screen from #2 eng chip det			reinstalled	Leone, M.	F	0.1
×		removed o-ring from #2 eng chip det			replaced	Leone, M.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 09:41	
		5. FAULT DATE 03 Jun 20	6. FAULT NUMBER 3			
7. FAULT PMD DUE						
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION		11. PID	12. CAT	13. MMH
×	 REMOVED INTERMEDIATE GEARBOX COVER	reinstalled		Leone, M.	F	0.1
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled		Leone, M.	F	0.1
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded reviewed initalized reinstalled		Leone, M.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 09:42	
		5. FAULT DATE 03 Jun 20		6. FAULT NUMBER 5			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R9 DATED 20 MAY 2020, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R5 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	not installed	EISENHAUEF	F	0.1	E CLOSED	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	not installed	EISENHAUEF	F	0.1	E CLOSED	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	complete	EISENHAUEF	F	0.1	E CLOSED	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	complete	EISENHAUEF	F	0.1	E CLOSED	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	complete	EISENHAUEF	F	0.1	E CLOSED	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	complete	EISENHAUEF	F	0.1	E CLOSED	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R5 DATED 31 MAY 18 (EFW DAY FLIGHT PANEL	complete	EISENHAUEF	F	0.1	E CLOSED	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	complete	EISENHAUEF	F	0.1	E CLOSED	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	complete	EISENHAUEF	F	0.1	E CLOSED	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	complete	EISENHAUEF	F	0.1	E CLOSED	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	complete	EISENHAUEF	F	0.1	E CLOSED	
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	complete	EISENHAUEF	F	0.1	E CLOSED	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	complete	EISENHAUEF	F	0.1	E CLOSED	



DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 09:42		
5. FAULT DATE 03 Jun 20		6. FAULT NUMBER 5			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R9 DATED 20 MAY 2020, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 21 MAY 19, AWR 1445 R7 DATED 02 OCT 19, AWR 1466 R8 DATED 21 AUG 17, AWR 1494 R10 DATED 01 NOV 19					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	complete	EISENHAUEF	F	0.1




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 11:51		
	5. FAULT DATE 03 Jun 20	6. FAULT NUMBER 7			
7. FAULT black o/b mr damper failed 120 hr tq check					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 removed cotter pin	replaced	Belyeu, C.	F	0.2
×	 removed damper hdwr	replaced tq'd to 1360in/lbs	Belyeu, C.	F	0.2



DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:16		
5. FAULT DATE 03 Jun 20		6. FAULT NUMBER 11			
7. FAULT h bar has working rivet on center section					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	removed h-bar hdwr	Reinstalled	MEADE, D.	F	1.0
X 	removed h-bar	reinstalled	EISENHAUER	F	0.5
X 	Rmvd 3ea working rivets	Replaced 3 ea rivets	Bither, c.	F	1.0

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:00		
	5. FAULT DATE 08 Jun 20	6. FAULT NUMBER 1			
7. FAULT INSP A103 AIRCRAFT WASH DUE FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 07 JUN 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 placed bag over mixer	rmvd	Belyeu, C.	F	0.2
×	 placed bags over hyd deck vents	rmvd 2ea	Belyeu, C.	F	0.2








DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 09:33
		5. FAULT DATE 10 Jun 20	6. FAULT NUMBER 1		
7. FAULT INSP A115 - LUBE REQUIRMENTS .					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	REMOVED L/H UPPER MAIN LANDING GEAR FAIRING	reinstalled	Belyeu, C.	F	0.1
×	REMOVED R/H UPPER MAIN LANDING GEAR FAIRING	reinstalled	Belyeu, C.	F	0.1
×	REMOVED L/H TAIL CONE ACCESS PANEL	reinstalled	Belyeu, C.	F	0.1


DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 11:00		
5. FAULT DATE 10 Jun 20		6. FAULT NUMBER 2			
7. FAULT #1 FM Radio display was either all 8's or blank during flight. - TROUBLESHOOTING IN PROGRESS					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 REMOVED NO.1 VHF R/T	REPLACED SN 00941A WITH SN 4565	TARBOX, C.	F	1.0
×	 REMOVED NO.1 FM CONTROL PANEL	REINSTALLED	TARBOX, C.	F	0.2
×	 REMOVED NO.2 FM CONTROL PANEL	REINSTALLED	TARBOX, C.	F	0.2
×	 REMOVED VHF FM 2 R/T	REINSTALLED	TARBOX, C.	F	0.3
×	 REMOVED FM 1 KY-58	REINSTALLED	TARBOX, C.	F	0.3
×	 REMOVED FM 2 KY-58	REINSTALLED	TARBOX, C.	F	0.3
×	 REMOVED COAXIAL CONNECTOR P1029 FROM CABLE FOR FM 1 R/T	REPLACED	TARBOX, C.	F	2.0




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 09:56		
5. FAULT DATE 13 Jun 20		6. FAULT NUMBER 1			
7. FAULT l/h and r/h machine gun mounts require installation					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	cotter pin and nut installation required in l/h and r/h mounts	complete	Hale, N.	F	0.3

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 11:01	
		5. FAULT DATE 16 Jun 20		6. FAULT NUMBER 1			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION		11. PID	12. CAT	13. MMH
×		REMOVED INTERMEDIATE GEARBOX COVER	reinstalled		Hale, N.	F	0.1
×		REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled		Hale, N.	F	0.1
×		IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded reviewed initialized reinstalled		Hale, N.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED









RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 11:02	
		5. FAULT DATE 16 Jun 20		6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R9 DATED 20 MAY 2020, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R5 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).			not installed	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN			complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN			complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT			complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).			complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).			complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R5 DATED 31 MAY 18 (EFW DAY FLIGHT PANEL			complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL			complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).			complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A			complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).			complete	EISENHAUEF	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19			complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).			complete	EISENHAUEF	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED


RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 11:02		
	5. FAULT DATE 16 Jun 20	6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R9 DATED 20 MAY 2020, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R35 DATED 21 NOV 17, AWR 1407 R5 DATED 21 MAY 19, AWR 1445 R7 DATED 02 OCT 19, AWR 1466 R9 DATED 21 AUG 17, AWR 1484					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	complete	EISENHAUEF	F	0.1

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 11:38		
5. FAULT DATE 16 Jun 20		6. FAULT NUMBER 5			
7. FAULT t/r hyd lines rubbing					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 removed fwd tgb cover	REINSTALLED.	JACKSON, N	F	0.2
×	 REMOVED PRESSURE AND RETURN QUICK DISCONNECTS FROM #2 HYDRAULIC PUMP.	RECONNECTED.	JACKSON, N	F	0.3
×	 REMOVED PRESSURE AND RETURN HYDRAULIC QUICK DISCONNECTS ON BACK UP HYDRAULIC	RECONNECTED.	JACKSON, N	F	0.3
×	 REMOVED PRESSURE HOSE FROM 1ST STAGE TAIL ROTOR SERVO CONNECTOR.	REINSTALLED. TORQUED TO 135 IN LBS.	Leone, M.	F	0.3
×	 REMOVED RETURN HOSE FROM FIRST STAGE TAIL ROTOR SERVO CONNECTOR.	REINSTALLED. TORQUED TO 240 IN LBS.	Leone, M.	F	0.3
×	 REMOVED PRESSURE AND RETURN QUICK DISCONNECTS FROM #1 HYDRAULIC PUMP	RECONNECTED.	JACKSON, N	F	0.2
×	 BROKE TORQUE ON T/R 1ST STAGE SERVO PRESSURE HOSE BULKHEAD NUT.	TORQUED TO 140 IN LBS.	JACKSON, N	F	0.3
×	 BROKE TORQUE ON T/R 1ST STAGE SERVO RETURN HOSE BULKHEAD NUT.	TORQUED TO 240 IN LBS.	JACKSON, N	F	0.4




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 15:20	
		5. FAULT DATE 18 Jun 20		6. FAULT NUMBER 2			
7. FAULT L/H GUNNERS ICS WILL NOT TRANSMIT							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
× 	REMOVED LH GUNNERS ICS CORD	repaired	BARTLETT, S	F	2.0		














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:50		
	5. FAULT DATE 18 Jun 20	6. FAULT NUMBER 4			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	CEPELAK, C.	F	0.1
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	CEPELAK, C.	F	0.1
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded reviewed initialized reinstalled	CEPELAK, C.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 15:50	
		5. FAULT DATE 18 Jun 20		6. FAULT NUMBER 5			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R9 DATED 20 MAY 2020, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R5 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA		9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	not installed	CEPELAK, C.	F	0.1	
—		PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	complete	CEPELAK, C.	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	complete	CEPELAK, C.	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	complete	CEPELAK, C.	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	complete	CEPELAK, C.	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	complete	CEPELAK, C.	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R5 DATED 31 MAY 18 (EFW DAY FLIGHT PANEL	complete	CEPELAK, C.	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	complete	CEPELAK, C.	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	complete	CEPELAK, C.	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	complete	CEPELAK, C.	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	complete	CEPELAK, C.	F	0.1	
—		PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	complete	CEPELAK, C.	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	complete	CEPELAK, C.	F	0.1	


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 15:50	
		5. FAULT DATE 18 Jun 20		6. FAULT NUMBER 5			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R9 DATED 20 MAY 2020, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R35 DATED 21 NOV 17, AWR 1407 R6 DATED 21 MAY 19, AWR 1445 R7 DATED 02 OCT 19, AWR 1466 R9 DATED 21 AUG 17, AWR 1494 R21 DATED 02 OCT 19, AWR 1517 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT	13. MMH	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).		complete	CEPELAK, C.	F	0.1	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).		complete	CEPELAK, C.	F	0.1	




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:20		
	5. FAULT DATE 19 Jun 20	6. FAULT NUMBER 1			
7. FAULT CoPi clock intermittent operation					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	DISCONNECTED P195 FROM COPILOTS CLOCK	RECONNECTED	TARBOX, C.	F	0.1










DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 16:14		
5. FAULT DATE 20 Jun 20		6. FAULT NUMBER 1			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 REMOVED INTERMEDIATE GEARBOX COVER	REINSTALLED.	JACKSON, N	F	0.2
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	REINSTALLED.	JACKSON, N	F	0.2
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	DOWNLOADED, REVIEWED, INITIALIZED AND REINSTALLED.	JACKSON, N	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 16:15	
		5. FAULT DATE 20 Jun 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R9 DATED 20 MAY 2020, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R5 DATED 31 MAY 18, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA		9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	N/A	JACKSON, N	F	0.1	
—		PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	INSP OK.	JACKSON, N	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	INSP OK.	JACKSON, N	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	INSP OK.	JACKSON, N	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	INSP OK.	JACKSON, N	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	INSP OK.	JACKSON, N	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R5 DATED 31 MAY 18 (EFW DAY FLIGHT PANEL	INSP OK.	JACKSON, N	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	INSP OK.	JACKSON, N	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	N/A	JACKSON, N	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	INSP OK.	JACKSON, N	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	INSP OK.	JACKSON, N	F	0.1	
—		PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	INSP OK.	JACKSON, N	F	0.1	
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	INSP OK.	JACKSON, N	F	0.1	


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 16:15	
		5. FAULT DATE 20 Jun 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R12 DATED 29 NOV 18, AWR 1279 R9 DATED 20 MAY 2020, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 21 MAY 19, AWR 1445 R7 DATED 02 OCT 19, AWR 1466 R9 DATED 21 AUG 17, AWR 1494 R10 DATED 03 OCT 19							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).			INSP OK.	JACKSON, N	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).			INSP OK.	JACKSON, N	F	0.1


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 18:03	
	5. FAULT DATE 20 Jun 20		6. FAULT NUMBER 5			
7. FAULT APR 39 CONNECTOR (J4) BROKEN						
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION		11. PID	12. CAT
× 	removed apr-39 connector from j4 of aft receiver		repaired connector		TARBOX, C.	F


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:01		
5. FAULT DATE 21 Jun 20		6. FAULT NUMBER 1			
7. FAULT INSP A230 INSPECT BATTERY COMPARTMENT FOR CORROSION (SLAB) FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 JUL 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	RMVD SAFETY	REPLACED	Belyeu, C.	F	0.2


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 17:51	
		5. FAULT DATE 22 Jun 20		6. FAULT NUMBER 1			
7. FAULT RADAR ALTIMETERS DIGITAL READOUT 3 FEET OFF GROUND.							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 RMVD 4 EA MOUNTING SCREWS	reinstalled	BARTLETT, S	F	0.5		


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE E	4. TIME 00:00		
5. FAULT DATE 23 Jun 20		6. FAULT NUMBER 1			
7. FAULT INSP E015 ASN 128D DOPPLER GPS BATTERY REPLACEMENT FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 29 JUL 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	REMOVED BATTERY COVER	REINSTALLED	TARBOX, C.	F	0.2














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428		3. SYSTEM CODE E		4. TIME 00:00
	5. FAULT DATE 23 Jun 20		6. FAULT NUMBER 2		
7. FAULT INSP E155 KY-58 BATTERY REPLACEMENT FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 29 JUL 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT
X 	REMOVED BATTERY COVERS FROM NO.1 & 2 VHF KY-58'S		REINSTALLED	TARBOX, C.	F

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:32		
		5. FAULT DATE 24 Jun 20		6. FAULT NUMBER 3				
7. FAULT PMD DUE								
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH	
×		REMOVED INTERMEDIATE GEARBOX COVER			REINSTALLED	CRONK, B.	F	0.2
×		REMOVED FWD TAIL ROTOR GEARBOX COVER			REINSTALLED	CRONK, B.	F	0.2
×		IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,			DOWNLOADED, INITIALIZED, AND REINSTALLED	RAND, B.	F	0.1
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).			n/a	RAND, B.	F	0.1
—		PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN			N/A	RAND, B.	F	0.1
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN			N/A	RAND, B.	F	0.1
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT			INSP COMPLETED	RAND, B.	F	0.1
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).			INSP COMPLETED	RAND, B.	F	0.1
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).			INSP COMPLETED	RAND, B.	F	0.1
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R5 DATED 31 MAY 18 (EFW DAY FLIGHT PANEL			INSP COMPLETED	RAND, B.	F	0.1
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL			INSP COMPLETED	RAND, B.	F	0.1
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).			INSP COMPLETED	RAND, B.	F	0.1
—		PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A			INSP COMPLETED	RAND, B.	F	0.1


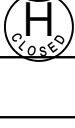
DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 08:32		
5. FAULT DATE 24 Jun 20		6. FAULT NUMBER 3			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	INSP COMPLETED	RAND, B.	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	INSP COMPLETED	RAND, B.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	INSP COMPLETED	RAND, B.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	INSP COMPLETED	RAND, B.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	INSP COMPLETED	RAND, B.	F	0.1


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 09:34	
	5. FAULT DATE 24 Jun 20	6. FAULT NUMBER 5			
7. FAULT #1 SIDE REAR CREW SEAT INERTIA REAL DOES NOT RETRACT COMPLETELY					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 RMVD HDWR SECURING REEL TO SEAT	REINSTALLED HDWR	RAND, B.	F	0.1
×	 RMVD REEL FROM CREW SEAT	REPLACED REEL	RAND, B.	F	1.0


DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 10:35	
	5. FAULT DATE 24 Jun 20	6. FAULT NUMBER 6			
7. FAULT 9-11 hr tq check required on o/b black mr damper hdwr between 6003.8-6005.8 acft hrs					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	RMVD 1 EA COTTER PIN FROM BLACK M/R DAMPER OUTBOARD BOLT	REPLACED	CRONK, B.	F	0.1





DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 13:19		
5. FAULT DATE 24 Jun 20		6. FAULT NUMBER 7			
7. FAULT 3rd 9-11 T/Q due on M/R BLACK OUTBOARD DAMPER BOLT between 6013.0 - 6015.0 ACFT hours					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	RMVD COTTER PIN 1EA	REPLACED	Bender, T.	F	0.2



DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 13:44		
	5. FAULT DATE 25 Jun 20	6. FAULT NUMBER 1			
7. FAULT Aircraft Grounded for lost tool. Orange snap on flashlight					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 REMOVED TAIL ROTOR GEARBOX COVER	REINSTALLED.	RAND, B.	F	0.2
×	 REMOVED INTERMEDIATE GEARBOX COVER	REINSTALLED.	JACKSON, N	F	0.2
×	 REMOVED MAIN TRANSMISSION DRIP PAN	REINSTALLED.	NEWTON, S.	F	0.2
×	 REMOVED R/H AFT BULKHEAD PANEL.	REINSTALLED.	MEADE, D.	F	0.2














DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:24		
5. FAULT DATE 26 Jun 20		6. FAULT NUMBER 1			
7. FAULT FM1 WONT ACCEPT FREQUENCY					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	Disconnected 1 ea connector from FM 1 Control Head	Reconnected	ANDERSON,	F	0.5
× 	Removed FM 1 Control Head	Replaced	ANDERSON,	F	0.5

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 08:04		
5. FAULT DATE 26 Jun 20		6. FAULT NUMBER 4			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 REMOVED INTERMEDIATE GEARBOX COVER	REINSTALLED.	Leone, M.	F	0.2
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	REINSTALLED.	Leone, M.	F	0.1
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	DOWNLOADED, REVIEWED, INITIALIZED AND REINSTALLED.	JACKSON, N	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	N/A	JACKSON, N	F	0.1
—	 PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	INSPECTED OK.	JACKSON, N	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	INSPECTED OK.	JACKSON, N	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	INSPECTED OK.	JACKSON, N	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	INSPECTED OK.	JACKSON, N	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	INSPECTED OK.	JACKSON, N	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R5 DATED 31 MAY 18 (EFW DAY FLIGHT PANEL	INSPECTED OK.	JACKSON, N	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	INSPECTED OK.	JACKSON, N	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	NOT INSTALLED.	JACKSON, N	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	INSPECTED OK.	JACKSON, N	F	0.1

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED



RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:04	
		5. FAULT DATE 26 Jun 20		6. FAULT NUMBER 4			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).			INSPECTED OK.	JACKSON, N	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19			INSPECTED OK.	JACKSON, N	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).			INSPECTED OK.	JACKSON, N	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).			INSPECTED OK.	JACKSON, N	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).			INSPECTED OK.	JACKSON, N	F	0.1







DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE E	4. TIME 00:00		
5. FAULT DATE 27 Jun 20		6. FAULT NUMBER 2			
7. FAULT INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 JUL 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X	 rmvd battery access panel and attch h/w	reinstalled	Belyeu, C.	F	0.2
X	 rmvd arc 220 battery cover	reinstalled	Belyeu, C.	F	0.2














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:01		
5. FAULT DATE 28 Jun 20		6. FAULT NUMBER 1			
7. FAULT INSP A501 MAIN ROTOR BLADE SPAR PRESSURE CHECK FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 AUG 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	rmvd 4ea safties from all m/r blade sharder valves	replaced 4ea	Belyeu, C.	F	0.5
X 	broke tq on red m/r blade sharder valve	tq'd	Belyeu, C.	F	0.2
X 	broke tq on blk m/r blade sharder valve	tq'd	Belyeu, C.	F	0.2
X 	broke tq on yellow m/r blade sharder valve	tq'd	Belyeu, C.	F	0.2
X 	broke tq on blue m/r blade sharder valve	tq'd	Belyeu, C.	F	0.2
X 	RMVD 4EA YELLOOW CAPS FROM ALL M/R BLADE SHRADER VALVES	REINSTALLED 4EA	Belyeu, C.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG












1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 09:42		
	5. FAULT DATE 29 Jun 20	6. FAULT NUMBER 1			
7. FAULT REMOVAL OF #1 ENGINE S/N- GE-E-763486 REQ'D PER CONTROL EXCHANGE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 DISCONNECTED #1 FUEL HOSE AT FUEL PUMP ELBOW.	connected and tq'd	Belyeu, C.	F	0.2
×	 DISCONNECTED #1ENGINE DRAIN HOSES FROM ELBOWS ON REAR ENGINE COMPARTMENT DECK.	connected 2 ea and tq'd	Belyeu, C.	F	0.2
×	 REMOVED CLAMPS HOLDING #1COMMON DRAIN TO ENGINE COMPARTMENT SHIELD.	reinstalled	Belyeu, C.	F	0.2
×	 REMOVED CLAMP HOLDING #1 SWIRL FRAME DRAIN TO AIRFRAME.	reinstalled and tq'd	Belyeu, C.	F	0.1
×	 DISCONNECTED #1 ELECTRICAL CONNECTOR, P815 AND P825, FROM FIREWALL RECEPTACLES.	connected 2ea	Belyeu, C.	F	0.2
×	 DISCONNECTED #1 POWER-AVAILABLE ROTARY INPUT FROM HYDROMECHANICAL UNIT ON ENGINE.	connected	Belyeu, C.	F	0.2
×	 DISCONNECTED #1 LOAD-DEMAND ROTARY INPUT FROM HYDROMECHANICAL UNIT ON ENGINE.	connected	Belyeu, C.	F	0.2
×	 REMOVED STARTER BLEED-AIR TUBE FROM #1 STARTER AND UPPER FIREWALL TUBE.	reinstalled	Belyeu, C.	F	0.2
×	 REMOVED #1 COUPLING HOLDING CROSS BLEED-AIR TUBE AT FIREWALL.	reinstalled and tq'd	Belyeu, C.	F	0.2
×	 REMOVED COUPLING FROM #1 INLET PARTICLE SEPARATOR (IPS) BLOWER DUCT AND IPS BLOWER.	reinstalled and tq'd	Belyeu, C.	F	0.2
×	 REMOVED #1 INLET PARTICLE SEPARATOR (IPS) BLOWER DUCT.	reinstalled	Belyeu, C.	F	0.2
×	 REMOVED #1 LOOP CLAMP FROM DESWIRL DUCT AND ENGINE POWER TURBINE FLANGE.	reinstalled and tq'd	Belyeu, C.	F	0.1
×	 REMOVED BOLTS HOLDING FLANGE/COUPLING TO #1 DRIVE SHAFT.	reinstalled and tq'd	Belyeu, C.	F	0.2

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED














RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 09:42	
		5. FAULT DATE 29 Jun 20		6. FAULT NUMBER 1			
7. FAULT REMOVAL OF #1 ENGINE S/N- GE-E-763486 REQ'D PER CONTROL EXCHANGE							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION		11. PID	12. CAT	13. MMH
×		REMOVED BOLTS AND WASHERS HOLDING #1 FORWARD SUPPORT TUBE TO GIMBAL.	reinstalled and tq'd		Belyeu, C.	F	0.2
×		REMOVE COTTER PINS 2 EA FROM #1 INNER AND OUTER MOUNT STRUTS TO	replaced 2ea		Belyeu, C.	F	0.2
×		REMOVED BOLTS, WASHERS, AND NUTS HOLDING #1 INNER AND OUTER MOUNT STRUTS TO MOUNT	replaced and tq'd		Belyeu, C.	F	0.2
×		REMOVED COTTER PIN FROM #1 CENTER MOUNT LINKS TO MOUNT SUPPORT.	replaced		Belyeu, C.	F	0.2
×		REMOVED BOLTS, WASHERS, AND NUTS, HOLDING #1 CENTER MOUNT LINKS TO MOUNT SUPPORT.	replaced and tq'd		Belyeu, C.	F	0.2
×		REMOVED #1 ENGINE.	replaced per controlled exchange		Belyeu, C.	F	0.2
×		REMOVED COTTER PINS 2 EA FROM #1 AFT MOUNT LINKS TO FLANGE.	replaced 2ea		Belyeu, C.	F	0.2
×		REMOVED BOLTS, WASHERS, AND NUTS HOLDING #1 AFT MOUNT LINKS TO FLANGE.	replaced and tq'd		Belyeu, C.	F	0.2
×		REMOVED #1 AFT MOUNT LINKS.	reinstalled		Belyeu, C.	F	0.2
×		RMVD #1 ENGINE HSS	REINSTALLED		Pacheco, J.	F	0.1
×		RMVD 3EA O-RING FROM #1 ENGINE HSS	REPLACED		Pacheco, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG












1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 09:44		
	5. FAULT DATE 29 Jun 20	6. FAULT NUMBER 2			
7. FAULT REMOVAL OF #2 ENGINE S/N- GE-E-762962 REQ'D PER CONTROL EXCHANGE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 DISCONNECTED #2 FUEL HOSE AT FUEL PUMP ELBOW.	RECONNECTED, TQED TO 500 IN LBS	DUFFY, J.	F	0.1
×	 DISCONNECTED #2 ENGINE DRAIN HOSES FROM ELBOWS ON REAR ENGINE COMPARTMENT DECK.	RECONNECTED AND TQED	DUFFY, J.	F	0.1
×	 REMOVED CLAMPS HOLDING #2 COMMON DRAIN TO ENGINE COMPARTMENT SHIELD.	REINSTALLED	DUFFY, J.	F	0.1
×	 DISCONNECTED #2 ELECTRICAL CONNECTOR, P814 AND P824, FROM FIREWALL RECEPTACLES.	RECONNECTED	DUFFY, J.	F	0.2
×	 DISCONNECTED #2 POWER-AVAILABLE ROTARY INPUT FROM HYDROMECHANICAL UNIT ON ENGINE.	RECONNECTED	DUFFY, J.	F	0.2
×	 DISCONNECTED #2 LOAD-DEMAND ROTARY INPUT FROM HYDROMECHANICAL UNIT ON ENGINE.	RECONNECTED	DUFFY, J.	F	0.2
×	 REMOVED STARTER BLEED-AIR TUBE FROM #2 STARTER AND UPPER FIREWALL TUBE.	RECONNECTED AND TQED CLAMPS	DUFFY, J.	F	0.2
×	 REMOVED #2 COUPLING HOLDING CROSS BLEED-AIR TUBE AT FIREWALL.	RECONNECTED AND TQED	DUFFY, J.	F	0.2
×	 REMOVED SCREW, WASHER, AND SPACER ATTACHING ENGINE CONTROL CABLES	REINSTALLED	DUFFY, J.	F	0.1
×	 REMOVED COUPLING FROM #2 INLET PARTICLE SEPARATOR (IPS) BLOWER DUCT AND IPS BLOWER.	REINSTALLED AND TQED	DUFFY, J.	F	0.2
×	 REMOVED #2 INLET PARTICLE SEPARATOR (IPS) BLOWER DUCT.	REINSTALLED	DUFFY, J.	F	0.1
×	 REMOVED #2 LOOP CLAMP FROM DESWIRL DUCT AND ENGINE POWER TURBINE FLANGE.	REINSTALLED AND TQED	DUFFY, J.	F	0.2
×	 REMOVED BOLTS HOLDING FLANGE/COUPLING TO #2 DRIVE SHAFT.	REINSTALLED AND TQED	DUFFY, J.	F	0.2

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED









RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 09:44	
		5. FAULT DATE 29 Jun 20		6. FAULT NUMBER 2			
7. FAULT REMOVAL OF #2 ENGINE S/N- GE-E-762962 REQ'D PER CONTROL EXCHANGE							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION		11. PID	12. CAT	13. MMH
×		REMOVED BOLTS AND WASHERS HOLDING #2 FORWARD SUPPORT TUBE TO GIMBAL.	REINSTALLED AND TQED		DUFFY, J.	F	0.2
×		REMOVE COTTER PINS 2 EA FROM #2 INNER AND OUTER MOUNT STRUTS TO	REPLACED COTTER PINS		DUFFY, J.	F	0.1
×		REMOVED BOLTS, WASHERS, AND NUTS HOLDING #2 INNER AND OUTER MOUNT STRUTS TO MOUNT	REINSTALLED AND TQED		DUFFY, J.	F	0.2
×		REMOVED COTTER PIN FROM #2 CENTER MOUNT LINKS TO MOUNT SUPPORT.	REPLACED		DUFFY, J.	F	0.2
×		REMOVED BOLTS, WASHERS, AND NUTS, HOLDING #2 CENTER MOUNT LINKS TO MOUNT SUPPORT.	REINSTALLED AND TQED		DUFFY, J.	F	0.1
×		REMOVED #2 ENGINE.	REPLACED ENGINE WITH ENGINE SN: GE-E-763777C		DUFFY, J.	F	0.4
×		REMOVED COTTER PINS 2 EA FROM #2 AFT MOUNT LINKS TO FLANGE.	REPLACED COTTER PINS		DUFFY, J.	F	0.2
×		REMOVED BOLTS, WASHERS, AND NUTS HOLDING #2 AFT MOUNT LINKS TO FLANGE.	REINSTALLED AND TQED		DUFFY, J.	F	0.2
×		REMOVED #2 AFT MOUNT LINKS.	REINSTALLED		DUFFY, J.	F	0.2
×		RMVD #2 ENG HSS	REINSTALLED		Pacheco, J.	F	0.1
×		RMVD 3 EA O-RINGS FROM #2 ENG HSS	REPLACED		Pacheco, J.	F	0.1










DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 09:46	
		5. FAULT DATE 29 Jun 20		6. FAULT NUMBER 3			
7. FAULT BALANCING OF THE #1 ENGINE HSS REQ'D FOR REPLACEMENT OF ENGINE							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT	13. MMH	
×		REMOVED #1 LOWER INLET FAIRING	REINSTALLED	Leone, M.	F	0.2	
×		DISCONNECTED ELECTRICAL CONNECTOR P823	RECONNECTED	Leone, M.	F	0.1	
×		DISCONNECT FLEXIBLE COUPLING FROM #1 AIR INLET AND BLEED-AIR TUBE	RECONNECTED AND TORQUED TO 45 IN LBS	Leone, M.	F	0.1	
×		REMOVED WATERWASH HOSE FROM #1 AIR INLET	REINSTALLED	Leone, M.	F	0.2	
×		DISCONNECTED #1 FIRE EXTINGUISHER DISCHARGE TUBE FROM FITTING ON THE FIREWALL	RECONNECTED AND TORQUED	Leone, M.	F	0.1	
×		REMOVED #1 COUPLING HOLDING AIR INLET TO ENGINE SWIRL FRAME	REINSTALLED AND TORQUED TO 70 IN LBS	Leone, M.	F	0.3	
×		REMOVED # 1 ENGINE AIR INLET	REINSTALLED	Leone, M.	F	0.2	
×		RMVD #1 SIDE CROTCH ASSY. WITH ATTACHING H/W FROM #1 FORWARD SUPPORT TUBE	reinstalled and tq'd	Belyeu, C.	F	0.2	














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 09:48	
		5. FAULT DATE 29 Jun 20		6. FAULT NUMBER 4			
7. FAULT BALANCING OF THE #2 ENGINE HSS REQ'D FOR REPLACEMENT OF ENGINE							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT	13. MMH	
×		REMOVED #2 LOWER INLET FAIRING	reinstalled	Belyeu, C.	F	0.2	
×		DISCONNECTED ELECTRICAL CONNECTOR P818	connected	Belyeu, C.	F	0.2	
×		DISCONNECTED ELECTRICAL CONNECTOR P819	connected	Belyeu, C.	F	0.2	
×		DISCONNECT FLEXIBLE COUPLING FROM #2 AIR INLET AND BLEED-AIR TUBE	reinstalled and tq'd	Belyeu, C.	F	0.2	
×		REMOVED WATERWASH HOSE FROM #2 AIR INLET	reinstalled	Belyeu, C.	F	0.2	
×		DISCONNECTED #2 FIRE EXTINGUISHER DISCHARGE TUBE FROM FITTING ON THE FIREWALL	connected and tq'd	Belyeu, C.	F	0.2	
×		REMOVED #2 COUPLING HOLDING AIR INLET TO ENGINE SWIRL FRAME	reinstalled and tq'd	Belyeu, C.	F	0.2	
×		REMOVED # 2 ENGINE AIR INLET	reinstalled	Belyeu, C.	F	0.2	
×		RMVD #2 SIDE CROTCH ASSY. WITH ATTACHING H/W FROM #2 FORWARD SUPPORT TUBE	reinstalled and tq'd	Belyeu, C.	F	0.2	

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG


1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:00		
	5. FAULT DATE 29 Jun 20	6. FAULT NUMBER 5			
7. FAULT TQ CHECK OF THE #1 AND #2 HSS ATTACHING HDWR DUE BETWEEN 6014.1- 6024.1 A/C HOURS FOR REPLACEMENT OF ENGINES					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 Removed #2 eng tear drop fairing	REINSTALLED	Bender, T.	F	0.3
×	 DISC #2 INLET WATER WASH LINE	REINSTALLED	Bender, T.	F	0.2
×	 RMVD V-BAND CLAMP FROM #2 INLET	REINSTALLED AND TRQ'D	Bender, T.	F	0.3
×	 RMVD COUPLE FROM BLEED AIR TUBE	REINSTALLED AND TRQ'D	Bender, T.	F	0.3
×	 DISC #2 FIRE EXTINGUISHER LINE FROM FIRE WALL	CONNECTED	Bender, T.	F	0.3
×	 DISC ELECTRICAL CONNECTORS P819 AND P818 ON #2 INLET	CONNECTED	Bender, T.	F	0.2
×	 REMOVED #1 LOWER INLET FAIRING	REINSTALLED	Bender, T.	F	0.2
×	 DISCONNECTED ELECTRICAL CONNECTOR P823	RECONNECTED	Bender, T.	F	0.2
×	 DISCONNECT FLEXIBLE COUPLING FROM #1 AIR INLET AND BLEED-AIR TUBE	REINSTALLED AND TRQ'D	Bender, T.	F	0.2
×	 REMOVED WATERWASH HOSE FROM #1 AIR INLET	REINSTALLED	Bender, T.	F	0.3
×	 DISCONNECTED #1 FIRE EXTINGUISHER DISCHARGE TUBE FROM FITTING ON THE FIREWALL	CONNECTED	Bender, T.	F	0.2
×	 REMOVED #1 COUPLING HOLDING AIR INLET TO ENGINE SWIRL FRAME	REINSTALLED AND TRQ'D	Bender, T.	F	0.2
×	 REMOVED # 1 ENGINE AIR INLET	REINSTALLED	Bender, T.	F	0.2

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED




RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:00		
	5. FAULT DATE 29 Jun 20	6. FAULT NUMBER 5			
7. FAULT TQ CHECK OF THE #1 AND #2 HSS ATTACHING HDWR DUE BETWEEN 6014.1- 6024.1 A/C HOURS FOR REPLACEMENT OF ENGINES					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	RMVD #2 INLET	REINSTALLED	Bender, T.	F	0.5




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 10:54	
		5. FAULT DATE 30 Jun 20		6. FAULT NUMBER 1			
7. FAULT BROKEN RIVET FOUND ON #1 ENGINE FORWARD SUPPORT TUBE							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION		11. PID	12. CAT	13. MMH
×		RMVD #1 ENG FRWD SUPPORT TUBE ATTACHING HDWR 14 EA	REINSTALLED TQ= 125 IN LBS		Pacheco, J.	F	0.1
×		RMVD #1 ENG FRWD SUPPORT TUBE	REPLACED		Pacheco, J.	F	0.1
×		RMVD O-RING FROM #1 ENG FRWD SUPPORT TUBE	REPLACED		Pacheco, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 10:16	
		5. FAULT DATE 02 Jul 20		6. FAULT NUMBER 1			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT	13. MMH	
×		REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	DUFFY, J.	F	0.2	
×		REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	DUFFY, J.	F	0.1	
×		IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviewed, initilized, and reinstalled	DUFFY, J.	F	0.2	

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 10:17	
		5. FAULT DATE 02 Jul 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).			N/A THIS INSP.	DUFFY, J.	F	0.1
—	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN			N/A THIS INSP.	DUFFY, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN			N/A THIS INSP.	DUFFY, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT			INSP. OK	DUFFY, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).			INSP. OK	DUFFY, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).			INSP. OK	DUFFY, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL			INSP. OK	DUFFY, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL			INSP. OK	DUFFY, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).			INSP. OK	DUFFY, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A			N/A THIS INSP.	DUFFY, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).			INSP. OK	DUFFY, J.	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19			INSP. OK	DUFFY, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).			INSP. OK	DUFFY, J.	F	0.1




DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:17		
5. FAULT DATE 02 Jul 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 02 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	INSP. OK	DUFFY, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	INSP. OK	DUFFY, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:07		
5. FAULT DATE 08 Jul 20		6. FAULT NUMBER 1			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	REMOVED INTERMEDIATE GEARBOX COVER	REINSTALLED	Belyeu, C.	F	0.2
× 	REMOVED FWD TAIL ROTOR GEARBOX COVER	REINSTALLED	Belyeu, C.	F	0.2
× 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	DOWNLOADED, REVIEWED, INITIALIZED, AND REINSTALLED	Belyeu, C.	F	0.3

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 10:08	
		5. FAULT DATE 08 Jul 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	N/A	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	N/A	Belyeu, C.	F	0.2		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	N/A	Belyeu, C.	F	0.2		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	INSP. OK	Belyeu, C.	F	0.2		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	INSP. OK	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	INSP. OK	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	INSP. OK	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	INSP. OK	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	INSP. OK	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	INSP. OK	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	INSP. OK	Belyeu, C.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	INSP. OK	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	INSP. OK	Belyeu, C.	F	0.1		

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:08		
5. FAULT DATE 08 Jul 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	INSP. OK	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	INSP. OK	Belyeu, C.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:13		
5. FAULT DATE 08 Jul 20		6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	DUPLICATE ENTRY	Leone, M.	F	0.1
—	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	DUPLICATE ENTRY	Leone, M.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	DUPLICATE ENTRY	Leone, M.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	DUPLICATE ENTRY	Leone, M.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	DUPLICATE ENTRY	Leone, M.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	DUPLICATE ENTRY	Leone, M.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	DUPLICATE ENTRY	Leone, M.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	DUPLICATE ENTRY	Leone, M.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	DUPLICATE ENTRY	Leone, M.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	DUPLICATE ENTRY	Leone, M.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	DUPLICATE ENTRY	Leone, M.	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	DUPLICATE ENTRY	Leone, M.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	DUPLICATE ENTRY	Leone, M.	F	0.1



DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:13		
5. FAULT DATE 08 Jul 20		6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	DUPLICATE ENTRY	Leone, M.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	DUPLICATE ENTRY	Leone, M.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG




1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 00:01	
	5. FAULT DATE 14 Jul 20	6. FAULT NUMBER 1			
7. FAULT INSP A103 AIRCRAFT WASH DUE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 13 JUL 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X	 placed bag over mixer	removed	Bender, T.	F	0.1
X	 placed bags over mixer	removed	Bender, T.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG




1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:01
	5. FAULT DATE 14 Jul 20	6. FAULT NUMBER 2	

7. FAULT
 INSP A115 LUBE REQUIRMENTS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE.
 STATUS UPGRADED TO X ON: 6038.8 AIRCRAFT HOURS OR 13 JUL 2020

8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	removed upper r/h mlg strut panel	reinstalled	Belyeu, C.	F	0.2
X 	removed upper l/h mlg strut panel	reinstalled	Belyeu, C.	F	0.2
X 	removed l/h tailcone access panel	reinstalled	Bender, T.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 11:02		
5. FAULT DATE 14 Jul 20		6. FAULT NUMBER 6			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	Bender, T.	F	0.2
× 	REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	Bender, T.	F	0.2
× 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded reviewed initialized reinstalled	Bender, T.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 11:02	
		5. FAULT DATE 14 Jul 20		6. FAULT NUMBER 7			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	not installed	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	not installed	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	complete	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	complete	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	complete	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	complete	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	complete	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	complete	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	complete	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	complete	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	complete	Bender, T.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	complete	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	complete	Bender, T.	F	0.1		




DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 11:02	
		5. FAULT DATE 14 Jul 20		6. FAULT NUMBER 7			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11							
8. STA —	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).			complete	Bender, T.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).			complete	Bender, T.	F	0.1













DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 11:02		
	5. FAULT DATE 14 Jul 20	6. FAULT NUMBER 8			
7. FAULT INSPECTION MANUALLY GENERATED ON 14 JUL 2020. INSP A160 90 DAY CORROSION INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 AUG 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 removed r/h fuel enclosure panel	reinstalled	Bender, T.	F	0.2
×	 lowered upper soundproofing aft of main mod	raised	Belyeu, C.	F	0.2
×	 lowered upper soundproofing fwd of main mod	raised	Belyeu, C.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG














1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:33		
5. FAULT DATE 15 Jul 20		6. FAULT NUMBER 1			
7. FAULT DEPANELED AIRCRAFT FOR ACE INCEPTION					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 TILTED PILOT SEAT BACK	secured in flight postion	BISHOP, J.	F	0.2
×	 TILTED CO-PILOT SEAT BACK	secured in flight position	BISHOP, J.	F	0.2
×	 REMOVED UPPER EXTERNAL STORES HARD POINT FAIRINGS (L/H)	Not applicable	Leone, M.	F	0.1
×	 REMOVED UPPER EXTERNAL STORES HARD POINT FAIRINGS (R/H)	Not applicable	Leone, M.	F	0.1
×	 REMOVED LOWER EXTERNAL STORES HARD POINT FAIRINGS (L/H)	Not removed	BISHOP, J.	F	0.1
×	 REMOVED LOWER EXTERNAL STORES HARD POINT FAIRINGS (R/H)	Not removed	BISHOP, J.	F	0.1
×	 REMOVED TRANSMISSION DRIP PAN	Reinstalled	BISHOP, J.	F	0.2
×	 LOWERED ALL HINGED CABIN SOUND PROOFING	raised and secured	BISHOP, J.	F	0.2
×	 REMOVED BROOM CLOSET (L/H)	reinstalled	BISHOP, J.	F	0.1
×	 REMOVED BROOM CLOSET (R/H)	reinstalled	BISHOP, J.	F	0.2
×	 REMOVED SOUND PROOFING FROM ABOVE BEADED PANEL (L/H)	Reinstalled	BISHOP, J.	F	0.2
×	 REMOVED SOUND PROOFING FROM ABOVE BEADED PANEL (R/H)	Reinstalled	BISHOP, J.	F	0.2
×	 REMOVED SOUND PROOFING FROM UPPER AFT CABIN DOOR (L/H)	Reinstalled	BISHOP, J.	F	0.2

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG


1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:33		
	5. FAULT DATE 15 Jul 20	6. FAULT NUMBER 1			
7. FAULT DEPANELED AIRCRAFT FOR ACE INCEPTION					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 REMOVED SOUND PROOFING FROM UPPER AFT CABIN DOOR (R/H)	Reinstalled	BISHOP, J.	F	0.2
×	 REMOVED AFT BULKHEAD SOUNDPROOFING	Reinstalled	BISHOP, J.	F	0.1
×	 REMOVED TAIL CONE ACCESS PANEL (L/H)	Reinstalled	BISHOP, J.	F	0.1
×	 REMOVED TAIL CONE ACCESS PANEL (R/H)	Reinstalled	BISHOP, J.	F	0.1
×	 REMOVED INTERMEDIATE GEARBOX COVER	Reinstalled	BISHOP, J.	F	0.1
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	Reinstalled	BISHOP, J.	F	0.2
×	 REMOVED TAIL STRUT ACCESS PANEL (L/H)	Reinstalled	BISHOP, J.	F	0.1
×	 REMOVED TAIL STRUT ACCESS PANEL (R/H)	Reinstalled	BISHOP, J.	F	0.1
×	 REMOVED LOWER TAIL PYLON 5-IN ROUND ACCESS PANEL TO FLIGHT CONTROLS	Reinstalled	BISHOP, J.	F	0.1
×	 DISCONNECTED ELEC CONNECTOR FROM #2 FM ANTENNA	Reconnected	Leone, M.	F	0.1
×	 REMOVED #2 FM ANTENNA	Reinstalled	Leone, M.	F	0.1
×	 REMOVED SOUNDPROOFING RIGHT OF MAIN TRANSMISSION	Reinstalled	BISHOP, J.	F	0.1
×	 REMOVED SOUNDPROOFING LEFT OF MAIN TRANSMISSION	Reinstalled	BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED




RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 13:08
	5. FAULT DATE 16 Jul 20		6. FAULT NUMBER 3		
7. FAULT fwd lh corner of soundproofing fwd of main transmission has bad nutplate					
8. STA /	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT
	NUTPLATE REQUIRES INSTALLATION		INSTALLED	Fraser, C.	F

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 08:20		
5. FAULT DATE 23 Jul 20		6. FAULT NUMBER 1			
7. FAULT OIL OBSERVED POOLING AT #2 ENG DESWIRL DUCT					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 LOOSENED OIL SUPPLY TUBE COUPLING NUTS FROM B-SUMP CHECK VALVE. (2EA)	reinstalled, trqd	CEPELAK, C.	F	0.1
×	 RMVD MOUNTING HDWR FROM B-SUMP CHECK VALVE SUPPORT BRACKET AND CLAMP.	reinstalled, trqd	CEPELAK, C.	F	0.1
×	 RMVD B-SUMP CHECK VAVLE.	replaced valve	CEPELAK, C.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG








1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 09:57		
	5. FAULT DATE 23 Jul 20	6. FAULT NUMBER 2			
7. FAULT STABILATOR HAS EXCESSIVE PLAY					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	REMOVED L/H STABILATOR PYLON FAIRING	reinstalled	WALKER, A.	F	0.1
×	REMOVED R/H STABILATOR PYLON FAIRING	reinstalled	Ellis, Z.	F	0.1
×	REMOVED TAIL ROTOR LOWER PYLON FAIRING	REINSTALLED	Ellis, Z.	F	0.2
×	DISCONNECTED COAXIAL CONNECTOR J3 FROM RECEPTACLE OF RECIEVER	RECONNECTED	WALKER, A.	F	0.1
×	DISCONNECTED COAXIAL CONNECTOR J4 FROM RECEPTACLE OF RECIEVER	RECONNECTED	WALKER, A.	F	0.1
×	DISCONNECTED COAXIAL CONNECTOR J5 FROM RECEPTACLE OF RECIEVER	RECONNECTED	WALKER, A.	F	0.2
×	DISCONNECTED BONDING JUMPER FROM RADAR WARNING SYSTEM RECIEVER	RECONNECTED	WALKER, A.	F	0.1
×	DISCONNECTED FORMATION LIGHT ELECTRICAL CONNECTOR J702 FROM PYLON	RECONNECTED	WALKER, A.	F	0.1
×	DISCONNECTED FORMATION LIGHT ELECTRICAL CONNECTOR J703 FROM PYLON	RECONNECTED	WALKER, A.	F	0.1
×	DISCONNECTED BONDING JUMPING CONENCTING STABILATOR TO PYLON	WRITE UP ENTERED IN ERROR	Ellis, Z.	F	0.1
×	REMOVED HDWR CONNECTING LIMIT SWITCH ACTUATOR ROD TO STABILATOR	reinstalled tq to 21in/lbs	WALKER, A.	F	0.1
×	REMOVED HDWR CONNECTING STABILATOR ACTUATOR ROD TO STABILATOR	REINSTALLED TQ'D NUT TO 150 INCH LBS.	Ellis, Z.	F	0.2
×	REMOVED L/H HDWR CONNECTING STABILATOR TO PYLON	REPLACED, TQ'D TO 680 IN LBS.	Ellis, Z.	F	0.5

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED




RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 09:57	
		5. FAULT DATE 23 Jul 20		6. FAULT NUMBER 2			
7. FAULT STABILATOR HAS EXCESSIVE PLAY							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION		11. PID	12. CAT	13. MMH
×		REMOVED R/H HDWR CONNECTING STABILATOR TO PYLON	REINSTALLED, TIGHTENED NUT UNTIL FIRMLY SEATED, BACKOFF		Ellis, Z.	F	0.3
×		REMOVED STABILATOR	REINSTALLED		Ellis, Z.	F	0.2
×		DISCONNECTED BONDING JUMPERS R/H, L/H CONNECTING STABILATOR TO PYLON	reinstalled		WALKER, A.	F	0.1
×		RMVD COTTERPIN FROM R/H STAB ATTACHMENT BOLT 1 EA	REPLACED		Ellis, Z.	F	0.2
×		RMVD COTTERPIN FROM L/H STAB ATTACHMENT BOLT 1 EA	REPLACED		Ellis, Z.	F	0.2
×		RMVD COTTERPIN FROM STAB ACTUATOR ATTACHMENT BOLT 1 EA	REPLACED		Ellis, Z.	F	0.2
×		RMVD COTTERPIN 1 EA FROM LIMIT SWITCH HDWR	REPLACED		Ellis, Z.	F	0.2














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:21		
5. FAULT DATE 23 Jul 20		6. FAULT NUMBER 5			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	Ellis, Z.	F	0.1
× 	REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	Ellis, Z.	F	0.1
× 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviewed, initialized, and reinstalled	Pacheco, J.	F	0.3

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:23		
	5. FAULT DATE 23 Jul 20	6. FAULT NUMBER 6			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	n/a	CEPELAK, C.	F	0.1
— 	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	n/a	CEPELAK, C.	F	0.1
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	n/a	CEPELAK, C.	F	0.1
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	insp ok	CEPELAK, C.	F	0.1
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	insp ok	CEPELAK, C.	F	0.1
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp ok	CEPELAK, C.	F	0.1
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	insp ok	CEPELAK, C.	F	0.1
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp ok	CEPELAK, C.	F	0.1
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	insp ok	CEPELAK, C.	F	0.1
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	insp ok	CEPELAK, C.	F	0.1
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	insp ok	CEPELAK, C.	F	0.1
— 	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp ok	CEPELAK, C.	F	0.1
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	insp ok	CEPELAK, C.	F	0.1

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG


1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:23
	5. FAULT DATE 23 Jul 20	6. FAULT NUMBER 6	

7. FAULT
 DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11

8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
— (H) (CLOSED)	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	insp ok	CEPELAK, C.	F	0.1
— (H) (CLOSED)	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	insp ok	CEPELAK, C.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 09:54		
5. FAULT DATE 24 Jul 20		6. FAULT NUMBER 1			
7. FAULT R/H TAIL PYLON STAB HINGE FITTING SPHERICAL BEARINGS WORN BEYOND LIMITS					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	RMVD BEARINGS 2 EA	replaced and staked new bearings 2 ea	HIGGINS, P.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE E	4. TIME 00:00		
5. FAULT DATE 27 Jul 20		6. FAULT NUMBER 2			
7. FAULT INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 02 AUG 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X	RMVD INSP COVER	REINSTALLED	Ellis, Z.	F	0.2
X	RMVD BATTERY COVER	REINSTALLED	Ellis, Z.	F	0.1

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 13:45	
		5. FAULT DATE 01 Aug 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	N/A THIS INSPECTION	Ellis, Z.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	N/A THIS INSPECTION	WALKER, A.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	N/A THIS INSPECTION	WALKER, A.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	INSPECT OK	WALKER, A.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	INSPECT OK	WALKER, A.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	INSPECT OK	WALKER, A.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	INSPECT OK	WALKER, A.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	INSPECT OK	WALKER, A.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	N/A THIS INSPECTION	WALKER, A.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	INSPECT OK	WALKER, A.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	INSPECT OK	WALKER, A.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	INSPECT OK	WALKER, A.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	INSPECT OK	WALKER, A.	F	0.1		


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 13:45		
5. FAULT DATE 01 Aug 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	INSPECT OK	WALKER, A.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	INSPECT OK	WALKER, A.	F	0.1


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 12:08	
		5. FAULT DATE 05 Aug 20	6. FAULT NUMBER 1			
7. FAULT APU NITROGEN CHARGE LEVEL TO LOW						
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION		11. PID	12. CAT	13. MMH
X 	BROKE TORQUE ON SCHRADER VALVE	RETORQUED 60IN LBS		MEADE, D.	F	0.3




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428		3. SYSTEM CODE E		4. TIME 00:01
	5. FAULT DATE 06 Aug 20		6. FAULT NUMBER 1		
7. FAULT INSP E351 REPLACE APX-118 TRANSPONDER BATTERY FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 11 SEP 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	REMOVED TRANSPONDER BATTERY COVER	REINSTALLED	TARBOX, C.	F	0.1


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 00:01	
	5. FAULT DATE 10 Aug 20	6. FAULT NUMBER 1			
7. FAULT INSP A115 LUBE REQUIRMENTS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6056.1 AIRCRAFT HOURS OR 16 AUG 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 removed upper r/h mlg strut panel	reinstalled	MEADE, D.	F	0.1
×	 removed upper l/h mlg strut panel	reinstalled	MEADE, D.	F	0.1
×	 removed r/h tailcone access panel	reinstalled	MEADE, D.	F	0.1














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:01		
5. FAULT DATE 10 Aug 20		6. FAULT NUMBER 2			
7. FAULT INSP A103 AIRCRAFT WASH DUE FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 16 AUG 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	placed bags over mixer and hyd deck vents	removed	MEADE, D.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 10:32	
		5. FAULT DATE 10 Aug 20		6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	not installed	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	not installed	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	complete	EISENHAUEF	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	complete	EISENHAUEF	F	0.1		




DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:32		
	5. FAULT DATE 10 Aug 20	6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	complete	EISENHAUEF	F	0.1


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:32		
	5. FAULT DATE 10 Aug 20	6. FAULT NUMBER 5			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	MEADE, D.	F	0.1
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	MEADE, D.	F	0.1
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded reviewed initialized reinstalled	MEADE, D.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:03		
	5. FAULT DATE 10 Aug 20	6. FAULT NUMBER 7			
7. FAULT worn turnlock receptical on trgb fairing					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	RMVD TURNLOCK RECEPTICAL	REPLACED	Fraser, C.	F	0.3

DA FORM 2408-13-2-SG, OCT 97 **RELATED MAINTENANCE ACTIONS RECORD**
 DA FORM 2408-13-2, NOV 91, MAY BE USED For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 13:04		
5. FAULT DATE 18 Aug 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	not installed	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	not installed	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	not applicable	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	NOT INSTALLED	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	inspect ok	MILLIKEN, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG




1. STATUS —		2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 13:04	
		5. FAULT DATE 18 Aug 20	6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 02 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11						
8. STA —	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).		inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).		inspect ok	MILLIKEN, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG




1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 13:04
	5. FAULT DATE 18 Aug 20	6. FAULT NUMBER 4	

7. FAULT
PMD DUE

8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	MILLIKEN, J.	F	0.2
X 	REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	MILLIKEN, J.	F	0.2
X 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviewed, intilized, reinstalled	MILLIKEN, J.	F	0.1












DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 11:14	
		5. FAULT DATE 21 Aug 20		6. FAULT NUMBER 1			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION		11. PID	12. CAT	13. MMH	
×	 REMOVED INTERMEDIATE GEARBOX COVER	REISNTALLED		Bender, T.	F	0.2	
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	REINSTALLED		Bender, T.	F	0.1	
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	DOWNLOADED, REVIEWED, INIALIZED AND REINSTALLED		Bender, T.	F	0.2	

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 12:18		
5. FAULT DATE 21 Aug 20		6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	NOT APPLICABLE THIS INSPECTION	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	NOT INSTALLED	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	NOT APPLICABLE	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	INSP OK	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	INSP OK	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	INSP OK	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	INSP OK	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	INSP OK	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	NOT INSTALLED	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	INSP OK	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	INSP OK	Bender, T.	F	0.1
—	 PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	INSP OK	Bender, T.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	INSP OK	Bender, T.	F	0.1




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 12:18	
	5. FAULT DATE 21 Aug 20	6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	INSP OK	Bender, T.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	INSP OK	Bender, T.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 10:58	
	5. FAULT DATE 24 Aug 20	6. FAULT NUMBER 1			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	HIGGINS, P.	F	0.2
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	HIGGINS, P.	F	0.2
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded reviewed intialized and reinstalled	HIGGINS, P.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:58		
	5. FAULT DATE 24 Aug 20	6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	n/a this insp	HIGGINS, P.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	n/a this insp	HIGGINS, P.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	n/a this insp	HIGGINS, P.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	insp ok	HIGGINS, P.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	insp ok	HIGGINS, P.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp ok	HIGGINS, P.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	insp ok	HIGGINS, P.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp ok	MILLIKEN, J.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	n/a this insp	HIGGINS, P.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	insp ok	HIGGINS, P.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	insp ok	HIGGINS, P.	F	0.2
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp ok	HIGGINS, P.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	insp ok	HIGGINS, P.	F	0.2

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED


RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 10:58	
	5. FAULT DATE 24 Aug 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11						
8. STA —	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).		insp ok	HIGGINS, P.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).		insp ok	HIGGINS, P.	F	0.2


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:00		
	5. FAULT DATE 29 Aug 20	6. FAULT NUMBER 1			
7. FAULT INSP A533 PITOT STATIC SYSTEM INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 28 OCT 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	REMOVED LH AND RH PITOT-STATIC DRAING PLUGS 4 TOTAL	REINSTALLED TO 60 IN-LBS	TARBOX, C.	F	0.3




DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 09:11		
5. FAULT DATE 01 Sep 20		6. FAULT NUMBER 2			
7. FAULT SAFETY MESSAGE NUMBER: H-60-20-ASAM-09 DESCRIPTION: COMPLY WITH H-60-20-ASAM-09 NON-CONFORMING TAIL ROTOR PUSHROD CLEVIS ROD END, BY 06 SEPT 20. IS DUE: 06 SEP 2020 CALENDAR					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	RMVD FWD T/R G/B COVER	REINSTALLED	HIGGINS, P.	F	0.2














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 10:29	
		5. FAULT DATE 01 Sep 20		6. FAULT NUMBER 4			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION		11. PID	12. CAT	13. MMH
×		REMOVED INTERMEDIATE GEARBOX COVER	reinstalled		MCGRAW, A	F	0.2
×		REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled		MCGRAW, A	F	0.2
×		IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviewed, and initilized		MCGRAW, A	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:29		
	5. FAULT DATE 01 Sep 20	6. FAULT NUMBER 5			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	complete	MCGRAW, A	F	0.2
— 	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	complete	Gonzalez, R.	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	complete	Gonzalez, R.	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	complete	Gonzalez, R.	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	complete	Gonzalez, R.	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	complete	MCGRAW, A	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	complete	Gonzalez, R.	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	complete	Gonzalez, R.	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	complete	Gonzalez, R.	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	complete	MCGRAW, A	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	complete	Gonzalez, R.	F	0.2
— 	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	complete	Gonzalez, R.	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	complete	Gonzalez, R.	F	0.2

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED


RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 10:29	
5. FAULT DATE 01 Sep 20		6. FAULT NUMBER 5				
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11						
8. STA —	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).		complete	Gonzalez, R.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).		complete	MCGRAW, A	F	0.2




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×		2. SERIAL NUMBER 8023428		3. SYSTEM CODE E		4. TIME 00:01	
		5. FAULT DATE 02 Sep 20		6. FAULT NUMBER 1			
7. FAULT INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 01 SEP 2020							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
× 	RMVD HF BATTERY ACCESS PANEL			REINSTALLED	Bender, T.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 11:19		
5. FAULT DATE 04 Sep 20		6. FAULT NUMBER 1			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	REMOVED INTERMEDIATE GEARBOX COVER	REINSTALLED	Bender, T.	F	0.1
X 	REMOVED FWD TAIL ROTOR GEARBOX COVER	REINSTALLED	Bender, T.	F	0.1
X 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	DOWNLOADED, REVIEWED, INITIALIZED, AND REINSTALLED	Bender, T.	F	0.1

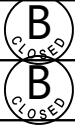

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 11:20	
		5. FAULT DATE 04 Sep 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	N/A THIS INSPECTION	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	N/A THIS INSPECTION	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	N/A THIS INSPECTION	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	INSPECT OK	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	INSPECT OK	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	INSPECT OK	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	INSPECT OK	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	INSPECT OK	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	N/A THIS INSPECTION	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	INSPECT OK	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	INSPECT OK	Bender, T.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	INSPECT OK	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	INSPECT OK	Bender, T.	F	0.1		




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 11:20	
		5. FAULT DATE 04 Sep 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	INSPECT OK	Bender, T.	F	0.1		
—		 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	INSPECT OK	Bender, T.	F	0.1	




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 12:27	
		5. FAULT DATE 04 Sep 20		6. FAULT NUMBER 3			
7. FAULT R/H INBOARD CARGO DOOR HANDLE WILL NOT OPEN DOOR							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 RMVD INNER DOOR HANDLE	REPLACED	Bender, T.	F	0.1		
×	 RMVD PANEL FROM LOCK MECHINISM	REISNTALLED	Bender, T.	F	0.2		
×	 RMVD DRIVE KEY	REISNTALLED	Bender, T.	F	0.2		

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG


1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 00:01	
		5. FAULT DATE 09 Sep 20		6. FAULT NUMBER 1			
7. FAULT INSP A115 LUBE REQUIRMENTS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 SEP 2020 OR 6056.1 AIRCRAFT HOURS							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 REMOVED L/H UPPER MAIN LANDING GEAR FAIRING	reinstalled	JACKSON, N	F	0.2		
×	 REMOVED R/H UPPER MAIN LANDING GEAR FAIRING	reinstalled	MILLIKEN, J.	F	0.2		
×	 REMOVED L/H TAIL CONE ACCESS PANEL	reinstalled	Belyeu, C.	F	0.2		

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:01
	5. FAULT DATE 09 Sep 20	6. FAULT NUMBER 2	

7. FAULT
 INSP A103 AIRCRAFT WASH DUE FOR HCPTN UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE.
 STATUS WILL UPGRADE TO X ON: 15 SEP 2020

8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	installed vent and mixer bags 3ea	rmvd 3ea	Belyeu, C.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:17	
		5. FAULT DATE 15 Sep 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	not installed	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	insp. ok	Belyeu, C.	F	0.1		




DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:17	
		5. FAULT DATE 15 Sep 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT	13. MMH	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).		insp. ok	Belyeu, C.	F	0.1	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).		insp. ok	Belyeu, C.	F	0.1	




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:17	
		5. FAULT DATE 15 Sep 20		6. FAULT NUMBER 3			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 REMOVED INTERMEDIATE GEARBOX COVER	REINSTALLED	JACKSON, N	F	0.1		
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	REINSTALLED	JACKSON, N	F	0.1		
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviewed, initialized and reinstalled	Belyeu, C.	F	0.2		














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:28		
		5. FAULT DATE 18 Sep 20		6. FAULT NUMBER 2				
7. FAULT PMD DUE								
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION		11. PID	12. CAT	13. MMH
×		REMOVED INTERMEDIATE GEARBOX COVER		reinstalled		Belyeu, C.	F	0.1
×		REMOVED FWD TAIL ROTOR GEARBOX COVER		reinstalled		Belyeu, C.	F	0.1
×		IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,		downloaded reviewed initialized reinstalled		Belyeu, C.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:28	
		5. FAULT DATE 18 Sep 20		6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	not installed	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	not installed	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	complete	EISENHAUEF	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	complete	EISENHAUEF	F	0.1		

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:28	
		5. FAULT DATE 18 Sep 20		6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).			complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).			complete	EISENHAUEF	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:00	
		5. FAULT DATE 26 Sep 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).			not installed	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN			not installed	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN			not applicable	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT			not installed	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).			inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).			inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL			not installed	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL			inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).			inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A			inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).			inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19			inspect ok	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).			inspect ok	MILLIKEN, J.	F	0.1




DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:00	
		5. FAULT DATE 26 Sep 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11							
8. STA —	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT	13. MMH	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).		inspect ok	MILLIKEN, J.	F	0.1	
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).		inspect ok	MILLIKEN, J.	F	0.1	







DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:00	
		5. FAULT DATE 26 Sep 20		6. FAULT NUMBER 3			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT	13. MMH	
×		REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	MILLIKEN, J.	F	0.2	
×		REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	MILLIKEN, J.	F	0.2	
×		IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviwed, initlized, reinstalled	MILLIKEN, J.	F	0.1	







DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:00		
5. FAULT DATE 28 Sep 20		6. FAULT NUMBER 1			
7. FAULT INSP A638 RESERVE FIRE BOTTLE #2, CARTRIDGE DODIC MH92 FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 27 SEP 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X	 disconnected power and ground elec connectors and hdwr 2 ea	installed on new cartridge	HIGGINS, P.	F	0.2
X	 RMVD SAFETY	replaced	HIGGINS, P.	F	0.2
X	 INSTALLED BONDING JUMPER	REMOVED	HIGGINS, P.	F	0.2
X	 RMVD CARTRIDGE S/N 313	REPLACED	HIGGINS, P.	F	0.2
X	 RMVD O-RING	REPLACED WITH NEW CARTRIDGE	HIGGINS, P.	F	0.2
X	 terminal wire connectors require replacement due to replacement of new squibs.	replaced terminal heads	Bartlett, C.	F	0.3







DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:00		
	5. FAULT DATE 28 Sep 20	6. FAULT NUMBER 2			
7. FAULT INSP A633 RESERVE FIRE BOTTLE #1, CARTRIDGE, DODIC MH92 FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 27 SEP 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X	 DISCONNECTED POWER AND GROUND ELEC CONNECTORS 2 EA AND HDWR	installed on new cartridge and tq'd	HIGGINS, P.	F	0.2
X	 RMVD SAFETY	replaced	HIGGINS, P.	F	0.2
X	 INSTALLED JUMPER	removed	HIGGINS, P.	F	0.2
X	 RMVD CARTRIDGE S/N 312	replaced	HIGGINS, P.	F	0.2
X	 RMVD O-RING	REPLACED WITH NEW CARTRIDGE	HIGGINS, P.	F	0.2
X	 terminal wire connectors require replacement due to replacement of new squibs.	replaced terminal heads.	Bartlett, C.	F	0.5











DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 00:01	
		5. FAULT DATE 03 Oct 20		6. FAULT NUMBER 1			
7. FAULT INSP A160 90 DAY CORROSION INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 21 OCT 2020							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 lowered soundproofing fwd of main transmission	secured	Belyeu, C.	F	0.2		
×	 lowered soundproofing aft of main transmission	secured	Belyeu, C.	F	0.2		
×	 removed rh fuel enclosure panel	reinstalled	Belyeu, C.	F	0.2		
×	 removed lh tail cone access panel and hdwr	entered in error	MILLIKEN, J.	F	0.1		
×	 removed IGB cover	reinstalled	Belyeu, C.	F	0.2		
×	 removed fwd TGB cover	reinstalled	Belyeu, C.	F	0.2		

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:58	
		5. FAULT DATE 03 Oct 20		6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	N/A	CEPELAK, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	N/A	CEPELAK, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	N/A	CEPELAK, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	INSP OK	CEPELAK, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	INSP OK	CEPELAK, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	INSP OK	CEPELAK, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	INSP OK	CEPELAK, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	INSP OK	CEPELAK, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	INSP OK	CEPELAK, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	INSP OK	CEPELAK, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	INSP OK	CEPELAK, C.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	INSP OK	CEPELAK, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	INSP OK	CEPELAK, C.	F	0.1		










DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 07:59	
		5. FAULT DATE 03 Oct 20	6. FAULT NUMBER 4			
7. FAULT PMD DUE						
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH	
×	REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	CRONK, B.	F	0.1	
×	REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	CRONK, B.	F	0.1	
×	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, initialized, reinstalled	CEPELAK, C.	F	0.1	






DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:55		
5. FAULT DATE 04 Oct 20		6. FAULT NUMBER 2			
7. FAULT INSP A110 PMS 40 HOUR INSPECTION FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6038.8 AIRCRAFT HOURS					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	removed upper r/h mlg strut panel	reinstalled	Vaillancourt, 3681203	F	0.1
X 	removed upper l/h mlg strut panel	reinstalled	Vaillancourt, 3681203	F	0.1
X 	removed l/h tailcone access panel	reinstalled	Vaillancourt, 3681203	F	0.1
X 	removed outboard stab insp panels	reinstalled	Vaillancourt, 3681203	F	0.1
X 	removed r/h fuel enclosure panel	reinstalled	Vaillancourt, 3681203	F	0.1
X 	lowered upper cabin soundproofing aft of main mod	reinstalled	Vaillancourt, 3681203	F	0.1
X 	lowered upper cabin soundproofing fwd of main mod	reinstalled	Vaillancourt, 3681203	F	0.1
X 	removed apu fuel control cover	reinstalled	CHADBOURNE	F	0.1
X 	removed oil cooler insp panel	reinstalled	CHADBOURNE	F	0.1














DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 15:56	
		5. FAULT DATE 04 Oct 20		6. FAULT NUMBER 3			
7. FAULT PILOT AND CO-PILOT WINDSHIELD ANTI-ICE INOP.							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 REMOVED CENTER WINDSHIELD DE-ICE CONTROLLER	REINSTALLED	TARBOX, C.	F	0.2		
×	 LOWERED AFT CEILING SOUNDPROOFING	REINSTALLED	TARBOX, C.	F	0.1		
×	 LOWERED FWD RH AND LH SOUNDPROOFING	REINSTALLED	TARBOX, C.	F	0.1		
×	 DISCONNECTED P275 FROM COPILOT WINDSHIELD DE-ICE CONTROLLER	RECONNECTED	TARBOX, C.	F	0.1		
×	 DISCONNECTED P217 FROM PILOT WINDSHIELD DE-ICE CONTROLLER	RECONNECTED	TARBOX, C.	F	0.1		

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 12:23	
		5. FAULT DATE 05 Oct 20		6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	not installed	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	not installed	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	complete	EISENHAUEF	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	complete	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	complete	EISENHAUEF	F	0.1		




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 12:23		
5. FAULT DATE 05 Oct 20		6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	complete	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	complete	EISENHAUEF	F	0.1


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 12:23	
		5. FAULT DATE 05 Oct 20		6. FAULT NUMBER 5			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION		11. PID	12. CAT	13. MMH	
×	 REMOVED INTERMEDIATE GEARBOX COVER	reinstalled		Vaillancourt, 3681203	F	0.1	
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled		Vaillancourt, 3681203	F	0.1	
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded reviewed initialized reinstalled		Vaillancourt, 3681203	F	0.1	














DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 12:23	
		5. FAULT DATE 05 Oct 20		6. FAULT NUMBER 6			
7. FAULT a/c nose screen change required from summer to winter							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
×	 removed summer screen			installed winter plate	EISENHAUEF	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG














1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 12:44	
		5. FAULT DATE 06 Oct 20		6. FAULT NUMBER 1			
7. FAULT PILOT AND COPILOT WINDSHIELD DE-ICE INOP. CENTER WINDSHIELD FUNCTIONS NORMALLY.							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 REMOVED 3EA FWD TROOP SEATS	reinstalled	Rezentes, N.	F	0.5		
×	 REMOVED H-BAR AND ATTACH HARDWARE	REINSTALLED	Rezentes, N.	F	1.0		
×	 LOWERED CENTER FWD SOUNDPROOFING	REINSTALLED	Rezentes, N.	F	0.5		
×	 REMOVED RH RELAY PANEL	REINSTALLED	TARBOX, C.	F	0.2		
×	 LOWERED OVERHEAD CONSOLE	REINSTALLED	TARBOX, C.	F	0.1		
×	 LOWERED FWD RH SOUDPROOFING	REINSTALLED	TARBOX, C.	F	0.2		
×	 DISCONNECTED TERMINALS 8 EA FROM COPILOTS WINDSHIELD	RECONNECTED	TARBOX, C.	F	0.4		
×	 DISCONNECTED TERMINALS 8 EA FROM CENTER WINDSHIELD	RECONNECTED	TARBOX, C.	F	0.4		
×	 DISCONNECTED CONNECTORS 2 EA FROM PILOTS WINDSHIELD ANTI-ICE CONTROLLER	RECONNECTED	TARBOX, C.	F	0.1		
×	 REMOVED NO.2 JUNCTION BOX COVER	REINSTALLED	TARBOX, C.	F	0.2		
×	 REMOVED NO.1 JUNCTION BOX COVER	REINSTALLED	TARBOX, C.	F	0.2		
×	 REMOVED COVER FROM K1 RELAY	REINSTALLED	TARBOX, C.	F	0.1		
×	 DISCONNECTED P212 FROM K1 RELAY	RECONNECTED	TARBOX, C.	F	0.1		

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED











RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 12:44	
		5. FAULT DATE 06 Oct 20		6. FAULT NUMBER 1			
7. FAULT PILOT AND COPILOT WINDSHIELD DE-ICE INOP. CENTER WINDSHIELD FUNCTIONS NORMALLY.							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 DISCONNECTED TERMINALS 15 EA FROM K1 RELAY	RECONNECTED	TARBOX, C.	F	0.3		
×	 REMOVED K1 RELAY	REPLACED	Mower, H.	F	0.4		
×	 REMOVED COVER FROM K19 RELAY	REINSTALLED	TARBOX, C.	F	0.1		
×	 DISCONNECTED TERMINALS 11 EA FROM K19 RELAY	RECONNECTED	TARBOX, C.	F	0.3		
×	 REMOVED K19 RELAY	REPLACED	TARBOX, C.	F	0.3		
×	 REMOVED COVER FROM K2 RELAY	REINSTALLED	TARBOX, C.	F	0.1		
×	 DISCONNECTED P204 FROM K2 RELAY	RECONNECTED	TARBOX, C.	F	0.1		
×	 DISCONNECTED TERMINALS 24 EA FROM K2 RELAY	RECONNECTED	TARBOX, C.	F	0.3		
×	 REMOVED K2 RELAY	REPLACED	TARBOX, C.	F	0.4		
×	 REMOVED COVER FROM K3 RELAY	REINSTALLED	TARBOX, C.	F	0.1		
×	 DISCONNECTED P205 FROM K3 RELAY	RECONNECTED	TARBOX, C.	F	0.1		
×	 DISCONNECTED TERMINALS 18 EA FROM K3 RELAY	RECONNECTED	TARBOX, C.	F	0.3		
×	 REMOVED K3 RELAY	REPLACED	TARBOX, C.	F	0.3		




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 12:44	
		5. FAULT DATE 06 Oct 20		6. FAULT NUMBER 1			
7. FAULT PILOT AND COPILOT WINDSHIELD DE-ICE INOP. CENTER WINDSHIELD FUNCTIONS NORMALLY.							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 REMOVED COVER FROM K4 RELAY	REINSTALLED	TARBOX, C.	F	0.1		
×	 DISCONNECTED P206 FROM K4 RELAY	RECONNECTED	TARBOX, C.	F	0.1		
×	 DISCONNECTED TERMINALS 9 EA FROM K4 RELAY	RECONNECTED	TARBOX, C.	F	0.3		
×	 REMOVED K4 RELAY	REINSTALLED	Mower, H.	F	0.3		
×	 REMOVED PILOTS OVERHEAD DUCT	REINSTALLED	TARBOX, C.	F	0.2		
×	 LOWERED PILOTS CIRCUIT BREAKER PANEL	REINSTALLED	TARBOX, C.	F	0.2		
×	 REMOVED COPILOTS OVERHEAD DUCT	REINSTALLED	TARBOX, C.	F	0.2		
×	 LOWERED COPILOTS CIRCUIT BREAKER PANEL	REINSTALLED	TARBOX, C.	F	0.2		
×	 REMOVED HYD DECK SLIDING COVER	REINSTALLED	TARBOX, C.	F	0.2		
×	 DISCONNECTED TERMINALS 8 EA FROM PILOTS WINDSHIELD	RECONNECTED	TARBOX, C.	F	0.4		



DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:01		
5. FAULT DATE 09 Oct 20		6. FAULT NUMBER 1			
7. FAULT INSP A115 LUBE REQUIRMENTS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6066.6 AIRCRAFT HOURS OR 15 OCT 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	removed rh upper strut fairing and hdwr	reinstalled	Belyeu, C.	F	0.2
X 	removed lh upper strut fairing and hdwr	reinstalled	Belyeu, C.	F	0.2
X 	removed lh tail cone acces panel and hdwr	reinstalled	Belyeu, C.	F	0.2




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:01		
5. FAULT DATE 09 Oct 20		6. FAULT NUMBER 2			
7. FAULT INSP A103 AIRCRAFT WASH DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 15 OCT 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X	 installed bags on hyd deck vents	removed	Belyeu, C.	F	0.2
X	 installed bag on mixer assy	removed	Belyeu, C.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 13:32	
		5. FAULT DATE 13 Oct 20		6. FAULT NUMBER 1			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION		11. PID	12. CAT	13. MMH
×		REMOVED INTERMEDIATE GEARBOX COVER	reinstalled		MILLIKEN, J.	F	0.2
×		REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled		MILLIKEN, J.	F	0.2
×		IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviewed, initialized and reinstalled		Belyeu, C.	F	0.2



DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 13:32	
		5. FAULT DATE 13 Oct 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	not applicable	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	not installed	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	not applicable	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	insp ok	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	insp ok	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp ok	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	not installed	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp ok	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	not installed	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	not installed	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	insp ok	BISHOP, J.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp ok	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	insp ok	BISHOP, J.	F	0.1		









DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 13:32		
5. FAULT DATE 13 Oct 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT). 	insp ok	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C). 	insp ok	BISHOP, J.	F	0.1







DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 14:44	
		5. FAULT DATE 13 Oct 20		6. FAULT NUMBER 3			
7. FAULT Red TRB boot torn near outboard zip tie							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 Removed red tiedown straps 2 ea	replaced	Belyeu, C.	F	0.2		
×	 rmvd tail red blade cips 4ea	fault narritave entered in error	MILLIKEN, J.	F	0.1		
×	 Disconnectd red pc rod from horn	reconnected	Belyeu, C.	F	0.2		
×	 disconnected red tail rotor de-ice connector from blade	reconnected	Belyeu, C.	F	0.2		
×	 rmvd red tail rotor blade boot	replaced	Belyeu, C.	F	0.5		
×	 rmvd tail red blade cips 2ea	duplicate fault narriative entered in error	MILLIKEN, J.	F	0.1		
×	 rmvd tail red blade clips 2ea	replaced	Belyeu, C.	F	0.2		
×	 rmvd lower red pc rod connecting hdwr	replaced nut tq'd 119 in lbs, washer, bolt	Belyeu, C.	F	0.2		



DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 10:44	
		5. FAULT DATE 14 Oct 20		6. FAULT NUMBER 1			
7. FAULT Troop commanders ICS box aft RH resilient mount torn							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 lowered soundproofing fwd of main xmsn	reinstalled	Rezentes, N.	F	0.5		
×	 loosenend fasteners on troop commanders ics control	reinstalled	BISHOP, J.	F	0.1		
×	 removed hdwr on aft rh resilient mount	reinstalled	BISHOP, J.	F	0.1		
×	 removed rivets holding mount to airframe	replaced	BISHOP, J.	F	0.2		
×	 removed mount	reinstalled	BISHOP, J.	F	0.2		
×	 removed resilient pad and rivets from mount	replaced	BISHOP, J.	F	0.2		




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:01		
5. FAULT DATE 19 Oct 20		6. FAULT NUMBER 1			
7. FAULT INSP A230 INSPECT BATTERY COMPARTMENT FOR CORROSION (SLAB) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 12 NOV 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	removed safeties from battery mount hdwr	replaced	BISHOP, J.	F	0.1
× 	removed battery	reinstalled	BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:28		
5. FAULT DATE 21 Oct 20		6. FAULT NUMBER 2			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X	 REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	Belyeu, C.	F	0.2
X	 REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	Belyeu, C.	F	0.2
X	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviewed instialized and reinstalled	Belyeu, C.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:28	
		5. FAULT DATE 21 Oct 20		6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	not installed	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	insp. ok	Belyeu, C.	F	0.1		














DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 07:28	
5. FAULT DATE 21 Oct 20		6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 30 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	insp. ok	Belyeu, C.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:49	
		5. FAULT DATE 27 Oct 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	insp. ok	Belyeu, C.	F	0.1		




DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:49		
		5. FAULT DATE 27 Oct 20		6. FAULT NUMBER 2				
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 30 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11								
8. STA —	9. RELATED MAINTENANCE ACTIONS			10. ACTION		11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).			insp. ok		Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).			insp. ok		Belyeu, C.	F	0.1

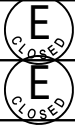

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:49	
		5. FAULT DATE 27 Oct 20		6. FAULT NUMBER 3			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	Belyeu, C.	F	0.2		
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	Belyeu, C.	F	0.2		
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviewed, intitialized and reinstalled	Belyeu, C.	F	0.2		

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE E	4. TIME 00:00		
	5. FAULT DATE 31 Oct 20	6. FAULT NUMBER 1			
7. FAULT INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 NOV 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	removed access panel and hdwr	reinstalled	BISHOP, J.	F	0.1
× 	removed battery box cover	reinstalled	BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 09:21		
5. FAULT DATE 04 Nov 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	not applicable	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	not installed	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	insp ok	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	insp ok	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	insp ok	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp ok	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	not installed	BISHOP, J.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp ok	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	not installed	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	not installed	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	insp ok	BISHOP, J.	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp ok	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	insp ok	BISHOP, J.	F	0.1


DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD




For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A			4. TIME 09:21
5. FAULT DATE 04 Nov 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	insp ok	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	insp ok	BISHOP, J.	F	0.1






DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 09:21		
5. FAULT DATE 04 Nov 20		6. FAULT NUMBER 3			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	BISHOP, J.	F	0.1
× 	REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	BISHOP, J.	F	0.1
× 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded reviewed initialized and reinstalled	BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:36	
		5. FAULT DATE 12 Nov 20	6. FAULT NUMBER 2		
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	MILLIKEN, J.	F	0.2
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	MILLIKEN, J.	F	0.2
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviewed, initialized and reinstalled	Belyeu, C.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:37	
		5. FAULT DATE 12 Nov 20		6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).			n/a	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN			n/a	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN			insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT			insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).			insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).			insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL			insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL			insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).			n/a	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A			insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).			insp. ok	Belyeu, C.	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19			insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).			insp. ok	Belyeu, C.	F	0.1

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG




1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:37		
	5. FAULT DATE 12 Nov 20	6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 02 OCT 19, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11 DATED 09 NOV 18, AWR 1510 R13 DATED 07 JUN 19, AWR 1536 R15 DATED 02 SEP 19, AWR 1562 R17 DATED 01 DEC 19, AWR 1588 R19 DATED 25 SEP 20					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	insp. ok	Belyeu, C.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:01
	5. FAULT DATE 15 Nov 20	6. FAULT NUMBER 1	

7. FAULT
 INSP A115 LUBE REQUIRMENTS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE.
 STATUS UPGRADED TO X ON: 6079.4 AIRCRAFT HOURS OR 14 NOV 2020

8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	removed upper r/h mlg strut panel	reinstalled	JACKSON, N	F	0.1
X 	removed upper l/h mlg srtut panel	reinstalled	JACKSON, N	F	0.1
X 	removed l/h tailcone access panel	reinstalled	JACKSON, N	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:01		
5. FAULT DATE 15 Nov 20		6. FAULT NUMBER 2			
7. FAULT INSP A103 AIRCRAFT WASH DUE FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 14 NOV 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X	placed bags over hyd deck vents	removed	JACKSON, N	F	0.1
X	placed bag over mixer	removed	JACKSON, N	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:16		
5. FAULT DATE 15 Nov 20		6. FAULT NUMBER 4			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	REMOVED INTERMEDIATE GEARBOX COVER	REINSTALLED	Leone, M.	F	0.1
×	REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	Leone, M.	F	0.1
×	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	REMOVED, LOADED NEW CARD	NEWTON, S.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED


RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:16	
		5. FAULT DATE 15 Nov 20		6. FAULT NUMBER 5			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	not installed	NEWTON, S.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	not installed	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	COMPLETE	EISENHAUEF	F	0.1		

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED




RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:16	
		5. FAULT DATE 15 Nov 20		6. FAULT NUMBER 5			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 02 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).			COMPLETE	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).			COMPLETE	EISENHAUEF	F	0.1















DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:43	
		5. FAULT DATE 16 Nov 20		6. FAULT NUMBER 5			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION		11. PID	12. CAT	13. MMH
×		REMOVED INTERMEDIATE GEARBOX COVER	REINSTALLED		BISHOP, J.	F	0.1
×		REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled		BISHOP, J.	F	0.1
×		IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded reviewed initialized reinstalled		BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:44	
		5. FAULT DATE 16 Nov 20		6. FAULT NUMBER 7			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	NOT INSTALLED	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	NOT INSTALLED	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	COMPLETE	EISENHAUEF	F	0.1		




DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:44		
5. FAULT DATE 16 Nov 20		6. FAULT NUMBER 7			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	COMPLETE	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	COMPLETE	EISENHAUEF	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:07		
5. FAULT DATE 17 Nov 20		6. FAULT NUMBER 1			
7. FAULT blue m/r damper assembly requires servicing					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 rmvd damper safety	replaced	MILLIKEN, J.	F	0.5
×	 rmvd 2ea bleed plugs	reinstalled 2ea tq'd to 75in/lbs	Belyeu, C.	F	0.2
×	 rmvd 2ea bleed plug o-rings	replaced	Belyeu, C.	F	0.2

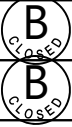

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:26	
		5. FAULT DATE 17 Nov 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R12 DATED 07 FEB 19, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R20 DATED 08 NOV 18 (BAMBI BUCKET).	n/a	Belyeu, C.	F	0.2		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R12 DATED 29 NOV 18 (M-240H MACHINE GUN	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R12 DATED 30 JUL 19 (OREGON SEAT	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R15 DATED 25 SEP 2018 (CMWS).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R12 DATED 07 FEB 19 (EBC-406HM ELT).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R10 DATED 28 MAR 18 (LED CDU/PDU).	insp. ok	Belyeu, C.	F	0.1		




DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:26	
		5. FAULT DATE 17 Nov 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R20 DATED 08 NOV 18, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R12 DATED 30 JUL 19, AWR 1324 R15 DATED 25 SEP 2018, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	insp. ok	Belyeu, C.	F	0.1		
—		 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	insp. ok	Belyeu, C.	F	0.1	



DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:26		
5. FAULT DATE 17 Nov 20		6. FAULT NUMBER 4			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	MILLIKEN, J.	F	0.2
× 	REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	MILLIKEN, J.	F	0.2
× 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviewed, initialized and reinstalled	Belyeu, C.	F	0.2




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE E	4. TIME 00:00		
	5. FAULT DATE 30 Nov 20	6. FAULT NUMBER 1			
7. FAULT INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 06 DEC 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 rmvd access cover	reinstalled	Belyeu, C.	F	0.2
×	 rmvd battery cover	reinstalled	Belyeu, C.	F	0.2


DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE E	4. TIME 00:00		
5. FAULT DATE 02 Dec 20		6. FAULT NUMBER 1			
7. FAULT INSP E135 AN/ARC-201(V) SINGARS RADIO HUB BATT REPL FOR HCPtr UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 07 JAN 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	disconnected pwr cable	reconnected	Shaw, M.	F	0.1
X 	loosened mount lugs	resecurd	Shaw, M.	F	0.1
X 	removed battery cover	reinstalled	Shaw, M.	F	0.1




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE E	4. TIME 00:00		
5. FAULT DATE 02 Dec 20		6. FAULT NUMBER 2			
7. FAULT INSP E801 REPLACEMENT OF AN/ARC-201 (V) BATTERIES (BATTERY BOX) FOR HCPTN UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 07 JAN 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	removed battery box cover	reinstalled	Shaw, M.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428		3. SYSTEM CODE E		4. TIME 00:00
	5. FAULT DATE 02 Dec 20		6. FAULT NUMBER 3		
7. FAULT INSP E145 AN/ARC-201A(V) SINGARS HUB BATT REPL FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 07 JAN 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 disconnected pwr cable	reconnected	Shaw, M.	F	0.1
×	 loosened mount lugs	retightened	Shaw, M.	F	0.1
×	 removed battery cover	reinstalled	Shaw, M.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:33	
		5. FAULT DATE 02 Dec 20		6. FAULT NUMBER 1			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
×		REMOVED INTERMEDIATE GEARBOX COVER		reinstalled	Belyeu, C.	F	0.1
×		REMOVED FWD TAIL ROTOR GEARBOX COVER		reinstalled	Belyeu, C.	F	0.2
×		IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,		downloaded, reviewed, initialized and reinstalled	Belyeu, C.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:33	
		5. FAULT DATE 02 Dec 20		6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R13 DATED 13 OCT 20 (EBC-406HM ELT).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).	insp. ok	Belyeu, C.	F	0.1		




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:33	
		5. FAULT DATE 02 Dec 20		6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 02 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).			insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).			insp. ok	Belyeu, C.	F	0.1




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:30		
5. FAULT DATE 02 Dec 20		6. FAULT NUMBER 4			
7. FAULT APU ACCUMULATOR REQUIRES NITROGEN SERVICING					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 LOWERED AFT OF TRANSMISSION SOUNDPROOFING	raised	Belyeu, C.	F	0.2
×	 RMVD FILL PORT CAP FROM PRESSURE GUAGE	reinstalled	Belyeu, C.	F	0.2
×	 BROKE TQ ON SHRADER VALVE	tq'd 60in/lbs	Belyeu, C.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 13:44		
5. FAULT DATE 03 Dec 20		6. FAULT NUMBER 1			
7. FAULT Copilots floor mic sticking down when pressed.					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	rmvd copilots floor switch bracket and attch. h/w	reinstalled	Belyeu, C.	F	0.2
× 	rmvd floor switch and attch h/w from bracket	replaced	Belyeu, C.	F	0.3
× 	disconnected 3ea leads and 1ea ground from floor switch	connected	Belyeu, C.	F	0.2



DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:30	
		5. FAULT DATE 04 Dec 20		6. FAULT NUMBER 1			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R13 DATED 13 OCT 20 (EBC-406HM ELT).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).	insp. ok	Belyeu, C.	F	0.1		




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 08:30		
5. FAULT DATE 04 Dec 20		6. FAULT NUMBER 1			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	insp. ok	Belyeu, C.	F	0.1
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	insp. ok	Belyeu, C.	F	0.1


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 08:30	
		5. FAULT DATE 04 Dec 20	6. FAULT NUMBER 3			
7. FAULT PMD DUE						
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION		11. PID	12. CAT	13. MMH
×	 REMOVED INTERMEDIATE GEARBOX COVER	reinstalled		Belyeu, C.	F	0.2
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled		Belyeu, C.	F	0.2
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviewed, initilized and reinstalled		Belyeu, C.	F	0.2




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:57		
5. FAULT DATE 04 Dec 20		6. FAULT NUMBER 5			
7. FAULT #2 engine hit check within 5 of upper limit. continue to monitor for next 5 flights					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	disconnected all cannon plugs from "white cable" on #2 engine	cleaned and connected	Belyeu, C.	F	0.3

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:40		
5. FAULT DATE 09 Dec 20		6. FAULT NUMBER 2			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	Belyeu, C.	F	0.2
× 	REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	Belyeu, C.	F	0.1
× 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviewed, intialized and reinstalled	Belyeu, C.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG













1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:40		
	5. FAULT DATE 09 Dec 20	6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020.					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).	n/a	Belyeu, C.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN	n/a	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT	insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).	insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp. ok	Belyeu, C.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	n/a	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R13 DATED 13 OCT 20 (EBC-406HM ELT).	insp. ok	Belyeu, C.	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp. ok	Belyeu, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).	insp. ok	Belyeu, C.	F	0.1

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG










1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 08:32		
	5. FAULT DATE 11 Dec 20	6. FAULT NUMBER 2			
7. FAULT Excessive hydraulic leak from #2 transfer module and lateral primary servos. Hydraulic fluid pooling on deck and present on aft main cabin floor.					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 disconnected backup pump press and return qds from pump	reconnected	BISHOP, J.	F	0.2
×	 disconnected #2 hyd pump pressure and return line QDs	reconnected	BISHOP, J.	F	0.2
×	 removed #2 transfer module mount hardware	reinstalled torqued nuts to 170 in lbs and bolt to 200 in lbs	BISHOP, J.	F	0.2
×	 removed male QDs from bottom of #2 transfer module 7 ea	replaced	BISHOP, J.	F	0.3
×	 removed packings from #2 transfer module male QDs 7 ea	replaced	BISHOP, J.	F	0.2
×	 removed 7 ea QDs from #2 transfer module manifold	replaced	BISHOP, J.	F	0.2
×	 removed packings from #2 transfer module manifold QDs 7 ea	replaced	BISHOP, J.	F	0.2
×	 disconnected 3 ea cannonplugs from #2 transfer module	reconnected	BISHOP, J.	F	0.1
×	 removed 6 ea safeties from #2 transfer module manifold QDs	entered in error	BISHOP, J.	F	0.1
×	 removed 4 ea safeties from #2 transfer module manifold QDs	replaced	BISHOP, J.	F	0.2
×	 removed 5 ea safeties from transfer module QDs	replaced	BISHOP, J.	F	0.2
×	 removed #2 transfer module	reinstalled	BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED







RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:15		
5. FAULT DATE 15 Dec 20		6. FAULT NUMBER 1			
7. FAULT Lateral primary servo leaking from aft scraper seals.					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 removed cotter pins from servo end of mixer to servo control rod hdwr	replaced	BISHOP, J.	F	0.2
×	 removed cotter pin from servo output control rod hdwr at servo end	replaced	BISHOP, J.	F	0.2
×	 disconnected P424 and P427 from lateral primary servo	reconnected	BISHOP, J.	F	0.2
×	 removed servo to mixer control rod hdwr from servo	reinstalled and torqued 50-100 in bls	BISHOP, J.	F	0.2
×	 removed hdwr from servo output rod at servo end	installed. torqued 600-900 and proof torqued at 400.	BISHOP, J.	F	0.1
×	 removed safeties from servo mount feet	replaced	BISHOP, J.	F	0.2
×	 removed servo mount hdwr	reinstalled torqued to 400 in lbs	BISHOP, J.	F	0.2
×	 removed servo	replaced	BISHOP, J.	F	0.2
×	 removed 4 ea barrel nuts from servo rail	inspected and reinstalled	BISHOP, J.	F	0.2



DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 16:24		
5. FAULT DATE 15 Dec 20		6. FAULT NUMBER 4			
7. FAULT Full hyd system bleed required for replacement of lateral primary servo					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	removed hyd sliding cover	reinstalled	BISHOP, J.	F	0.1
X 	removed safeties from SAS servo bleed screws 3 ea	replaced	Bender, T.	F	0.3
X 	connected external hyd cart to backup hyd system	disconnected cart and serviced pump	BISHOP, J.	F	0.2
X 	connected external hyd cart to #1 Hyd System	disconnected cart and serviced pump	BISHOP, J.	F	0.2
X 	connected external hydraulics to #2 hydraulic system	disconnected cart and serviced pump	BISHOP, J.	F	0.2
X 	loosened bleed screws on 3 sas actuator servos.	retorqued	BISHOP, J.	F	0.1




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 08:58		
5. FAULT DATE 16 Dec 20		6. FAULT NUMBER 2			
7. FAULT backup pump drain hose on bleed port dry rotted and cracked					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	removed clamp from drain hose 2 ea	reinstalled	BISHOP, J.	F	0.1
X 	removed drain hose	replaced	BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 10:05	
		5. FAULT DATE 16 Dec 20		6. FAULT NUMBER 3			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT	13. MMH	
×		REMOVED INTERMEDIATE GEARBOX COVER	entered in error	BISHOP, J.	F	0.1	
×		REMOVED FWD TAIL ROTOR GEARBOX COVER	entered in error	BISHOP, J.	F	0.1	
×		IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	entered in error	BISHOP, J.	F	0.1	

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 10:05	
		5. FAULT DATE 16 Dec 20		6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).			entered in error	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN			entered in error	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN			entered in error	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT			entered in error	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).			entered in error	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).			entered in error	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL			entered in error	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL			entered in error	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).			entered in error	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A			entered in error	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R13 DATED 13 OCT 20 (EBC-406HM ELT).			entered in error	BISHOP, J.	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19			entered in error	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).			entered in error	BISHOP, J.	F	0.1

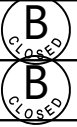

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 10:05
	5. FAULT DATE 16 Dec 20		6. FAULT NUMBER 4		
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	entered in error	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	entered in error	BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:36		
	5. FAULT DATE 16 Dec 20	6. FAULT NUMBER 5			
7. FAULT INSP A103 AIRCRAFT WASH DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 18 DEC 2020					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X	 INSTALLED BAGS OVER VENTS ON HYD DECK 3EA	RMVD	Bender, T.	F	0.2
X	 INSTALLED BAG OVER MIXER	RMVD	Bender, T.	F	0.3

DA FORM 2408-13-2-SG, OCT 97




DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG




1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:43
	5. FAULT DATE 16 Dec 20	6. FAULT NUMBER 7	

7. FAULT
INSP A115 LUBE REQUIRMENTS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE.
STATUS WILL UPGRADE TO X ON: 6085.6 AIRCRAFT HOURS OR 18 DEC 2020

8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	removed rh upper strut fairing and hdwr	reinstalled	BISHOP, J.	F	0.1
× 	removed lh upper strut fairing and hdwr	reinstalled	BISHOP, J.	F	0.1
× 	removed lh tail cone access panel and hdwr	reinstalled	BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 14:24	
		5. FAULT DATE 17 Dec 20		6. FAULT NUMBER 1			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
×		REMOVED INTERMEDIATE GEARBOX COVER		reinstalled	BISHOP, J.	F	0.1
×		REMOVED FWD TAIL ROTOR GEARBOX COVER		reinstalled	BISHOP, J.	F	0.1
×		IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,		reinstalled	BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 14:24	
		5. FAULT DATE 17 Dec 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020.							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).	not applicable	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN	not installed	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	insp ok	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT	insp ok	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).	insp ok	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp ok	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	not installed	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp ok	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	not installed	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	not installed	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R13 DATED 13 OCT 20 (EBC-406HM ELT).	insp ok	BISHOP, J.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp ok	BISHOP, J.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).	insp ok	BISHOP, J.	F	0.1		


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:24		
	5. FAULT DATE 17 Dec 20	6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	insp ok	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	insp ok	BISHOP, J.	F	0.1


DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE E	4. TIME 00:00		
	5. FAULT DATE 20 Dec 20	6. FAULT NUMBER 1			
7. FAULT INSP E155 KY-58 BATTERY REPLACEMENT FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 25 JAN 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	removed battery cover	reinstalled	Shaw, M.	F	0.1




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE E		4. TIME 00:00	
	5. FAULT DATE 20 Dec 20	6. FAULT NUMBER 2			
7. FAULT INSP E015 ASN 128D DOPPLER GPS BATTERY REPLACEMENT FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 25 JAN 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	rmvd batery cover	reinstalled	Bartlett, C.	F	0.3

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 08:29	
		5. FAULT DATE 28 Dec 20	6. FAULT NUMBER 1		
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	BISHOP, J.	F	0.1
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	BISHOP, J.	F	0.1
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded reviewed initialized and reinstalled	BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG



1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 08:29		
5. FAULT DATE 28 Dec 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020.					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).	not applicable	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN	not installed	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	not applicable	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT	insp ok	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).	insp ok	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp ok	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	not installed	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp ok	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	not installed	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	not installed	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R13 DATED 13 OCT 20 (EBC-406HM ELT).	insp ok	BISHOP, J.	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp ok	BISHOP, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).	insp ok	BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED


RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 08:29	
5. FAULT DATE 28 Dec 20		6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11 DATED 10 JUL 19					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	insp ok	BISHOP, J.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	insp ok	BISHOP, J.	F	0.1




DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 10:04	
	5. FAULT DATE 28 Dec 20	6. FAULT NUMBER 3			
7. FAULT TR gear box oil over serviced					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 removed tgb chip detector	reinstalled	BISHOP, J.	F	0.1


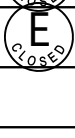
DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 00:00	
		5. FAULT DATE 29 Dec 20		6. FAULT NUMBER 1			
7. FAULT INSP A501 MAIN ROTOR BLADE SPAR PRESSURE CHECK FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 03 FEB 2021							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 rmvd 4ea fill caps from all m/r blade shreder valves	reinstalled 4ea	Belyeu, C.	F	0.2		
×	 rmvd 4ea safeties from all m/r blade shreder valves	replaced 4ea	Belyeu, C.	F	0.4		
×	 broke tq' on 4ea shreder valves on all m/r blades	tq'd 4ea to 70in/lbs	Belyeu, C.	F	0.2		

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE E	4. TIME 00:00		
	5. FAULT DATE 30 Dec 20	6. FAULT NUMBER 1			
7. FAULT INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 05 JAN 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	removed batt access panel	reinstalled	Shaw, M.	F	0.1
X 	removed batt box cover	reinstalled	Shaw, M.	F	0.1


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 00:01	
	5. FAULT DATE 31 Dec 20		6. FAULT NUMBER 1			
7. FAULT ACTUATED DEVICE SERVICE LIFE EXCEEDED ON 31 DEC 2020 FOR CTG IMPULSE CAGE: 30003 PN: 1512AS121 SN: 6886 LOT NUMBER: ESD03F003-001						
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT	13. MMH
X	rmvd thruster sn: 0870 and squid sn:6886		replaced with thruster sn:0931 and squib sn: 0399	Belyeu, C.	F	0.3
X	disconnected electrical connector		connected	Belyeu, C.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 00:01	
		5. FAULT DATE 01 Jan 21		6. FAULT NUMBER 1			
7. FAULT INSP A160 90 DAY CORROSION INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 19 JAN 2021							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
×	 rmvd h/w from l/h and r/h apu strap fairing			reinstalled	Belyeu, C.	F	0.2




DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:01		
5. FAULT DATE 05 Jan 21		6. FAULT NUMBER 1			
7. FAULT INSP A550 REPLACE IVHMU AA LITHIUM BATTERY FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 04 JAN 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	disconnected elec connectors	reconnected	Shaw, M.	F	0.1
×	removed 4 mount screws	reinstalled	Shaw, M.	F	0.1
×	removed battery cover	reinstalled	Shaw, M.	F	0.1














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:51	
		5. FAULT DATE 05 Jan 21		6. FAULT NUMBER 4			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
×		REMOVED INTERMEDIATE GEARBOX COVER		reinstalled	Shaw, M.	F	0.1
×		REMOVED FWD TAIL ROTOR GEARBOX COVER		reinstalled	Shaw, M.	F	0.1
×		IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,		downloaded reviewed initialized reinstalled	Shaw, M.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:51	
		5. FAULT DATE 05 Jan 21		6. FAULT NUMBER 5			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).	NOT INSTALLED	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN	NOT INSTALLED	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R13 DATED 13 OCT 20 (EBC-406HM ELT).	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	COMPLETE	EISENHAUEF	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).	COMPLETE	EISENHAUEF	F	0.1		

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG




1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:51		
5. FAULT DATE 05 Jan 21		6. FAULT NUMBER 5			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	COMPLETE	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	COMPLETE	EISENHAUEF	F	0.1

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG




1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 11:29
	5. FAULT DATE 07 Jan 21	6. FAULT NUMBER 1	

7. FAULT
apu accumulator requires precharge servicing backup pump would not shut off

8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	lowered aft soundproofing	raised	Shaw, M.	F	0.2
X 	rmvd apu accumulator shreder valve cap	reinstalled	Belyeu, C.	F	0.2
X 	broke tq on apu shreder valve	tq'd	Belyeu, C.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:41		
5. FAULT DATE 07 Jan 21		6. FAULT NUMBER 3			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	REMOVED INTERMEDIATE GEARBOX COVER	REINSTALLED	BISHOP, J.	F	0.1
× 	REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	BISHOP, J.	F	0.1
× 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded reviewed initialized reinstalled	BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 15:41	
		5. FAULT DATE 07 Jan 21		6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).			NOT INSTALLED	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN			NOT INSTALLED	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN			COMPLETE	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT			COMPLETE	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).			COMPLETE	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).			COMPLETE	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL			COMPLETE	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL			COMPLETE	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).			COMPLETE	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A			COMPLETE	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R13 DATED 13 OCT 20 (EBC-406HM ELT).			COMPLETE	EISENHAUEF	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19			COMPLETE	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).			COMPLETE	EISENHAUEF	F	0.1





DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:41		
5. FAULT DATE 07 Jan 21		6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	COMPLETE	EISENHAUEF	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	COMPLETE	EISENHAUEF	F	0.1


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:56		
5. FAULT DATE 07 Jan 21		6. FAULT NUMBER 7			
7. FAULT TAIL YOKE LWR WASHER DISBONDED					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 removed dustboot	reinstalled	EISENHAUEF	F	0.1
×	 removed snap ring	reinstalled	EISENHAUEF	F	0.1
×	 removed fork assy	reinstalled	EISENHAUEF	F	0.1
×	 removed lwr washer	replaced	EISENHAUEF	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG



1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A			4. TIME 10:41
	5. FAULT DATE 08 Jan 21	6. FAULT NUMBER 1			
7. FAULT tail fork bushing elongated					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 removed bushing	replaced bushing	EISENHAUEF	F	0.1

DA FORM 2408-13-2-SG, OCT 97 **RELATED MAINTENANCE ACTIONS RECORD**
 DA FORM 2408-13-2, NOV 91, MAY BE USED For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 21:13	
		5. FAULT DATE 08 Jan 21		6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).			Completed	CRONK, B.	F	0.1
—	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN			completed	CRONK, B.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN			completed	CRONK, B.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT			Completed	CRONK, B.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).			Completed	CRONK, B.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).			completed	CRONK, B.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL			completed	CRONK, B.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL			Completed	CRONK, B.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).			completed	CRONK, B.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A			completed	CRONK, B.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R13 DATED 13 OCT 20 (EBC-406HM ELT).			completed	CRONK, B.	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19			completed	CRONK, B.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).			completed	CRONK, B.	F	0.1




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 21:13		
	5. FAULT DATE 08 Jan 21	6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11 DATED 21 NOV 17, AWR 1487 R6 DATED 20 MAY 20, AWR 1495 R7 DATED 03 OCT 10, AWR 1499 R9 DATED 21 AUG 17, AWR 1504 R11 DATED 21 NOV 17, AWR 1507 R6 DATED 20 MAY 20, AWR 1515 R7 DATED 03 OCT 10, AWR 1519 R9 DATED 21 AUG 17, AWR 1524 R16 DATED 22 SEP 20, AWR 1532 R13 DATED 30 SEP 20, AWR 1540 R9 DATED 20 MAY 20, AWR 1545 R7 DATED 03 OCT 10, AWR 1549 R9 DATED 20 MAY 20, AWR 1554 R16 DATED 22 SEP 20, AWR 1562 R13 DATED 30 SEP 20, AWR 1570 R9 DATED 20 MAY 20, AWR 1575 R7 DATED 03 OCT 10, AWR 1579 R9 DATED 20 MAY 20, AWR 1584 R16 DATED 22 SEP 20, AWR 1592 R13 DATED 30 SEP 20, AWR 1597 R6 DATED 20 MAY 20, AWR 1605 R7 DATED 03 OCT 10, AWR 1609 R9 DATED 20 MAY 20, AWR 1614 R16 DATED 22 SEP 20, AWR 1622 R13 DATED 30 SEP 20, AWR 1630 R9 DATED 20 MAY 20, AWR 1635 R7 DATED 03 OCT 10, AWR 1639 R9 DATED 20 MAY 20, AWR 1644 R16 DATED 22 SEP 20, AWR 1652 R13 DATED 30 SEP 20, AWR 1660 R9 DATED 20 MAY 20, AWR 1665 R7 DATED 03 OCT 10, AWR 1669 R9 DATED 20 MAY 20, AWR 1674 R16 DATED 22 SEP 20, AWR 1682 R13 DATED 30 SEP 20, AWR 1690 R9 DATED 20 MAY 20, AWR 1695 R7 DATED 03 OCT 10, AWR 1699 R9 DATED 20 MAY 20, AWR 1704 R16 DATED 22 SEP 20, AWR 1712 R13 DATED 30 SEP 20, AWR 1720 R9 DATED 20 MAY 20, AWR 1725 R7 DATED 03 OCT 10, AWR 1729 R9 DATED 20 MAY 20, AWR 1734 R16 DATED 22 SEP 20, AWR 1742 R13 DATED 30 SEP 20, AWR 1750 R9 DATED 20 MAY 20, AWR 1755 R7 DATED 03 OCT 10, AWR 1759 R9 DATED 20 MAY 20, AWR 1764 R16 DATED 22 SEP 20, AWR 1772 R13 DATED 30 SEP 20, AWR 1780 R9 DATED 20 MAY 20, AWR 1785 R7 DATED 03 OCT 10, AWR 1789 R9 DATED 20 MAY 20, AWR 1794 R16 DATED 22 SEP 20, AWR 1802 R13 DATED 30 SEP 20, AWR 1810 R9 DATED 20 MAY 20, AWR 1815 R7 DATED 03 OCT 10, AWR 1819 R9 DATED 20 MAY 20, AWR 1824 R16 DATED 22 SEP 20, AWR 1832 R13 DATED 30 SEP 20, AWR 1840 R9 DATED 20 MAY 20, AWR 1845 R7 DATED 03 OCT 10, AWR 1849 R9 DATED 20 MAY 20, AWR 1854 R16 DATED 22 SEP 20, AWR 1862 R13 DATED 30 SEP 20, AWR 1870 R9 DATED 20 MAY 20, AWR 1875 R7 DATED 03 OCT 10, AWR 1879 R9 DATED 20 MAY 20, AWR 1884 R16 DATED 22 SEP 20, AWR 1892 R13 DATED 30 SEP 20, AWR 1900 R9 DATED 20 MAY 20, AWR 1905 R7 DATED 03 OCT 10, AWR 1909 R9 DATED 20 MAY 20, AWR 1914 R16 DATED 22 SEP 20, AWR 1922 R13 DATED 30 SEP 20, AWR 1930 R9 DATED 20 MAY 20, AWR 1935 R7 DATED 03 OCT 10, AWR 1939 R9 DATED 20 MAY 20, AWR 1944 R16 DATED 22 SEP 20, AWR 1952 R13 DATED 30 SEP 20, AWR 1960 R9 DATED 20 MAY 20, AWR 1965 R7 DATED 03 OCT 10, AWR 1969 R9 DATED 20 MAY 20, AWR 1974 R16 DATED 22 SEP 20, AWR 1982 R13 DATED 30 SEP 20, AWR 1990 R9 DATED 20 MAY 20, AWR 1995 R7 DATED 03 OCT 10, AWR 1999 R9 DATED 20 MAY 20					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	completed	CRONK, B.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	completed	CRONK, B.	F	0.1









DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 21:14	
		5. FAULT DATE 08 Jan 21		6. FAULT NUMBER 5			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT	13. MMH	
×		REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	CRONK, B.	F	0.3	
×		REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	CRONK, B.	F	0.3	
×		IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	card down loaded, reviewed, inlzd, reinstalled	CRONK, B.	F	0.3	


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 21:47		
	5. FAULT DATE 09 Jan 21	6. FAULT NUMBER 2			
7. FAULT INSP A110 PMS 40 HOUR INSPECTION FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 6078.8 AIRCRAFT HOURS					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 rmvd l/h tail cone access panel	reinstalled	Belyeu, C.	F	0.2
×	 rmvd l/h upper m/l/g strut panel	reinstalled	Belyeu, C.	F	0.2
×	 rmvd r/h upper m/l/g strut panel	reinstalled	Belyeu, C.	F	0.2
×	 rmvd 4ea stab inspection covers	reinstalled 4ea	Belyeu, C.	F	0.2
×	 rmvd oil cooler inspection panel	reinstalled	Belyeu, C.	F	0.2
×	 rmvd apu fuel inclosure cover	reinstalled	Belyeu, C.	F	0.2
×	 rmvd r/h fuel inclosure panel	reinstalled	Belyeu, C.	F	0.2
×	 lowered cabin soundproofing fwd and aft of transmission	raised soundproofing	Belyeu, C.	F	0.2




DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:00		
5. FAULT DATE 11 Jan 21		6. FAULT NUMBER 2			
7. FAULT INSP A103 AIRCRAFT WASH DUE FOR HCPTTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 17 JAN 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	installed 2ea bags on hydraulic deck vents and 1 ea bag over mixer	rmvd bags 3ea	Belyeu, C.	F	0.3

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:05	
		5. FAULT DATE 11 Jan 21		6. FAULT NUMBER 4			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	Belyeu, C.	F	0.2		
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	Belyeu, C.	F	0.2		
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviewed initialized and reinstalled	Belyeu, C.	F	0.2		



DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:05	
		5. FAULT DATE 11 Jan 21		6. FAULT NUMBER 5			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	n/a	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R13 DATED 13 OCT 20 (EBC-406HM ELT).	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp. ok	Belyeu, C.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).	insp. ok	Belyeu, C.	F	0.1		




DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 08:05		
5. FAULT DATE 11 Jan 21		6. FAULT NUMBER 5			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	insp. ok	Belyeu, C.	F	0.1
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	insp. ok	Belyeu, C.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 14:00		
		5. FAULT DATE 19 Jan 21		6. FAULT NUMBER 3				
7. FAULT PMD DUE								
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION		11. PID	12. CAT	13. MMH
× 	REMOVED INTERMEDIATE GEARBOX COVER			INSTALLED		Bender, T.	F	0.2
× 	REMOVED FWD TAIL ROTOR GEARBOX COVER			INSTALLED		Bender, T.	F	0.3
× 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,			DOWNLOADED, REVIEWED, INIALIZED AND REINSTALLED		Bender, T.	F	0.3

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 14:00	
		5. FAULT DATE 19 Jan 21		6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).	Na this insp	Shaw, M.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN	Na this insp	Shaw, M.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	Na this insp	Shaw, M.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT	INSP OK	Bender, T.	F	0.2		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).	INSP OK	Bender, T.	F	0.2		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	INSP OK	Bender, T.	F	0.2		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	INSP OK	Bender, T.	F	0.3		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	INSP OK	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	NOT INSTALLED	Bender, T.	F	0.3		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	INSP OK	Bender, T.	F	0.3		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R13 DATED 13 OCT 20 (EBC-406HM ELT).	INSP OK	Bender, T.	F	0.2		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	INSP OK	Bender, T.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).	INSP OK	Bender, T.	F	0.2		


DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:00		
5. FAULT DATE 19 Jan 21		6. FAULT NUMBER 4			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 20 MAY 20, AWR 1445 R7 DATED 02 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	INSP OK	Bender, T.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	INSP OK	Bender, T.	F	0.2




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:49		
5. FAULT DATE 19 Jan 21		6. FAULT NUMBER 6			
7. FAULT #1 hydraulic pump drain hose torn and requires replacment					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	rmvd hose clamp	installed	Bender, T.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:59	
		5. FAULT DATE 22 Jan 21		6. FAULT NUMBER 2			
7. FAULT PMD DUE							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 REMOVED INTERMEDIATE GEARBOX COVER	reinstalled	Shaw, M.	F	0.1		
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	reinstalled	Shaw, M.	F	0.1		
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	downloaded, reviewed, initialized and reinstalled	Belyeu, C.	F	0.2		



DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG




1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 07:59	
		5. FAULT DATE 22 Jan 21		6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).	n/a	Belyeu, C.	F	0.2		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN	n/a	Shaw, M.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	n/a	Shaw, M.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT	insp. ok	Shaw, M.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).	insp. ok	Shaw, M.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	insp. ok	Shaw, M.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	insp. ok	Shaw, M.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	insp. ok	Shaw, M.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	n/a	Shaw, M.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	insp. ok	Shaw, M.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R13 DATED 13 OCT 20 (EBC-406HM ELT).	insp. ok	Shaw, M.	F	0.1		
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	insp. ok	Shaw, M.	F	0.1		
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).	insp. ok	Shaw, M.	F	0.1		

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 07:59		
5. FAULT DATE 22 Jan 21		6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 02 OCT 10, AWR 1466 R9 DATED 21 AUG 17, AWR 1484 R11					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R8 DATED 28 MAR 2019 (EDM-BFT).	insp. ok	Shaw, M.	F	0.1
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	insp. ok	Shaw, M.	F	0.1

DA FORM 2408-13-2-SG, OCT 97 **RELATED MAINTENANCE ACTIONS RECORD**
 DA FORM 2408-13-2, NOV 91, MAY BE USED For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 11:20	
		5. FAULT DATE 27 Jan 21	6. FAULT NUMBER 1			
7. FAULT PMD DUE						
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION		11. PID	12. CAT	13. MMH
×	 REMOVED INTERMEDIATE GEARBOX COVER	INSTALLED		Bender, T.	F	0.3
×	 REMOVED FWD TAIL ROTOR GEARBOX COVER	INSTALLED		Bender, T.	F	0.3
×	 IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	DOWNLOADED, REVIEWED, INIALIZED AND REINSTALLED		Bender, T.	F	0.3

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG




1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 11:21		
	5. FAULT DATE 27 Jan 21	6. FAULT NUMBER 2			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1346 R25 DATED 21 NOV 17, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R8 DATED 31 AUG 17, AWR 1494 R11 DATED 27 DEC 17, AWR 1516 R13 DATED 13 OCT 20, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020.					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).	NOT APPLICABLE THIS INSP	Bender, T.	F	0.1
—	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN	NOT APPLICABLE THIS INSP	Bender, T.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	INSP OK	Bender, T.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT	INSP OK	Bender, T.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).	INSP OK	Bender, T.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1346 R25 DATED 21 NOV 17 (IVHMS).	INSP OK	Bender, T.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	INSP OK	Bender, T.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	INSP OK	Bender, T.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R8 DATED 31 AUG 17 (GARMIN GPS).	NOT INSTALLED	Bender, T.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R11 DATED 27 DEC 17 (CMWS 5TH SENSOR A	INSP OK	Bender, T.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R13 DATED 13 OCT 20 (EBC-406HM ELT).	INSP OK	Bender, T.	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	INSP OK	Bender, T.	F	0.2
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).	INSP OK	Bender, T.	F	0.3

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED







RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:59		
	5. FAULT DATE 28 Jan 21	6. FAULT NUMBER 1			
7. FAULT APU accumulator would not recharge above 2600, Backup pump would not turn off and APU accum low light did not extinguish					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 lowered aft cabin soundproofing	reinstalled	BISHOP, J.	F	0.1
×	 removed accumulator nitrogen valve cap	reinstalled	BISHOP, J.	F	0.1
×	 loosened jamnut on accumulator nitrogen valve	torqued to 60 in lbs	BISHOP, J.	F	0.1














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 14:49	
		5. FAULT DATE 03 Feb 21		6. FAULT NUMBER 2			
7. FAULT AUXILARY CABIN HEATER REMOVAL REQUIRED FOR BEST PROGRAM							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 REMOVED TROOPS SEATS/CREW SEATS	Installed Crew and Troop Seats	MCGRAW, A	F	1.0		
×	 removed seat bar from cabin	reinstalled and torqued	Bartlett, C.	F	0.3		
×	 REMOVED H-BAR FROM CABIN	reinstalled and torqued	Bartlett, C.	F	0.3		
×	 removed rear cabin bulkheads	reinstalled	Bartlett, C.	F	0.3		
×	 removed main mod drip pan	reinstalled	Bartlett, C.	F	0.3		
×	 removed upper cabin soundproofing lh/rh of main mod	reinstalled	Bartlett, C.	F	0.3		
×	 removed upper cabin soundproofing aft of main mod	reinstalled	Bartlett, C.	F	0.2		
×	 DISCONNECTED P731 FROM MUFFLER	REMOVED PER WP 1834	Bartlett, C.	F	0.2		
×	 DISCONNECTED P728 FROM MUFFLER SUPPORT	REMOVED PER WP1834	Bartlett, C.	F	0.2		
×	 DISCONNECTED P732 FROM HEATER SUPPORT	REMOVED PER WP1834	Bartlett, C.	F	0.2		
×	 DISCONNECTED P730 FROM HEATER SUPPORT	REMOVED PER WP1834	Bartlett, C.	F	0.2		
×	 DISCONNECTED P729 ON HEATER SUPPORT	REMOVED PER WP1834	Bartlett, C.	F	0.2		
×	 DISCONNECTED P723, 722, AND 721 FROM NO 3 RELAY	REMOVED PER WP 1834	Bartlett, C.	F	0.2		

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG




1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:49		
5. FAULT DATE 03 Feb 21		6. FAULT NUMBER 2			
7. FAULT AUXILARY CABIN HEATER REMOVAL REQUIRED FOR BEST PROGRAM					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 Remove Muffler	REMOVED PER WP1822	Bither, c.	F	1.0
×	 Remove Blower	REMOVED PER WP1822	Bither, c.	F	0.5
×	 Remove distribution elbow and duct	REMOVED PER WP1822 and WP1829	Bither, c.	F	0.5
×	 Remove heater	REMOVED PER WP1822	Bither, c.	F	0.5
×	 Remove transition duct	REMOVED PER WP1822	Bither, c.	F	0.5
×	 Remove No. 3 Relay with hdwr	REMOVED PER WP1822	Bither, c.	F	0.5
×	 Rmvd hdwr and temperature controller from bracket under gunners window	REMOVED PER WP1822	Bither, c.	F	0.5
×	 Remove muffler support from STA. 421.0	REMOVED PER WP1822	Bither, c.	F	1.0
×	 Remove blower/muffler support at STA. 431.21	REMOVED PER WP1822	Bither, c.	F	1.0
×	 Remove blower support at 443.5	REMOVED PER WP1822	Bither, c.	F	0.5
×	 Remove distribution duct/distribution elbow support at STA. 456.6	REMOVED PER WP1822	Bither, c.	F	0.5
×	 Remove heater support at STA 443.5	REMOVED PER WP1822	Bither, c.	F	1.0
×	 Remove heater support at STA. 443.5	REMOVED PER WP1822	Bither, c.	F	1.0

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED


RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:49		
5. FAULT DATE 03 Feb 21		6. FAULT NUMBER 2			
7. FAULT AUXILARY CABIN HEATER REMOVAL REQUIRED FOR BEST PROGRAM					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	Removed heater support a STA 421.0	REMOVED PER WP1822	Bither, c.	F	1.0
X 	RMVD LEFT HAND RELAY PANEL	REINSTALLED	Bartlett, C.	F	0.2
X 	RMVD #1 AND #2 JUNCTION BOX COVERS	REINSTALLED	Bartlett, C.	F	0.3




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:01		
5. FAULT DATE 08 Feb 21		6. FAULT NUMBER 1			
7. FAULT INSP A092 30 DAY SLAB BATTERY INSPECTION (D8565/11-1) FOR HCPTU UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 07 FEB 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	RMVD SAFETY	REPLACED	MCGRAW, A	F	0.2


DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:00		
5. FAULT DATE 17 Feb 21		6. FAULT NUMBER 1			
7. FAULT INSP A115 LUBE REQUIRMENTS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 16 FEB 2021 OR 6119.0 AIRCRAFT HOURS					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 RMVD L/H TAILCONE ACCESS PANEL	REINSTALLED	JACKSON, N	F	0.3
×	 RMVD L/H UPPER STRUT PANEL AND HDWR	REINSTALLED	JACKSON, N	F	0.3
×	 RMVD R/H UPPER STRUT PANEL AND HDWR	REINSTALLED	JACKSON, N	F	0.3














DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 00:00	
	5. FAULT DATE 17 Feb 21	6. FAULT NUMBER 2			
7. FAULT INSP A103 AIRCRAFT WASH DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 16 FEB 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	INSTALLED PLASTIC BAG 3 EA ON HYD DECK	RMVD BAGS 3 EA	GAGNE, A.	F	0.2

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG









1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:35		
5. FAULT DATE 23 Feb 21		6. FAULT NUMBER 1			
7. FAULT CONFIGURE AIRCRAFT FOR BEST PROGRAM					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 RMVD #1 AND #2 VHF KY-58 RCUS	CAPPED AND STOWED ELECTRICAL CONNECTORS	Bartlett, C.	F	0.3
×	 RMVD HUD SDC WITH MOUNTING BRACKET	CAPPED AND STOWED ELECTRICAL CONNECTORS	Bartlett, C.	F	0.3
×	 RMVD FOGS AHRU GYRO SN 2209	REPLACED WITH LEGACY SYSTEM	Bartlett, C.	F	0.3
×	 RMVD APR-39 FRONT RADAR RECIEVER	CAPPED AND STOWED ELECTRICAL CONNECTORS	Bartlett, C.	F	0.5
×	 RMVD 2 EA FRONT APR 39 ANTENNAS	INSTALLED BLANKOFF PLATES	Bartlett, C.	F	0.3
×	 RMVD APR-39 PROCESSOR	CAPPED AND STOWED ELECTRICAL CONNECTORS	Bartlett, C.	F	0.3
×	 RMVD PILOTS KICK PANEL W/ HARDWARE	REINSTALLED	Bartlett, C.	F	0.3
×	 RMVD TAIL FAIRING W/ HARDWARE	REINSTALLED	Bartlett, C.	F	0.3
×	 RMVD APR-39 SHARK FIN ANTENNA	INSTALLED BLANKOFF PLATE	Bartlett, C.	F	1.0
×	 RMVD AFT APR-39 RECIEVER WITH 2 EA ANTENNAS FROM AFT TAIL FAIRING	INSTALLED BLANK OFF PLATES	Bartlett, C.	F	0.3
×	 RMVD HUD RDC	CAPPED AND STOWED ELECTRICAL CONNECTORS	Bartlett, C.	F	0.3
×	 RMVD KY-100 RCU	CAPPED AND STOWED ELECTRICAL CONNECTORS	Bartlett, C.	F	0.3
×	 RMVD CMWS CHAFF CONTROL, JUNCTION BOX, SAFE/ARM BOX, AND SWITCH ASSEMBLY	CAPPED AND STOWED ELECTRICAL CONNECTORS	Bartlett, C.	F	0.3

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED





RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 15:35	
		5. FAULT DATE 23 Feb 21		6. FAULT NUMBER 1			
7. FAULT CONFIGURE AIRCRAFT FOR BEST PROGRAM							
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION		11. PID	12. CAT	13. MMH
×		RMVD C-12436/URC RADIO RCU	CAPPED AND STOWED ELECTRICAL CONNECTORS		Bartlett, C.	F	0.3
×		DISCONNECTED P-1348 AND P-152 FROM SDC	RECONNECTED		Bartlett, C.	F	0.3
×		RMVD BFT PALLET	CAPPED AND STOWED ELECTRICAL CONNECTORS		Bartlett, C.	F	0.3
×		RMVD QUADBAY ANTENNA	REINSTALLED		Bartlett, C.	F	0.3
×		RMVD IVHMU SYSTEM TO INCLUDE DIGITAL COMPUTER, DTU, INTERFACE UNIT, AND CDU	CAPPED AND STOWED ELECTRICAL CONNECTORS		Bartlett, C.	F	0.3
×		RMVD RADIO AMPLIFIER AM-7531/URC	CAPPED AND STOWED ELECTRICAL CONNECTORS		Bartlett, C.	F	0.3
×		RMVD ARC 201 SINGARS SYSTEM TO INCLUDE 2 RT 1477, CONTROL HEAD AND AM-7189A	CAPPED AND STOWED ELECTRICAL CONNECTORS		Bartlett, C.	F	0.3
×		RMVD #2 AND #3 CHAFF PAYLOAD MODULES	RMVD FOR AIRCRAFT SEND-OFF		Bartlett, C.	F	0.3




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 09:32		
5. FAULT DATE 08 Mar 21		6. FAULT NUMBER 1			
7. FAULT CENTER CABBIN FLOOR REQUIRES REMOVAL					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	RMVD FLOOR HDWR	reinstalled	MCGRAW, A	F	1.0
X 	RMVD CENTER FLOOR PANNEL	reinstalled	MCGRAW, A	F	1.0
X 	RMVD CABIN TIEDOWN RING COTTER PINS 10 EA	REPLACED	MCGRAW, A	F	0.5
X 	RMVD CABIN FLOOR TIE DOWN RINGS 10 EA	REINSTALLED	MCGRAW, A	F	0.5


DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 09:36	
	5. FAULT DATE 09 Mar 21		6. FAULT NUMBER 2			
7. FAULT PMD DUE						
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION	11. PID	12. CAT	13. MMH
× 	REMOVED INTERMEDIATE GEARBOX COVER		REINSTALLED	MCGRAW, A	F	0.2
× 	REMOVED FWD TAIL ROTOR GEARBOX COVER		REINSTALLED	MCGRAW, A	F	0.2
× 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,		IVHMS NOT INSTALLED	MCGRAW, A	F	0.2

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG


1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 09:36		
	5. FAULT DATE 09 Mar 21	6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R9 DATED 23 AUG 19, AWR 1494 R12 DATED 14 JAN 20, AWR 1516 R14 DATED 19 FEB 21, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R9 DATED 18 JUL 19					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).	COMPLETE	MCGRAW, A	F	0.2
— 	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN	COMPLETE INSP OK	MCGRAW, A	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN	COMPLETE	MCGRAW, A	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT	COMPLETE INSP OK	MCGRAW, A	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).	NOT INSTALLED	MCGRAW, A	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL	COMPLETE INSP OK	MCGRAW, A	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL	COMPLETE INSP OK	MCGRAW, A	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R9 DATED 23 AUG 19 (GARMIN GPS).	COMPLETE	MCGRAW, A	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R12 DATED 14 JAN 20 (CMWS 5TH SENSOR A	NOT INSTALLED	MCGRAW, A	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R14 DATED 19 FEB 21 (EBC-406HM ELT).	COMPLETE	MCGRAW, A	F	0.2
— 	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19	COMPLETE INSP OK	MCGRAW, A	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).	COMPLETE INSP OK	MCGRAW, A	F	0.2
— 	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R9 DATED 18 JUL 19 (EDM-BFT).	NOT INSTALLED	MCGRAW, A	F	0.2

DA FORM 2408-13-2-SG, OCT 97

DA FORM 2408-13-2, NOV 91, MAY BE USED



RELATED MAINTENANCE ACTIONS RECORD

For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 09:36		
		5. FAULT DATE 09 Mar 21		6. FAULT NUMBER 3				
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1407 R6 DATED 29 MAY 20, AWR 1445 R7 DATED 03 OCT 18, AWR 1466 R9 DATED 21 AUG 17, AWR 1494 R12 DATED 14 JAN 20, AWR 1516 R14								
8. STA —		9. RELATED MAINTENANCE ACTIONS PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).		10. ACTION COMPLETE INSP OK		11. PID MCGRAW, A	12. CAT F	13. MMH 0.2









DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 12:50
	5. FAULT DATE 09 Mar 21		6. FAULT NUMBER 4		
7. FAULT ELETROSTATIC DISCHARGE CABLE ON L/H SIDE OF STABILATOR FOUND BROKEN					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 RMVD 2 EA HDWR SECURING STATIC DISCHARGE CABLE TO STABILATOR	REPLACED AND TIGHTENED	Pacheco, J.	F	0.1
×	 RMVD STATIC DISCHARGE CABLE FROM STABILATOR	REPLACED	Pacheco, J.	F	0.1



DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:26		
5. FAULT DATE 10 Mar 21		6. FAULT NUMBER 4			
7. FAULT INSPECTION MANUALLY GENERATED ON 10 MAR 2021. INSP A160 90 DAY CORROSION INSPECTION FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 19 APR 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	LOWERED SOUND PROOFING PANEL STA 297 TO 327	RAISED	GAGNE, A.	F	0.2
X 	REMOVED DRIP PAN	REINSTALLED	MCGRAW, A	F	0.2
X 	LOWERED SOUND PROOFING PANEL STA 360 TO 398	RAISED	GAGNE, A.	F	0.2
X 	REMOVED L/H & R/H FUEL CELL ENCLOSURE PANELS	REINSTALLED	GAGNE, A.	F	0.2
X 	OPEN ALL DRIVE SHAFT COVERS	CLOSED	JACKSON, N	F	0.2
X 	REMOVED HARDWARE FROM APU PANEL STA 460.0 - STA 480.0	REINSTALLED	MCGRAW, A	F	0.2
X 	RMVD INTERMEDIATE GBX COVER	REINSTALLED	JACKSON, N	F	0.2
X 	RMVD TR GBX COVER	REINSTALLED	GAGNE, A.	F	0.2


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:00		
	5. FAULT DATE 13 Mar 21	6. FAULT NUMBER 1			
7. FAULT INSP A230 INSPECT BATTERY COMPARTMENT FOR CORROSION (SLAB) FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 12 MAR 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X	 RMVD SAFTIES FROM BATTERY 2EA	REPLACED	Bender, T.	F	0.1
X	 RMVD BATTERY	INSTALLED	Bender, T.	F	0.1



DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE E	4. TIME 00:00		
5. FAULT DATE 15 Mar 21		6. FAULT NUMBER 1			
7. FAULT INSP E351 REPLACE APX-118 TRANSPONDER BATTERY FOR HCPTX UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 14 MAR 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	rmvd battery cover	reinstalled	Bartlett, C.	F	0.2



DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS X	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:00		
5. FAULT DATE 22 Mar 21		6. FAULT NUMBER 2			
7. FAULT INSP A117 TAIL GEARBOX OIL SAMPLE FOR TAIL ROTOR GEARBOX ASSY CAGE: 78286 PN: 70358-06600-046 NSN: 1615013765089 SN: A00600437 WAS DUE. STATUS UPGRADED TO X ON: 21 MAR 2021 OR 6475.2 AIRCRAFT HOURS					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X	 rmvd t/r g/b cover	reinstalled	CEPELAK, C.	F	0.1
X	 rmvd t/r g/b chipdetector	reinstalled	CEPELAK, C.	F	0.1


DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 00:00		
	5. FAULT DATE 22 Mar 21	6. FAULT NUMBER 3			
7. FAULT INSP A116 INTERMEDIATE GEARBOX OIL SAMPLE FOR INTERMEDIATE GEARBOX CAGE: 78286 PN: 70357-06300-042 NSN: 1680010745152 SN: A005-01881 WAS DUE. STATUS UPGRADED TO X ON: 21 MAR 2021 OR 6475.2 AIRCRAFT HOURS					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 rmvd i/g/b cover	reinstalled	CEPELAK, C.	F	0.1
×	 rmvd i/g/b chip detector	reinstalled	CEPELAK, C.	F	0.1




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:54		
	5. FAULT DATE 05 Apr 21	6. FAULT NUMBER 1			
7. FAULT INSPECTION MANUALLY GENERATED ON 05 APR 2021. INSP A103 AIRCRAFT WASH DUE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 12 APR 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	installed bags over hyd deck vents and mixer 3ea	rmvd	Bender, T.	F	0.2

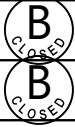

DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 00:01
5. FAULT DATE 06 Apr 21		6. FAULT NUMBER 1			
7. FAULT INSP A115 LUBE REQUIRMENTS FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 IS DUE. STATUS WILL UPGRADE TO X ON: 12 APR 2021 OR 6142.7 AIRCRAFT HOURS					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	REMOVED L/H UPPER MAIN LANDING GEAR FAIRING	Reinstalled	CEPELAK, C.	F	0.1
X 	REMOVED R/H UPPER MAIN LANDING GEAR FAIRING	Reinstalled	CEPELAK, C.	F	0.1
X 	REMOVED L/H TAIL CONE ACCESS PANEL	Reinstalled	CEPELAK, C.	F	0.1




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE E	4. TIME 00:01		
	5. FAULT DATE 07 Apr 21	6. FAULT NUMBER 2			
7. FAULT INSP E050 ARC-220 RADIO SET BATTERY INSPECTION OR REPLACE FOR HCPTR UTILITY UH-60A CAGE: 78286 PN: UH-60A NSN: 1520010350266 SN: 8023428 WAS DUE. STATUS UPGRADED TO X ON: 06 APR 2021					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 removed battery access panel and hdwr	reinstalled	BISHOP, J.	F	0.1
×	 removed battery cover	reinstalled	BISHOP, J.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 14:54	
		5. FAULT DATE 07 Apr 21	6. FAULT NUMBER 2			
7. FAULT PMD DUE						
8. STA	9. RELATED MAINTENANCE ACTIONS		10. ACTION		11. PID	12. CAT
×		REMOVED INTERMEDIATE GEARBOX COVER	installed		CEPELAK, C.	F
×		REMOVED FWD TAIL ROTOR GEARBOX COVER	installed		CEPELAK, C.	F
×		IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	IVHMS removed from aircraft for turn in		CEPELAK, C.	F


DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 14:54	
		5. FAULT DATE 07 Apr 21		6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R9 DATED 23 AUG 19, AWR 1494 R12 DATED 14 JAN 20, AWR 1516 R14 DATED 19 FEB 21, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R9 DATED 18 JUL 19							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).			NOT INSTALLED	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN			NOT INSTALLED	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN			INSPECT OK	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT			INSPECT OK	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).			INSPECT OK	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL			NOT INSTALLED	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL			INSPECT OK	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R9 DATED 23 AUG 19 (GARMIN GPS).			INSPECT OK	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R12 DATED 14 JAN 20 (CMWS 5TH SENSOR A			INSPECT OK	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R14 DATED 19 FEB 21 (EBC-406HM ELT).			INSPECT OK	MILLIKEN, J.	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19			INSPECT OK	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).			INSPECT OK	MILLIKEN, J.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R9 DATED 18 JUL 19 (EDM-BFT).			INSPECT OK	MILLIKEN, J.	F	0.1




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 14:54		
	5. FAULT DATE 07 Apr 21	6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 02 OCT 19, AWR 1466 R8 DATED 21 AUG 17, AWR 1494 R12 DATED 14 JAN 20, AWR 1516 R11					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	INSPECT OK	MILLIKEN, J.	F	0.1




DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS ×	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 15:41		
5. FAULT DATE 07 Apr 21		6. FAULT NUMBER 4			
7. FAULT Blue M/R damper requires servicing					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
×	 rmvd bleed plugs 2ea	installed and trq'd	MILLIKEN, J.	F	0.2
×	 rmvd bleed plug packings 2ea	replaced	MILLIKEN, J.	F	0.1
×	 rmvd safety from bleed plugs	replaced	MILLIKEN, J.	F	0.3





DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 10:27		
5. FAULT DATE 08 Apr 21		6. FAULT NUMBER 1			
7. FAULT APU accumulator precharge low					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
X 	lowered aft overhead soundproofing	reinstalled	BISHOP, J.	F	0.2
X 	removed acuumulator nitrogen valve cap	reinstalled	BISHOP, J.	F	0.2
X 	loosenend jamnut on nitrogen filler valve	retorqued	BISHOP, J.	F	0.2




DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS /		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 14:22	
		5. FAULT DATE 09 Apr 21		6. FAULT NUMBER 1			
7. FAULT #2 ENGINE IPS DUCT HAS OIL LEAKAGE							
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH		
×	 LOOSENED #2 ENGINE STARTER BLEED AIR TUBE CLAMP	entered in error	Mower, H.	F	0.1		
×	 LOOSENED #2 ENGINE IPS DUCT CLAMP	entered in error	Mower, H.	F	0.1		
×	 RMVD CLAMP AND HDWR SECURING CABLES TO #2 ENGINE IPS DUCT	entered in error	Mower, H.	F	0.1		
×	 RMVD #2 ENGINE IPS DUCT	entered in error	Mower, H.	F	0.1		

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A	4. TIME 08:17		
5. FAULT DATE 13 Apr 21		6. FAULT NUMBER 2			
7. FAULT PMD DUE					
8. STA	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
× 	REMOVED INTERMEDIATE GEARBOX COVER	Reinstalled	CEPELAK, C.	F	0.1
× 	REMOVED FWD TAIL ROTOR GEARBOX COVER	Reinstalled	CEPELAK, C.	F	0.1
× 	IVHMS DATA CARD REMOVED FROM THE DATA TRANSFER UNIT FOR DATA DOWNLOAD, REVIEW,	N/A Not Installed or Auction	CEPELAK, C.	F	0.1


DA FORM 2408-13-2-SG, OCT 97
DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —		2. SERIAL NUMBER 8023428		3. SYSTEM CODE A		4. TIME 08:18	
		5. FAULT DATE 13 Apr 21		6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20, AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 03 OCT 19, AWR 1466 R9 DATED 23 AUG 19, AWR 1494 R12 DATED 14 JAN 20, AWR 1516 R14 DATED 19 FEB 21, AWR 1566 R7 DATED 05 FEB 19, AWR 1607 R11 DATED 13 MAR 2020, AWR 1800 R9 DATED 18 JUL 19							
8. STA	9. RELATED MAINTENANCE ACTIONS			10. ACTION	11. PID	12. CAT	13. MMH
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1054 R21 DATED 01 JUL 20 (BAMBI BUCKET).			N/A	CEPELAK, C.	F	0.1
—	PERFORM VISUAL INSPECTION REQUIRED BY AWR 1120 R13 DATED 28 APR 20 (M-240H MACHINE GUN			N/A	CEPELAK, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1279 R9 DATED 20 MAY 2020 (COCKPIT/CABIN			N/A	CEPELAK, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1309 R13 DATED 30 SEP 20 (OREGON SEAT			Insp OK	CEPELAK, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1324 R16 DATED 22 SEP 20 (CMWS).			Insp OK	CEPELAK, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1407 R6 DATED 28 MAY 20 (EFW DAY FLIGHT PANEL			INSP OK	CEPELAK, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1445 R7 DATED 03 OCT 19 (TRC AFCS SWITCH PANEL			INSP OK	CEPELAK, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1466 R9 DATED 23 AUG 19 (GARMIN GPS).			Insp OK	CEPELAK, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1494 R12 DATED 14 JAN 20 (CMWS 5TH SENSOR A			Insp OK	CEPELAK, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1516 R14 DATED 19 FEB 21 (EBC-406HM ELT).			Insp Ok	CEPELAK, C.	F	0.1
—	PERFORM HOIST CABLE GUARD INSPECTION PRIOR TO NEXT USE IAW AWR 1566 R7 DATED 05 FEB 19			Insp Ok	CEPELAK, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1607 R11 DATED 13 MAR 2020 (LED CDU/PDU).			Insp Ok	CEPELAK, C.	F	0.1
—	PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1800 R9 DATED 18 JUL 19 (EDM-BFT).			Insp OK	CEPELAK, C.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG

1. STATUS —	2. SERIAL NUMBER 8023428	3. SYSTEM CODE A		4. TIME 08:18	
	5. FAULT DATE 13 Apr 21	6. FAULT NUMBER 3			
7. FAULT DAILY VISUAL INSPECTION DUE FOR INSTALLED EQUIPMENT IN ACCORDANCE WITH AWR 1054 R21 DATED 01 JUL 20, AWR 1120 R13 DATED 28 APR 20 , AWR 1279 R9 DATED 20 MAY 20, AWR 1309 R13 DATED 30 SEP 20, AWR 1324 R16 DATED 22 SEP 20, AWR 1407 R6 DATED 28 MAY 20, AWR 1445 R7 DATED 02 OCT 19, AWR 1466 R9 DATED 21 AUG 17, AWR 1494 R13 DATED 14 JAN 20, AWR 1516 R11 DATED 15 MAY 20					
8. STA —	9. RELATED MAINTENANCE ACTIONS	10. ACTION	11. PID	12. CAT	13. MMH
—	 PERFORM VISUAL INSPECTION AS REQUIRED BY AWR 1823 R9 DATED 22 NOV 2019 (IVHMS BLOCK 5.0/5C).	INSP OK	CEPELAK, C.	F	0.1

DA FORM 2408-13-2-SG, OCT 97
 DA FORM 2408-13-2, NOV 91, MAY BE USED

RELATED MAINTENANCE ACTIONS RECORD
 For use of this form see DA PAM 738-751, the proponent agency is DCSLOG