## WALL LEGEND:

RESTORE EXISTING DAMAGED WALLS ACCORDING TO THE FOLLOWING DETAILS;

6A EXTERIOR WALLS (1-HR FIRE RATED):

EXISTING 1" CEMENT PLASTER OVER PAPER BACKED METAL LATH ON THE EXTERIOR SIDE TO REMAIN PROVIDE ONE LAYER OF 5/8" TYPE "X" GYP. BD. ON THE INTERIOR SIDE OF EXISTING 2 X STUDS @ 16" O.C. WHERE INTERIOR FINISH HAS BEEN REMOVED. PROVIDE R-13 INSULATION IN STUD SPACE

(68) INTERIOR PARTITIONS (1-HR FIRE RATED THROUGHOUT):


PROVIDE ONE LAYER OF 5/8" TYPE "X" GYP. BD. EACH SIDE OF EXISTING 2 X STUDS @ 16" O.C. WHERE INTERIOR FINISH HAS BEEN REMOVED.
PROVIDE R-13 INSULATION IN PLUMBING WALL STUD SPACE

PROVIDE TWO LAYERS OF 5/8" TYPE "X" GYP. BD. EACH SIDE OF EXISTING 2X STUDS @ 16" O.C. WHERE INTERIOR FINISH HAS BEEN REMOVED.



ALL FLOOR / CEILING ASSEMBLIES (1-HR FIRE RATED):

PROVIDE ONE LAYER OF 5/8" TYPE "X" GYP. BD. UNDER EXISTING FLOOR JOISTS WHERE INTERIOR CEILING FINISH HAS BEEN REMOVED.

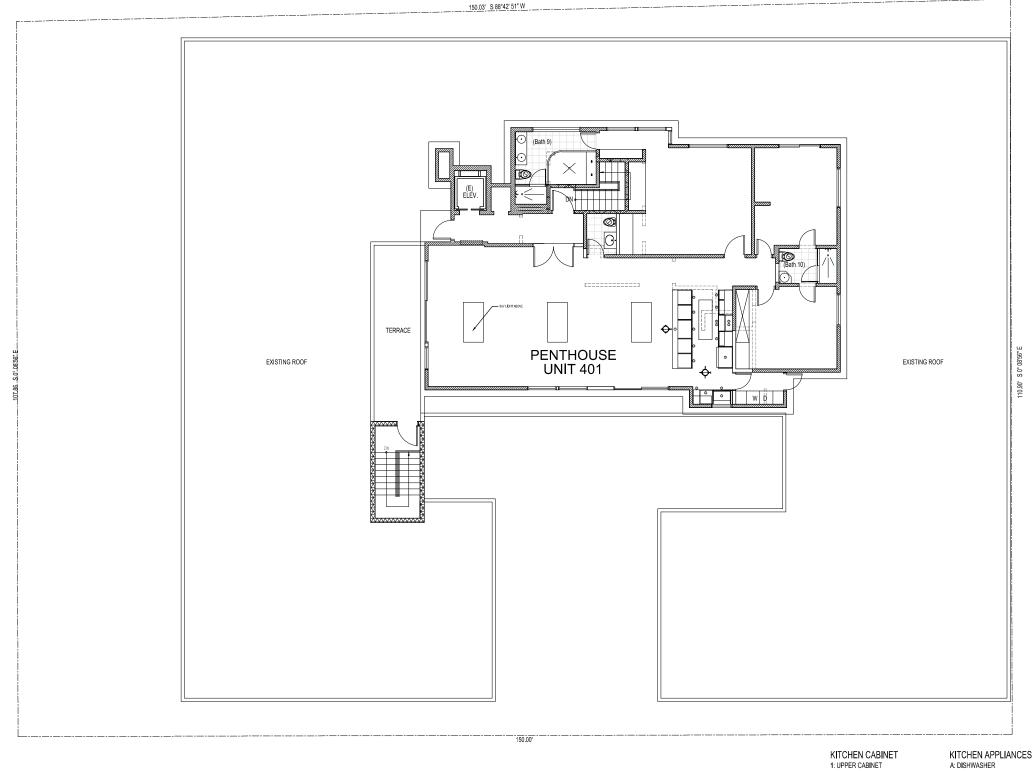

EXISTING PENTHOUSE RESTORATION PLAN SCALE 1/8"=1'-0"

KITCHEN CABINET 1: UPPER CABINET 2: DOUBLE DOOR SINK CABINET 3: CORNER CABINET 4: BROOM CLOSET

C: COOK TOP
D: MICROWAVE
E: OVEN
F: REFRIGERATOR 4. BROOM CLOSE! DI. MICROV
F. PANTRY
ROLL-OUT STORAGE BASKET F: REFRIGI
6. SINK CABINET WITH TRASH BIN AND
ROLL-OUT BASKET
7: BAR TOP
8: DRAWERS