
CONSTRUCTION HEALTH AND SAFETY PLAN

for

**250 WATER STREET
NEW YORK, NEW YORK
NYC Tax Block 98, Lot 1
NYSDEC BCP Site No. C231127**

Prepared For:

**The Howard Hughes Corporation
199 Water Street, 28th Floor
New York, New York**

Prepared By:

**Langan Engineering, Environmental, Surveying,
Landscape Architecture and Geology, D.P.C.
21 Penn Plaza
360 West 31st Street, 8th Floor
New York, New York 10001**

LANGAN

**June 2022
Langan Project No. 170381202**

TABLE OF CONTENTS

	<u>Page No.</u>
1.0 INTRODUCTION	1
1.1 GENERAL.....	1
1.2 SITE LOCATION AND BACKGROUND	1
1.3 SUMMARY OF WORK TASKS	2
1.3.1 Excavation Observation and Screening.....	2
1.3.2 Soil Screening & Reporting	2
1.3.3 Soil Sampling.....	3
1.3.4 Characterization of Excavated Material.....	3
1.3.5 Stockpiling	3
1.3.6 Geophysical Investigation	3
1.3.7 Hand Clearing of Borehole Locations.....	4
1.3.8 Groundwater Investigation and Sampling	4
1.3.9 Construction Dewatering	4
1.3.10 Excavation Backfill.....	5
1.3.11 Decommissioning and Removal of Above-Ground and Underground Storage Tanks	5
1.3.12 Installation of Waterproofing and Vapor Barrier	5
1.3.13 Construction Activity Inspections and Observations	5
1.3.14 Equipment Decontamination.....	5
1.3.15 Management of Investigative-Derived Waste	6
1.3.16 Drum Sampling.....	6
1.3.17 Surveying.....	6
2.0 IDENTIFICATION OF KEY PERSONNEL/HEALTH AND SAFETY PERSONNEL	6
2.1 LANGAN PROJECT MANAGER	6
2.2 LANGAN CORPORATE HEALTH AND SAFETY MANAGER.....	7
2.3 LANGAN SITE HEALTH & SAFETY OFFICER	7
2.4 LANGAN FIELD TEAM LEADER RESPONSIBILITIES	8
2.5 CONTRACTOR RESPONSIBILITIES	8
3.0 TASK/OPERATION SAFETY AND HEALTH RISK ANALYSES	9
3.1 SPECIFIC TASK SAFETY ANALYSIS.....	9
3.1.1 Excavation and Soil Screening	9
3.1.2 Stockpile Sampling	9
3.1.3 Geophysical Survey	9
3.1.4 Hand Clearing of Borehole Locations.....	10
3.1.5 Groundwater Investigation and Sampling	10
3.1.6 Construction Activity Inspection	10
3.1.7 Construction Dewatering	10
3.1.8 Removal of UST	11
3.1.9 Backfilling of Excavated Areas to Development Grade.....	11
3.1.10 Installation of Waterproofing and Vapor Barrier	11
3.1.11 Drum Sampling.....	12
3.2 RADIATION HAZARDS.....	12
3.3 PHYSICAL HAZARDS.....	12
3.3.1 Explosion	12
3.3.2 Heat Stress.....	12

3.3.3	Cold-Related Illness.....	14
3.3.4	Noise	15
3.3.5	Hand and Power Tools	15
3.3.6	Slips, Trips and Fall Hazards.....	15
3.3.7	Utilities (Electrocution and Fire Hazards)	15
3.3.7.1	Utility Clearance.....	15
3.3.7.2	Lockout-Tagout.....	15
3.3.8	Physical Hazard Considerations for Material Handling.....	16
3.3.9	Hearing Conservation	17
3.4	BIOLOGICAL HAZARDS.....	17
3.4.1	Animals.....	17
3.4.2	Insects.....	17
3.4.3	Plants.....	17
3.4.4	Coronavirus	18
3.4.4.1	General Preventative Measures	18
3.4.4.2	Construction Trailers.....	18
3.4.4.3	Communication	18
3.4.4.4	Sick/Ill Workers.....	18
3.5	ADDITIONAL SAFETY ANALYSIS.....	19
3.5.1	Presence of Non-Aqueous Phase Liquids (NAPL).....	19
3.6	JOB SAFETY ANALYSIS.....	19
4.0	PERSONNEL TRAINING	20
4.1	BASIC TRAINING	20
4.2	INITIAL SITE-SPECIFIC TRAINING	20
4.3	TAILGATE SAFETY BRIEFINGS.....	20
5.0	MEDICAL SURVEILLANCE.....	21
6.0	PERSONAL PROTECTIVE EQUIPMENT	21
6.1	LEVELS OF PROTECTION	21
6.2	RESPIRATOR FIT-TEST	22
6.3	RESPIRATOR CARTRIDGE CHANGE-OUT SCHEDULE.....	22
7.0	AIR QUALITY MONITORING AND ACTION LEVELS	23
7.1	MONITORING DURING SITE OPERATIONS.....	23
7.1.1	Volatile Organic Compounds.....	24
7.1.2	PAHs and Metals.....	24
7.1.3	Mercury Vapor.....	24
7.2	MONITORING EQUIPMENT CALIBRATION AND MAINTENANCE.....	24
7.3	DETERMINATION OF BACKGROUND LEVELS.....	24
8.0	COMMUNITY AIR MONITORING PROGRAM	25
8.1	DUST SUPPRESSION TECHNIQUES	28
9.0	WORK ZONES AND DECONTAMINATION	28
9.1	SITE CONTROL	28
9.2	CONTAMINATION ZONE.....	29
9.2.1	Personnel Decontamination Station.....	29
9.2.2	Minimization of Contact with Contaminants.....	29
9.2.3	Personnel Decontamination Sequence	29
9.2.4	Emergency Decontamination.....	29

9.2.5	Hand-Held Equipment Decontamination.....	30
9.2.6	Heavy Equipment Decontamination.....	30
9.3	SUPPORT ZONE.....	30
9.4	COMMUNICATIONS.....	31
9.5	THE BUDDY SYSTEM.....	31
10.0	NEAREST MEDICAL ASSISTANCE.....	31
11.0	STANDING ORDERS/SAFE WORK PRACTICES.....	32
12.0	SITE SECURITY.....	32
13.0	UNDERGROUND UTILITIES.....	32
14.0	SITE SAFETY INSPECTION.....	32
15.0	HAND AND POWER TOOLS.....	32
16.0	EMERGENCY RESPONSE.....	33
16.1	GENERAL.....	33
16.2	RESPONSIBILITIES.....	33
16.2.1	Health and Safety Officer (HSO).....	33
16.2.2	Emergency Coordinator.....	33
16.2.3	Site Personnel.....	34
16.3	COMMUNICATIONS.....	34
16.4	LOCAL EMERGENCY SUPPORT UNITS.....	34
16.5	PRE-EMERGENCY PLANNING.....	34
16.6	EMERGENCY MEDICAL TREATMENT.....	35
16.7	EMERGENCY SITE EVACUATION ROUTES AND PROCEDURES.....	35
16.7.1	Designated Assembly Locations.....	36
16.7.2	Accounting for Personnel.....	36
16.8	FIRE PREVENTION AND PROTECTION.....	36
16.8.1	Fire Prevention.....	37
16.9	SIGNIFICANT VAPOR RELEASE.....	37
16.10	OVERT CHEMICAL EXPOSURE.....	37
16.11	DECONTAMINATION DURING MEDICAL EMERGENCIES.....	38
16.12	ADVERSE WEATHER CONDITIONS.....	38
16.13	SPILL CONTROL AND RESPONSE.....	38
16.14	EMERGENCY EQUIPMENT.....	40
16.15	RESTORATION AND SALVAGE.....	40
16.16	DOCUMENTATION.....	40
17.0	SPECIAL CONDITIONS.....	40
17.1	SCOPE.....	40
17.2	RESPONSIBILITIES.....	40
17.3	PROCEDURES.....	41
17.3.1	Ladders.....	41
17.3.1.1	Ladder Use.....	41
17.3.1.2	Portable Ladders.....	41
17.3.1.3	Step Stools.....	42
17.3.1.4	Extension Ladders.....	42
17.3.1.5	Inspection.....	42
17.3.2	First Aid/Cardiopulmonary Resuscitation (CPR).....	42
17.3.2.1	Emergency Procedures.....	42
17.3.2.2	First Aid Supplies.....	43

17.3.3 Hydrogen Sulfide	43
17.3.3.1 Characteristics	43
17.3.3.2 Health Effects	44
17.3.3.3 Protective Clothing and Equipment	44
17.3.3.4 Emergency and First Aid Procedures	45
17.3.4 Fire Protection/Extinguishers	46
17.3.5 Overhead lines	46
17.3.5.1 Vehicle and Equipment Clearance	47
17.3.6 Trade Secret	47
17.3.7 Bloodborne Pathogens	48
17.3.7.1 Training	48
17.3.7.2 Recordkeeping	50
18.0 RECORDKEEPING	50
18.1 FIELD CHANGE AUTHORIZATION REQUEST	51
18.2 MEDICAL AND TRAINING RECORDS	51
18.3 ONSITE LOG	51
18.4 DAILY SAFETY MEETINGS (“TAILGATE TALKS”)	51
18.5 EXPOSURE RECORDS	51
18.6 HAZARD COMMUNICATION PROGRAM/MSDS-SDS	51
18.7 DOCUMENTATION	51
18.7.1 Accident and Injury Report Forms	52
18.7.1.1 Accident/Incident Report	52
18.7.1.2 First Aid Treatment Record	52
18.7.1.3 OSHA Form 300	52
19.0 CONFINED SPACE ENTRY	52
20.0 HASP ACKNOWLEDGEMENT FORM	53

LIST OF TABLES

Table 1	Task Hazard Analysis
Table 2	Contaminant Hazards of Concern
Table 3	Summary of Monitoring Equipment
Table 4	Instrumentation Action Levels
Table 5	Emergency Notification List*
Table 6	Suggested Frequency of Physiological Monitoring For Fit and Acclimated Workers
Table 7	Heat Index

LIST OF FIGURES

Figure 1	Site Location Map
Figure 2	Route to Hospital (map with directions)*

LIST OF APPENDICES

Attachment A	Standing Orders*
Attachment B	Decontamination Procedures
Attachment C	Employee Exposure/Injury Incident Report
Attachment D	Calibration Log
Attachment E	Material Data Safety Sheets / Safety Data Sheets*
Attachment F	Jobsite Safety Inspection Checklist
Attachment G	Job Safety Analysis Forms
Attachment H	Tailgate Safety Meeting Log

* Items to be posted prominently on site, or made readily available to personnel.

1.0 INTRODUCTION

1.1 General

This Construction Health and Safety Plan (CHASP) was developed to address disturbance of known and reasonably anticipated subsurface contaminants and comply with Occupational Safety and Health Administration (OSHA) Standard 29 CFR 1910.120(b)(4), *Hazardous Waste Operations and Emergency Response* during anticipated site work at 250 Water Street adjacent to the South Street Seaport Historic District in New York, New York (the "Site"). The Site is identified on the Manhattan Borough Tax Map as Block 98, Lot 1. This CHASP provides the minimum requirements for implementing site operations during future remedial measure activities. All contractors performing work on this site shall implement their own CHASP that, at a minimum, adheres to this CHASP. The contractor is responsible for their own health and safety and that of their subcontractors. Langan personnel will implement this CHASP while onsite.

The management of the day-to-day site activities and implementation of this CHASP in the field is the responsibility of the site Langan Field Team Leader (FTL). Assistance in the implementation of this CHASP can also be obtained from the site Langan Health and Safety Officer (HSO) and the Langan Health and Safety Manager (HSM). Contractors operating on the site shall designate their own FTL, HSO and HSM. The content of this CHASP may change or undergo revision based upon additional information made available to health and safety personnel, monitoring results, or changes in the work plan.

1.2 Site Location and Background

The site is approximately 48,057 square feet (1.10 acres) in area and is located at 250 Water Street in the South Street Seaport neighborhood of New York, New York (Block 98, Lot 1 on the Borough of Manhattan tax map). The site occupies the entire city block bordered by Pearl Street to the northwest (project north), Peck Slip to the northeast (project east), Water Street to the southeast (project south), and Beekman Street to the southwest (project west). It is used as an open-air, asphalt-covered commercial parking lot; a parking attendant kiosk and temporary storage shed are located near the center of the lot. The perimeter of the site is fenced with one automated barrier ingress/egress gate on Pearl Street. A site location map is provided as Figure 1.

The "project north" is perpendicular to Water Street and points towards Pearl Street. All directions described herein are referenced to the project north arrow unless otherwise noted.

According to the New York City Zoning Map 12b, the site is located in a C6-2A commercial

district. The C6-2A district is mapped within the South Street Seaport Subdistrict of the Special Lower Manhattan District. C6 districts allow for a wide range of mixed residential and commercial uses. According to the New York City Landmarks Preservation Commission, the site is located in the South Street Seaport Historic District.

Historical uses of the site include a factory (cast-iron stoves, boilers, radiators, and other unknown uses), an oil company, a printer, a metal works, a chemicals and glue company, a chemical company, thermometer factories/workshops, a garage with two 550-gallon underground storage tanks (USTs), a machine shop, and a gasoline service station.

1.3 Summary of Work Tasks

1.3.1 Excavation Observation and Screening

As part of the excavation activities, Langan personnel will observe soil excavation per the work plan. If encountered, debris from the demolition of a concrete slab may be segregated for separate disposal. Langan will report the location of the concrete debris stockpile and note if the contractor has complied with the concrete debris stockpile instructions when specified in the work plan.

Langan will screen excavated material for visual, olfactory, and instrumental indicators suggestive of a potential chemical or petroleum release. Instrument screening for the presence of Volatile Organic Compounds (VOCs) may be performed with a duly field-calibrated Photoionization Detector (PID) and/or Jerome J405 Mercury Vapor Analyzer. Contractors will excavate for utilities, foundation components and potential grading using heavy equipment and hand tools in such a manner as to avoid negatively impacting buried utilities or foundation components. Contractors will notify Langan personnel if they identify indications suggestive of a potential chemical or petroleum release.

Langan will coordinate trucking in cooperation with the soil disposal contractors. Langan will only sign non-hazardous manifests if instructed by the Project Manager (PM) and provide the specific language. Langan is not to sign hazardous waste manifests unless specifically instructed by the PM to do so. Langan will record the information associated with each manifest as specified in the work plan. Contaminated material shall be handled and properly disposed in accordance with federal, state and city regulations, criteria and guidelines. If excavation occurs over several days, Langan will confirm that the contractor has placed a barrier around the excavation and stockpile to prevent 3rd party injury.

1.3.2 Soil Screening & Reporting

As part of excavation activities, the Langan personnel will report when they have observed visual

and olfactory indications of possible soil impact. Langan personnel will also report concentrations of VOCs above background when using a duly calibrated hand held PID (or equivalent) or mercury vapor above background when using a duly calibrated hand held Jerome J405 Mercury Vapor Analyzer (or equivalent).

1.3.3 Soil Sampling

As part of the excavation activities, soil samples (waste characterization, excavation endpoint, delineation, or quality assurance/quality control [QA/QC]) may be collected during construction, as required. Langan personnel will coordinate with the contractor in sampling soil (in accordance with the work plan, where applicable).

Soil samples excavation endpoint or delineation sampling (along with QA/QC samples) may be collected and subsequently submitted to a New York State Department of Health (NYSDOH) Environmental Laboratory Approval Program (ELAP)-certified laboratory and analyzed in accordance with work plan specifications.

1.3.4 Characterization of Excavated Material

When required by the work plan, Langan personnel will characterize excavated soil or clean backfill in accordance with Langan standards.

1.3.5 Stockpiling

Visibly contaminated soil, if encountered, shall be segregated and stockpiled on at least 8 millimeters of plastic sheeting; reusable soil and fill shall be segregated and stockpiled separately from unusable fill, concrete and other debris; the stockpiles shall be kept covered with 8 millimeters thick plastic sheeting; the plastic sheeting covering the stockpiles shall be anchored firmly in place by weights, stakes, or both; the Contractor shall maintain the plastic sheeting.

1.3.6 Geophysical Investigation

Langan will conduct further intrusive field activities (i.e., soil borings). If required, Langan will retain a geophysical consultant to conduct a geophysical survey using ground penetrating radar (GPR) and electromagnetic detection equipment. Langan personnel will coordinate the geophysical survey. The objective of the survey will be to identify any underground storage tank (UST) structures, drains, underground utilities, and other subsurface anomalies that may be encountered during the investigation. During this time Langan personnel will inspect the site and confirm sample locations.

1.3.7 Hand Clearing of Borehole Locations

If there is no geophysical survey for utility clearance or the results of the geophysical survey are inconclusive at specific locations subject to intrusive work, Langan will instruct the drilling contractor to hand clear each location to confirm utilities or other known or suspected subsurface structures. Hand clearing of a soil boring location should extend to a depth of 5-feet and be about 1.5 times the anticipated diameter of the borehole when drilled. Langan personnel will confirm that hand clearing activities are completed to these specifications.

1.3.8 Groundwater Investigation and Sampling

Langan will collect additional groundwater data as part of the remedial program. Langan may contract a drilling contractor to install temporary or permanent monitoring wells or use existing monitoring wells to sample groundwater at the site. If used, the drilling contractor will contact the appropriate utility mark-out authority and make available to their drilling staff the verification number and effective dates. Langan will record the verification number and effective dates from the drillers. Langan will also note the location of marked out utilities on the site plan and scan the data into the project folder.

Groundwater samples will be collected from one or more of the new and if available, pre-existing monitoring wells in accordance with the Langan Low Flow Groundwater Sampling SOP (SOP #12). Groundwater samples will be submitted to an approved laboratory and analyzed for constituents as specified in the work plan. Temporary monitoring wells will be plugged and abandoned during the investigation in the manner. Permanent monitoring wells will be completed with a road box set in concrete. Permanent monitoring wells may be eventually backfilled and abandoned in accordance with State and Local regulations.

Groundwater samples will be submitted to a NYSDOH ELAP-certified laboratory in accordance with work plan specifications.

1.3.9 Construction Dewatering

The dewatering contractor shall be responsible for handling contaminated dewatering fluids in accordance with federal, state and local regulations. Dewatering fluids are to be discharged to the local sanitary sewer system after treatment and under approved regulatory permit. Alternatively, the contractor may provide containerized storage to allow for testing of groundwater prior to, and after, treatment and before disposal. If required, Langan field personnel may sample dewatering treatment system liquids from either a discharge standpipe or a storage tank. Dewatering samples will be submitted to an NYSDEP ELAP-certified laboratory for analysis.

1.3.10 Excavation Backfill

Areas of the site that were over-excavated may be backfilled to development grade (i.e., the grade required to complete construction of the foundation and sidewalk extension). Imported material should meet specifications defined in the work plan. Langan will observe and record trucks importing fill material and, when required by the work plan, collect appropriate samples for possible submission for analysis.

1.3.11 Decommissioning and Removal of Above-Ground and Underground Storage Tanks

Langan will retain an underground storage tanks (USTs) decommissioning and removal contractor to furnish all labor and materials, equipment and incidentals required for the proper decontamination, removal and closure of any UST in accordance with federal, state and local regulations. The removal contractor will contact the appropriate utility mark-out authority and make available to their staff the verification number and effective dates. Langan personnel will monitor air with a calibrated PID and lower explosion limit (LEL) device downwind from the UST excavation and record the PID and LEL readings.

1.3.12 Installation of Waterproofing and Vapor Barrier

As specified in the work plan, Langan will observe a properly licensed contractor while installing the waterproofing membrane and vapor barrier system as specified in the work plan. Langan or other authorized personnel, as specified in the contract documents, will inspect the waterproofing and vapor barrier installation and record the work plan specified information as required.

1.3.13 Construction Activity Inspections and Observations

Langan will observe construction activities including the general oversight, observation of landscaping activities, and other select observation project management and supervision as specified in the work plan or in accordance with the construction documents, or special inspection requirements administered by the New York City Department of Buildings. Materials used for construction will be inspected by Langan for conformance to the design documents.

1.3.14 Equipment Decontamination

If samples are collected, then before the start of the day's sampling and after sampling each run, sampling equipment will be decontaminated by the decontamination process outlined Attachment B - Decontamination Procedures. Decontamination wastes and purge water will be temporarily stored on site pending analytical results.

1.3.15 Management of Investigative-Derived Waste

The investigative-derived waste (IDW) generated during this investigation may be stockpiled as defined under the stockpile section (above) or contained in DOT-approved 55-gallon drums. The drums will be temporarily stored on the site or as directed by the client representative. All drums will be filled between to two-thirds full to allow easy maneuvering during drum pickup and disposal. Drum labels are to be provided by Langan (Environmental Closet). All drums will be labeled as "IDW Pending Analysis" until sample data are reported from the laboratory. Drum labels will include date filled and locations where waste was generated along with the standard information required by the labels in accordance with the Langan SOP09, Drum Labeling.

Closed top drums are to be used to store liquids. Debris, including plastic sheeting, polyethylene tubing, personal protection equipment (PPE), decontamination debris, etc. will be segregated from and disposed in large heavy duty garbage bags and disposed of at the site. Excess unused glassware should be returned to the lab along with the last day of collection samples.

1.3.16 Drum Sampling

Excess or impacted soil and water that is drummed during the remedial action activities must be labeled in accordance with the Langan Drum Labeling Standard Operating Procedure (SOP-#9). Langan personnel will collect drum samples, as required, prior to off-site drum disposal. Samples will be placed into laboratory-supplied batch-certified clean glassware and submitted to a NYSDOH ELAP-certified laboratory.

1.3.17 Surveying

If specified in the work plan, surveying activities may be completed by Langan. Surveying will be conducted by licensed surveyors.

2.0 IDENTIFICATION OF KEY PERSONNEL/HEALTH AND SAFETY PERSONNEL

The following briefly describes the health and safety (H&S) designations and general responsibilities that may be employed for this site. The titles have been established to accommodate the project needs and requirements and ensure the safe conduct of site activities. The H&S personnel requirements for a given work location are based upon the proposed site activities.

2.1 Langan Project Manager

The Langan Environmental PM is Paul McMahon, his responsibilities include:

- Ensuring that this CHASP is developed, current, and approved prior to on-site activities.
- Ensuring that all the tasks in the project are performed in a manner consistent with Langan's comprehensive *Health and Safety Program for Hazardous Waste Operations* and this CHASP.

2.2 Langan Corporate Health and Safety Manager

The Langan Corporate Health and Safety Manager (HSM) is Tony Moffa. His responsibilities include:

- Updating the *Construction Health and Safety Program for Hazardous Waste Operations*.
- Assisting the site Health and Safety Officer (HSO) with development of the HASP, updating CHASP as dictated by changing conditions, jobsite inspection results, etc. and approving changes to this CHASP.
- Assisting the HSO in the implementation of this CHASP and conducting Jobsite Safety Inspections and assisting with communication of results and correction of shortcomings found.
- Maintaining records on personnel (medical evaluation results, training and certifications, accident investigation results, etc.).

2.3 Langan Site Health & Safety Officer

The Langan HSO is William Bohrer. His responsibilities include:

- Participating in the development and implementation of this CHASP.
- When on-site, assisting the Langan Field Team Leader in conducting Tailgate Safety Meetings and Jobsite Safety Inspections and correcting any shortcomings in a timely manner.
- Ensuring that proper PPE is available, worn by employees, and properly stored and maintained.
- Controlling entry into and exit from the site contaminated areas or zones.
- Monitoring employees for signs of stress, such as heat stress, fatigue, and cold exposure.
- Monitoring site hazards and conditions.
- Knowing (and ensuring that all site personnel also know) emergency procedures, evacuation routes, and the telephone numbers of the ambulance, local hospital, poison control center, fire department, and police department.
- Resolving conflicts that may arise concerning safety requirements and working conditions.
- Reporting all incidents, injuries and near misses to the Langan Incident/Injury Hotline

immediately and the client representative.

2.4 Langan Field Team Leader Responsibilities

The Langan Field Team Leader (FTL) is to be determined. The FTL's responsibilities include:

- The management of the day-to-day site activities and implementation of this CHASP in the field.
- Participating in and/or conducting Tailgate Safety Meetings and Jobsite Safety Inspections and correcting any shortcomings in a timely manner.
- When a Community Air Monitoring Operating Program (CAMP) is part of the scope, the FTL will set up and maintaining community air monitoring activities and instructing the responsible contractor to implement organic vapor or dust mitigation when necessary.
- Overseeing the implementation of activities specified in the work plan.

2.5 Contractor Responsibilities

The contractor, if one is utilized, shall develop and implement their own CHASP for their employees, lower-tier subcontractors, and consultants. The contractor is responsible for their own health and safety and that of their subcontractors. Contractors operating on the site shall designate their own FTL, HSO and HSM. The contractor's CHASP will be at least as stringent as this Langan CHASP. The contractor must be familiar with and abide by the requirements outlined in their own CHASP. A contractor may elect to adopt Langan's CHASP as its own provided that it has given written notification to Langan, but where Langan's CHASP excludes provisions pertinent to the contractor's work (i.e., confined space entry); the contractor must provide written addendums to this CHASP. Additionally, the contractor must:

- Ensure their employees are trained in the use of all appropriate PPE for the tasks involved;
- Notify Langan of any hazardous material brought onto the job site or site related area, the hazards associated with the material, and must provide a material safety data sheet (MSDS) or safety data sheet (SDS) for the material;
- Have knowledge of, understand, and abide by all current federal, state, and local health and safety regulations pertinent to the work;
- Ensure their employees handling hazardous materials, if identified at the site, have received current training in the appropriate levels of 29 CFR 1910.120, *Hazardous Waste Operations and Emergency Response* (HAZWOPER) if hazardous waste is identified at the Site;
- Ensure their employees handling hazardous materials, if identified at the Site, have been fit-tested within the year on the type of respirator they will wear; and
- Ensure all air monitoring is in place pertaining to the health and safety of their employees

as required by OSHA 1910.120; and

- All contractors must adhere to all federal, state, and local regulatory requirements.

3.0 TASK/OPERATION SAFETY AND HEALTH RISK ANALYSES

A Task-Hazard Analysis (Table 1) was completed for general construction hazards that may be encountered at the site. The potential contaminants that might be encountered during the field activities and the exposure limits are listed in Table 2. Complete inventory of MSDS/SDS for chemical products used on site is included as Attachment E.

3.1 Specific Task Safety Analysis

3.1.1 Excavation and Soil Screening

Langan personnel will observe excavation and SOE activities including the general oversight, observation of landscaping activities, and other select observation project management and supervision as specified in the work plan or in accordance with the construction documents, or special inspection requirements administered by the New York City Department of Buildings. Materials used for construction may be inspected by Langan personnel for conformance to the design documents. Prior to entering excavation, Langan personnel will insure that excavation shoring conforms to proper shoring/benching/sloping techniques, at a minimum that soil and equipment is kept at least 2 feet from the edge of the excavation, that there is no water in the excavation, and that a competent person has inspected excavation prior to allow persons to enter. When entering excavation via a ladder, Langan personnel will only use ladders that are properly situated in accordance with the ladder section of the CHASP.

Sampling the soil requires the donning of chemical resistant gloves in addition to the standard PPE. Langan personnel are not to operate nor direct the use of excavation equipment. These tasks are to be completed by the excavation contractor.

3.1.2 Stockpile Sampling

Langan personnel are not to scale or otherwise climb stockpiles. If the soil sampling plan requires sampling from the stockpile above ground level, samples are to be obtained using suitable excavation equipment operated by the contractor (i.e. front end loader).

3.1.3 Geophysical Survey

Langan personnel are not permitted to operate or otherwise handle the geophysical equipment including any downhole geophysical equipment subsequently used to survey boreholes. When

boring locations are surveyed with surface geophysical equipment, the locations of the borings as well as possible utilities and other artifacts that may interfere with the subsurface investigation are to be marked with indelible paint, flags, or color tape (when marking indoor locations that the client has specifically requested not be marked with indelible paint). This information must also be added to the site map. When applying paint, proper PPE including at a minimum hand protections should be used.

3.1.4 Hand Clearing of Borehole Locations

Hand clearing will be completed by the contractor. Langan personnel are not permitted to operate or otherwise handle the contractor equipment. Langan will update the site map to include the locations of the cleared borehole locations as well as possible utilities and other artifacts that may interfere with the subsurface investigation.

3.1.5 Groundwater Investigation and Sampling

Sampling groundwater requires the donning of chemical resistant gloves in addition to the standard PPE and cut resistant gloves when cutting sampling-tubing to length. Langan personnel are not to operate drilling equipment nor assemble or install monitoring well equipment. These tasks are to be completed by the driller contractor.

3.1.6 Construction Activity Inspection

The contractor will operate equipment used during site construction. Langan personnel will observe construction activities in accordance with specification in the work plan and record the data the work plan requires. Construction activities are to be done exclusively by the contractor following their own health and safety specifications outlined in their HASPs. Langan personnel are not to operate or assist in the operation of equipment used in construction activities unless defined as part of an inspection or observation in the work plan.

3.1.7 Construction Dewatering

The contractor shall be responsible for handling all contaminated groundwater removed from the site in accordance with federal, state and local regulations; including any sampling, treatment and disposal. Dewatering discharge is likely to require treatment and in accordance with a NYSDEC SPDES permit. Alternatively, the contractor may provide sufficient containerized storage to allow for testing of groundwater prior to and after treatment and before disposal.

If required, Langan may sample dewatering treatment system liquids from either a discharge standpipe or a storage tank. Prior to collecting the samples, Langan will don the necessary PPE including nitrile gloves and if necessary, facial splash guard. Samples may be collected from either the direct discharge standpipe or from a sample port or valve built into the storage tank.

Sample ports and valves may only be sampled if they are accessible at ground level. Sampling from heights over 6 feet is prohibited unless Langan field personnel are fully accredited in fall protection and are wearing approved fall protection safety apparatus.

3.1.8 Removal of UST

If UST excavation and removal activity is initiated, Langan personnel will conduct air monitoring for lower explosion limit (LEL) conditions within the UST excavation itself. This task is to be performed using calibrated air monitoring equipment designed to sound an audio alarm when atmospheric concentrations of VOC are within 10% of the LEL. In normal atmospheric oxygen concentrations, the LEL monitoring may be done with a Wheatstone bridge/catalytic bead type sensor (i.e. MultiRAE). However in oxygen depleted atmospheres (confined space), only an LEL designed to work in low oxygen environments may be used. Best practices require that the LEL monitoring unit be equipped with a long sniffer tube to allow the LEL unit to remain outside the UST excavation. Langan personnel are not to enter the UST excavation nor enter an excavated UST.

In addition to monitoring LEL, Langan personnel will monitor atmospheric VOC concentrations directly downwind of the UST excavation in accordance with standard CAMP procedures using calibrated air monitoring equipment.

3.1.9 Backfilling of Excavated Areas to Development Grade

The backfilling contractor will provide their employees with equivalent PPE to protect them from the specific hazards likely to be encountered on-site. Selection of the appropriate PPE must take into consideration: (1) identification of the hazards or suspected hazards; (2) potential exposure routes; and, (3) the performance of the PPE construction (materials and seams) in providing a barrier to these hazards. Langan personnel may survey backfilling material with a calibrated PID; however, as they are not permitted to climb the material delivery truck, the contractor must provide samples from each truck as required.

3.1.10 Installation of Waterproofing and Vapor Barrier

Specifically trained contractors are to install waterproofing and vapor barrier. Langan personnel are there only to observe and record the data required in the work plan. Installation and assemblage of the waterproofing and vapor barrier is to be done exclusively by the contractor following their own health and safety specific CHASP.

3.1.11 Drum Sampling

Drilling fluid, rinse water, grossly-contaminated soil samples and cuttings may be containerized in 55-gallon drums for transport and disposal off site. Each drum must be labeled in accordance with the Langan Drum Labeling Standard Operating Procedure (SOP-#9). Langan may collect drum samples, as required, prior to off-site drum disposal. Samples will be placed into laboratory-supplied batch-certified clean glassware and submitted to a NYSDOH ELAP-certified laboratory.

Langan personnel and contractors are not to move or open any orphaned (unlabeled) drum found on the site without approval of the project manager.

3.2 Radiation Hazards

No radiation hazards are known or expected at the site.

3.3 Physical Hazards

Physical hazards, which may be encountered during site operations for this project, are detailed in Table 1.

3.3.1 Explosion

No explosion hazards are expected for the scope of work at this site.

3.3.2 Heat Stress

The use of Level C protective equipment, or greater, may create heat stress. Monitoring of personnel wearing personal protective clothing should commence when the ambient temperature is 72°F or above. Table 6 presents the suggested frequency for such monitoring. Monitoring frequency should increase as ambient temperature increases or as slow recovery rates are observed. Refer to the Table 7 to assist in assessing when the risk for heat related illness is likely. To use this table, the ambient temperature and relative humidity must be obtained (a regional weather report should suffice). Heat stress monitoring should be performed by the HSO or the FTL, who shall be able to recognize symptoms related to heat stress.

To monitor the workers, be familiar with the following heat-related disorders and their symptoms:

- **Heat Cramps:** Painful spasm of arm, leg or abdominal muscles, during or after work
- **Heat Exhaustion:** Headache, nausea, dizziness; cool, clammy, moist skin; heavy sweating; weak, fast pulse; shallow respiration, normal temperature
- **Heat Stroke:** Headache, nausea, weakness, hot dry skin, fever, rapid strong pulse, rapid

deep respirations, loss of consciousness, convulsions, coma. *This is a life threatening condition.*

Do not permit a worker to wear a semi-permeable or impermeable garment when they are showing signs or symptoms of heat-related illness.

To monitor the worker, measure:

- **Heart rate:** Count the radial pulse during a 30-second period as early as possible in the rest period. If the heart rate exceeds 100 beats per minute at the beginning of the rest period, shorten the next work cycle by one-third and keep the rest period the same. If the heart rate still exceeds 100 beats per minute at the next rest period, shorten the following work cycle by one-third. A worker cannot return to work after a rest period until their heart rate is below 100 beats per minute.
- **Oral temperature:** Use a clinical thermometer (3 minutes under the tongue) or similar device to measure the oral temperature at the end of the work period (before drinking). If oral temperature exceeds 99.6°F (37.6°C), shorten the next work cycle by one-third without changing the rest period. A worker cannot return to work after a rest period until their oral temperature is below 99.6°F. If oral temperature still exceeds 99.6°F (37.6°C) at the beginning of the next rest period, shorten the following cycle by one-third. Do not permit a worker to wear a semi-permeable or impermeable garment when oral temperature exceeds 100.6°F (38.1°C).

Prevention of Heat Stress - Proper training and preventative measures will aid in averting loss of worker productivity and serious illness. Heat stress prevention is particularly important because once a person suffers from heat stroke or heat exhaustion, that person may be predisposed to additional heat related illness. To avoid heat stress the following steps should be taken:

- Adjust work schedules.
- Mandate work slowdowns as needed.
- Perform work during cooler hours of the day if possible or at night if adequate lighting can be provided.
- Provide shelter (air-conditioned, if possible) or shaded areas to protect personnel during rest periods.
- Maintain worker's body fluids at normal levels. This is necessary to ensure that the cardiovascular system functions adequately. Daily fluid intake must approximately equal the amount of water lost in sweat, i.e., eight fluid ounces (0.23 liters) of water must be ingested for approximately every eight ounces (0.23 kg) of weight lost. The normal thirst mechanism is not sensitive enough to ensure that enough water will be drunk to replace lost sweat. When heavy sweating occurs, encourage the worker to drink more. The following strategies may be useful:

- Maintain water temperature 50° to 60°F (10° to 16.6°C).
- Provide small disposal cups that hold about four ounces (0.1 liter).
- Have workers drink 16 ounces (0.5 liters) of fluid (preferably water or dilute drinks) before beginning work.
- Urge workers to drink a cup or two every 15 to 20 minutes, or at each monitoring break. A total of 1 to 1.6 gallons (4 to 6 liters) of fluid per day are recommended, but more may be necessary to maintain body weight.
- Train workers to recognize the symptoms of heat related illness.

3.3.3 Cold-Related Illness

If work on this project begins in the winter months, thermal injury due to cold exposure can become a problem for field personnel. Systemic cold exposure is referred to as hypothermia. Local cold exposure is generally called frostbite.

- **Hypothermia** - Hypothermia is defined as a decrease in the patient core temperature below 96°F. The body temperature is normally maintained by a combination of central (brain and spinal cord) and peripheral (skin and muscle) activity. Interference with any of these mechanisms can result in hypothermia, even in the absence of what normally is considered a "cold" ambient temperature. Symptoms of hypothermia include: shivering, apathy, listlessness, sleepiness, and unconsciousness.
- **Frostbite** - Frostbite is both a general and medical term given to areas of local cold injury. Unlike systemic hypothermia, frostbite rarely occurs unless the ambient temperatures are less than freezing and usually less than 20°F. Symptoms of frostbite are: a sudden blanching or whitening of the skin; the skin has a waxy or white appearance and is firm to the touch; tissues are cold, pale, and solid.

Prevention of Cold-Related Illness - To prevent cold-related illness:

- Educate workers to recognize the symptoms of frostbite and hypothermia
- Identify and limit known risk factors.
- Assure the availability of enclosed, heated environment on or adjacent to the site.
- Assure the availability of dry changes of clothing.
- Assure the availability of warm drinks.
- Start (oral) temperature recording at the job site.
- At the FSO or Field Team Leader's discretion when suspicion is based on changes in a worker's performance or mental status.
- At a worker's request.
- As a screening measure, two times per shift, under unusually hazardous conditions (e.g., wind-chill less than 20°F, or wind-chill less than 30°F with precipitation).
- As a screening measure whenever a worker on the site develops hypothermia.

Any person developing moderate hypothermia (a core temperature of 92°F) cannot return to work for 48 hours.

3.3.4 Noise

Work activities during the proposed activities may be conducted at locations with high noise levels from the operation of equipment. Hearing protection will be used as necessary.

3.3.5 Hand and Power Tools

The use of hand and power tools can present a variety of hazards, including physical harm from being struck by flying objects, being cut or struck by the tool, fire, and electrocution. All hand and power tools should be inspected for health and safety hazards prior to use. If deemed unserviceable/un-operable, notify supervisor and tag equipment out of service. Ground Fault Circuit Interrupters (GFCI) are required for all power tools requiring direct electrical service.

3.3.6 Slips, Trips and Fall Hazards

Care should be exercised when walking at the site, especially when carrying equipment. The presence of surface debris, uneven surfaces, pits, facility equipment, and soil piles contribute to tripping hazards and fall hazards. To the extent possible, all hazards should be identified and marked on the site, with hazards communicated to all workers in the area.

3.3.7 Utilities (Electrocution and Fire Hazards)

3.3.7.1 Utility Clearance

The possibility of encountering underground utilities poses fire, explosion, and electrocution hazards. All excavation work will be preceded by review of available utility drawings and by notification of the subsurface work to the N.Y. One-Call-Center.

3.3.7.2 Lockout-Tagout

The potential adverse effects of electrical hazards include burns and electrocution, which could result in death. Therefore, there is a procedure that establishes the requirements for the lockout/tagout (LOTO) of energy isolating devices in accordance with the OSHA electrical lockout and tagging requirements as specified in 29 CFR 1926.417. This procedure will be used to ensure that all machines and equipment are isolated from potentially hazardous energy. If possible, equipment that could cause injury due to unexpected energizing, start-up, or release of stored energy will be locked/tagged before field personnel perform work activities.

Depending upon the specific work task involved, Langan's SSC or FTL will serve as the authorized lockout/tagout coordinator, implement the lockout/tagout procedure and will be responsible to locate, lock and tag valves, switches, etc.

SPECIAL NOTE: Project personnel will assume that all electrical equipment at surface, subsurface and overhead locations is energized, until equipment has been designated and confirmed as de-energized by a utility company representative. Langan will notify the designated utility representative prior to working adjacent to this equipment and will verify that the equipment is energized or de-energized in the vicinity of the work location.

No project work shall be performed by Langan personnel or subcontractors on or near energized electrical lines or equipment unless hazard assessments are completed in writing, reviewed by Langan's SSHO, and clearly communicated to the field personnel.

The FTL shall conduct a survey to locate and identify all energy isolating devices. They shall be certain which switches, valves or other isolating devices apply to the equipment. The lockout/tagout procedure involves, but is not limited to, electricity, motors, steam, natural gas, compressed air, hydraulic systems, digesters, sewers, etc.

3.3.8 Physical Hazard Considerations for Material Handling

There are moderate to severe risks associated with moving heavy objects at the site. The following physical hazards should be considered when handling materials at the site:

- Heavy objects will be lifted and moved by mechanical devices rather than manual effort whenever possible.
- The mechanical devices will be appropriate for the lifting or moving task and will be operated only by trained and authorized personnel.
- Objects that require special handling or rigging will only be moved under the guidance of a person who has been specifically trained to move such objects.
- Lifting devices will be inspected, certified, and labeled to confirm their weight capacities. Defective equipment will be taken out of service immediately and repaired or destroyed.
- The wheels of any trucks being loaded or unloaded will be chocked to prevent movement. Outriggers will be fully extended on a flat, firm surface during operation.
- Personnel will not pass under a raised load, nor will a suspended load be left unattended.
- Personnel will not be carried on lifting equipment, unless it is specifically designed to carry passengers.
- All reciprocating, rotating, or other moving parts will be guarded at all times.

- Accessible fire extinguishers, currently (monthly) inspected, will be available in all mechanical lifting devices.
- Verify all loads/materials are secure before transportation.

Material handling tasks that are unusual or require specific guidance will need a written addendum to this CHASP. The addendum must identify the lifting protocols before the tasks are performed. Upon approval, the plan must be reviewed with all affected employees and documented. Any deviation from a written plan will require approval by the Langan HSM.

3.3.9 Hearing Conservation

Under the construction industry standard, the maximum permissible occupational noise exposure is 90 dbA (8-hour TWA), and noise levels in excess of 90 dbA must be reduced through feasible administrative and engineering controls (20 CFR 1926.52). Hearing protection is required when working within 15 feet of vacuum extraction equipment and drill rigs.

3.4 Biological Hazards

3.4.1 Animals

There is a possibility of encountering wildlife including reptiles, rodents and other small and medium size mammals. The Langan personnel is to avoid interacting with any wildlife.

3.4.2 Insects

Ticks and other biting or stinging insects may to be encountered during site operations. Langan personnel should take necessary precautions including donning long sleeve shirts and insecticide to prevent bites and stings. After field work, Langan personnel should perform a complete visual inspection of their clothing to insure they are not inadvertently harboring ticks. If they do observe a tick bite, they are to contact the HSM or HSO and report the event.

3.4.3 Plants

Poisonous plants may to be encountered during site operations. Langan personnel should take necessary precautions including donning long sleeve shirts and applying preventative poison Ivy/Sumac lotion to prevent or limit effects of exposure. If after field work, Langan employees do observe a reaction to poisonous plant exposure, they are to contact the HSM or HSO and report the event.

3.4.4 Coronavirus

3.4.4.1 General Preventative Measures

Field personnel must follow general proper hygiene measures while in the field including:

- Avoid touching eyes, nose and mouth.
- Cover cough or sneeze with tissue, and throw in trash.
- Wash hands often with soap and water for 20 seconds after going to bathroom, before eating, after blowing nose, coughing or sneezing.
- Use hand sanitizer with at least 60% alcohol if soap and water are not available.
- Avoid physical contact with other people (e.g., no handshakes).
- Maintain a safe distance of at least 6 feet from other people (social distancing).
- Wear face coverings when around other worker to minimize spread of COVID-19 (may be required in certain states or locations).

3.4.4.2 Construction Trailers

Employees should avoid use of shared construction trailers or where employees cannot maintain a safe distance (minimum 6 feet) from other workers. If trailer use is needed, areas such as desks, phones, chairs and other common areas, should be cleaned and disinfected before and after use. Protocols should be developed to minimize trailer use to essential personal, restrict use from any workers who are ill or showing symptoms of being ill, and ensure a safe distance of 6 feet can be established between workers.

3.4.4.3 Communication

Include Coronavirus topics and prevention topics in daily tailgate meetings to ensure Coronavirus awareness is communicated daily. Discussions can focus on general topics including: social distancing, prevention measures for field personnel, signs and symptoms and recent news on the Coronavirus. Site-specific topics should include minimizing face-to-face contact, disinfecting/sterilizing field equipment, use of PPE to reduce exposure, site security and other potential exposure issues/concerns.

3.4.4.4 Sick/Ill Workers

No Langan employee is permitted to be on-site when ill and/or showing potential symptoms of the Coronavirus. Symptoms of the Coronavirus may appear 2-14 days after exposure and can range from mild to severe. The most common symptoms include: fever, fatigue, dry cough and shortness of breath. If an employee or subcontractor is observed being ill or exhibiting symptoms

of Coronavirus, employees must immediately utilize their Stop Work Authority and contact their project manager to address the situation. If an employee observes another worker onsite exhibiting symptoms of Coronavirus, immediately utilize Stop Work Authority and notify their project manager and site construction manager or safety officer. Work should resume when the safety and health of Langan and subcontractors is adequately addressed.

3.5 Additional Safety Analysis

3.5.1 Presence of Non-Aqueous Phase Liquids (NAPL)

There is potential for exposure to NAPL at this site. Special care and PPE should be considered when NAPL is observed as NAPL is a typically flammable fluid and releases VOCs known to be toxic and/or carcinogenic. If NAPL is present in a monitoring well, vapors from the well casing may contaminate the work area breathing zone with concentrations of VOCs potentially exceeding health and safety action levels. In addition, all equipment used to monitor or sample NAPL (or ground water from wells containing NAPL) must be intrinsically safe. Equipment that directly contacts NAPL must also be resistant to organic solvents.

At a minimum, a PID should be used to monitor for VOCs when NAPL is observed. If NAPL is expected to be observed in an excavation or enclosed area, air monitoring must be started using calibrated air monitoring equipment designed to sound an audio alarm when atmospheric concentrations of VOC are within 10% of the LEL. In normal atmospheric oxygen concentrations, the LEL monitoring may be done with a Wheatstone bridge/catalytic bead type sensor (i.e. MultiRAE). However in oxygen depleted atmospheres (confined space), only an LEL designed to work in low oxygen environments may be used. Best practices require that the LEL monitoring unit be equipped with a long sniffer tube to allow the LEL unit to remain outside the UST excavation.

When NAPL is present, Langan personnel are required to use disposable nitrile gloves at all times to prevent skin contact with contaminated materials. They should also consider having available a respirator and protective clothing (Tyvek® overalls), especially if NAPL is in abundance and there are high concentrations of VOCs.

All contaminated disposables including PPE and sampling equipment must be properly disposed of in labeled 55-gallon drums.

3.6 Job Safety Analysis

A Job Safety Analysis (JSA) is a process to identify existing and potential hazards associated with each job or task so these hazards can be eliminated, controlled or minimized. A JSA will be

performed at the beginning of each work day, and additionally whenever an employee begins a new task or moves to a new location. All JSAs must be developed and reviewed by all parties involved. A blank JSA form and documentation of completed JSAs are in Attachment G.

4.0 PERSONNEL TRAINING

4.1 Basic Training

Completion of an initial 40-hour HAZWOPER training program as detailed in OSHA's 29 CFR 1910.120(e) is required for all employees working on a site engaged in hazardous substance removal or other activities which expose or potentially expose workers to hazardous substances, health hazards, or safety hazards as defined by 29 CFR 1910.120(a). Annual 8-hour refresher training is also required to maintain competencies to ensure a safe work environment. In addition to these training requirements, all employees must complete the OSHA 10 hour Construction Safety and Health training and supervisory personnel must also receive eight additional hours of specialized management training. Training records are maintained by the HSM.

4.2 Initial Site-Specific Training

Training will be provided to specifically address the activities, procedures, monitoring, and equipment for site operations at the beginning of each field mobilization and the beginning of each discrete phase of work. The training will include the site and facility layout, hazards, and emergency services at the site, and will detail all the provisions contained within this CHASP. For a HAZWOPER operation, training on the site must be for a minimum of 3 days. Specific issues that will be addressed include the hazards described in Section 3.0.

4.3 Tailgate Safety Briefings

Before starting work each day or as needed, the Langan HSO will conduct a brief tailgate safety meeting to assist site personnel in conducting their activities safely. Tailgate meetings will be documented in Attachment H. Briefings will include the following:

- Work plan for the day;
- Review of safety information relevant to planned tasks and environmental conditions;
- New activities/task being conducted;
- Results of Jobsite Safety Inspection Checklist;
- Changes in work practices;
- Safe work practices; and
- Discussion and remedies for noted or observed deficiencies.

5.0 MEDICAL SURVEILLANCE

All personnel who will be performing field work involving potential exposure to toxic and hazardous substances (defined by 29 CFR 1910.120(a)) will be required to have passed an initial baseline medical examination, with follow-up medical exams thereafter, consistent with 29 CFR 1910.120(f). Medical evaluations will be performed by, or under the direction of, a physician board-certified in occupational medicine.

Additionally, personnel who may be required to perform work while wearing a respirator must receive medical clearance as required under CFR 1910.134(e), *Respiratory Protection*. Medical evaluations will be performed by, or under the direction of, a physician board-certified in occupational medicine. Results of medical evaluations are maintained by the HSM.

6.0 PERSONAL PROTECTIVE EQUIPMENT

6.1 Levels of Protection

Langan will provide PPE to Langan employees to protect them from the specific hazards they are likely to encounter on-site. Direct hired contractors will provide their employees with equivalent PPE to protect them from the specific hazards likely to be encountered on-site. Selection of the appropriate PPE must take into consideration: (1) identification of the hazards or suspected hazards; (2) potential exposure routes; and, (3) the performance of the PPE construction (materials and seams) in providing a barrier to these hazards.

Based on anticipated site conditions and the proposed work activities to be performed at the site, Level D protection will be used. The upgrading/downgrading of the level of protection will be based on continuous air monitoring results as described in Section 6.0 (when applicable). The decision to modify standard PPE will be made by the site HSO or FTL after conferring with the PM. The levels of protection are described below.

Level D Protection (as needed)

- Safety glasses with side shields or chemical splash goggles
- Safety boots/shoes
- Coveralls (Tyvek® or equivalent)
- Hard hat
- Long sleeve work shirt and work pants
- Nitrile gloves
- Hearing protection
- Reflective safety vest

Level D Protection (Modified, as needed)

- Safety glasses with sideshields or chemical splash goggles
- Safety boots/shoes (toe-protected)
- Disposable chemical-resistant boot covers
- Coveralls (polycoated Tyvek or equivalent to be worn when contact with wet contaminated soil, groundwater, or non-aqueous phase liquids is anticipated)
- Hard hat
- Long sleeve work shirt and work pants
- Nitrile gloves
- Hearing protection (as needed)
- Personal floatation device (for work within 5 feet of the water)
- Reflective traffic vest

Level C Protection (as needed)

- Full or Half face, air-purifying respirator, with NIOSH approved HEPA filter
- Inner (latex) and outer (nitrile) chemical-resistant gloves
- Safety glasses with side shields or chemical splash goggles
- Chemical-resistant safety boots/shoes
- Hard hat
- Long sleeve work shirt and work pants
- Coveralls (Tyvek® or equivalent)
- Hearing protection (as needed)
- Reflective safety vest

The action levels used in determining the necessary levels of respiratory protection and upgrading to Level C are summarized in Table 4. The written Respiratory Protection Program is maintained by the HSM and is available if needed. The monitoring procedures and equipment are outlined in Section 6.0 (when applicable).

6.2 Respirator Fit-Test

All Langan employees who may be exposed to hazardous substances at the work site are in possession of a full- or half-face, air-purifying respirator and have been successfully fit-tested within the past year. Fit-test records are maintained by the HSM.

6.3 Respirator Cartridge Change-Out Schedule

Respiratory protection is required to be worn when certain action levels (Table 2) are reached. A

respirator cartridge change-out schedule has been developed in order to comply with 29 CFR 1910.134. The respirator cartridge change-out schedule for this project is as follows:

- Cartridges shall be removed and disposed of at the end of each shift, when cartridges become wet or wearer experiences breakthrough, whichever occurs first.
- If the humidity exceeds 85%, then cartridges shall be removed and disposed of after 4 hours of use.

Respirators shall not be stored at the end of the shift with contaminated cartridges left on. Cartridges shall not be worn on the second day, no matter how short the time period was the previous day they were used.

7.0 AIR QUALITY MONITORING AND ACTION LEVELS

7.1 Monitoring During Site Operations

Atmospheric air monitoring results will be collected and used to provide data to determine when exclusion zones need to be established and when certain levels of personal protective equipment are required. For all instruments there are site-specific action level criteria which are used in making field health and safety determinations. Other data, such as the visible presence of contamination or the steady state nature of air contaminant concentration, are also used in making field health and safety decisions. Therefore, the HSO may establish an exclusion zone or require a person to wear a respirator even though atmospheric air contaminant concentrations are below established CHASP action levels.

During site work involving disturbance of petroleum-impacted or fill material, real time air monitoring will be conducted for volatile organic compounds (VOCs). A photoionization detector (PID) and/or flame ionization detector (FID) will be used to monitor concentrations of VOCs at personnel breathing-zone height. A Jerome® J405 (or equivalent) will be used to monitor mercury vapor during the mercury-impacted soil hot spot removal. Air monitoring will be the responsibility of the HSO or designee. Air monitoring will be conducted during intrusive activities associated with the completion of excavation, debris removal, and soil grading. All manufacturers' instructions for instrumentation and calibration will be available onsite.

Subcontractors' air monitoring plans must be equal or more stringent as the Langan plan.

An air monitoring calibration log is provided in Attachment D of this CHASP.

7.1.1 Volatile Organic Compounds

Monitoring with a PID, such as a MiniRAE 2000 (10.6v) or equivalent will occur during intrusive work at the site. Colorimetric Indicator Tubes for benzene may be used as backup for the PID, if measurements remain above background monitor every 2 hours. A portable PID will be used to monitor the workers breathing zone and CAMP stations will continuously monitor the site perimeter. Instrument action levels for monitored gases are provided in Table 4.

7.1.2 PAHs and Metals

Based upon the previous site investigation, there soils contain PAHs and metals. During the ground-intrusive procedures which have the potential for creating airborne dust, a real-time airborne dust monitor such as a DustTrak will be used to continuously monitor for air particulates at the site perimeter. Instrument action levels for dust monitoring are provided in Table 4.

7.1.3 Mercury Vapor

Monitoring with a mercury vapor analyzer, such as a Jerome J405 or equivalent will occur during intrusive work at the site until the mercury-impacted soil hot spot is removed. The work zone will monitor by a handheld mercury vapor analyzer and CAMP stations will continuously monitor the site perimeter. Instrument action levels for monitored gases are provided in Table 4.

7.2 Monitoring Equipment Calibration and Maintenance

Instrument calibration and warmup shall be documented and included in a dedicated safety and health logbook or on separate calibration pages of the field book. All instruments shall be calibrated before and after each shift. Calibration checks may be used during the day to confirm instrument accuracy. Duplicate readings may be taken to confirm individual instrument response. Additionally, mercury vapor analyzers will be warmed up using the warmup function prior to use.

All instruments shall be operated in accordance with the manufacturers' specifications. Manufacturers' literature, including an operations manual for each piece of monitoring equipment will be maintained on site by the HSO for reference.

7.3 Determination of Background Levels

Background (BKD) levels for VOCs, mercury vapor, and dust will be established prior to intrusive activities during the background monitoring events. A notation of BKD levels will be referenced in the daily monitoring log. BKD levels are a function of prevailing conditions. BKD levels will be taken in an appropriate upwind location as determined by the HSO.

Table 4 lists the instrument action levels.

8.0 COMMUNITY AIR MONITORING PROGRAM

Community air monitoring will be conducted in compliance with local standards or the NYSDOH generic CAMP outlined below:

Continuous monitoring at the perimeter of the site will be performed during ground-intrusive and soil handling activities such as investigation and excavation. Perimeter CAMP stations will be set to an inlet height between 3 and 5 feet above ground surface; if work is occurring while schools adjoining the site are in session, the stations on the perimeter adjoining the schools will be set to an inlet height of 3 feet above ground surface.

To comply with the Special Requirements in DER-10 Appendix 1A, when intrusive work or exposed soil/fill is located within 20 feet of the perimeter fence line, an additional CAMP station will be placed on the sidewalk of the street opposite the site. Time periods of off-site relocation of the CAMP station will be recorded by Langan field personnel and reported in daily field reports. Work zone action levels will be lowered to the community air monitoring levels.

The CAMP will include perimeter CAMP stations, off-site CAMP stations (as needed), one weather station, and one handheld mercury vapor analyzer (Jerome® J505 or equivalent). Extra batteries for each CAMP station and extra mercury vapor analyzers (one Jerome® J405 and one Jerome® J505 or equivalent) will be kept on site for use in the event of an equipment malfunction or battery depletion. CAMP stations will monitor for VOCs with a PID; mercury vapor with a Jerome® J405, Jerome® J505, or equivalent; and dust emissions with equipment using real-time monitoring capable of measuring PM-10 (e.g., DustTrak). Background concentrations of mercury vapor and VOCs will be recorded in Daily Field Reports at each perimeter CAMP station using the handheld mercury vapor analyzer (Jerome® J505 or equivalent) and PID prior to implementation of ground-intrusive work.

Prior to turning off the equipment at the end of each work day, mercury vapor and VOC concentrations will be recorded to verify that ambient concentrations have either returned to background concentrations or show a decreasing trend over a period of 15 minutes at each perimeter CAMP station using the handheld mercury vapor analyzer (Jerome® J505) and PID. Additionally, during excavation, an overnight cover, consisting of polyethylene sheeting and/or a temporary foam cover (Atmos® AC-645 or equivalent), or other NYSDEC- and NYSDOH-approved cover, will be applied to areas of exposed soil/fill prior to turning off the equipment. The overnight cover will not be required in areas of exposed soil after NYSDEC approval based on review of endpoint sample results. The ambient concentrations of mercury vapor and VOCs and the time of shut-down for each CAMP station will be recorded by Langan field personnel and reported in

daily field reports.

The day-to-day location of CAMP stations will be fluid and dynamic based on wind direction and work zone location and will take into account the location of sensitive receptors and ground level air-intakes. The weather and perimeter air monitoring stations will utilize a wireless telemetry system to monitor real-time wind direction, temperature, and concentrations. In accordance with the CAMP, downwind CAMP monitoring data will be compared to upwind CAMP monitoring data, to provide a real-time comparison to ambient conditions.

A portable PID and portable mercury vapor analyzer (Jerome® J505 or equivalent) will be used to monitor the work zone and perimeter of the site for VOCs and instantaneous mercury vapor concentrations, respectively, during all ground-intrusive activities. The dedicated CAMP monitor will periodically screen the ambient air quality using the portable PID and portable mercury vapor analyzer at various heights between the ground surface and the breathing zone (3 to 5 feet above grade surface) and the results of ambient air monitoring for VOCs and mercury vapor will be recorded in Daily Field Reports. The site perimeter will be monitored for fugitive dust emissions by visual observations as well as instrumentation measurements. Particulate or dust will be monitored continuously with real-time field instrumentation that will meet, at a minimum, the performance standards from DER-10 Appendix 1B. Raw CAMP data will be provided with the Daily Field Reports and uploaded in the project website.

Out of an abundance of caution, the following measures will also be implemented during active excavation of soil/fill in the mercury-impacted hotspot and petroleum-impacted area:

- Installation of odor-neutralizing sleeves (Atmos® RusScent Sleeves or equivalent) about every 10 feet along the perimeter construction fence for odor mitigation.
- Proactive application of dust/vapor suppressing foam (Atmos® AC-645 or equivalent) and MERCON-X® (mercury hotspot area only), as needed, to exposed soil/fill and excavation areas.
- The remedial excavation will be phased, to the extent feasible, to minimize the potential for air impacts.

CAMP Action Levels

For VOC monitoring, the following actions will be taken based on VOC levels measured:

- If total VOC levels exceed 5 parts per million (ppm) above background for the 15-minute average at the site perimeter, work activities will be halted and monitoring continued. If levels readily decrease (per instantaneous readings) below 5 ppm above background at the site perimeter, work activities will resume with continued monitoring.

- If total VOC levels at the downwind perimeter of the site persist at levels in excess of 5 ppm above background but less than 25 ppm, work activities will be halted, the source of vapors identified, corrective actions taken to abate emissions, and monitoring continued. After these steps, work activities will resume provided that the total organic vapor level 200 feet downwind of the work zone or half the distance to the nearest potential receptor or residential/commercial structure, whichever is less – but in no case less than 20 feet, is below 5 ppm above background for the 15-minute average.
- If the downwind total VOC level persist above 25 ppm at the perimeter of the site, activities will be shut down.

All 15-minute readings will be recorded and be available for State (NYSDEC and NYSDOH) personnel to review. Instantaneous readings, if any, used for decision purposes will also be recorded.

For dust monitoring with field instrumentation, the following actions will be taken based on instrumentation measurements:

- If the downwind particulate level is 100 $\mu\text{g}/\text{m}^3$ greater than background (upwind perimeter) for the 15-minute period or if airborne dust is observed leaving the work zone or the site, then dust suppression must be employed. Work may continue with dust suppression techniques provided that downwind PM10 levels do not exceed 150 $\mu\text{g}/\text{m}^3$ above the background level and provided that no visible dust is migrating from the work zone or the site.
- If, after implementation of dust suppression techniques, downwind PM10 levels are greater than 150 $\mu\text{g}/\text{m}^3$ above the background level, work must be stopped and a re-evaluation of activities initiated. Work can resume provided that dust suppression measures and other controls are successful in reducing the downwind PM10 concentration to within 150 $\mu\text{g}/\text{m}^3$ of the upwind level and in preventing visible dust migration.

For mercury vapor monitoring with field instrumentation, the following actions will be taken based on instrumentation measurements:

- If the downwind mercury vapor level is greater than 1 $\mu\text{g}/\text{m}^3$ for the 15-minute period, then work activities will be halted and monitoring continued. The source of the vapors will be identified, and corrective actions will be taken to abate emissions, and monitoring continued. Corrective actions will include covering any exposed stockpiles with polyethylene sheeting, and MERCON-X[®] will be sprayed onto any exposed soil exhibiting elevated Jerome meter readings. If levels readily decrease (per instantaneous readings) below 1 $\mu\text{g}/\text{m}^3$ above background, work activities will resume with continued monitoring.

- If mercury vapor levels within the work zone persist at levels in excess of $10 \mu\text{g}/\text{m}^3$ above background, work activities will be halted, the source of vapors identified, corrective actions taken to abate emissions, and monitoring continued. After these steps, work activities will resume provided that the mercury vapor level at the site perimeter, is below $1 \mu\text{g}/\text{m}^3$ above background for the 15-minute average.

8.1 Dust Suppression Techniques

Preventative measures for dust generation may include wetting site fill and soil, construction of an engineered construction entrance with gravel pad, a truck wash area, covering soils with tarps, and limiting vehicle speeds to five miles per hour.

Work practices to minimize odors and vapors include limiting the time that the excavations remain open, minimizing stockpiling of contaminated-source soil, and minimizing the handling of contaminated material. Offending odor and organic vapor controls may include the application of foam suppressants or tarps over the odor or VOC source areas. Foam suppressants may include biodegradable foams applied over the source material for short-term control of the odor and VOCs.

If odors develop and cannot be otherwise controlled, additional means to eliminate odor nuisances will include: direct load-out of soils to trucks for off-site disposal; use of chemical odorants in spray or misting systems; and, use of staff to monitor odors in surrounding neighborhoods.

Where odor nuisances have developed during remedial work and cannot be corrected, or where the release of nuisance odors cannot otherwise be avoided due to on-site conditions or close proximity to sensitive receptors, odor control will be achieved by sheltering excavation and handling areas under tented containment structures equipped with appropriate air venting/filtering systems.

9.0 WORK ZONES AND DECONTAMINATION

9.1 Site Control

Work zones are intended to control the potential spread of contamination throughout the site and to assure that only authorized individuals are permitted into potentially hazardous areas.

Any person working in an area where the potential for exposure to site contaminants exists will only be allowed access after providing the HSO with proper training and medical documentation.

Exclusion Zone (EZ) - All activities which may involve exposure to site contaminants, hazardous materials and/or conditions should be considered an EZ. Decontamination of field equipment will also be conducted in the Contaminant Reduction Zone (CRZ) which will be located on the perimeter of the EZ. The EZ and the CRZ will be clearly delineated by cones, tapes or other means. The HSO may establish more than one EZ where different levels of protection may be employed or different hazards exist. The size of the EZ shall be determined by the HSO allowing adequate space for the activity to be completed, field members and emergency equipment.

9.2 Contamination Zone

9.2.1 Personnel Decontamination Station

Personal hygiene, coupled with diligent decontamination, will significantly reduce the potential for exposure.

9.2.2 Minimization of Contact with Contaminants

During completion of all site activities, personnel should attempt to minimize the chance of contact with contaminated materials. This involves a conscientious effort to keep "clean" during site activities. All personnel should minimize kneeling, splash generation, and other physical contact with contamination as PPE is intended to minimize accidental contact. This may ultimately minimize the degree of decontamination required and the generation of waste materials from site operations.

Field procedures will be developed to control over spray and runoff and to ensure that unprotected personnel working nearby are not affected.

9.2.3 Personnel Decontamination Sequence

Decontamination may be performed by removing all PPE used in EZ and placing it in drums/trash cans at the CRZ. Baby wipes should be available for wiping hands and face. Drums/trash cans will be labeled by the field crews in accordance with all local, state, and federal requirements. Management plans for contaminated PPE, and tools are provided below.

9.2.4 Emergency Decontamination

If circumstances dictate that contaminated clothing cannot be readily removed, then remove gross contamination and wrap injured personnel with clean garments/blankets to avoid contaminating other personnel or transporting equipment. If the injured person can be moved, he/she will be decontaminated by site personnel as described above before emergency

responders handle the victim. If the person cannot be moved because of the extent of the injury (a back or neck injury), provisions shall be made to ensure that emergency response personnel will be able to respond to the victim without being exposed to potentially hazardous atmospheric conditions. If the potential for inhalation hazards exist, such as with open excavation, this area will be covered with polyethylene sheeting to eliminate any potential inhalation hazards. All emergency personnel are to be immediately informed of the injured person's condition, potential contaminants, and provided with all pertinent data.

9.2.5 Hand-Held Equipment Decontamination

Hand-held equipment includes all monitoring instruments as stated earlier, samples, hand tools, and notebooks. The hand-held equipment is dropped at the first decontamination station to be decontaminated by one of the decontamination team members. These items must be decontaminated or discarded as waste prior to removal from the CRZ.

To aid in decontamination, monitoring instruments can be sealed in plastic bags or wrapped in polyethylene. This will also protect the instruments against contaminants. The instruments will be wiped clean using wipes or paper towels if contamination is visually evident. Sampling equipment, hand tools, etc. will be cleaned with non-phosphorous soap to remove any potentially contaminated soil, and rinsed with deionized water. All decontamination fluids will be containerized and stored on-site pending waste characterization sampling and appropriate off-site disposal.

9.2.6 Heavy Equipment Decontamination

All heavy equipment and vehicles arriving at the work site will be free from contamination from offsite sources. Any vehicles arriving to work that are suspected of being impacted will not be permitted on the work site. Potentially contaminated heavy equipment will not be permitted to leave the EZ unless it has been thoroughly decontaminated and visually inspected by the HSO or his designee.

9.3 Support Zone

The support zone or cold zone will include the remaining areas of the job site. Break areas and support facilities (including equipment storage and maintenance areas) will be located in this zone. No equipment or personnel will be permitted to enter the cold zone from the hot zone without passing through the decontamination station in the warm zone (if necessitated). Eating, smoking, and drinking will be allowed only in this area.

9.4 Communications

The following communications equipment will be utilized as appropriate.

- Telephones - A cellular telephone will be located with the HSO for communication with the HSM and emergency support services/facilities.
- Hand Signals - Hand signals shall be used by field teams, along with the buddy system. The entire field team shall know them before operations commence and their use covered during site-specific training. Typical hand signals are the following:

Hand Signal	Meaning
Hand gripping throat	Out of air; cannot breathe
Grip partners wrists or place both hands around waist	Leave immediately without debate
Hands on top of head	Need assistance
Thumbs up	OK; I'm alright; I understand
Thumbs down	No; negative
Simulated "stick" break with fists	Take a break; stop work

9.5 The Buddy System

When working in teams of two or more, workers will use the "buddy system" for all work activities to ensure that rapid assistance can be provided in the event of an emergency. This requires work groups to be organized such that workers can remain close together and maintain visual contact with one another. Workers using the "buddy system" have the following responsibilities:

- Provide his/her partner with assistance.
- Observe his/her partner for signs of chemical or heat exposure.
- Periodically check the integrity of his/her partner's PPE.
- Notify the HSO or other site personnel if emergency service is needed.

10.0 NEAREST MEDICAL ASSISTANCE

The address and telephone number of the nearest hospital are as follows:

New York Presbyterian Hospital
83 Gold Street/170 William Street
New York, New York
212-312-5000

A map with directions to the hospital are shown in Figure 2. This information will either be posted prominently at the site or will be available to all personnel at all times. Further, all field personnel,

including the HSO & FTL, will know the directions to the hospital.

11.0 STANDING ORDERS/SAFE WORK PRACTICES

The standing orders, which consist of a description of safe work practices that must always be followed while on-site by Langan employees and contractors, are shown in Attachment A. The site HSO and FTL each have the responsibility for enforcing these practices. The standing orders will be posted prominently at the site, or are made available to all personnel at all times. Those who do not abide by these safe work practices will be removed from the site.

12.0 SITE SECURITY

No unauthorized personnel shall be permitted access to the work areas.

13.0 UNDERGROUND UTILITIES

As provided in Langan's Underground Utility Clearance Guidelines, the following safe work practices should be followed by Langan personnel and the contractor before and during subsurface work in accordance with federal, state and local regulations:

- Obtain available utility drawings from the property owner/client or operator.
- Provide utility drawings to the project team.
- In the field, mark the proposed area of subsurface disturbance (when possible).
- Ensure that the utility clearance system has been notified.
- Ensure that utilities are marked before beginning subsurface work.
- Discuss subsurface work locations with the owner/client and contractors.
- Obtain approval from the owner/client and operators for proposed subsurface work locations.
- Use safe digging procedures when applicable.
- Stay at least 10 feet from all equipment performing subsurface work.

14.0 SITE SAFETY INSPECTION

The Langan HSO or alternate will check the work area daily, at the beginning and end of each work shift or more frequently to ensure safe work conditions. The HSO or alternate must complete the Jobsite Safety Inspection Checklist, found in Attachment F. Any deficiencies shall be shared with the FTL, HSM and PM and will be discussed at the daily tailgate meeting.

15.0 HAND AND POWER TOOLS

All hand- and electric-power tools and similar equipment shall be maintained in a safe operating condition. All electric-power tools must be inspected before initial use. Damaged tools shall be removed immediately from service or repaired. Tools shall be used only for the purpose for which they were designed. All users must be properly trained in their safe operation.

16.0 EMERGENCY RESPONSE

16.1 General

This section establishes procedures and provides information for use during a project emergency. Emergencies happen unexpectedly and quickly, and require an immediate response; therefore, contingency planning and advanced training of staff is essential. Specific elements of emergency support procedures that are addressed in the following subsections include communications, local emergency support units, and preparation for medical emergencies, first aid for injuries incurred on site, record keeping, and emergency site evacuation procedures. In case of emergency, in addition to 911, call *Incident Intervention®* at 1-888-479-7787 to report their injuries. For all other communications, contact the Langan Incident Hotline at **(800) 9-LANGAN** (800-952-6426) extension 4699 as soon as possible.

Should outside assistance be needed for accidents, fire, or release of hazardous substances, the emergency numbers will be available and posted at the site (Table 5) where a readily accessible telephone is made available for emergency use.

16.2 Responsibilities

16.2.1 Health and Safety Officer (HSO)

The HSO is responsible for ensuring that all personnel are evacuated safely and that machinery and processes are shut down or stabilized in the event of a stop work order or evacuation. The HSO is responsible for ensuring the HSM are notified of all incidents, all injuries, near misses, fires, spills, releases or equipment damage. The HSO is required to immediately notify the HSM of any fatalities or catastrophes (three or more workers injured and hospitalized) so that the HSM can notify OSHA within the required time frame.

16.2.2 Emergency Coordinator

The HSO or their designated alternate will serve as the Emergency Coordinator. The Emergency Coordinator is responsible for ensuring that all personnel are evacuated safely and that machinery and processes are shut down or stabilized in the event of a stop work order or evacuation. They are also responsible for ensuring the HSM are notified of all incidents, all injuries, near misses, fires, spills, releases or equipment damage. The Emergency Coordinator is required to

immediately notify the HSM of any fatalities or catastrophes (three or more workers injured and hospitalized).

The Emergency Coordinator shall locate emergency phone numbers and identify hospital routes prior to beginning work on the sites. The Emergency Coordinator shall make necessary arrangements to be prepared for any emergencies that could occur.

The Emergency Coordinator is responsible for implementing the Emergency Response Plan.

16.2.3 Site Personnel

Project site personnel are responsible for knowing the Emergency Response Plan and the procedures contained herein. Personnel are expected to notify the Emergency Coordinator of situations that could constitute a site emergency. Project site personnel, including all subcontractors will be trained in the Emergency Response Plan.

16.3 Communications

Once an emergency situation has been stabilized, or as soon as practically, the injured Langan personnel should contact *Incident Intervention@* at 1-888-479-7787 to report their injuries. For all other communications, contact the Langan Incident Hotline at **(800) 9-LANGAN** (800-952-6426) extension 4699 as soon as possible.

16.4 Local Emergency Support Units

In order to be able to deal with any emergency that might occur during investigative activities at the site, the Emergency Notification Numbers (Table 5) will be posted and provided to all personnel conducting work within the EZ.

Figure 2 shows the hospital route map. Outside emergency number 911 and local ambulance should be relied on for response to medical emergencies and transport to emergency rooms. Always contact first responders when there are serious or life threatening emergencies on the site. Project personnel are instructed not to drive injured personnel to the Hospital. In the event of an injury, provide first aid and keep the injured party calm and protected from the elements and treat for shock when necessary.

16.5 Pre-Emergency Planning

Langan will communicate directly with administrative personnel from the emergency room at the hospital in order to determine whether the hospital has the facilities and personnel needed to

treat cases of trauma resulting from any of the contaminants expected to be found on the site. Instructions for finding the hospital will be posted conspicuously in the site office and in each site vehicle.

16.6 Emergency Medical Treatment

The procedures and rules in this CHASP are designed to prevent employee injury. However, should an injury occur, no matter how slight, immediately report it will be reported to the HSO. First-aid equipment will be available on site at the following locations:

- First Aid Kit: Contractor Vehicles
- Emergency Eye Wash: Contractor Vehicles

During the site safety briefing, project personnel will be informed of the location of the first aid station(s) that has been set up. Some injuries, such as severe cuts and lacerations or burns, may require immediate treatment. Any first aid instructions that can be obtained from doctors or paramedics, before an emergency-response squad arrives at the site or before the injured person can be transported to the hospital, will be followed closely. Personnel with current first aid and CPR certification will be identified.

Only in non-emergency situations may an injured person be transported to an urgent care facility. Due to hazards that may be present at the site and the conditions under which operations are conducted, it is possible that an emergency situation may develop. Emergency situations can be characterized as injury or acute chemical exposure to personnel, fire or explosion, environmental release, or hazardous weather conditions.

16.7 Emergency Site Evacuation Routes and Procedures

All project personnel will be instructed on proper emergency response procedures and locations of emergency telephone numbers during the initial site safety meeting. If an emergency occurs as a result of the site investigation activities, including but not limited to fire, explosion or significant release of toxic gas into the atmosphere, the Langan Project Manager will be verbally notified immediately. All heavy equipment will be shut down and all personnel will evacuate the work areas and assemble at the nearest intersection to be accounted for and to receive further instructions.

In the event that an emergency situation arises, the FTL will implement an immediate evacuation of all project personnel due to immediate or impending danger. The FTL will also immediately communicate with the contractor to coordinate any needed evacuation of the property.

The FTL or Site Supervisor will give necessary instructions until the Designated Incident

Commander (IC) assumes control. After the emergency has been resolved, the FTL or Site Supervisor will coordinate with the IC and indicate when staff should resume their normal duties. If dangers are present for those at the designated assembly point, another designated location of assembly will be established.

It will be the responsibility of the FTL or Site Supervisor to report a fire or emergency, assess the seriousness of the situation, and initiate emergency measures until the arrival of the local fire fighters or other first responders, should they be necessary. The FTL, working with emergency responders, may also order the closure of the Site for an indefinite period as long as it is deemed necessary.

Under no circumstances will incoming visitors be allowed to proceed to the area of concern, once an emergency evacuation has been implemented. Visitors or other persons present in the area of the emergency shall be instructed to evacuate the area. The FTL will ensure that access roads are not obstructed and will remain on-site to provide stand-by assistance upon arrival of emergency personnel.

If it is necessary to temporarily control traffic in the event of an emergency, those persons controlling traffic will wear proper reflection warning vests until the arrival of police or fire personnel.

16.7.1 Designated Assembly Locations

All personnel will evacuate the site and assemble at a designated assembly location. The assembly location will be designated by Langan personnel and discussed during each shift's pre-job safety briefing.

16.7.2 Accounting for Personnel

All contractor and subcontractor supervisors are responsible for the accounting of all personnel assembled at the designed assembly area. The Designated Incident Commander shall be notified if personnel are not found.

16.8 Fire Prevention and Protection

In the event of a fire or explosion, procedures will include immediately evacuating the site and notification of the Langan Project Manager of the investigation activities. Portable fire extinguishers will be provided at the work zone. The extinguishers located in the various locations should also be identified prior to the start of work. No personnel will fight a fire beyond the stage where it can be put out with a portable extinguisher (incipient stage).

16.8.1 Fire Prevention

Fires will be prevented by adhering to the following precautions:

- Good housekeeping and storage of materials.
- Storage of flammable liquids and gases away from oxidizers.
- Shutting off engines to refuel.
- Grounding and bonding metal containers during transfer of flammable liquids.
- Use of UL approved flammable storage cans.
- Fire extinguishers rated at least 10 pounds ABC located on all heavy equipment, in all trailers and near all hot work activities.

The person responsible for the control of fuel source hazards and the maintenance of fire prevention and/or control equipment is the HSO.

16.9 Significant Vapor Release

Based on the proposed tasks, the potential for a significant vapor release is low. However, if a release occurs, the following steps will be taken:

- Move all personnel to an upwind location. All non-essential personnel shall evacuate.
- Downwind perimeter locations shall be monitored for volatile organics and mercury vapor.
- If the release poses a potential threat to human health or the environment in the community, the Emergency Coordinator shall notify the Langan Project Manager.
- Local emergency response coordinators (ie. 911) will be notified
- NYSDEC, NYSDOH, and the 250 Water Street BCP Contact List will be notified.

16.10 Overt Chemical Exposure

The following are standard procedures to treat chemical exposures. Other, specific procedures detailed on the Material Safety Data Sheet (MSDS) will be followed, when necessary.

SKIN AND EYE: Use copious amounts of soap and water from eye-wash kits and portable hand wash stations.

CONTACT: Wash/rinse affected areas thoroughly, then provide appropriate medical attention. Skin shall also be rinsed for 15 minutes if contact with caustics, acids or hydrogen peroxide occurs. Affected items of clothing shall also be removed from contact with skin.

Providing wash water and soap will be the responsibility of each individual contractor or subcontractor on-site.

16.11 Decontamination during Medical Emergencies

If emergency life-saving first aid and/or medical treatment is required, normal decontamination procedures may need to be abbreviated or omitted. The HSO or designee will accompany contaminated victims to the medical facility to advise on matters involving decontamination when necessary. The outer garments can be removed if they do not cause delays, interfere with treatment or aggravate the problem. Respiratory equipment must always be removed. Protective clothing can be cut away. If the outer contaminated garments cannot be safely removed on site, a plastic barrier placed between the injured individual and clean surfaces should be used to help prevent contamination of the inside of ambulances and/or medical personnel. Outer garments may then be removed at the medical facility. No attempt will be made to wash or rinse the victim if his/her injuries are life threatening, unless it is known that the individual has been contaminated with an extremely toxic or corrosive material which could also cause severe injury or loss of life to emergency response personnel. For minor medical problems or injuries, the normal decontamination procedures will be followed.

16.12 Adverse Weather Conditions

In the event of adverse weather conditions, the HSO will determine if work will continue without potentially risking the safety of all field workers. Some of the items to be considered prior to determining if work should continue are:

- Potential for heat stress and heat-related injuries.
- Potential for cold stress and cold-related injuries.
- Treacherous weather-related working conditions (hail, rain, snow, ice, high winds).
- Limited visibility (fog).
- Potential for electrical storms.
- Earthquakes.
- Other major incidents.

Site activities will be limited to daylight hours, or when suitable artificial light is provided, and acceptable weather conditions prevail. The HSO will determine the need to cease field operations or observe daily weather reports and evacuate, if necessary, in case of severe inclement weather conditions.

16.13 Spill Control and Response

All small spills/environmental releases shall be contained as close to the source as possible. Whenever possible, the MSDS will be consulted to assist in determining proper waste characterization and the best means of containment and cleanup. For small spills, sorbent materials such as sand, sawdust or commercial sorbents should be placed directly on the

substance to contain the spill and aid recovery. Any acid spills should be diluted or neutralized carefully prior to attempting recovery. Berms of earthen or sorbent materials can be used to contain the leading edge of the spills. All spill containment materials will be properly disposed. An exclusion zone of 50 to 100 feet around the spill area should be established depending on the size of the spill.

All contractor vehicles shall have spill kits on them with enough material to contain and absorb the worst-case spill from that vehicle. All vehicles and equipment shall be inspected prior to be admitted on site. Any vehicle or piece of equipment that develops a leak will be taken out of service and removed from the job site.

The following seven steps shall be taken by the Emergency Coordinator:

1. Determine the nature, identity and amounts of major spills.
2. Make sure all unnecessary persons are removed from the spill area.
3. Notify the HSO immediately.
4. Use proper PPE in consultation with the HSO.
5. If a flammable liquid, gas or vapor is involved, remove all ignition sources and use non-sparking and/or explosion-proof equipment to contain or clean up the spill (diesel-only vehicles, air-operated pumps, etc.)
6. If possible, try to stop the leak with appropriate material.
7. Remove all surrounding materials that can react or compound with the spill.

In addition to the spill control and response procedures described in this HASP, Langan personnel will coordinate with the designated project manager relative to spill response and control actions. Notification to the Project Manager must be immediate and, to the extent possible, include the following information:

- Time and location of the spill.
- Type and nature of the material spilled.
- Amount spilled.
- Whether the spill has affected or has a potential to affect a waterway or sewer.
- A brief description of affected areas/equipment.
- Whether the spill has been contained.
- Expected time of cleanup completion. If spill cleanup cannot be handled by Langan's on-site personnel alone, such fact must be conveyed to the Project Manager immediately.

Langan shall not make any notification of spills to outside agencies. The client will notify regulatory agencies as per their reporting procedures.

16.14 Emergency Equipment

The following minimum emergency equipment shall be kept and maintained on site:

- Industrial first aid kit.
- Fire extinguishers (one per site).

16.15 Restoration and Salvage

After an emergency, prompt restoration of utilities, fire protection equipment, medical supplies and other equipment will reduce the possibility of further losses. Some of the items that may need to be addressed are:

- Refilling fire extinguishers.
- Refilling medical supplies.
- Recharging eyewashes and/or showers.
- Replenishing spill control supplies.

16.16 Documentation

Immediately following an incident or near miss, unless emergency medical treatment is required, either the employee or a coworker must contact the Langan Incident/Injury Hotline at 1-(800)-9-LANGAN (ext. #4699) and the client representative to report the incident or near miss. For emergencies involving personnel injury and/or exposure, the HSO and affected employee will complete and submit an Employee Exposure/Injury Incident Report (Attachment C) to the Langan Corporate Health and Safety Manager as soon as possible following the incident.

17.0 SPECIAL CONDITIONS

This guideline contains information and requirements for special conditions that may not be routinely encountered.

17.1 Scope

The guideline applies to the specific projects identified within this document. Additional provisions will be addressed in each Site-Specific HASP, as needed.

17.2 Responsibilities

Site Personnel - All site personnel must be alert to safety hazards on work sites and take action to minimize such hazards. Personnel must utilize the buddy system, watch for inappropriate behavior, and be alert to changes in site conditions.

Health and Safety Officer (HSO) - The HSO is responsible for considering these procedures in the development of site specific HASPs. The HSO shall schedule frequent "tail gate" safety briefings to enhance safety awareness and discuss potential problems.

17.3 Procedures

The procedures outlined below shall be followed when such conditions are encountered.

17.3.1 Ladders

Langan safety procedures shall be used to ensure employee safety when using ladders in the office or work sites. All ladders shall be coated or repaired to prevent injury to the employee from punctures or lacerations and to prevent snagging or clothing. Any wood ladders used must have an opaque covering except for identification or warning labels, which may be placed on one face only of a side rail.

17.3.1.1 Ladder Use

Employees shall only use ladders for the purposes, which they were designed and shall not be used as scaffolding. Ladders will be maintained and inspected prior to use for slip hazards including oil and grease. Employees shall use ladders only on stable and level surfaces unless the ladder is secured to prevent possible displacement. Ladders should not be used on slippery surfaces unless secured or provided with slip resistant feet to prevent accidental displacement. Ladders should not be used in locations where they could be displaced by workplace activities or traffic. Ladder rungs, cleats and steps shall be parallel, level and uniformly spaced when the ladder is in the use position.

Employees should not be carrying anything including equipment that could cause injury if there was a fall while utilizing the ladder. The top and bottom of the ladder area must remain clear while in use. When ascending and descending the ladder, employees must face the ladder.

Ladders shall not be loaded beyond the maximum intended load for which they were built or the manufacturer's rated capacity.

17.3.1.2 Portable Ladders

Rungs, cleats and steps for portable ladders and fixed ladders shall be spaced not less than 10 inches apart, nor more than 14 inches apart, as measured between center lines of the rungs, cleats and steps. When used to access an upper landing surface, the ladder side rails must extend at least three feet above the upper landing surface to which the ladder is used to gain

access. If this is not possible, due to the ladders length, then the top of the ladder shall be secured at its top to a rigid support.

17.3.1.3 Step Stools

Rungs, cleats and steps of step stools shall not be less than 8 inches apart, nor more than 12 inches apart, as measured between center lines of the rungs, cleats and steps.

17.3.1.4 Extension Ladders

Rungs, cleats and steps of the base section of extension trestle ladders shall be spaced not less than 8 inches apart, nor more than 18 inches apart, as measured between center lines of the rungs, cleats and steps. The rung spacing on the extension section of the extension trestle ladder shall not be less than 6 inches nor more than 12 inches, as measured between center lines of the rungs, cleats and steps. Ladders shall be used at an angle such that the horizontal distance from the top support to the foot of the ladder is approximately one-quarter of the working length of the ladder (the distance along the ladder between the foot and the top support).

17.3.1.5 Inspection

Ladders will be inspected for visible defects periodically, prior to utilization or after any occurrence that could have negatively affected the ladder. Portable ladders with defects including broken or missing rungs, cleats, or steps, broken or split rails, corroded components or other faulty or defective components shall not be used. The ladder will be immediately marked as defective, tagged as "Do Not Use" or blocked from being used and removed from service until repaired.

17.3.2 First Aid/Cardiopulmonary Resuscitation (CPR)

Langan field and office personnel will be encouraged to be trained in First Aid and Cardiopulmonary Resuscitation (CPR). Training will be provided free of charge by Langan to all employees. Employees will receive a training certificate that will be kept on file with the Health & Safety Coordinator (HSC). Training and certification will be provided by a credited provider such as American Red Cross or equivalent.

17.3.2.1 Emergency Procedures

Prior to work at sites the Langan employees certified in first aid and CPR will be identified in the site specific CHASP. Langan will endeavor to have at least one employee at a job site trained and able to render first aid and CPR. The site specific CHASP will contain first aid information on both potential chemical and physical hazards. Emergency procedures to be followed are in case of

injury or illnesses are provided in the CHASP. The CHASP will include emergency contact information including local police and fire departments, hospital emergency rooms, ambulance services, on-site medical personnel and physicians. The CHASP will also include directions and contact information to the nearest emergency facility in case immediate medical attention is required. The emergency contact information will be conspicuously posted at the worksite. Employees that are injured and require immediate medical attention shall call either 911 or the local posted emergency contacts. Employees should use ambulatory services to transport injured workers to the nearest facility for emergency medical care. In areas where 911 is not available, the telephone numbers of the physicians, hospitals, or ambulances shall be conspicuously posted.

17.3.2.2 First Aid Supplies

First aid supplies are readily available to all Langan employees when required. First aid kits are located in each Langan office. Portable first aid kits are available for employees to use at work sites. First aid kits should consist of items needed to treat employees for potential chemical and physical injuries. At a minimum, first aid kits should contain items to allow basic first aid to be rendered. Where the eyes or body of an employee may be exposed to corrosive materials, suitable facilities for quick drenching or flushing of the eyes and body shall be provided within the work area for immediate emergency use including eye wash.

First aid kits will be weatherproof with individual sealed packages of each item. All portable first aid kits shall be inspected by Langan employees before and after use to ensure all used items are replaced. When out in the field, employees shall check first aid kits weekly to ensure used items are replaced.

17.3.3 Hydrogen Sulfide

Langan employees with the potential to be exposed to hydrogen sulfide while at work sites shall have training in hydrogen sulfide awareness. The training will include identification of areas where employees could be exposed to hydrogen sulfide, health effects, permissible exposure limits, first-aid procedures and personnel protective equipment. Langan employees could be exposed to hydrogen sulfide while at job sites including petroleum refineries, hazardous waste treatment, storage and disposal facilities, uncontrolled hazardous waste sites and remediation projects.

17.3.3.1 Characteristics

Hydrogen sulfide is a colorless gas with a strong odor of rotten eggs that is soluble in water. Hydrogen sulfide is used to test and make other chemicals. It is also found as a by-product of

chemical reactions, such as in sewer treatment. It is a highly flammable gas and a dangerous fire hazard. Poisonous gases are produced in fires including sulfur oxides. Hydrogen sulfide is not listed as a carcinogen.

17.3.3.2 Health Effects

Hydrogen Sulfide can affect employees if inhaled or through contact with skin or eyes. Acute (or short term) health effects of hydrogen sulfide exposure include irritation of the nose and throat, dizziness, confusion, headache and trouble sleeping. Inhalation of hydrogen sulfide can irritate the lungs causing coughing and/or shortness of breath. Higher levels of exposure can cause build-up of fluid in the lungs (pulmonary edema), a medical emergency, with severe shortness of breath.

Chronic (or long term) health effects of low levels of exposure to hydrogen sulfide can cause pain and redness of the eyes with blurred vision. Repeated exposure may cause bronchitis with cough, phlegm and shortness of breath.

17.3.3.3 Protective Clothing and Equipment

Respirators are required for those operations in which employees will be exposed to hydrogen sulfide above OSHA permissible exposure level. The maximum OSHA permissible exposure limit (PEL) for hydrogen sulfide is 20 parts of hydrogen sulfide vapor per million parts of air (20 ppm) for an 8-hour workday and the maximum short-term exposure limit (STEL) is 10 ppm for any 10-minute period.

Where employees are exposed to levels up to 100 parts of hydrogen sulfide vapor per million parts of air (100 ppm), the following types of respiratory protection are allowed:

- Any powered, air purifying respirator with cartridge(s);
- Any air purifying, full-facepiece respirator (gas mask) with a chin style, front- or back-mounted canister;
- Any supplied air system with escape self-contained breathing apparatus, if applicable; and,
- Any self-contained breathing apparatus with a full facepiece.

Respirators used by employees must have joint Mine Safety and Health Administration and the National Institute for Occupational Safety and Health (NIOSH) seal of approval. Cartridges or canisters must be replaced before the end of their service life, or the end of the shift, whichever occurs first. Langan employees that have the potential to be exposed to hydrogen sulfide will be trained in the proper use of respirators. Respirator training is discussed under Langan's

Respiratory Protection Program.

Employees with potential exposure to hydrogen sulfide, or when required by the client, will wear a portable hydrogen sulfide gas detector. The detector should have an audible, visual and vibrating alarm. The detector may also provide detection for carbon monoxide, sulfur dioxide and oxygen deficient atmospheres. The hydrogen sulfide monitor will, at a minimum, be calibrated to detect hydrogen sulfide at a level of 20 parts of hydrogen sulfide vapor per million parts of air (20 ppm). Many portable gas detectors will have factory defaults with a low level alarm at 10 ppm and a high level alarm at 15 ppm. Langan employees shall consult clients to determine if any site specific threshold levels exist.

If the hydrogen sulfide gas detector sounds and employees are not wearing appropriate respiratory protection, employees must immediately vacate the area and meet at the assigned emergency location. Langan employees may not re- enter the site without proper respiratory protection and approval from the client or property owner, if needed.

Employees shall wear PPE to prevent eye and skin contact with hydrogen sulfide. Employees must wear appropriate protective clothing including boots, gloves, sleeves and aprons, over any parts of their body that could be exposed to hydrogen sulfide. Non-vented, impact resistant goggles should be worn when working with or exposed to hydrogen sulfide.

17.3.3.4 *Emergency and First Aid Procedures*

Eye and Face Exposure

If hydrogen sulfide comes in contact with eyes, it should be washed out immediately with large amounts of water for 30 minutes, occasionally lifting the lower and upper eye lids. Seek medical attention immediately.

Skin Exposure

If hydrogen sulfide contaminates clothing or skin, remove the contaminated clothing immediately and wash the exposed skin with large amounts of water and soap. Seek medical attention immediately. Contaminated clothing should either be disposed of or washed before wearing again.

Breathing

If a Langan employee or other personnel breathe in hydrogen sulfide, immediately get the exposed person to fresh air. If breathing has stopped, artificial respiration should be started. Call

for medical assistance or a doctor as soon as possible.

Safety Precautions

Hydrogen sulfide is a highly flammable gas and a dangerous fire hazard. Containers of hydrogen sulfide may explode in a fire situation. Poisonous gases are produced during fires.

Langan employees should contact property owners and operators prior to conducting work onsite to be aware of any site specific contingency plans, identify where hydrogen sulfide is used at the facility and be informed about additional safety rules or procedures.

17.3.4 Fire Protection/Extinguishers

Langan field personnel that have been provided with portable fire extinguishers for use at worksites will be trained to familiarize employees with general principles of fire extinguisher use and hazards associated with the incipient stage of firefighting. Training will be provided prior to initial assignment for field work and annually thereafter.

Portable fire extinguishers shall be visually inspected monthly and subjected to an annual maintenance check. Langan shall retain records of the annual maintenance date.

17.3.5 Overhead lines

When field work is performed near overhead lines, the lines shall be deenergized and grounded, or other protective measures shall be provided before the work shall commence. If overhead lines are to be deenergized, arrangements shall be made with the client, property owner or organization that operates or controls the electric circuits involved to deenergize and ground them. If protective measures, such as guarding, isolating, or insulating, are provided, these precautions shall prevent employees from contacting such lines directly with any part of their body or indirectly through conductive materials, tools, or equipment.

When unqualified Langan personnel are working in an elevated position near overhead lines, the location shall be such that the person and the longest conductive object they may contact cannot come closer to any unguarded, energized overhead line than the following distances:

1. For voltages to ground 50kV or below - 10 feet; and
2. For voltages to ground over 50kV - 10 feet, plus 4 inches for every 10kV over 50kV.

As previously indicated, Langan does not retain qualified employees to perform work on energized equipment.

17.3.5.1 *Vehicle and Equipment Clearance*

Any vehicle or mechanical equipment capable of having parts of its structure elevated near energized overhead lines shall be operated so that a clearance of 10 feet is maintained. If the voltage of the overhead lines is higher than 50kV, the clearance shall be increased 4 inches for every 10kV over that voltage.

If any of the following discussed conditions occur, the clearance may be reduced.

- If the vehicle is in transit with its structure lowered, the clearance may be reduced to 4 ft. If the voltage is higher than 50kV, the clearance shall be increased 4 in. for every 10 kV over that voltage.
- If insulating barriers are installed to prevent contact with the lines, and if the barriers are rated for the voltage of the line being guarded and are not a part of or an attachment to the vehicle or its raised structure, the clearance may be reduced to a distance within the designed working dimensions of the insulating barrier.

Employees standing on the ground may not contact the vehicle or mechanical equipment or any of its attachments, unless the employee is using protective equipment rated for the voltage; or the equipment is located so that no uninsulated part of its structure (that portion of the structure that provides a conductive path to employees on the ground) can come closer to the overhead line than permitted.

If any vehicle or mechanical equipment capable of having parts of its structure elevated near energized overhead lines is intentionally grounded, employees working on the ground near the point of grounding may not stand at the grounding location whenever there is a possibility of overhead line contact. Additional precautions, such as the use of barricades or insulation, shall be taken to protect employees from hazardous ground potentials, depending on earth resistivity and fault currents, which can develop within the first few feet or more outward from the grounding point.

17.3.6 Trade Secret

Langan employees could potentially be provided trade secret information by the client or property owner when site specific information is provided about highly hazardous chemicals. Trade secret means any confidential formula, pattern, process, device, information or compilation of information that is used in an employer's business, and that gives the employer an opportunity to obtain an advantage over competitors who do not know or use it. Langan employees understand that this information should be kept confident and if required, may enter into a confidentially agreement with the client.

17.3.7 Bloodborne Pathogens

Langan employees that can reasonably anticipate exposure to blood or other potentially infectious material while at work sites shall have training in bloodborne pathogens. Applicable employees would include those trained in first aid and serving a designated role as an emergency medical care provider. Bloodborne pathogens are pathogenic microorganisms that are present in human blood and can cause disease in humans. These pathogens include, but are not limited to, hepatitis B virus and human immunodeficiency virus.

17.3.7.1 Training

Langan employees with potential occupational exposure to blood or other potentially infectious material must participate in a training program. Training must be conducted prior to initial assignment where there would be potential for exposure and annually thereafter within one year of previous training. The training program will be provided to Langan employees at no cost to them and during working hours.

Langan will ensure the training program shall consist of the following:

- An accessible copy of the regulatory text of 29 CFR 1910.1030 and an explanation of its contents;
- A general explanation of the epidemiology and symptoms of bloodborne diseases;
- An explanation of the modes of transmission of bloodborne pathogens;
- An explanation of Langan's exposure control plan and the means by which the employee can obtain a copy of the written plan;
- An explanation of the appropriate methods for recognizing tasks and other activities that may involve exposure to blood and other potentially infectious materials;
- An explanation of the use and limitations of personal protective equipment (PPE) to prevent and reduce exposure;
- Information on the types, proper use, location, removal, handling and disposal of PPE;
- An explanation of the basis for selection of PPE;
- Information on the hepatitis B vaccine, including information on its efficacy, safety, method of administration, the benefits of being vaccinated, and that the vaccine and vaccination will be offered free of charge;
- Information on the appropriate actions to take and persons to contact in an emergency involving blood or other potentially infectious materials;
- An explanation of the procedure to follow if an exposure incident occurs, including the method of reporting the incident and the medical follow-up that will be made available;
- Information on the post-exposure evaluation and follow-up that the employer is required to provide for the employee following an exposure incident;

- An explanation of the signs and labels and/or color coding required by paragraph 29 CFR 1910.1030(g)(1); and,
- An opportunity for interactive questions and answers with the person conducting the training session.

Langan will develop and implement a written Exposure Control Plan, which will be designed to eliminate or minimize employee exposure to bloodborne pathogens. The Exposure Control Plan will contain the following elements:

- An exposure determination for employees;
- The schedule and method of implementation for Methods of Compliance (29 CFR 191.1030(d)), Hepatitis B Vaccination and Post-Exposure Evaluation and Follow-up (29 CFR 1910.1030(f)), Communication of Hazards to Employees (29 CFR 1910.1030(g)) and (h) Recordkeeping (29 CFR 1910.1030(h));
- The procedure for the evaluation of circumstances surrounding exposure incidents;
- Ensure a copy of the Exposure Control Plan will be accessible to employees; and,
- The Exposure Control Plan shall be reviewed and updated at least annually.

Langan employees with occupational exposure to bloodborne pathogens include any employees trained in first aid that would be expected to provide emergency medical care. This determination is made without regards to the use of PPE, which could eliminate or minimize exposure.

Universal precautions shall be observed to prevent contact with blood or other potentially infectious materials. According to the concept of Universal Precautions, all human blood and certain human body fluids are treated as if known to be infectious for bloodborne pathogens. Under circumstances in which differentiation between body fluid types is difficult or impossible, all body fluids shall be considered potentially infectious materials.

Work practice controls shall be used to eliminate or minimize employee exposure, if applicable. Since Langan employees will have occupational exposure only during rendering of first aid, personnel protective equipment will be utilized to reduce or minimize exposure. PPE that could be available to Langan personnel when administering first aid includes safety glasses, gloves, and Tyvek suits or sleeves. PPE and first aid kits will be provided to employees at no cost to them.

Langan employees that render first aid in office areas will have access to hand washing facilities or restrooms. For first aid rendered at field locations, first aid kits will contain an appropriate antiseptic hand cleanser and clean cloth/paper towels or antiseptic towelettes. After using antiseptic hand cleansers or towelettes, employees shall wash their hands with soap and running water as soon as feasible.

After administering first aid, potentially infectious materials, including towels, personnel protective equipment, clothes and bandages, shall be placed in a container, which prevents leakage during collection, handling, processing, storage, transport, or shipping. All PPE will be disposed of after use. Any equipment or working surfaces which was exposed to blood or potentially infectious materials due to an injury, will be decontaminated prior to reuse.

Langan will make available the hepatitis B vaccine and vaccination series to all employees who have occupational exposure, and post-exposure evaluation and follow-up to all employees who have had an exposure incident. These services will be available to the employee at no cost to them through a medical provider.

17.3.7.2 Recordkeeping

Langan will maintain training and medical records for each employee with occupational exposure to blood or potentially infectious materials. Medical and training records will be maintained by Langan's H&S Department.

Training records will include the following:

- Dates of the training sessions;
- Contents or a summary of the training sessions;
- Names and qualifications of persons conducting the training; and
- Names and job titles of all persons attending the training sessions.

Training records shall be maintained for 3 years from the date on which the training occurred. Medical records will be preserved and maintained for the duration of employment plus 30 years.

All records will be made available upon request to employees, the Assistant Secretary of Labor for Occupational Safety and Health, and Director of National Institute for Occupational Safety and Health Director of OSHA for examination and copying. Medical records must have written consent from employee before releasing.

If Langan ceases to do business, all records shall be transferred to the successor employer. The successor employer shall receive and maintain these records.

If there will not be a successor, Langan will notify current employees of their rights to access records at least three months prior to the cessation of business.

18.0 RECORDKEEPING

The following is a summary of required health and safety logs, reports and recordkeeping.

18.1 Field Change Authorization Request

Any changes to the work to be performed that is not included in the CHASP will require an addendum that is approved by the Langan project manager and Langan HSM to be prepared. Approved changes will be reviewed with all field personnel at a safety briefing.

18.2 Medical and Training Records

Copies or verification of training (40-hour, 8-hour, supervisor, site-specific training, documentation of three-day OJT, and respirator fit-test records) and medical clearance for site work and respirator use will be maintained in the office and available upon request. Records for all subcontractor employees must also be available upon request. All employee medical records will be maintained by the HSM.

18.3 Onsite Log

A log of personnel on site each day will be kept by the HSO or designee.

18.4 Daily Safety Meetings (“Tailgate Talks”)

Completed safety briefing forms will be maintained by the HSO.

18.5 Exposure Records

All personal monitoring results, laboratory reports, calculations and air sampling data sheets are part of an employee exposure record. These records will be maintained by the HSO during site work. At the end of the project they will be maintained according to 29 CFR 1910.1020.

18.6 Hazard Communication Program/MSDS-SDS

Material safety data sheets (MSDS) or Safety Data Sheets (SDS) have been obtained for applicable substances and are included in this CHASP (Attachment E). Langan’s written hazard communication program, in compliance with 29 CFR 1910.1200, is maintained by the HSM.

18.7 Documentation

Immediately following an incident or near miss, unless emergency medical treatment is required, either the employee or a coworker must contact the Langan incident/injury hotline at 1-800-952-6426, extension 4699 and the Project Manager to report the incident or near miss. The Project Manager will contact the client or client representative. A written report must be completed and submitted HSM within 24 hours of the incident. For emergencies involving personnel injury and/or exposure, employee will complete and submit the Langan incident/injury report to the

Langan corporate health and safety manager as soon as possible following the incident. Accidents will be investigated in-depth to identify all causes and to recommend hazard control measures.

18.7.1 Accident and Injury Report Forms

18.7.1.1 Accident/Incident Report

All injuries, no matter how slight, shall be reported to the FTL and the PM immediately. The accident/incident report forms, attached in Attachment C will be filled out on all accidents by the applicable contractor supervision personnel, the FTL, or the HSO. Copies of all accident/incident reports shall be kept on-site and available for review. Project personnel will be instructed on the location of the first aid station, hospital, and doctor and ambulance service near the job. The emergency telephone numbers will be conspicuously posted in site vehicles near the work zone. First aid supplies will be centrally located and conspicuously posted between restricted and non-restricted areas to be readily accessible to all on the site.

18.7.1.2 First Aid Treatment Record

The first aid treatment record forms will be used for recording all non-lost time injuries treated by the project first-aid attendant, the local physician or hospital will be entered in detail on this record. "Minor" treatment of scratches, cuts, etc. will receive the same recording attention as treatment of more severe injuries.

18.7.1.3 OSHA Form 300

An OSHA Form 300 will be kept at the Langan Corporate Office in Parsippany, New Jersey. All recordable injuries or illnesses will be recorded on this form. Subcontractor employers must also meet the requirements of maintaining an OSHA 300 form. The Incident Report form used to capture the details of work-related injuries/illnesses meets the requirements of the OSHA Form 301 (supplemental record) and must be maintained with the OSHA Form 300 for all recordable injuries or illnesses.

19.0 CONFINED SPACE ENTRY

Confined spaces are not anticipated at the site during planned construction activities. If confined spaces are identified, the contractor must implement their own confined space program that adheres to all applicable federal, state and local regulations. Confined spaces **will not** be entered by Langan personnel.

20.0 HASP ACKNOWLEDGEMENT FORM

All Langan personnel and contractors will sign this CHASP Compliance Agreement indicating that they have become familiar with this CHASP and that they understand it and agree to abide by it.

Printed Name	Signature	Company	Date

Printed Name	Signature	Company	Date

Printed Name	Signature	Company	Date

TABLES

**TABLE 1
TASK HAZARD ANALYSES**

Task	Hazard	Description	Control Measures	First Aid
1.3.1 – 1.3.17	Contaminated Soil or Groundwater- Dermal Contact	Contaminated water spills on skin, splashes in eyes; contact with contaminated soil/fill during construction activities or sampling.	Wear proper PPE; follow safe practices, maintain safe distance from construction activities	See Table 2, seek medical attention as required
1.3.1 – 1.3.17	Lacerations, abrasions, punctures	Cutting bailer twine, pump tubing, acetate liners, etc. with knife; cuts from sharp site objects or previously cut piles, tanks, etc.; Using tools in tight spaces	Wear proper PPE; follow safe practices	Clean wound, apply pressure and/or bandages; seek medical attention as required.
1.3.1 – 1.3.17	Contaminated Media Inhalation	Opening drums, tanks, wells; vapors for non-aqueous phase liquids or other contaminated site media; dust inhalation during excavation; vapor accumulation in excavation	Follow air monitoring plan; have quick access to respirator, do not move or open unlabeled drums found at the site, maintain safe distance from construction activities	See Table 2, seek medical attention as required
1.3.1 – 1.3.17	Lifting	Improper lifting/carrying of equipment and materials causing strains	Follow safe lifting techniques; Langan employees are not to carry contractor equipment or materials	Rest, ice, compression, elevation; seek medical attention as required
1.3.1 – 1.3.17	Slips, trips, and falls	Slips, trips and falls due to uneven surfaces, cords, steep slopes, debris and equipment in work areas	Good housekeeping at site; constant awareness and focus on the task; avoid climbing on stockpiles; maintain safe distance from construction activities and excavations; avoid elevated areas over six feet unless fully accredited in fall protection and wearing an approved fall protection safety apparatus	Rest, ice, compression, elevation; seek medical attention as required
1.3.1 – 1.3.17	Noise	Excavation equipment, hand tools, drilling equipment.	Wear hearing protection; maintain safe distance from construction activities	Seek medical attention as required
1.3.1 – 1.3.17	Falling objects	Soil material, tools, etc. dropping from drill rigs, front-end loaders, etc.	Hard hats to be worn at all times while in work zones; maintain safe distance from construction activities and excavations	Seek medical attention as required
1.3.1 – 1.3.17	Underground/ overhead utilities	Excavation equipment, drill rig auger makes contact with underground object; boom touches overhead utility	"One Call" before dig; follow safe practices; confirm utility locations with contractor; wear proper PPE; maintain safe distance from construction activities and excavations	Seek medical attention as required
1.3.1 – 1.3.17	Insects (bees, wasps, hornet, mosquitoes, and spider)	Sings, bites	Insect Repellent; wear proper protective clothing (work boots, socks and light colored pants);field personnel who may have insect allergies (e.g., bee sting) should provide this information to the HSO or FSO prior to commencing work, and will have allergy medication on site.	Seek medical attention as required
1.3.1 – 1.3.17	Vehicle traffic / Heavy Equipment Operation	Vehicles unable to see workers on site, operation of heavy equipment in tight spaces, equipment failure, malfunctioning alarms	Wear proper PPE, especially visibility vest; use a buddy system to look for traffic; rope off area of work with cones and caution tape or devices at points of hazard, maintain safe distance from construction activities and equipment	Seek medical attention as required

**TABLE 2
CONTAMINANT HAZARDS OF CONCERN**

Task	Contaminant	CAS Number	Monitoring Device	PEL/IDLH	Source of Concentration on Site	Route of Exposure	Symptoms	First Aid
1.3.1 – 1.3.17	1,1,2-Trichloro-1,2,2-trifluoroethane Chlorofluorocarbon-113 CFC-113 Freon® 113 Genetron® 113 Halocarbon 113 Refrigerant 113 TTE Frigen 113 TR Freon TF Trichlorotrifluoroethane	76-13-1	PID	1000 ppm 2000 ppm	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation skin, throat, drowsiness, dermatitis; central nervous system depression; dizziness, tremor, asphyxia, unconsciousness, cardiac arrhythmias, cardiac arrest; liquid: frostbite. In animals: cardiac arrhythmias, narcosis,	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	1,1'-Biphenyl 1,1-Biphenyl Biphenyl Phenyl benzene Diphenyl	92-52-4	None	1 mg/m3 100 mg/m3	Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, throat; headache, nausea, lassitude (weakness, exhaustion), numb limbs; liver damage	Eye: Irrigate immediately Skin: Water flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	1,1-Dichloroethane Asymmetrical dichloroethane Ethylidene chloride 1,1-Ethylidene dichloride 1,1-DCA	75-34-3	PID	100 ppm 3000 ppm	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the skin; central nervous system depression; liver, kidney, lung damage	Eye: Irrigate immediately Skin: Soap flush promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	1,2,4,5-Tetramethylbenzene	95-93-2	NA	None None	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat, respiratory system; bronchitis; hypochromic anemia; headache, drowsiness, lassitude (weakness, exhaustion), dizziness, nausea, incoordination; vomiting, confusion; chemical pneumonitis (aspiration liquid)	Eye: Irrigate immediately Skin: Soap flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	1,2,4-Trimethylbenzene	95-63-6	PID	None None	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat, respiratory system; bronchitis; hypochromic anemia; headache, drowsiness, lassitude (weakness, exhaustion), dizziness, nausea, incoordination; vomiting, confusion; chemical pneumonitis (aspiration liquid)	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	1,2-Dichlorobenzene	95-50-1	PID	50 ppm 200 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eye, swelling periorbital (situated around the eye); profuse rhinitis; headache, anorexia, nausea, vomiting; weight loss, jaundice, cirrhosis; in animals: liver, kidney injury; [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	1,2-Dichloroethane Ethylene dichloride 1,2-DCA DCE[1] Ethane dichloride Dutch liquid, Dutch oil Freon 150 Glycol dichloride	107-06-2	PID	1 ppm 50 ppm	Groundwater Soil Vapor	inhalation, ingestion, skin absorption, skin and/or eye contact	irritation to the eyes, corneal opacity; central nervous system depression; nausea, vomiting; dermatitis; liver, kidney, cardiovascular system damage; [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	1,2-Dichloroethene 1,2-Dichloroethylene 1,2-DCE Total 1,2-Dichloroethene cis-1,2-Dichloroethylene mixture of cis and trans Acetylene dichloride cis-Acetylene dichloride sym-Dichloroethylene cis-1,2-Dichloroethene cDCE 1,1-dimethyl-;dimethyl,1,1- cyclohexane sym-Dichloroethylene Dichloroethylenes	159-59-2 156-60-5 540-59-0	PID	200 ppm 4000 ppm	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	Irritant to eyes, skin, mucous membranes and respiratory system. May be harmful by ingestion, skin absorption and inhalation	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	1,3,5-Trimethylbenzene Mesitylene sym-Trimethylbenzene	108-67-8	PID	None None	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat, respiratory system; bronchitis; hypochromic anemia; headache, drowsiness, lassitude (weakness, exhaustion), dizziness, nausea, incoordination; vomiting, confusion; chemical pneumonitis (aspiration liquid)	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	1,3-Butadiene Biethylene Bivinyll Butadiene Divinyll Erythrene Vinylethylene	106-99-0	PID	1 ppm 2000 ppm	Vapor	inhalation, skin and/or eye contact (liquid)	irritation to the eyes, nose, throat; drowsiness, dizziness; liquid: frostbite; teratogenic, reproductive effects; [potential occupational carcinogen]	Eye: Frostbite Skin: Frostbite Breathing: Respiratory support
1.3.1 – 1.3.17	1,3-Dichlorobenzene m-Dichlorobenzol; m-Phenylene dichloride m-dichlorobenzene	541-73-1	PID	None None	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, swelling periorbital (situated around the eye); profuse rhinitis; headache, anorexia, nausea, vomiting; weight loss, jaundice, cirrhosis; in animals: liver, kidney injury; [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	1,4-Dioxane 1,4-Dioxacyclohexane [1,4]Dioxane p-Dioxane [6]-crown-2 Diethylene dioxide Diethylene ether Dioxan Dioxane 1,4-Dioxane	123-91-1	PID	100 ppm 500 ppm	Groundwater Soil Vapor	Inhalation, ingestion, skin and/or eye contact	Irritant to eyes, skin, mucous membranes and respiratory system. May be harmful by ingestion, skin absorption and inhalation	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	1H,1H,2H,2H-Perfluorooctanes ulfonic Acid (6:2FTS) Sodium 1H,1H, 2H, 2H- Perfluorooctane Sulfonate (6:2)(6:2FTS) 6:2 Fluorinated Telomer Sulfonates (6:2FTS) Sodium 1H,1H,2H,2H- Perfluorooctane Sulfonate (6:2)	27619- 97-2	NA	NA NA	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	2,2,4-Trimethylpentane Isooctane	540-84-1	PID	NA NA	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat, respiratory system; bronchitis; hypochromic anemia; headache, drowsiness, lassitude (weakness, exhaustion), dizziness, nausea, incoordination; vomiting, confusion; chemical pneumonitis (aspiration liquid)	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	2,4-Dimethylphenol 2,4-Xylenol m-Xylenol 1-Hydroxy-2,4- dimethylbenzene 2,4-Dimethylphenol 4-Hydroxy-1,3- dimethylbenzene 4,6-Dimethylphenol 1,3-Dimethyl-4-hydroxybenze	105-67-9	None	NA NA	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, mucous membrane; headache, narcosis, coma; dermatitis; in animals: liver, kidney damage	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	2-Butanone Ethyl methyl ketone MEK Methyl acetone Methyl ethyl ketone	78-93-3	PID	200 ppm 3000 ppm	Soil Groundwater Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose; headache; dizziness; vomiting; dermatitis	Eye: Irrigate immediately Skin: Water wash immediately Breathing: Fresh air Swallow: Medical attention immediately
1.3.1 – 1.3.17	2-Hexanone Butyl methyl ketone MBK Methyl butyl ketone Methyl n-butyl ketone	591-78-6	PID	100 ppm 1600 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, nose; peripheral neuropathy; lassitude (weakness, exhaustion), paresthesia; dermatitis; headache, drowsiness	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	2-Methylnaphthalene β-methylnaphthalene	91-57-6	PID	NA NA	Groundwater Soil Vapor	inhalation, ingestion or skin absorption, eye contact	irritation to the skin, eyes, mucous membranes and upper respiratory tract. It may also cause headaches, nausea, vomiting, diarrhea, anemia, jaundice, euphoria, dermatitis, visual disturbances, convulsions and comatose	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	3,3'-Dichlorobenzidine 4-(4-Amino-3-chlorophenyl)-2- chloroaniline 4,4'-Diamino-3,3'- dichlorobiphenyl o,o'-Dichlorobenzidine 3,3'-Dichlorobiphenyl-4,4'- diamine 3,3'-Dichloro-4,4'- biphenyldiamine 3,3'-Dichloro-4,4'- diaminobiphenyl	91-94-1	None	NA NA	Soil Groundwater Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat, respiratory system;	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	4,4'-DDD Dichlorodiphenyldichloroethan e 1,1'-(2,2-Dichloroethylidene)bis (4-chlorobenzene) p,p'-DDD	72-54-8	None	NA NA	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin; paresthesia tongue, lips, face; tremor; anxiety, dizziness, confusion, malaise (vague feeling of discomfort), headache, lassitude (weakness, exhaustion); convulsions; paresis hands; vomiting; [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	4-Isopropyltoluene 1-Methyl-4-(1-methylethyl)benzene 4-Isopropyltoluene; 4-Methylcumene; 1-Methyl-4-isopropylbenzene Dolcymene Camphogen Paracymene Cymene p-Cymene p-Isopropyltoluene	99-87-6	PID	NA NA	Soil Groundwater Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, mucous membrane; dermatitis; headache, narcosis, coma	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	4-Methyl-2-pentanone Hexone Isobutyl methyl ketone Methyl isobutyl ketone MIBK	108-10-1	PID	100 ppm 500 ppm	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, mucous membrane; headache, narcosis, coma; dermatitis; in animals: liver, kidney damage	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Acenaphthene 1,2-Dihydroacenaphthylene 1,8-Ethylenenaphthalene peri-Ethylenenaphthalene Naphthyleneethylene Tricyclododecapentaene	83-32-9	PID	NA NA	Soil	inhalation, ingestion, skin and/or eye contact,	irritation to the skin, eyes, mucous membranes and upper respiratory tract; If ingested, it can cause vomiting	Eye: Irrigate immediately Skin: Soap wash immediately, if redness or irritation develop, seek medical attention immediately Breathing: Move to fresh air Swallow: do not induce vomiting, seek medical attention immediately

1.3.1 – 1.3.17	Acenaphthylene Cycopental(de)naphthalene, Acenaphthalene	208-96-8	PID	NA NA	Soil	inhalation, ingestion, skin and/or eye contact	irritation to the skin, eyes, mucous membranes and upper respiratory tract	Eye: Irrigate immediately, seek medical attention immediately, Skin: Soap wash immediately, if redness or irritation develop, seek medical attention immediately Breathing: Move to fresh air Swallow: do not induce vomiting, seek medical attention immediately
1.3.1 – 1.3.17	Acetone Dimethyl ketone Ketone propane 2-Propanone	67-64-1	PID	1000 ppm 2500 ppm	Groundwater Soil	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, nose, throat; headache, dizziness, central nervous system depression; dermatitis	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Aldrin 1,2,3,4,10,10-Hexachloro- 1,4,4a,5,8,8a-hexahydro-endo- 1,4-exo-5,8- dimethanonaphthalene HHDN Octalene	309-00-2	PID	0.25 ppm 5 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	headache, dizziness; nausea, vomiting, malaise (vague feeling of discomfort); myoclonic jerks of limbs; clonic, tonic convulsions; coma; hematuria (blood in the urine), azotemia; [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Alpha-BHC alpha-Hexachlorocyclohexane -alpha,2-alpha,3-beta,4-alpha,5- beta,6-beta- Hexachlorocyclohexane alpha-1,2,3,4,5,6- Hexachlorocyclohexane alpha-Benzenehexachloride α-1,2,3,4,5,6- hexachlorocyclohexane α-HCH α-Benzenehexachloride alpha-hexacloran(e) alpha-Lindane Alpha Hexachlorocyclohexane	319-84-6	PID	NA NA	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, mucous membrane possible carcinogenic, effects to liver, blood, and central nervous system	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Alpha-Chlordane Alpha Chlordane a-Chlordane	5103-71- 9	None	0.5 mg/m3 100 mg/m3	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	Blurred vision; confusion; ataxia, delirium; cough; abdominal pain, nausea, vomiting, diarrhea; irritability, tremor, convulsions; anuria	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Aluminum	7429-90- 5	None	0.5 mg/m3 50 mg/m3	Soil	inhalation, skin and/or eye contact	irritation to the eyes, skin, respiratory system	Eye: Irrigate immediately Breathing: Fresh air
1.3.1 – 1.3.17	Ammonia Nitrogen, Ammonia	7664-41- 7	None	50 ppm 300 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, respiratory system	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Anthracene	120-12-7	PID	0.2 mg/m3 80 mg/m3 (Coal Pitch Tar)	Soil	inhalation, skin or eye contact, ingestion	irritation to the skin, eyes, mucous membranes and upper respiratory tract, abdominal pain if ingested.	Eye: Irrigate immediately, seek medical attention immediately, Skin: Soap wash immediately, Breathing: Move to fresh air, refer to medical attention; Swallow: refer to medical attention
1.3.1 – 1.3.17	Antimony	7440-36- 0	None	0.5 mg/m3 50 mg/m3	Groundwater Soil	inhalation, ingestion, skin and/or eye contact	irritation skin, possible dermatitis; resp distress; diarrhea; muscle tremor, convulsions; possible gastrointestinal tract	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Aroclor 1016	12674- 11-2	None	0.5 mg/m3 5 mg/m3	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, chloracne	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Aroclor 1232	11141- 16-5	None	0.5 mg/m3 5 mg/m3	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, chloracne	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Aroclor 1242	53469- 21-9	None	0.5 mg/m3 5 mg/m3	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, chloracne	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Aroclor 1248	12672- 26-6	None	0.5 mg/m3 5 mg/m3	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, chloracne	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Aroclor 1254	11097- 69-1	None	0.5 mg/m3 5 mg/m3	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, chloracne	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Aroclor 1260	11096- 82-5	None	0.5 mg/m3 5 mg/m3	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, chloracne	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Arsenic	NA	None	0.5 mg/m3 NA	Groundwater Soil	inhalation, ingestion, skin and/or eye contact	irritation skin, possible dermatitis; resp distress; diarrhea; muscle tremor, convulsions; possible gastrointestinal tract	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Barium	10022- 31-8	None	0.5 mg/m3 50 mg/m3	Groundwater Soil	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, upper respiratory system; skin burns; gastroenteritis; muscle spasm; slow pulse	Eye: Irrigate immediately Skin: Water flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Benzene Benzol Phenyl hydride Alkyl benzene isomers	71-43-2	PID	3.19 mg/m3 1,595 mg/mg3	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, respiratory system; dizziness; headache, nausea, staggered gait; lassitude (weakness, exhaustion) [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Benzo(a)anthracene Benzanthracene Benzanthrene 1,2-Benzanthracene Benzo[b]phenanthrene Tetraphene	56-55-3	PID	0.2 mg/m3 80 mg/m3 (Coal Pitch Tar)	Groundwater Soil	inhalation, skin or eye contact, ingestion	dermatitis, bronchitis, [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Benzo(a)pyrene	50-32-8	PID	0.2 mg/m3 80 mg/m3 (Coal Pitch Tar)	Soil	inhalation, skin or eye contact, ingestion	dermatitis, bronchitis, [potential occupational carcinogen]	Eye: Irrigate immediately, seek medical attention Skin: Soap wash immediately; Breathing: move to fresh air; Swallow: Induce vomiting if conscious, seek medical attention immediately
1.3.1 – 1.3.17	Benzo(b)fluoranthene	205-99-2	PID	0.2 mg/m3 80 mg/m3 (Coal Pitch Tar)	Soil	inhalation, skin or eye contact, ingestion	irritation to eyes and skin, respiratory irritation(dizziness, weakness, fatigue, nausea, headache)	Eye: Irrigate immediately, refer to medical attention Skin: Soap wash immediately Breathing: move to fresh air Swallow: Medical attention immediately
1.3.1 – 1.3.17	Benzo(g,h,i)perylene Benzo(ghi)perylene	191-24-2	PID	0.2 mg/m3 80 mg/m3 (Coal Pitch Tar)	Soil	inhalation, skin or eye contact, ingestion	NA	Eye: Irrigate immediately, refer to medical attention Skin: Soap wash immediately Breathing: move to fresh air Swallow: Medical attention immediately

1.3.1 – 1.3.17	Benzo(k)fluoranthene	207-08-9	PID	0.2 mg/m3 80 mg/m3 (Coal Pitch Tar)	Soil	inhalation, skin or eye contact, ingestion	irritation to eyes and skin, respiratory irritation (dizziness, weakness, fatigue, nausea, headache)	Eye: Irrigate immediately, refer to medical attention Skin: Soap wash immediately Breathing: move to fresh air Swallow: Medical attention immediately
1.3.1 – 1.3.17	Benzoic acid Carboxybenzene E210 Dracrylic acid Phenylmethanoic acid Benzenecarboxylic acid Benzoic acid isomer	65-85-0	None	NA NA	Groundwater Soil Vapor	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately, refer to medical attention Skin: Soap wash immediately Breathing: move to fresh air
1.3.1 – 1.3.17	Benzyl butyl phthalate Butyl benzyl phthalate Butylbenzylphthalate	86-66-7	None	NA NA	Groundwater Soil Vapor	inhalation, skin or eye contact, ingestion	irritation to eyes and skin, respiratory irritation (dizziness, weakness, fatigue, nausea, headache)	Eye: Irrigate immediately, refer to medical attention Skin: Soap wash immediately Breathing: move to fresh air Swallow: Medical attention immediately
1.3.1 – 1.3.17	Beryllium	7440-41- 7	None	0.002 mg/m3 4 mg/m3	Soil	inhalation, skin and/or eye contact	berylliosis (chronic exposure): anorexia, weight loss, lassitude (weakness, exhaustion), chest pain, cough, clubbing of fingers, cyanosis, pulmonary insufficiency; irritation to the eyes; dermatitis; [potential occupational carcinogen]	Eye: Irrigate immediately Breathing: Fresh air

1.3.1 – 1.3.17	Beta BHC Beta Hexachlorocyclohexane 1-alpha,2-beta,3-alpha,4-beta,5- alpha,6-beta- Hexachlorocyclohexane beta-1,2,3,4,5,6- Hexachlorocyclohexane Beta-BHC	319-85-7	None	NA NA	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin; paresthesia tongue, lips, face; tremor; anxiety, dizziness, confusion, malaise (vague feeling of discomfort), headache, lassitude (weakness, exhaustion); convulsions; paresis hands; vomiting; [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately	
1.3.1 – 1.3.17	Beta-Endosulfan Beta Endosulfan Endosulfan II (beta) Endosulfan II	33213- 65-9	None	None	NA NA	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation skin; nausea, confusion, agitation, flushing, dry mouth, tremor, convulsions, headache; in animals: kidney, liver injury; decreased testis weight	Eye: imme Skin: imme Breath Resp supp Swal atten imme
1.3.1 – 1.3.17	Bis(2-ethylhexyl)phthalate Bis(2-Ethylhexyl) Phthalate Di-sec octyl phthalate DEHP Di(2-ethylhexyl)phthalate Octyl phthalate bis(2-ethylexyl)phthalate Bis(2-Ethylhexyl) Phthalate	117-81-7	None	5 mg/m ³ 5000 mg/m ³	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, mucous membrane; in animals: liver damage; teratogenic effects; [potential occupational carcinogen]	Eye: Irrigate immediately Breathing: Respiratory support Swallow: Medical attention immediately	

1.3.1 – 1.3.17	Cadmium	7440-43-9	None	0.005 mg/m ³ 9 mg/m ³	Soil	inhalation, ingestion	pulmonary edema, dyspnea (breathing difficulty), cough, chest tightness, substernal (occurring beneath the sternum) pain; headache; chills, muscle aches; nausea, vomiting, diarrhea; anosmia (loss of the sense of smell), emphysema, proteinuria, mild anemia; [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Calcium	7440-70-2	None	NA	Groundwater Soil	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, upper resp tract; ulcer, perforation nasal septum; pneumonitis; dermatitis	Eye: Irrigate immediately Skin: Water flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Carbazole 9-azafluorene Dibenzopyrrole Diphenylenimine diphenyleneimide	86-74-8	None	NA NA	Soil	inhalation, skin absorption (liquid), skin and/or eye contact	irritation to eyes and skin, respiratory irritation	Eye: Irrigate immediately, refer to medical attention Skin: Soap wash immediately Breathing: move to fresh air Swallow: Medical attention immediately

1.3.1 – 1.3.17	Carbon disulfide	75-15-0	PID	20 ppm 500 ppm	Soil Groundwater Vapor	inhalation, skin or eye contact, ingestion	irritation to the eyes, skin, respiratory system	Eye: Irrigate immediately (liquid) Skin: Water flush immediately (liquid) Breathing: Respiratory support
1.3.1 – 1.3.17	Carbon tetrachloride Carbon chloride Carbon tet Freon® 10 Halon® 104 Tetrachloromethane	56-23-5	PID	10 ppm 200 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin; central nervous system depression; nausea, vomiting; liver, kidney injury; drowsiness, dizziness, incoordination; [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Chlorobenzene benzene chloride monochlorobenzene Phenyl chloride Chlorobenzol MCB	108-90-7	PID	75 ppm 1000 ppm	Groundwater Soil Vapor	inhalation, skin or eye contact, ingestion	irritation to the eyes, skin, nose; drowsiness, incoordination; central nervous system depression; in animals: liver, lung, kidney injury	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Chloroform Methane trichloride Trichloromethane Chloro-3-methyl phenol	67-66-3	None	50 ppm 500 ppm	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin; dizziness, mental dullness, nausea, confusion; headache, lassitude (weakness, exhaustion); anesthesia; enlarged liver; [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Chromium Total Chromium Chromium, Total	7440-47- 3	None	1.0 mg/m ³ 250 mg/m ³	Groundwater Soil	inhalation absorption ingestion	irritation to eye, skin, and respiratory	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Chrysene Benzo[a]phenanthrene 1,2-Benzphenanthrene	218-01-9	PID	0.2 mg/m ³ 80 mg/m ³ (Coal Pitch Tar)	Groundwater Soil	inhalation, absorption, ingestion, consumption	irritation to eye, skin, and respiratory, gastrointestinal irritation nausea, vomit, diarrhea [potential occupational carcinogen]	Eyes: Irrigate immediately Skin: Soap wash promptly. Breath: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Cobalt	7440-48- 4	None	0.1mg/m ³ 20 mg/m ³	Soil	inhalation, ingestion, skin and/or eye contact	Cough, dyspnea (breathing difficulty), wheezing, decreased pulmonary function; weight loss; dermatitis; diffuse nodular fibrosis; resp hypersensitivity, asthma	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Copper	7440-50- 8	None	1.0 mg/m ³ 100 mg/m ³	Groundwater Soil	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, nose, metallic taste; dermatitis; anemia	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Cumene Cumol Isopropylbenzene 2-Phenyl propane 1-methylethy lbenzene	98-82-8	PID	50 ppm 900 ppm	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, mucous membrane; dermatitis; headache, narcosis, coma	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Cyanide	57-12-5	None	5 mg/m ³ 25 mg/m ³	Groundwater Soil	inhalation, ingestion, skin and/or eye contact	Exposure to cyanide can cause weakness, headaches, confusion, dizziness, fatigue, anxiety, sleepiness, nausea and vomiting. Breathing can speed up then become slow and gasping. Coma and convulsions also occur. If large amounts of cyanide have been absorbed by the body, the person usually collapses and death can occur very quickly. Long-term exposure to lower levels of cyanide can cause skin and nose irritation, itching, rashes and thyroid changes.	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Cyclohexane Benzene hexahydride Hexahydrobenzene Hexamethylene Hexanaphthene	110-82-7	PID	300 ppm 1300 ppm	Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, respiratory system; drowsiness; dermatitis; narcosis, coma	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	DDE 4,4-DDE 4,4'-DDE 1,1-bis-(4-chlorophenyl)-2,2-dichloroethene Dichlorodipenyldichloroethylene p,p'-DDE	72-55-9	None	NA NA	Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	Oral ingestion of food is the primary source of exposure for the general population. Acute and chronic ingestion may cause nausea, vomiting, diarrhea, stomach pain, headache, dizziness, disorientation, tingling sensation, kidney damage, liver damage, convulsions, coma, and death. 4,4' DDE may cross the placenta and can be excreted in breast milk	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	DDT 4,4-DDT 4,4'-DDT p,p'-DDT Dichlorodiphenyltrichloroethane 1,1,1-Trichloro-2,2-bis(p-chlorophenyl)ethane	50-29-3	None	1 mg/m ³ 500 mg/m ³	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin; paresthesia tongue, lips, face; tremor; anxiety, dizziness, confusion, malaise (vague feeling of discomfort), headache, lassitude (weakness, exhaustion); convulsions; paresis hands; vomiting; [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Delta BHC Delta-BHC Delta-hexachlorocyclohexane Delta Hexachlorocyclohexane	319-86-8	None	0.5 mg/m ³ 50 mg/m ³	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat; headache; nausea; clonic convulsions; resp difficulty; cyanosis; aplastic anemia; muscle spasm; in animals: liver, kidney damage	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Dibenz(a,h)anthracene Dibenzo(a,h)anthracene Dibenzo[a,h]anthracene	53-70-3	PID	0.2 mg/m ³ 80 mg/m ³ (Coal Pitch Tar)	Groundwater Soil	inhalation, absorption, ingestion, consumption	irritation to eyes, skin, respiratory, and digestion [potential occupational carcinogen]	Eyes: Irrigate immediately Skin: Soap wash promptly. Breath: Respiratory support PID Swallow: Medical attention immediately
1.3.1 – 1.3.17	Dibenzofuran	132-64-9	None	NA NA	Soil	inhalation, absorption	irritation to eyes, and skin	Eyes: Irrigate immediately Skin: Soap wash promptly.
1.3.1 – 1.3.17	Dibutyl phthalate Di-n-butyl phthalate Butyl phthalate n-Butyl phthalate 1,2-Benzenedicarboxylic acid dibutyl ester o-Benzenedicarboxylic acid dibutyl ester DBP Palatinol C, Elaol Dibutyl-1,2-benzene- dicarboxylate Di-n-butylphthalate	84-74-2	None	5 mg/m ³ 4000 mg/m ³	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, upper respiratory system, stomach	Eye: Irrigate immediately Skin: Wash regularly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Dichlorodifluoromethane Difluorodichloromethane, Fluorocarbon 12 Freon 12 Freon® 12 Genetron® 12 Halon® 122 Propellant 12 Refrigerant 12 Dichlorodifluoromethane	75-71-8	None	1000 pp, 15,000 ppm	Groundwater Soil Vapor	inhalation, skin and/or eye contact (liquid)	dizziness, tremor, asphyxia, unconsciousness, cardiac arrhythmias, cardiac arrest; liquid: frostbite	Eye: Frostbite Skin: Frostbite Breathing: Respiratory support

1.3.1 – 1.3.17	Dieldrin HEOD 1,2,3,4,10,10-Hexachloro-6,7- epoxy-1,4,4a,5,6,7,8,8a- octahydro-1,4-endo exo-5,8-dimethanonaphthalene	60-57-1	PID	0.25 mg/m ³ 50 mg/m ³	Groundwater Soil Water	inhalation, skin absorption, ingestion, skin and/or eye contact	headache, dizziness; nausea, vomiting, malaise (vague feeling of discomfort), sweating; myoclonic limb jerks; clonic, tonic convulsions; coma; [potential occupational carcinogen]; in animals: liver, kidney damage	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Diesel Fuel automotive diesel fuel oil No. 2 distillate diesoline diesel oil diesel oil light diesel oil No. 1-D summer diesel	68334- 30-5	PID	NA NA	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat; burning sensation in chest; headache, nausea, lassitude (weakness, exhaustion), restlessness, incoordination, confusion, drowsiness; vomiting, diarrhea; dermatitis; chemical pneumonitis (aspiration liquid)	Eye: Irrigate immediately Skin: Soap flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Di-n-octyl phthalate Di-n-cotylphthalate Di-n-octylphthalate Di-sec octyl phthalate Dioctyl phthalate DEHP, Di(2- ethylhexyl)phthalate, DOP, bis- (2-Ethylhexyl)phthalate, Octyl phthalate	117-84-0	None	5 mg/m ³ 5000 mg/m ³	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, mucous membrane; in animals: liver damage; teratogenic effects; [potential occupational carcinogen]	Eye: Irrigate immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Endosulfan I Alpha Endosulfan	959-98-8	None	NA NA	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation skin; nausea, confusion, agitation, flushing, dry mouth, tremor, convulsions, headache; in animals: kidney, liver injury; decreased testis weight	Eye: Irrigate immediately Skin: Soap flush immediately Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Endosulfan sulfate 1,4,5,6,7,7-Hexachloro-5-norbornene-2,3-dimethanol, cyclic sulfate 6,7,8,9,10,10-hexachloro-1,5,5a,9,9a-hexahydro-6,9-methano-2,4,3-benzodioxathiepin-3,3-dioxide	1031-07-8	None	NA NA	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	Hypersensitive to stimulation, sensation of prickling, tingling or creeping on skin. Headache, dizziness, nausea, vomiting, incoordination, tremor, mental confusion, hyperexcitable state. In severe cases: convulsions, seizures, coma and respiratory depression.	Eye: Irrigate immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Endrin 1,2,3,4,10,10-Hexachloro-6,7-epoxy-1,4,4a,5,6,7,8,8a-octahydro-1,4-endo,endo-5,8-dimethanonaphthalene; Hexadrin	72-20-8	None	0.1 mg/m ³ 2 mg/m ³	Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	epileptiform convulsions; stupor, headache, dizziness; abdominal discomfort, nausea, vomiting; insomnia; aggressiveness, confusion; drowsiness, lassitude (weakness, exhaustion); anorexia; in animals: liver damage	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Ethanol Absolute alcohol Alcohol cologne spirit drinking alcohol ethane monoxide ethyl alcohol EtOH ethyl alcohol ethyl hydrate ethyl hydroxide ethylol grain alcohol hydroxyethane methylcarbinol	64-17-5	PID	1000 ppm 3300 ppm	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose; headache, drowsiness, lassitude (weakness, exhaustion), narcosis; cough; liver damage; anemia; reproductive, teratogenic effects	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Fresh air Swallow: Medical attention immediately

1.3.1 – 1.3.17	Ethyl benzene Ethylbenzene Ethylbenzol Phenylethane	100-41-4	PID	435 mg/m ³ 3,472 mg/m ³	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, mucous membrane; headache; dermatitis; narcosis, coma	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Ethyl chloride Chloroethane Hydrochloric ether Monochloroethane Muriatic ether Hydrochloric ether	75-00-3	PID	1000 ppm 3800 ppm	Groundwater Soil Vapor	inhalation, skin absorption (liquid), ingestion (liquid), skin and/or eye contact	incoordination, inebriation; abdominal cramps; cardiac arrhythmias, cardiac arrest; liver, kidney damage	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Fluoranthene Benzo(j, k)fluorene	206-44-0	PID	0.2 mg/m ³ 80 mg/m ³ (Coal Pitch Tar)	Groundwater Soil	inhalation, skin or eye contact, ingestion	irritation to eyes and skin, respiratory irritation(dizziness, weakness, fatigue, nausea, headache)	Eye: Irrigate immediately, refer to medical attention Skin: Soap wash immediately Breathing: move to fresh air Swallow: Medical attention immediately
1.3.1 – 1.3.17	Fluorene	86-73-7	PID	0.2 mg/m ³ 80 mg/m ³ (Coal Pitch Tar)	Soil	inhalation, skin or eye contact, ingestion	irritation to eyes and skin, respiratory irritation(dizziness, weakness, fatigue, nausea, headache)	Eye: Irrigate immediately, refer to medical attention Skin: Soap wash immediately Breathing: move to fresh air Swallow: Medical attenti

1.3.1 – 1.3.17	Fuel Oil No. 2	68476-30-2	PID	NA NA	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat; burning sensation in chest; headache, nausea, lassitude (weakness, exhaustion), restlessness, incoordination, confusion, drowsiness; vomiting, diarrhea; dermatitis; chemical pneumonitis (aspiration liquid)	Eye: Irrigate immediately Skin: Soap flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Gasoline	8006-61-9	PID	NA NA	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, mucous membrane; dermatitis; headache, lassitude (weakness, exhaustion), blurred vision, dizziness, slurred speech, confusion, convulsions; chemical pneumonitis (aspiration liquid)	Eye: Irrigate immediately Skin: Soap flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Helium	7440-59-7	Helium Detector	NA NA	NA	inhalation	dizziness, headache, and nausea	Breathing: Respiratory support
1.3.1 – 1.3.17	Heptane n-Heptane	142-82-5	PID	500 ppm 750 ppm	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	dizziness, stupor, incoordination; loss of appetite, nausea; dermatitis; chemical pneumonitis (aspiration liquid); unconsciousness	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Hexachlorobenzene Perchlorobenzene Pentachlorophenylchloride Benzene hexachloride Phenyl perchloryl HCB BHC	118-74-1	NA	NA NA	Groundwater Soil	inhalation, ingestion, skin and/or eye contact	Irritating to eyes, skin and mucous membranes. Prolonged periods of ingestion may cause cutaneous porphyria	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Hexavalent Chromium Chromium VI Chromium, Hexavalent	18540- 29-9	None	1.0 mg/m ³ 250 mg/m ³	Groundwater Soil	inhalation absorption ingestion	irritation to eye, skin, and respiratory	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Indeno(1,2,3-cd)pyrene Indeno(1,2,3-c,d)Pyrene Indeno[1,2,3-cd]Pyrene	193-39-5	None	0.2 mg/m ³ 80 mg/m ³ (Coal Pitch Tar)	Groundwater Soil	inhalation, absorption, ingestion, consumption	irritation to eyes, skin, respiratory, and digestion [potential occupational carcinogen]	Eyes: Irrigate immediately Skin: Soap wash promptly. Breath: Respiratory support Swallow: Medical attention immediately, wash mouth with water
1.3.1 – 1.3.17	Iron	7439-89- 6	None	10 mg/m ³ NA	Groundwater Soil	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, mucous membrane; abdominal pain, diarrhea, vomiting	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Isopropyl alcohol Iso-Propyl Alcohol Carbinol IPA Isopropanol 2-Propanol sec-Propyl alcohol Rubbing alcohol Isopropylalcohol	67-63-0	PID	400 ppm 2000 ppm	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, nose, throat; drowsiness, dizziness, headache; dry cracking skin; in animals: narcosis	Eye: Irrigate immediately Skin: Water flush Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Lead	7439-92- 1	None	0.050 mg/m ³ 100 mg/m ³	Groundwater Soil	inhalation, ingestion, skin and/or eye contact	lassitude (weakness, exhaustion), insomnia; facial pallor; anorexia, weight loss, malnutrition; constipation, abdominal pain, colic; anemia; gingival lead line; tremor; paralysis wrist, ankles; encephalopathy; kidney disease; irritation to the eyes; hypertension	Eye: Irrigate immediately Skin: Soap flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Lindane Gamma BHC HCH α-Hexachlorocyclohexane gamma isomer of 1,2,3,4,5,6- Hexachlorocyclohexane gamma- Hexachlorocyclohexane	58-89-9	None	0.5 mg/m ³ 50 mg/m ³	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat; headache; nausea; clonic convulsions; resp difficulty; cyanosis; aplastic anemia; muscle spasm; in animals: liver, kidney damage	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Magnesium	7439-95- 4	None	15 mg/m ³ NA	Soil	inhalation, skin and/or eye contact	irritation to the eyes, skin, respiratory system; cough	Eye: Irrigate immediately Breathing: Fresh air

1.3.1 – 1.3.17	Manganese	7439-96- 5	None	5 mg/m ³ 500 mg/m ³	Groundwater Soil	inhalation, ingestion	aerosol is irritating to the respiratory tract	Eye: Irrigate immediately Skin: Soap flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	m-Cresol meta-Cresol 3-Cresol m-Cresylic acid 1-Hydroxy-3-methylbenzene 3-Hydroxytoluene 3-Methylphenol	108-39-4	PID	5 ppm 250 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, mucous membrane; central nervous system effects: confusion, depression, resp failure; dyspnea (breathing difficulty), irreg rapid resp, weak pulse; eye, skin burns; dermatitis; lung, liver, kidney, pancreas damage	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Mercury	7439-97- 6	None	0.1 mg/m ³ 10 mg/m ³	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin; cough, chest pain, dyspnea (breathing difficulty), bronchitis, pneumonitis; tremor, insomnia, irritability, headache, lassitude (weakness, exhaustion); stomatitis, salivation; gastrointestinal disturbance, anorexia, weight loss; proteinuria	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Methyl Chloride Chloromethane Monochloromethane Refrigerant-40 R-40	74-87-3	NA	100 ppm 2000 ppm	Groundwater Soil	inhalation, skin and/or eye contact	dizziness, nausea, vomiting; visual disturbance, stagger, slurred speech, convulsions, coma; liver, kidney damage; liquid: frostbite; reproductive, teratogenic effects; [potential occupational carcinogen]	Eye: Frostbite Skin: Frostbite Breathing: Respiratory support
1.3.1 – 1.3.17	Methyl chloroform Chloroethene 1,1,1-Trichloroethane 1,1,1-Trichloroethane- (stabilized) 1,1,1-TCA	71-55-6	PID	350 ppm 700 ppm	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin; headache, lassitude (weakness, exhaustion), central nervous system depression, poor equilibrium; dermatitis; cardiac arrhythmias; liver damage	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention
1.3.1 – 1.3.17	Methyl <i>tert</i> -butyl ether MTBE Methyl tertiary-butyl ether Methyl <i>t</i> -butyl ether <i>tert</i> -Butyl methyl ether <i>t</i> BME <i>tert</i> -BuOMe Methyl <i>tert</i> butyl ether	1634-04- 4	PID	NA NA	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat; burning sensation in chest; headache, nausea, lassitude (weakness, exhaustion), restlessness, incoordination, confusion, drowsiness; vomiting, diarrhea; dermatitis; chemical pneumonitis (aspiration liquid)	Eye: Irrigate immediately Skin: Soap flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Methylene Chloride Dichloromethane Methylene dichloride	75-09-2	PID	25 ppm 2300 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin; lassitude (weakness, exhaustion), drowsiness, dizziness; numb, tingle limbs; nausea; [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	m-Xylenes 1,3-Dimethylbenzene m-Xylol Metaxylene	108-38-3 179601- 23-1	PID	100 ppm 900 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat; dizziness, excitement, drowsiness, incoordination, staggering gait; corneal vacuolization; nausea, vomiting, abdominal pain; dermatitis	Eye: Irrigate immediately Skin: Soap flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Naphthalene Naphthalin Tar camphor White tar	91-20-3	PID	50 mg/m ³ 250 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes; headache, confusion, excitement, malaise (vague feeling of discomfort); nausea, vomiting, abdominal pain; irritation bladder; profuse sweating; hematuria (blood in the urine); dermatitis, optical neuritis	Eye: Irrigate immediately Skin: Molten flush immediately/solid- liquid soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	n-Butylbenzene Butylbenzene 1-phenylbutane	104-51-8	PID	NA NA	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin; dry nose, throat; headache; low blood pressure, tachycardia, abnormal cardiovascular system stress; central nervous system, hematopoietic depression; metallic taste; liver, kidney injury	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	N-ethyl perfluorooctane sulfonamido acetic acid NEtFOSAA N- Ethylperfluorooctanesulfonami de	4151-50- 2	NA	NA NA	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	n-Hexane Hexane, Hexyl hydride, normal-Hexane	110-54-3	PID	500 ppm 1100 ppm	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, nose; nausea, headache; peripheral neuropathy: numb extremities, muscle weak; dermatitis; dizziness; chemical pneumonitis (aspiration liquid)	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Nickel	7440-02- 0	None	NA 10 mg/m ³	Groundwater Soil	ion, ingestion, skin and/or eye contact	sensitization dermatitis, allergic asthma, pneumonitis; [potential occupational carcinogen]	Skin: Water flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Nitrate	14797- 55-8	None	NA NA	Groundwater Soil	inhalation, skin and/or eye contact	irritation to the eyes, skin, mucous membrane	Eye: Irrigate immediately Skin: Soap wash Breathing: Fresh air
1.3.1 – 1.3.17	N-methyl perfluorooctane- sulfonamidoacetic acid NMeFOSAA	2355-31- 9	NA	None None	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Non-Flammable Gas Mixture CALGAS (Equipment Calibration Gas : Oxygen Methane Hydrogen Sulfide Carbon Monoxide Nitrogen	7782-44- 7 74-82-8 7783-08- 4 830-08-0 7727-37- 9	Multi-Gas PID	NA/NA NA/NA 10/100 ppm 50/1200 ppm NA/NA	NA	inhalation	dizziness, headache, and nausea	Breathing: Respiratory support

1.3.1 – 1.3.17	Non-Flammable Gas Mixture CALGAS (Equipment Calibration Gas : Oxygen Isobutylene Nitrogen	7782-44- 7 115-11-7 7727-37- 9	PID	NA/NA NA/NA NA/NA	NA	inhalation	dizziness, headache, and nausea	Breathing: Respiratory support
1.3.1 – 1.3.17	n-Propylbenzene Isocumene Propylbenzene 1-Phenylpropane 1-Propylbenzene Phenylpropane	103-65-1	PID	NA NA	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin; dry nose, throat; headache; low blood pressure, tachycardia, abnormal cardiovascular system stress; central nervous system, hematopoietic depression; metallic taste; liver, kidney injury	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	o-Cresol ortho-Cresol 2-Cresol o-Cresylic acid 1-Hydroxy-2-methylbenzene 2-Hydroxytoluene 2-Methyl phenol 2-Methylphenol 2-Methylphenol	95-48-7	PID	5 ppm 250 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, mucous membrane; central nervous system effects: confusion, depression, resp failure; dyspnea (breathing difficulty), irreg rapid resp, weak pulse; eye, skin burns; dermatitis; lung, liver, kidney, pancreas damage	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately ethylyp hhhhhhhhh
1.3.1 – 1.3.17	o-Xylenes 1,2-Dimethylbenzene ortho-Xylene o-XyloI	95-47-6 179601- 23-1	PID	100 ppm 900 ppm	Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat; dizziness, excitement, drowsiness, incoordination, staggering gait; corneal vacuolization; nausea, vomiting, abdominal pain; dermatitis	Eye: Irrigate immediately Skin: Soap flush immediately Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	p-Cresol para-Cresol 4-Cresol p-Cresylic acid 1-Hydroxy-4-methylbenzene 4-Hydroxytoluene 4-Methylphenol	106-44-5	PID	5 ppm 250 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, mucous membrane; central nervous system effects: confusion, depression, resp failure; dyspnea (breathing difficulty), irreg rapid resp, weak pulse; eye, skin burns; dermatitis; lung, liver, kidney, pancreas damage	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	p-Dichlorobenzene p-DCB 1,4-Dichlorobenzene para-Dichlorobenzene Dichlorocide	106-46-7	PID	75 ppm 150 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, swelling periorbital (situated around the eye); profuse rhinitis; headache, anorexia, nausea, vomiting; weight loss, jaundice, cirrhosis; in animals: liver, kidney injury; [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	p-Diethylbenzene 1,4-Diethylbenzene 1,4-Diethyl benzene	105-05-5	PID	None None	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, respiratory system; skin burns; in animals: central nervous system depression	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Pentachlorophenol PCP; Penta; 2,3,4,5,6-Pentachlorophenol	87-86-5	PID	0.5 mg/m ³ 2.5 mg/m ³	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, nose, throat; sneezing, cough; lassitude (weakness, exhaustion), anorexia, weight loss; sweating; headache, dizziness; nausea, vomiting; dyspnea (breathing difficulty), chest pain; high fever; dermatitis	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Perfluorobutanesulfonic acid FC-98 Nonaflate Nonfluorobutanesulphonic acid Perfluorobutanesulfonic Acid Perfluorobutane sulfonate PFBS	375-73-5	NA	None None	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Perfluorobutanoic Acid Heptafluorobutyric acid Heptafluorobutanoic acid Perfluorobutyric acid PFBA	375-22-4	NA	None None	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Perfluorodecanesulfonic Acid PFDS	335-77-3	NA	NA NA	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Perfluorodecanoic acid PFDA	335-76-2	NA	None None	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Perfluorododecanoic acid Perfluoralaauric acid Tricosafuorododecanoic acid PFDoA	307-55-1	NA	None None	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Perfluoroheptane sulfonic Acid Perfluoroheptane sulfonate Perfluoroheptanesulfonic acid PFHpS	375-92-8	NA	None None	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Perfluoroheptanoic acid Perfluoroheptanoic acid Tridecafluoroheptanoic acid PFHpA	375-85-9	NA	None None	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Perfluorohexanesulfonic Acid perfluorohexanesulfonate perfluorohexanesulfonic acid Perfluorohexane-1- sulphonic acid PFHxS	355-46-4	NA	None None	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Perfluorohexanoic Acid PFHxA	307-24-4	NA	None None	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Perfluoronoanoic Acid Perfluorononanoic Acid PFNA perfluoro-n-nonanoic acid perfluorononanoate	375-95-1	NA	None None	Groundwater	Groundwater	inhalation, skin or eye contact, ingestion; strong acid	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Perfluorooctanesulfonamide Erfluoroctylsulfonamide Perfluorooctane sulfonamide Heptadecafluorooctanesulphon amide Perfluorooctanesulfonic acid amide Deethylsulfuramid FC-99 PFOSA FOSA	754-91-6	NA	NA NA	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Perfluorooctanesulfonic Acid PFOS	1763-23- 1	NA	None None	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Perfluorooctanoic Acid PFOA pentadecafluorooctanoic acid perfluorooctanoate perfluorocaprylic acid	335-67-1	NA	None None	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Perfluoropentanoic Acid PFPeA	2706-90- 3	NA	None None	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Perfluoroundecanoic Acid PFUnA PFUnDA Perfluoroundecanoic Acid Henicosfluoroundecanoic Acid	4234-23- 5	NA	None None	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	p-Ethyltoluene 4-Ethyltoluene 1-ethyl-4-methyl-benzene 1-methyl-4-ethylbenzene	622-96-8	NA	NA NA	Soil	ingestion, skin and/or eye contact	irritation to the eyes, skin, mucous membrane; headache; dermatitis; narcosis, coma	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Phenanthrene	85-01-8	PID	0.2 mg/m ³ 80 mg/m ³ (Coal Pitch Tar)	Groundwater Soil	inhalation, skin or eye contact, ingestion	irritation to eyes and skin, respiratory irritation(dizziness, weakness, fatigue, nausea, headache)	Eye: Irrigate immediately, refer to medical attention Skin: Soap wash immediately Breathing: move to fresh air Swallow: Medical attention immediately
1.3.1 – 1.3.17	Phenol Carbolic acid Hydroxybenzene, Monohydroxybenzene Phenyl alcohol Phenyl hydroxide	108-95-2	PID	5 ppm 250 ppm	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, nose, throat; anorexia, weight loss; lassitude (weakness, exhaustion), muscle ache, pain; dark urine, skin burns; dermatitis; tremor, convulsions, twitching	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Posphate	14265- 44-2	NA	0.1 mg/m ³ 70 mg/m ³	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, respiratory system	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Potassium	7440-09-7	None	NA NA	Soil	inhalation, skin absorption, ingestion, skin and/or eye contact inhalation, ingestion, skin and/or eye contact	eye: Causes eye burns. Skin: Causes skin burns. Reacts with moisture in the skin to form potassium hydroxide and hydrogen with much heat. ingestion: Causes gastrointestinal tract burns. inhalation: May cause irritation of the respiratory tract with burning pain in the nose and throat, coughing, wheezing, shortness of breath and pulmonary edema. Causes chemical burns to the respiratory tract. inhalation may be fatal as a result of spasm, inflammation, edema of the larynx and bronchi, chemical pneumonitis and pulmonary edema.	Eyes: Get medical aid immediately Skin: Get medical aid immediately. Immediately flush skin with plenty of water for at least 15 minutes while removing contaminated clothing and shoes. Ingestion: If victim is conscious and alert, give 2-4 full cups of milk or water. Get medical aid immediately. inhalation: Get medical aid immediately.
1.3.1 – 1.3.17	Propylene dichloride Dichloro-1,2-propane 1,2-Dichloropropane	78-87-5	PIDL	75 ppm 400 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, respiratory system; drowsiness, dizziness; liver, kidney damage; in animals: central nervous system depression; [potential occupational carcinogen]	irritation to the eyes, skin, respiratory system; drowsiness, dizziness; liver, kidney damage; in animals: central nervous system depression; [potential occupational carcinogen]

1.3.1 – 1.3.17	p-Xylenes 1,4-Dimethylbenzene para-Xylene p-Xylol	106-42-3	PID	100 ppm 900 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat; dizziness, excitement, drowsiness, incoordination, staggering gait; corneal vacuolization; nausea, vomiting, abdominal pain; dermatitis	Eye: Irrigate immediately Skin: Soap flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Pyrene benzo[def]phenanthrene	129-00-0	PID	0.2 mg/m ³ 80 mg/m ³ (Coal Pitch Tar)	Groundwater Soil	inhalation, skin or eye contact, ingestion	irritation to eyes and skin, respiratory irritation(dizziness, weakness, fatigue, nausea, headache)	Eye: Irrigate immediately, refer to medical attention Skin: Soap wash immediately Breathing: move to fresh air Swallow: Medical attention immediately
1.3.1 – 1.3.17	sec-Butylbenzene	135-98-8	PID	10 ppm 100 ppm	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, nose, throat; inhalation: nausea or vomiting	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Selenium	7782-49- 2	None	1 mg/m ³ 0.2 mg/m ³	Soil	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat; visual disturbance; headache; chills, fever; dyspnea (breathing difficulty), bronchitis; metallic taste, garlic breath, gastrointestinal disturbance; dermatitis; eye, skin burns; in animals: anemia; liver necrosis, cirrhosis; kidney, spleen damage	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Silver	7440-22- 4	None	0.01 mg/ m ³ 10 mg/m ³	Soil	inhalation, ingestion, skin and/or eye contact	blue-gray eyes, nasal septum, throat, skin; irritation, ulceration skin; gastrointestinal disturbance	Eye: Irrigate immediately Skin: Water flush Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Sodium	7440-23- 5	None	NA NA	Groundwater Soil	ion, ingestion, skin and/or eye contact	sensitization dermatitis, allergic asthma, pneumonitis; [potential occupational carcinogen]	Skin: Water flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Sodium 1H,1H,2H,2H- Perfluorodecane Sulfonate; 8:2 FTS	27619- 96-1	NA	None None	Groundwater	inhalation, skin or eye contact, ingestion	irritation to eyes with possible eye damage, skin causing rash, redness or burning, irritation to nose, throat and lungs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Styrene Ethenyl benzene Phenylethylene Styrene monomer Styrol Vinyl benzene	100-42-5	PID	100 ppm 700 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, nose, respiratory system; headache, lassitude (weakness, exhaustion), dizziness, confusion, malaise (vague feeling of discomfort), drowsiness, unsteady gait; narcosis; defatting dermatitis; possible liver injury; reproductive effects	Eye: Irrigate immediately Skin: Water flush Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Sulfate	14808- 79-8	None	NA NA	Groundwater Soil	inhalation, skin and/or eye contact	irritation to the eyes, skin, mucous membrane	Eye: Irrigate immediately Skin: Soap wash Breathing: Fresh air
1.3.1 – 1.3.17	Tert-Butyl Alcohol Tertiary Butyl Alcohol Tert-Butanol Butyl alcohol 2-Methyl-2-propanol Trimethyl carbinol TBA	75-65-0	PID	100 ppm 1600 ppm	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat; drowsiness, narcosis	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	tert-Butylbenzene t-Butylbenzene 2-Methyl-2-phenylpropane Pseudobutylbenzene	98-06-6	PID	10 ppm NA	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	eye, skin irritation; dry nose, throat; headaches; low blood pressure, tachycardia; abnormal cardiovascular system; central nervous system depression; hematopoietic depression	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Tetrachloroethylene Perchloroethylene Perchloroethylene PCE Perk Tetrachlorethylene Tetrachloroethene	127-18-4	PID	100 ppm 150 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat, respiratory system; nausea; flush face, neck; dizziness, incoordination; headache, drowsiness; skin erythema (skin redness); liver damage; [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Tetrahydrofuran Diethylene oxide 1,4-Epoxybutane Tetramethylene oxide THF	109-99-9	PID	200 ppm 2000 ppm	Groundwater Soil Vapor	inhalation, skin and/or eye contact, ingestion	irritation to the eyes, upper respiratory system; nausea, dizziness, headache, central nervous system depression	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immedi
1.3.1 – 1.3.17	Thallium	7440-28- 0	None	0.1 mg/m ³ 15 mg/m ³	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	nausea, diarrhea, abdominal pain, vomiting; ptosis, strabismus; peri neuritis, tremor; retrosternal (occurring behind the sternum) tightness, chest pain, pulmonary edema; convulsions, chorea, psychosis; liver, kidney damage; alopecia; paresthesia legs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Toluene Methyl benzene Methyl benzol Phenyl methane Toluol	108-88-3	PID	200 ppm 500 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, nose; lassitude (weakness, exhaustion), confusion, euphoria, dizziness, headache; dilated pupils, lacrimation (discharge of tears); anxiety, muscle fatigue, paresthesia; dermatitis	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Total PCBs Chlorodiphenyl (42% chlorine) Aroclor® 1242 PCB Polychlorinated biphenyl	53469- 21-9	None	0.5 mg/m ³ 5 mg/m ³	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, chloracne	Eye: Irrigate immediately Skin: Soap wash immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Total Petroleum Hydrocarbons TPH	CASID30 220	PID	NA NA	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, mucous membrane; dermatitis; headache, lassitude (weakness, exhaustion), blurred vision, dizziness, slurred speech, confusion, convulsions; chemical pneumonitis (aspiration liquid)	Eye: Irrigate immediately Skin: Soap flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Total Xylenes Dimethylbenzene Xylol	1330-20- 7	PID	100 ppm 900 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin, nose, throat; dizziness, excitement, drowsiness, incoordination, staggering gait; corneal vacuolization; nausea, vomiting, abdominal pain; dermatitis	Eye: Irrigate immediately Skin: Soap flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Trans-1,2-Dichloroethene trans-1,2-Dichloroethylene tDEC trans-Acetylene dichloride	156-60-5	PID	200 ppm 4000 ppm	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	Irritant to eyes, skin, mucous membranes and respiratory system. May be harmful by ingestion, skin absorption and inhalation	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Trichloroethylene Ethylene trichloride TCE Trichloroethene Trilene	79-01-6	PID	100 ppm 1000 ppm	Groundwater Soil Vapor	inhalation, skin absorption, ingestion, skin and/or eye contact	irritation to the eyes, skin; headache, visual disturbance, lassitude (weakness, exhaustion), dizziness, tremor, drowsiness, nausea, vomiting; dermatitis; cardiac arrhythmias, paresthesia; liver injury; [potential occupational carcinogen]	Eye: Irrigate immediately Skin: Soap wash promptly Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Trichlorofluoromethane Fluorotrichloromethane Freon® 11 Monofluorotrichloromethane Refrigerant 11 Trichloromonofluoromethane	75-69-4	PID	1000 ppm 2000 ppm	Groundwater Soil Vapor	inhalation, ingestion, skin and/or eye contact	incoordination, tremor; dermatitis; cardiac arrhythmias, cardiac arrest; asphyxia; liquid: frostbite	Eye: Irrigate immediately Skin: Water flush immediately Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Trivalent Chromium Chromium III Chromium, Trivalent	NA	None	1.0 mg/m ³ 250 mg/m ³	Groundwater Soil	inhalation absorption ingestion	irritation to eye, skin, and respiratory	Eye: Irrigate immediately Skin: Soap wash Breathing: Respiratory support Swallow: Medical attention immediately
1.3.1 – 1.3.17	Vanadium	7440-62- 2	None	0.1 mg/m ³ 15 mg/m ³	Groundwater Soil	inhalation, skin absorption, ingestion, skin and/or eye contact	nausea, diarrhea, abdominal pain, vomiting; ptosis, strabismus; peri neuritis, tremor; retrosternal (occurring behind the sternum) tightness, chest pain, pulmonary edema; convulsions, chorea, psychosis; liver, kidney damage; alopecia; paresthesia legs	Eye: Irrigate immediately Skin: Water flush promptly Breathing: Respiratory support Swallow: Medical attention immediately

1.3.1 – 1.3.17	Vinyl Chloride Chloroethene Chloroethylen Ethylene monochloride Monochloroethene Monochloroethylene VC Vinyl chloride monomer (VCM)	75-01-4	PID	1 ppm NA	Groundwater Soil Vapor	inhalation, skin and/or eye contact (liquid)	lassitude (weakness, exhaustion); abdominal pain, gastrointestinal bleeding; enlarged liver; pallor or cyanosis of extremities; liquid: frostbite; [potential occupational carcinogen]	Eye: Frostbite Skin: Frostbite Breathing: Respiratory support
1.3.1 – 1.3.17	Zinc	7440-62- 2	None	15 mg/m ³ 500 mg/m ³	Groundwater Soil	inhalation	chills, muscle ache, nausea, fever, dry throat, cough; lassitude (weakness, exhaustion); metallic taste; headache; blurred vision; low back pain; vomiting; malaise (vague feeling of discomfort); chest tightness; dyspnea (breathing difficulty), rales, decreased pulmonary function	Breathing: Respiratory support

EXPLANATION OF ABBREVIATIONS

PID = Photoionization Detector

PEL = Permissible Exposure Limit (8-hour Time Weighted Average)

IDLH = Immediately Dangerous to Life and Health

ppm = part per million

mg/m³ = milligrams per cubic meter

TABLE 3
Summary of Monitoring Equipment

Instrument	Operation Parameters
Photoionization Detector (PID)	<p>Hazard Monitored: Many organic and some inorganic gases and vapors.</p> <p>Application: Detects total concentration of many organic and some inorganic gases and vapors. Some identification of compounds is possible if more than one probe is measured.</p> <p>Detection Method: Ionizes molecules using UV radiation; produces a current that is proportional to the number of ions.</p> <p>General Care/Maintenance: Recharge or replace battery. Regularly clean lamp window. Regularly clean and maintain the instrument and accessories.</p> <p>Typical Operating Time: 10 hours. 5 hours with strip chart recorder.</p>
Oxygen Meter	<p>Hazard Monitored: Oxygen (O₂).</p> <p>Application: Measures the percentage of O₂ in the air.</p> <p>Detection Method: Uses an electrochemical sensor to measure the partial pressure of O₂ in the air, and converts the reading to O₂ concentration.</p> <p>General Care/Maintenance: Replace detector cell according to manufacturer's recommendations. Recharge or replace batteries prior to expiration of the specified interval. If the ambient air is less than 0.5% C O₂, replace the detector cell frequently.</p> <p>Typical Operating Time: 8 – 12 hours.</p>
Mercury Vapor Analyzer	<p>Hazard Monitored: Mercury Vapor.</p> <p>Application: Detects total concentration of mercury in the air.</p> <p>Detection Method: Uses a gold film sensor. A thin gold film, in the presence of mercury vapor, undergoes an increase in electrical resistance proportional to the mass of mercury vapor in the sample.</p> <p>General Care/Maintenance: Recharge or replace battery. Regular change the intake filter. Replace the acidic gas filter as need. Regularly clean and maintain the instrument and accessories.</p> <p>Typical Operating Time: 8 – 12 hours.</p>
Additional equipment (if needed, based on site conditions)	
Combustible Gas Indicator (CGI)	<p>Hazard Monitored: Combustible gases and vapors.</p> <p>Application: Measures the concentration of combustible gas or vapor.</p> <p>Detection Method: A filament, usually made of platinum, is heated by burning the combustible gas or vapor. The increase in heat is measured. Gases and vapors are ionized in a flame. A current is produced in proportion to the number of carbon atoms present.</p> <p>General Care/Maintenance: Recharge or replace battery. Calibrate immediately before use.</p> <p>Typical Operating Time: Can be used for as long as the battery lasts, or for the recommended interval between calibrations, whichever is less.</p>
Flame Ionization Detector (FID) with Gas Chromatography Option <i>(i.e., Foxboro Organic Vapor Analyzer (OVA))</i>	<p>Hazard Monitored: Many organic gases and vapors (approved areas only).</p> <p>Application: In survey mode, detects the concentration of many organic gases and vapors. In gas chromatography (GC) mode, identifies and measures specific compounds. In survey mode, all the organic compounds are ionized and detected at the same time. In GC mode, volatile species are separated.</p> <p>General Care/Maintenance: Recharge or replace battery. Monitor fuel and/or combustion air supply gauges. Perform routine maintenance as described in the manual. Check for leaks.</p> <p>Typical Operating Time: 8 hours; 3 hours with strip chart recorder.</p>

Instrument	Operation Parameters
Potable Infrared (IR) Spectrophotometer	<p>Hazard Monitored: Many gases and vapors.</p> <p>Application: Measures concentration of many gases and vapors in air. Designed to quantify one or two component mixtures.</p> <p>Detection Method: Passes different frequencies of IR through the sample. The frequencies absorbed are specific for each compound.</p> <p>General Care/Maintenance: As specified by the manufacturer.</p>
Direct Reading Colorimetric Indicator Tube	<p>Hazard Monitored: Specific gas and vapors.</p> <p>Application: Measures concentration of specific gases and vapors.</p> <p>Detection Method: The compound reacts with the indicator chemical in the tube, producing a stain whose length or color change is proportional to the compound's concentration.</p> <p>General Care/Maintenance: Do not use a previously opened tube even if the indicator chemical is not stained. Check pump for leaks before and after use. Refrigerate before use to maintain a shelf life of about 2 years. Check expiration dates of tubes. Calibrate pump volume at least quarterly. Avoid rough handling which may cause channeling.</p>
Aerosol Monitor	<p>Hazard Monitored: Airborne particulate (dust, mist, fume) concentrations</p> <p>Application: Measures total concentration of semi-volatile organic compounds, PCBs, and metals.</p> <p>Detection Method: Based on light-scattering properties of particulate matter. Using an internal pump, air sample is drawn into the sensing volume where near infrared light scattering is used to detect particles.</p> <p>General Care/Maintenance: As specified by the mfr. Also, the instrument must be calibrated with particulates of a size and refractive index similar to those to be measured in the ambient air.</p>
Monitox	<p>Hazard Monitored: Gases and vapors.</p> <p>Application: Measures specific gases and vapors.</p> <p>Detection Method: Electrochemical sensor relatively specific for the chemical species in question.</p> <p>General Care/Maintenance: Moisten sponge before use; check the function switch; change the battery when needed.</p>
Gamma Radiation Survey Instrument	<p>Hazard Monitored: Gamma Radiation.</p> <p>Application: Environmental radiation monitor.</p> <p>Detection Method: Scintillation detector.</p> <p>General Care/Maintenance: Must be calibrated annually at a specialized facility.</p> <p>Typical Operating Time: Can be used for as long as the battery lasts, or for the recommended interval between calibrations, whichever is less.</p>

**TABLE 4
INSTRUMENTATION ACTION LEVELS**

Photoionization Detector Action Levels	Action Required
Background to 5 ppm ¹	No Respirator, no further action
> 5 ppm but < 25 ppm for > 15 minutes ²	Temporarily discontinue all activities and evaluate potential causes of the excessive readings. If these levels persist and cannot be mitigated, contact HSO to review conditions and determine source and appropriate response action
>25ppm ³	1. Activities will shut down 2. Evaluate potential causes of the excessive readings, activate mitigation measures until levels fall below 25 ppm
Particulate Monitoring Action Levels⁴	Action Required
Background to 100 µg/m ³ , no dust observed	No further action
Background to 100 µg/m ³ , dust observed leaving the work area	Dust suppression must be employed
100 to 150 µg/m ³ at the downwind perimeter of the hot zone	Temporarily discontinue all activities and implement dust suppression techniques. Work may continue with dust suppression techniques provided that no visible dust is migrating from the work area.
>150 µg/m ³ at the perimeter of the hot zone	Temporarily discontinue all activities and evaluate potential causes of the excessive readings. If these levels persist and cannot be mitigated, contact HSO to review conditions and determine source and appropriate response action.
Mercury Vapor Action Levels	Action Required
Background to 1 µg/m ³	No further action
> 1 µg/m ³ but < 10 µg/m ³	Temporarily discontinue all activities and evaluate potential causes of the excessive readings. If these levels persist and cannot be mitigated, contact HSO to review conditions and determine source and appropriate response action.
> 10 µg/m ³	1. Discontinue all work; all workers shall move to an area upwind of the jobsite. 2. Evaluate potential causes of the excessive readings, activate mitigation measures until levels fall below 10 µg/m ³

¹ 5 ppm level based on OSHA Short Term Exposure Limit (STEL) for benzene based on a 15-minute averages above site background (upwind parameter)

² 100 ppm level based on 1 percent being the OSHA Permissible Exposure Limit (PEL) for benzene (1 ppm), the cited value of 25 ppm is based on NYSDEP CAMP requirements

³ 500 ppm level based on NIOSH Immediately Dangerous to Life and Health (IDLH) for benzene and toluene

⁴ Particulate concentrations are 15 minute averages above site background (upwind parameter)

**TABLE 5
EMERGENCY NOTIFICATION LIST**

ORGANIZATION	CONTACT	TELEPHONE
Local Police Department		911
Local Fire Department		911
Ambulance/Rescue Squad		911
Hospital	New York Presbyterian Hospital	911 or 212-312-5000
Langan Incident Hotline		800-952-6426 ex 4699
Medical Treatment Hotline	Incident Intervention	888-449-7787
Langan Environmental Project Manager	Paul McMahon	914-433-1157 (cell)
Langan Health and Safety Manager (HSM)	Tony Moffa	215-756-2523 (cell)
Langan Health & Safety Officer (HSO)	William Bohrer	410-984-3068 (cell)
Langan Field Team Leader (FTL)	To Be Determined	
Client's Representative	Adam Meister	212-248-5168
National Response Center (NRC)		800-424-8802
Chemical Transportation Emergency Center (Chemtrec)		800-424-9300
Center for Disease Control (CDC)		404-639-3534
EPA (RCRA Superfund Hotline)		800-424-9346
TSCA Hotline		202-554-1404
Poison Control Center		800-222-1222

Immediately following an injury, unless immediate emergency medical treatment is required, the injured employee must contact Incident Intervention® at 888-449-7787.

For all other incidents or near misses, unless emergency response is required, either the employee or a coworker must contact the Langan Incident Hotline at 1-(800)-9-LANGAN (ext. #4699).

1. TABLE 6
SUGGESTED FREQUENCY OF PHYSIOLOGICAL MONITORING
FOR FIT AND ACCLIMATED WORKERS^A

Adjusted Temperature^b	Normal Work Ensemble^c	Impermeable Ensemble
90°F or above (32.2°C) or above	After each 45 min. of work	After each 15 min. of work
87.5°F (30.8°-32.2°C)	After each 60 min. of work	After each 30 min. of work
82.5°-87.5°F (28.1°-30.8°C)	After each 90 min. of work	After each 60 min. of work
77.5°-82.5°F (25.3°-28.1°C)	After each 120 min. of work	After each 90 min. of work
72.5°-77.5°F (22.5°-25.3°C)	After each 150 min. of work	After each 120 min. of work

a For work levels of 250 kilocalories/hour.

b Calculate the adjusted air temperature (ta adj) by using this equation: $ta\ adj\ ^\circ F = ta\ ^\circ F + (13 \times \% \text{ sunshine})$. Measure air temperature (ta) with a standard mercury-in-glass thermometer, with the bulb shielded from radiant heat. Estimate percent sunshine by judging what percent time the sun is not covered by clouds that are thick enough to produce a shadow. (100 percent sunshine = no cloud cover and a sharp, distinct shadow; 0 percent sunshine = no shadows.)

c A normal work ensemble consists of cotton coveralls or other cotton clothing with long sleeves and pants.

**TABLE 7
HEAT INDEX**

RELATIVE HUMIDITY	ENVIRONMENTAL TEMPERATURE (Fahrenheit)										
	70	75	80	85	90	95	100	105	110	115	120
	APPARENT TEMPERATURE*										
0%	64	69	73	78	83	87	91	95	99	103	107
10%	65	70	75	80	85	90	95	100	105	111	116
20%	66	72	77	82	87	93	99	105	112	120	130
30%	67	73	78	84	90	96	104	113	123	135	148
40%	68	74	79	86	93	101	110	123	137	151	
50%	69	75	81	88	96	107	120	135	150		
60%	70	76	82	90	100	114	132	149			
70%	70	77	85	93	106	124	144				
80%	71	78	86	97	113	136					
90%	71	79	88	102	122						
100%	72	80	91	108							

*Combined Index of Heat and Humidity...what it "feels like" to the body
Source: National Oceanic and Atmospheric Administration

How to use Heat Index:

1. Across top locate Environmental Temperature
2. Down left side locate Relative Humidity
3. Follow across and down to find Apparent Temperature
4. Determine Heat Stress Risk on chart at right

Note: Exposure to full sunshine can increase Heat Index values by up to 15 degrees F.

Apparent Temperature	Heat Stress Risk with Physical Activity and/or Prolonged Exposure
90-105	Heat Cramps or Heat Exhaustion Possible
105-130	Heat Cramps or Heat Exhaustion Likely, Heat Stroke Possible
>130	Heatstroke Highly Likely

FIGURES

FIGURE 2

HOSPITAL ROUTE PLAN


HOSPITAL ROUTE PLAN

Hospital Location: New York Presbyterian Hospital
83 Gold Street/170 William Street
New York, New York
212-312-5000

START: 250 Water Street, NY, NY

1. Head northeast on Water Street toward Peck Slip
2. Turn left at 1st cross street onto Peck Slip
3. Turn right onto Pearl Street
4. Turn left onto Frankfort Street
5. Turn left at the 1st cross street onto Gold Street, destination will be on the left.

END: New York Presbyterian Hospital, 83 Gold Street/170 William Street, NY, NY

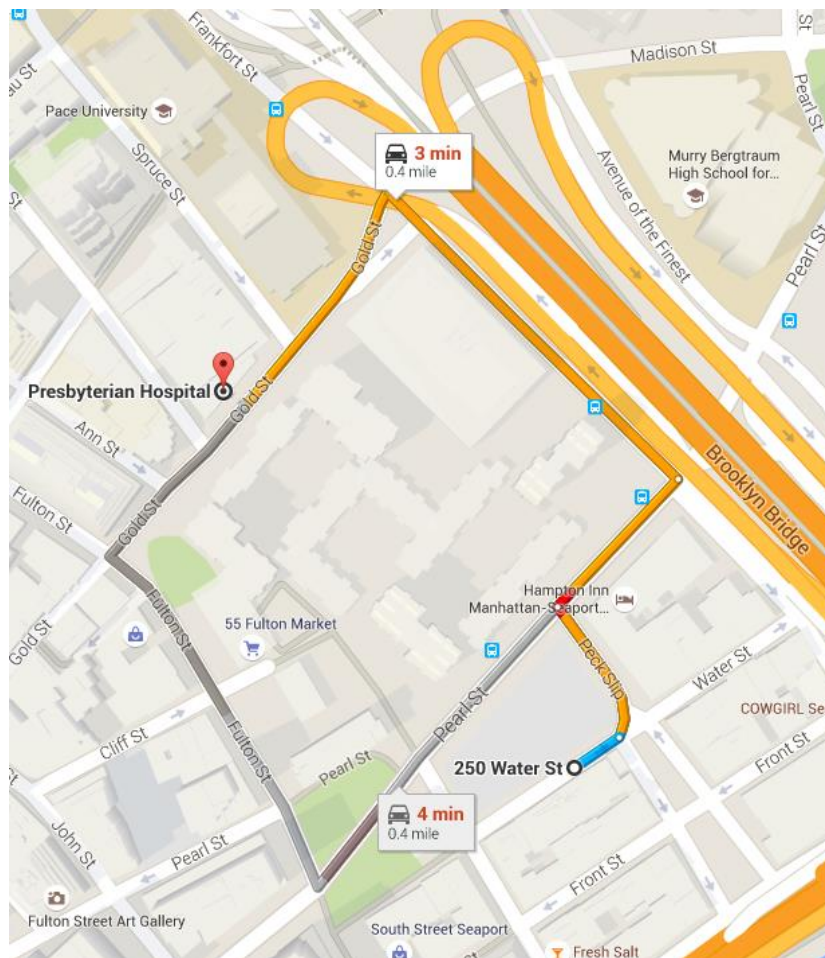

ATTACHMENT A

STANDING ORDERS

STANDING ORDERS

GENERAL

- No smoking, eating, or drinking in this work zone.
- Upon leaving the work zone, personnel will thoroughly wash their hands and face.
- Minimize contact with contaminated materials through proper planning of work areas and decontamination areas, and by following proper procedures. Do not place equipment on the ground. Do not sit on contaminated materials.
- No open flames in the work zone.
- Only properly trained and equipped personnel are permitted to work in potentially contaminated areas.
- Always use the appropriate level of PPE.
- Maintain close contact with your buddy in the work zone
- Contaminated material will be contained in the Exclusion Zone (EZ).
- Report any unusual conditions.
- Work areas will be kept clear and uncluttered. Debris and other slip, trip, and fall hazards will be removed as frequently as possible.
- The number of personnel and equipment in the work zone will be kept to an essential minimum.
- Be alert to the symptoms of fatigue and heat/cold stress, and their effects on the normal caution and judgment of personnel.
- Conflicting situations which may arise concerning safety requirements and working conditions must be addressed and resolved quickly by the site HSO.

TOOLS AND HEAVY EQUIPMENT

- Do not, under any circumstances, enter or ride in or on any backhoe bucket, materials hoist, or any other device not specifically designed to carrying passengers.
- Loose-fitting clothing or loose long hair is prohibited around moving machinery.
- Ensure that heavy equipment operators and all other personnel in the work zone are using the same hand signals to communicate.
- Drilling/excavating within 10 feet in any direction of overhead power lines is prohibited.
- The locations of all underground utilities must be identified and marked out prior to initiating any subsurface activities.
- Check to insure that the equipment operator has lowered all blades and buckets to the ground before shutting off the vehicle.
- If the equipment has an emergency stop device, have the operator show all personnel its location and how to activate it.
- Help the operator ensure adequate clearances when the equipment must negotiate in tight quarters; serve as a signalman to direct backing as necessary.
- Ensure that all heavy equipment that is used in the EZ is kept in that zone until the job is done, and that such equipment is completely decontaminated before moving it into the clean area of the work zone.
- Samplers must not reach into or get near rotating equipment such as the drill rig. If personnel must work near any tools that could rotate, the equipment operator must completely shut down the rig prior to initiating such work. It may be necessary to use a remote sampling device.

ATTACHMENT B

DECONTAMINATION PROCEDURES

PERSONNEL DECONTAMINATION

LEVEL C DECONTAMINATION

Station 1:	Equipment Drop	1. Deposit equipment used on-site (tools, sampling devices and containers, monitoring instruments, radios, clipboards, etc.) on plastic drop cloths. Segregation at the drop reduces the probability of cross contamination. During hot weather operations, cool down stations may be set up within this area.
Station 2:	Outer Garment, Boots, and Gloves Wash and Rinse	2. Scrub outer boots, outer gloves and chemical-resistant splash suit with decon solution or detergent and water. Rinse off using copious amounts of water.
Station 3:	Outer Boot and Glove Removal	3. Remove outer boots and gloves. Deposit in container with plastic liner.
Station 4:	Canister or Mask Change	4. If worker leaves Exclusion Zone to change canister (or mask), this is the last step in the decontamination procedure. Worker's canister is exchanged, new outer gloves and boot covers donned, joints taped, and worker returns to duty.
Station 5:	Boot, Gloves and Outer Garment Removal	5. Boots, chemical-resistant splash suit, inner gloves removed and deposited in separate containers lined with plastic.
Station 6:	Face piece Removal	6. Face piece is removed (avoid touching face with fingers). Face piece deposited on plastic sheets.
Station 7:	Field Wash	7. Hands and face are thoroughly washed. Shower as soon as possible.

LEVEL D DECONTAMINATION

Station 1:	Equipment Drop	1. Deposit equipment used on-site (tools, sampling devices and containers, monitoring instruments, radios, clipboards, etc.) on plastic drop cloths. Segregation at the drop reduces the probability of cross contamination. During hot weather operations, cool down stations may be set up within this area.
Station 2:	Outer Garment, Boots, and Gloves Wash and Rinse	2. Scrub outer boots, outer gloves and chemical-resistant splash suit with decon solution or detergent and water. Rinse off using copious amounts of water.
Station 3:	Outer Boot and Glove Removal	3. Remove outer boots and gloves. Deposit in container with plastic liner.
Station 4:	Boot, Gloves and Outer Garment Removal	4. Boots, chemical-resistant splash suit, inner gloves removed and deposited in separate containers lined with plastic.
Station 5:	Field Wash	5. Hands and face are thoroughly washed. Shower as soon as possible.

EQUIPMENT DECONTAMINATION

GENERAL:

Equipment to be decontaminated during the project may include tools, monitoring equipment, respirators, sampling containers, laboratory equipment and drilling equipment.

All decontamination will be done by personnel in protective gear, appropriate for the level of decontamination, as determined by the site HSO. The decontamination work tasks will be split or rotated among support and work crews.

Depending on site conditions, backhoe and pumps may be decontaminated over a portable decontamination pad to contain wash water; or, wash water may be allowed to run off into a storm sewer system. Equipment needed may include a steam generator with high-pressure water, empty drums, screens, screen support structures, and shovels. Drums will be used to hold contaminated wash water pumped from the lined pit. These drums will be labeled as such.

Miscellaneous tools and equipment will be dropped into a plastic pail, tub, or other container. They will be brushed off and rinsed with a detergent solution, and finally rinsed with clean water.

MONITORING EQUIPMENT:

Monitoring equipment will be protected as much as possible from contamination by draping, masking, or otherwise covering as much of the instruments as possible with plastic without hindering the operation of the unit. The PID, HNu or OVA meter, for example, can be placed in a clear plastic bag, which allows reading of the scale and operation of knobs. The probes can be partially wrapped keeping the sensor tip and discharge port clear.

The contaminated equipment will be taken from the drop area and the protective coverings removed and disposed in the appropriate containers. Any dirt or obvious contamination will be brushed or wiped with a disposable paper wipe.

RESPIRATORS:

Respirators will be cleaned and disinfected after every use. Taken from the drop area, the masks (with the cartridges removed and disposed of with other used disposable gear) will be immersed in a cleaning solution and scrubbed gently with a soft brush, followed by a rinse in plain warm water, and then allowed to air dry. In the morning, new cartridges will be installed. Personnel will inspect their own masks for serviceability prior to donning them. And, once the mask is on, the wearer will check the respirator for leakage using the negative and positive pressure fit check techniques.

ATTACHMENT C

EMPLOYEE EXPOSURE/ INJURY INCIDENT REPORT

EMPLOYEE INCIDENT/INJURY REPORT LANGAN ENGINEERING & ENVIRONMENTAL SERVICES

(Complete and return to Tony Moffa in the Doylestown Office)

Affected Employee Name: _____ Date: _____

Incident type: Injury Report Only/No Injury
 Near Miss Other: _____

EMPLOYEE INFORMATION (Person completing Form)

Employee Name: _____ Employee
No: _____

Title: _____ Office _____ Location: _____

Length of time employed or date of hire: _____

Mailing address: _____

Sex: M F Birth date: _____

Business phone & extension: _____ Residence/cell phone: _____

ACCIDENT INFORMATION

Project: _____ Project #:

Date & time of incident: _____ Time work started & ended: _____

Site location: _____

Incident Type: Possible Exposure Exposure Physical Injury

Names of person(s) who witnessed the incident: _____

Exact location incident occurred: _____

Describe work being done: _____

Describe what affected employee was doing prior to the incident occurring: _____

Describe in detail how the incident occurred: _____

Nature of the incident (List the parts of the body affected): _____

Person(s) to whom incident was reported (Time and Date): _____

List the names of other persons affected during this incident: _____

Possible causes of the incident (equipment, unsafe work practices, lack of PPE, etc.):

Weather conditions during incident:

MEDICAL CARE INFORMATION

Did affected employee receive medical care? Yes No

If Yes, when and where was medical care received: _____

Provide name of facility (hospital, clinic, etc.):

Length of stay at the facility?

Did the employee miss any work time? Yes No Undetermined

Date employee last worked: _____ Date employee returned to work: _____

Has the employee returned to work? Yes No

Does the employee have any work limitations or restrictions from the injury? : Yes No

If Yes, please describe:

Did the exposure/injury result in permanent disability? Yes No Unknown

If Yes, please describe:

HEALTH & SAFETY INFORMATION

Was the operation being conducted under an established site specific HEALTH AND SAFETY PLAN?

Yes No Not Applicable:

Describe protective equipment and clothing used by the employee:

Did any limitations in safety equipment or protective clothing contribute to or affect exposure / injury? If so, explain:

Employee Signature

Date

Langan Representative

Date

ATTACHMENT D

CALIBRATION LOG

ATTACHMENT E

MATERIAL SAFETY DATA SHEETS

SAFETY DATA SHEETS

All Langan Field Personnel Completing This Work Plan Are To Have Real Time Accessibility To Material Safety Data Sheet (MSDs) or Safety Data Sheet (SDSs) Through Their Smart Phone.

*The link is <http://www.msds.com/>
The login name is "drapehead"
The password is "2angan987"*

If You Are Unable To Use the Smart Phone App, You Are To Bring Printed Copies of the MSDs/SDSs to the Site

CINNAMON/VANILLA GRANULES RusScent

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 /
Monday, March 26, 2012 / Rules and Regulations
Date of issue: 02/03/2014 Revision date: 01/01/2016
Supersedes: 01/01/2011
Version: 1.2014

SECTION 1: Identification of the substance/mixture and of the company/undertaking

1.1. Product identifier

Product form : Mixture
Product name. : CINNAMON/VANILLA GRANULES RusScent
Product code : 10813 G

1.2. Relevant identified uses of the substance or mixture and uses advised against

Use of the substance/mixture : Deodorant

1.3. Details of the supplier of the safety data sheet

1.4. Emergency telephone number

Emergency number : +1 610 436-4314

SECTION 2: Hazards identification

2.1. Classification of the substance or mixture

GHS-US classification

Not classified

2.2. Label elements

GHS-US labelling

Precautionary Statement : P501 - Dispose of contents/container in accordance with all local/regional/federal/international laws.

2.3. Other hazards

Other hazards not contributing to the classification : None under normal conditions.

2.4. Unknown acute toxicity (GHS-US)

No data available

SECTION 3: Composition/information on ingredients

3.1. Substances

Not applicable

Full text of H-phrases: see section 16

3.2. Mixture

SECTION 4: First aid measures

4.1. Description of first aid measures

First-aid measures general : IF exposed or concerned: Get medical advice/attention.
First-aid measures after inhalation : If breathing is difficult, remove victim to fresh air and keep at rest in a position comfortable for breathing. If you feel unwell, seek medical advice.
First-aid measures after skin contact : Brush off loose particles from skin. Remove affected clothing and wash all exposed skin area with mild soap and water, followed by warm water rinse. Wash contaminated clothing before reuse.
First-aid measures after eye contact : IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. Obtain medical attention if pain, blinking or redness persist.
First-aid measures after ingestion : Drink plenty of water. Do NOT induce vomiting. Call a POISON CENTER/doctor/physician if you feel unwell.

4.2. Most important symptoms and effects, both acute and delayed

Symptoms/injuries : Not expected to present a significant hazard under anticipated conditions of normal use.
Symptoms/injuries after inhalation : None under normal use.
Symptoms/injuries after skin contact : Contact during a long period may cause light irritation.
Symptoms/injuries after eye contact : Direct contact with the eyes is likely to be irritating.

4.3. Indication of any immediate medical attention and special treatment needed

No additional information available

CINNAMON/VANILLA GRANULES RusScent

Safety Data Sheet

According to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

SECTION 5: Firefighting measures

5.1. Extinguishing media

Suitable extinguishing media : Carbon dioxide. Dry powder. Foam.

5.2. Special hazards arising from the substance or mixture

Reactivity : Product is not explosive.

5.3. Advice for firefighters

No additional information available

SECTION 6: Accidental release measures

6.1. Personal precautions, protective equipment and emergency procedures

General measures : Remove ignition sources.

6.1.1. For non-emergency personnel

No additional information available

6.1.2. For emergency responders

No additional information available

6.2. Environmental precautions

No additional information available

6.3. Methods and material for containment and cleaning up

Methods for cleaning up : On land, sweep or shovel into suitable containers. This material and its container must be disposed of in a safe way, and as per local legislation.

6.4. Reference to other sections

No additional information available

SECTION 7: Handling and storage

7.1. Precautions for safe handling

Precautions for safe handling : Do not eat, drink or smoke when using this product. Do not get in eyes, on skin, or on clothing. Keep away from sources of ignition - No smoking. Use personal protective equipment as required. Wash hands and other exposed areas with mild soap and water before eating, drinking or smoking and when leaving work.

Hygiene measures : Do not eat, drink or smoke when using this product. Wash contaminated clothing before reuse. Wash hands and other exposed areas with mild soap and water before eating, drinking or smoking and when leaving work.

7.2. Conditions for safe storage, including any incompatibilities

Technical measures : Comply with applicable regulations.

Storage conditions : Keep container closed when not in use. Keep only in the original container in a cool, well ventilated place away from : Direct sunlight. Protect from moisture.

Incompatible products : Oxidizing agent.

Maximum storage period : >= 2 year may darken with

Storage area : Store away from heat. Store in a well-ventilated place.

Special rules on packaging : Keep only in original container.

7.3. Specific end use(s)

No additional information available

SECTION 8: Exposure controls/personal protection

8.1. Control parameters

No additional information available

8.2. Exposure controls

Personal protective equipment : Dust formation: dust mask. Gloves. Safety glasses.



Hand protection : Wear chemically resistant gloves.

CINNAMON/VANILLA GRANULES RusScent

Safety Data Sheet

According to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Eye protection	: Chemical goggles or safety glasses.
Skin and body protection	: Wear suitable protective clothing.
Respiratory protection	: Dust Mask.
Thermal hazard protection	: Not necessary.

SECTION 9: Physical and chemical properties

9.1. Information on basic physical and chemical properties

Physical state	: Solid
Appearance	: Granular.
Color	: Gray to tan (or red) granules.
Odor	: Cinnamon/ vanilla.
Odor threshold	: No data available
pH	: No data available
Relative evaporation rate (butyl acetate=1)	: No data available
Melting point	: N/A
Freezing point	: N/A
Boiling point	: N/A
Flash point	: N/A
Self-ignition temperature	: No data available
Decomposition temperature	: No data available
Flammability (solid, gas)	: No data available
Vapor pressure	: No data available
Relative vapor density at 20 °C	: No data available
Relative density	: N/A
Solubility	: N/A.
Log Pow	: No data available
Log Kow	: No data available
Viscosity, kinematic	: No data available
Viscosity, dynamic	: No data available
Explosive properties	: No data available
Oxidizing properties	: No data available
Explosive limits	: No data available

9.2. Other information

No additional information available

SECTION 10: Stability and reactivity

10.1. Reactivity

Product is not explosive.

10.2. Chemical stability

No additional information available

10.3. Possibility of hazardous reactions

No additional information available

10.4. Conditions to avoid

No additional information available

10.5. Incompatible materials

No additional information available

10.6. Hazardous decomposition products

None Known.

SECTION 11: Toxicological information

11.1. Information on toxicological effects

CINNAMON/VANILLA GRANULES RusScent

Safety Data Sheet

According to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Acute toxicity	: Not classified
Skin corrosion/irritation	: Not classified
Serious eye damage/irritation	: Not classified
Respiratory or skin sensitization	: Not classified
Germ cell mutagenicity	: Not classified
Carcinogenicity	: Not classified
Reproductive toxicity	: Not classified
Specific target organ toxicity (single exposure)	: Not classified
Specific target organ toxicity (repeated exposure)	: Not classified
Aspiration hazard	: Not classified
Symptoms/injuries after inhalation	: None under normal use.
Symptoms/injuries after skin contact	: Contact during a long period may cause light irritation.
Symptoms/injuries after eye contact	: Direct contact with the eyes is likely to be irritating.

SECTION 12: Ecological information

12.1. Toxicity

No additional information available

12.2. Persistence and degradability

No additional information available

12.3. Bio accumulative potential

No additional information available

12.4. Mobility in soil

No additional information available

12.5. Other adverse effects

No additional information available

SECTION 13: Disposal considerations

13.1. Waste treatment methods

Waste disposal recommendations : Dispose in a safe manner in accordance with local/national regulations.

SECTION 14: Transport information

In accordance with DOT

No dangerous good in sense of transport regulations

Additional information

Other information : No supplementary information available.

ADR

Transport document description :

Transport by sea

No additional information available

Air transport

No additional information available

SECTION 15: Regulatory information

15.1. US Federal regulations

No additional information available

15.2. International regulations

CANADA

No additional information available

CINNAMON/VANILLA GRANULES RusScent

Safety Data Sheet

According to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

EU-Regulations

No additional information available

Classification according to Regulation (EC) No. 1272/2008 [CLP]

Classification according to Directive 67/548/EEC or 1999/45/EC

Not classified

15.2.2. National regulations

No additional information available

15.3. US State regulations

No additional information available

SECTION 16: Other information

HMIS III Rating

Health	: 1 Slight Hazard - Irritation or minor reversible injury possible
Flammability	: 1 Slight Hazard
Physical	: 0 Minimal Hazard
Personal Protection	: B

SDS US (GHS HazCom 2012)

This information is based on our current knowledge and is intended to describe the product for the purposes of health, safety and environmental requirements only. It should not therefore be construed as guaranteeing any specific property of the product



SAFETY DATA SHEET

LONG DURATION FOAM AC-645

Section 1. Identification

GHS product identifier : LONG DURATION FOAM AC-645
Chemical name : Proprietary Surfactant.
Other means of identification : Aqueous anionic surfactant mixture.
Product type : Liquid.

Relevant identified uses of the substance or mixture and uses advised against

Product use : Aqueous Surfactant. Spray application for VOC and Odor control.
Area of application : Industrial applications.

Supplier/Manufacturer : Rusmar, Inc.
216 Garfield Avenue
West Chester, PA 19380
Phone: 610-436-4314
Fax: 610-436-8436

e-mail address of person responsible for this SDS : info@rusmarinc.com
Website: www.rusmarinc.com

Emergency telephone number (with hours of operation) : 888 488 8044 or 212 682 1200
CHEMTREC 800 424 9300

Section 2. Hazards identification

OSHA/HCS status : While this material is not considered hazardous by the OSHA Hazard Communication Standard (29 CFR 1910.1200), this SDS contains valuable information critical to the safe handling and proper use of the product. This SDS should be retained and available for employees and other users of this product.

Classification of the substance or mixture : Not classified.

GHS label elements

Signal word : No signal word.
Hazard statements : No known significant effects or critical hazards.

Precautionary statements

Prevention : Not applicable.
Response : Not applicable.
Storage : Not applicable.
Disposal : Not applicable.

Hazards not otherwise classified : None known.

Date of issue/Date of revision : 05/28/2015 **Date of previous issue** : No previous validation **Version** : 1 1/11

Section 3. Composition/information on ingredients

Substance/mixture : Substance
Chemical name : Proprietary Surfactant.
Other means of identification : Aqueous anionic surfactant mixture.

CAS number/other identifiers

CAS number : Not available.
Product code : Not available.

Ingredient name	Other names	%	CAS number
Proprietary Surfactant.	-	100	-

Any concentration shown as a range is to protect confidentiality or is due to batch variation.

There are no additional ingredients present which, within the current knowledge of the supplier and in the concentrations applicable, are classified as hazardous to health and hence require reporting in this section.

Section 4. First aid measures

Description of necessary first aid measures

Eye contact : Immediately flush eyes with plenty of water, occasionally lifting the upper and lower eyelids. Check for and remove any contact lenses. Get medical attention if irritation occurs.

Inhalation : Remove victim to fresh air and keep at rest in a position comfortable for breathing. Get medical attention if symptoms occur.

Skin contact : Flush contaminated skin with plenty of water. Remove contaminated clothing and shoes. Get medical attention if symptoms occur.

Ingestion : Wash out mouth with water. Remove victim to fresh air and keep at rest in a position comfortable for breathing. If material has been swallowed and the exposed person is conscious, give small quantities of water to drink. Do not induce vomiting unless directed to do so by medical personnel. Get medical attention if symptoms occur.

Most important symptoms/effects, acute and delayed

Potential acute health effects

Eye contact : No known significant effects or critical hazards.
Inhalation : No known significant effects or critical hazards.
Skin contact : No known significant effects or critical hazards.
Ingestion : No known significant effects or critical hazards.

Over-exposure signs/symptoms

Eye contact : No specific data.
Inhalation : No specific data.
Skin contact : No specific data.
Ingestion : No specific data.

Indication of immediate medical attention and special treatment needed, if necessary

Notes to physician : Treat symptomatically. Contact poison treatment specialist immediately if large quantities have been ingested or inhaled.

Specific treatments : No specific treatment.

Section 4. First aid measures

Protection of first-aiders : No action shall be taken involving any personal risk or without suitable training.

See toxicological information (Section 11)

Section 5. Fire-fighting measures

Extinguishing media

Suitable extinguishing media : Use an extinguishing agent suitable for the surrounding fire.

Unsuitable extinguishing media : None known.

Specific hazards arising from the chemical : In a fire or if heated, a pressure increase will occur and the container may burst.

Hazardous thermal decomposition products : Decomposition products may include the following materials:
carbon dioxide
carbon monoxide
sulfur oxides

Special protective actions for fire-fighters : Promptly isolate the scene by removing all persons from the vicinity of the incident if there is a fire. No action shall be taken involving any personal risk or without suitable training.

Special protective equipment for fire-fighters : Fire-fighters should wear appropriate protective equipment and self-contained breathing apparatus (SCBA) with a full face-piece operated in positive pressure mode.

Section 6. Accidental release measures

Personal precautions, protective equipment and emergency procedures

For non-emergency personnel : No action shall be taken involving any personal risk or without suitable training. Evacuate surrounding areas. Keep unnecessary and unprotected personnel from entering. Do not touch or walk through spilled material. Put on appropriate personal protective equipment.

For emergency responders : If specialised clothing is required to deal with the spillage, take note of any information in Section 8 on suitable and unsuitable materials. See also the information in "For non-emergency personnel".

Environmental precautions : Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers. Inform the relevant authorities if the product has caused environmental pollution (sewers, waterways, soil or air).

Methods and materials for containment and cleaning up

Small spill : Stop leak if without risk. Move containers from spill area. Dilute with water and mop up if water-soluble. Alternatively, or if water-insoluble, absorb with an inert dry material and place in an appropriate waste disposal container. Dispose of via a licensed waste disposal contractor.

Section 6. Accidental release measures

- Large spill** : Stop leak if without risk. Move containers from spill area. Prevent entry into sewers, water courses, basements or confined areas. Wash spillages into an effluent treatment plant or proceed as follows. Contain and collect spillage with non-combustible, absorbent material e.g. sand, earth, vermiculite or diatomaceous earth and place in container for disposal according to local regulations (see Section 13). Dispose of via a licensed waste disposal contractor. Note: see Section 1 for emergency contact information and Section 13 for waste disposal.

Section 7. Handling and storage

Precautions for safe handling

- Protective measures** : Put on appropriate personal protective equipment (see Section 8).
- Advice on general occupational hygiene** : Eating, drinking and smoking should be prohibited in areas where this material is handled, stored and processed. Workers should wash hands and face before eating, drinking and smoking. Remove contaminated clothing and protective equipment before entering eating areas. See also Section 8 for additional information on hygiene measures.

- Conditions for safe storage, including any incompatibilities** : Store in accordance with local regulations. Store in original container protected from direct sunlight in a dry, cool and well-ventilated area, away from incompatible materials (see Section 10) and food and drink. Keep container tightly closed and sealed until ready for use. Containers that have been opened must be carefully resealed and kept upright to prevent leakage. Do not store in unlabeled containers. Use appropriate containment to avoid environmental contamination.

Section 8. Exposure controls/personal protection

Control parameters

Occupational exposure limits

None.

- Appropriate engineering controls** : Good general ventilation should be sufficient to control worker exposure to airborne contaminants.
- Environmental exposure controls** : Emissions from ventilation or work process equipment should be checked to ensure they comply with the requirements of environmental protection legislation. In some cases, fume scrubbers, filters or engineering modifications to the process equipment will be necessary to reduce emissions to acceptable levels.

Individual protection measures

- Hygiene measures** : Wash hands, forearms and face thoroughly after handling chemical products, before eating, smoking and using the lavatory and at the end of the working period. Appropriate techniques should be used to remove potentially contaminated clothing. Wash contaminated clothing before reusing. Ensure that eyewash stations and safety showers are close to the workstation location.
- Eye/face protection** : Safety eyewear complying with an approved standard should be used when a risk assessment indicates this is necessary to avoid exposure to liquid splashes, mists, gases or dusts. If contact is possible, the following protection should be worn, unless the assessment indicates a higher degree of protection: safety glasses with side-shields.

Skin protection

Section 8. Exposure controls/personal protection

- Hand protection** : Chemical-resistant, impervious gloves complying with an approved standard should be worn at all times when handling chemical products if a risk assessment indicates this is necessary.
- Body protection** : Personal protective equipment for the body should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product.
- Other skin protection** : Appropriate footwear and any additional skin protection measures should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product.
- Respiratory protection** : Use a properly fitted, air-purifying or air-fed respirator complying with an approved standard if a risk assessment indicates this is necessary. Respirator selection must be based on known or anticipated exposure levels, the hazards of the product and the safe working limits of the selected respirator.

Section 9. Physical and chemical properties

Appearance

- Physical state** : Liquid. [Clear viscous liquid.]
- Color** : Translucent. White.
- Odor** : Odorless.
- Odor threshold** : Not available.
- pH** : Not available.
- Melting point** : Not available.
- Boiling point** : 99°C (210.2°F)
- Flash point** : Not applicable.
- Evaporation rate** : Not available.
- Flammability (solid, gas)** : Not applicable.
- Lower and upper explosive (flammable) limits** : Not available.
- Vapor pressure** : 3.3 kPa (25 mm Hg) [room temperature]
- Vapor density** : Not available.
- Relative density** : 1.01 to 1.06
- Solubility** : Easily soluble in the following materials: cold water and hot water.
- Solubility in water** : Easily soluble.
- Partition coefficient: n-octanol/water** : Not available.
- Auto-ignition temperature** : Not available.
- Decomposition temperature** : Not available.
- SADT** : Not available.
- Viscosity** : Not available.

Section 10. Stability and reactivity

Reactivity	: No specific test data related to reactivity available for this product or its ingredients.
Chemical stability	: The product is stable.
Possibility of hazardous reactions	: Under normal conditions of storage and use, hazardous reactions will not occur. Under normal conditions of storage and use, hazardous polymerization will not occur.
Conditions to avoid	: Keep away from heat.
Incompatible materials	: No specific data.
Hazardous decomposition products	: Low levels of sulfur oxides on exposure to high temperatures (concentrate).

Section 11. Toxicological information

Information on toxicological effects

Acute toxicity

Not available.

Conclusion/Summary : Not expected.

Irritation/Corrosion

Not available.

Sensitization

Not available.

Mutagenicity

Conclusion/Summary : Not available.

Carcinogenicity

Conclusion/Summary : Not available.

Reproductive toxicity

Conclusion/Summary : Not available.

Teratogenicity

Conclusion/Summary : Not available.

Specific target organ toxicity (single exposure)

Not available.

Specific target organ toxicity (repeated exposure)

Not available.

Aspiration hazard

Not available.

Information on the likely routes of exposure : Not available.

Section 11. Toxicological information

Potential acute health effects

Eye contact	: No known significant effects or critical hazards.
Inhalation	: No known significant effects or critical hazards.
Skin contact	: No known significant effects or critical hazards.
Ingestion	: No known significant effects or critical hazards.

Symptoms related to the physical, chemical and toxicological characteristics

Eye contact	: No specific data.
Inhalation	: No specific data.
Skin contact	: No specific data.
Ingestion	: No specific data.

Delayed and immediate effects and also chronic effects from short and long term exposure

Short term exposure

Potential immediate effects	: Not available.
Potential delayed effects	: Not available.

Long term exposure

Potential immediate effects	: Not available.
Potential delayed effects	: Not available.

Potential chronic health effects

Not available.

General	: No known significant effects or critical hazards.
Carcinogenicity	: No known significant effects or critical hazards.
Mutagenicity	: No known significant effects or critical hazards.
Teratogenicity	: No known significant effects or critical hazards.
Developmental effects	: No known significant effects or critical hazards.
Fertility effects	: No known significant effects or critical hazards.

Numerical measures of toxicity

Acute toxicity estimates

Not available.

Section 12. Ecological information

Toxicity

Not available.

Persistence and degradability

Not available.

Section 12. Ecological information

Bioaccumulative potential

Not available.

Mobility in soil

Soil/water partition coefficient (K_{oc}) : Not available.

Other adverse effects : No known significant effects or critical hazards.

Section 13. Disposal considerations

Disposal methods : The generation of waste should be avoided or minimized wherever possible. Disposal of this product, solutions and any by-products should at all times comply with the requirements of environmental protection and waste disposal legislation and any regional local authority requirements. Dispose of surplus and non-recyclable products via a licensed waste disposal contractor. Waste should not be disposed of untreated to the sewer unless fully compliant with the requirements of all authorities with jurisdiction. Waste packaging should be recycled. Incineration or landfill should only be considered when recycling is not feasible. This material and its container must be disposed of in a safe way. Empty containers or liners may retain some product residues. Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers.

Section 14. Transport information

	DOT Classification	IMDG	IATA
UN number	Not regulated.	Not regulated.	Not regulated.
UN proper shipping name	-	-	-
Transport hazard class(es)	-	-	-
Packing group	-	-	-
Environmental hazards	No.	No.	No.
Additional information	-	-	-

Special precautions for user : **Transport within user's premises:** always transport in closed containers that are upright and secure. Ensure that persons transporting the product know what to do in the event of an accident or spillage.

Transport in bulk according to Annex II of MARPOL 73/78 and the IBC Code : Not available.

Section 15. Regulatory information

U.S. Federal regulations : **United States inventory (TSCA 8b)**: Not determined.

Clean Air Act Section 112 (b) Hazardous Air Pollutants (HAPs) : Not listed

Clean Air Act Section 602 Class I Substances : Not listed

Clean Air Act Section 602 Class II Substances : Not listed

DEA List I Chemicals (Precursor Chemicals) : Not listed

DEA List II Chemicals (Essential Chemicals) : Not listed

SARA 302/304

Composition/information on ingredients

No products were found.

SARA 304 RQ : Not applicable.

SARA 311/312

Classification : Not applicable.

Composition/information on ingredients

No products were found.

SARA 313

Not applicable.

State regulations

Massachusetts : This material is not listed.

New York : This material is not listed.

New Jersey : This material is not listed.

Pennsylvania : This material is not listed.

California Prop. 65

None of the components are listed.

Chemical Weapon Convention List Schedules I, II & III Chemicals

Not listed.

Montreal Protocol (Annexes A, B, C, E)

Not listed.

Stockholm Convention on Persistent Organic Pollutants

Not listed.

Rotterdam Convention on Prior Inform Consent (PIC)

Not listed.

UNECE Aarhus Protocol on POPs and Heavy Metals

Not listed.

Section 16. Other information

Hazardous Material Information System (U.S.A.)

Health	0
Flammability	0
Physical hazards	0

Caution: HMIS® ratings are based on a 0-4 rating scale, with 0 representing minimal hazards or risks, and 4 representing significant hazards or risks. Although HMIS® ratings are not required on SDSs under 29 CFR 1910.1200, the preparer may choose to provide them. HMIS® ratings are to be used with a fully implemented HMIS® program. HMIS® is a registered mark of the National Paint & Coatings Association (NPCA). HMIS® materials may be purchased exclusively from J. J. Keller (800) 327-6868.

The customer is responsible for determining the PPE code for this material.

National Fire Protection Association (U.S.A.)



Reprinted with permission from NFPA 704-2001, Identification of the Hazards of Materials for Emergency Response Copyright ©1997, National Fire Protection Association, Quincy, MA 02269. This reprinted material is not the complete and official position of the National Fire Protection Association, on the referenced subject which is represented only by the standard in its entirety.

Copyright ©2001, National Fire Protection Association, Quincy, MA 02269. This warning system is intended to be interpreted and applied only by properly trained individuals to identify fire, health and reactivity hazards of chemicals. The user is referred to certain limited number of chemicals with recommended classifications in NFPA 49 and NFPA 325, which would be used as a guideline only. Whether the chemicals are classified by NFPA or not, anyone using the 704 systems to classify chemicals does so at their own risk.

Procedure used to derive the classification

Classification	Justification
Not classified.	

History

Date of issue/Date of revision	: 05/28/2015
Date of previous issue	: No previous validation
Version	: 1
Prepared by	: IHS
Key to abbreviations	: ATE = Acute Toxicity Estimate BCF = Bioconcentration Factor GHS = Globally Harmonized System of Classification and Labelling of Chemicals IATA = International Air Transport Association IBC = Intermediate Bulk Container IMDG = International Maritime Dangerous Goods LogPow = logarithm of the octanol/water partition coefficient MARPOL 73/78 = International Convention for the Prevention of Pollution From Ships, 1973 as modified by the Protocol of 1978. ("Marpol" = marine pollution) UN = United Nations

Section 16. Other information

References : HCS (U.S.A.)- Hazard Communication Standard
International transport regulations

✔ Indicates information that has changed from previously issued version.

Notice to reader

To the best of our knowledge, the information contained herein is accurate. However, neither the above-named supplier, nor any of its subsidiaries, assumes any liability whatsoever for the accuracy or completeness of the information contained herein.

Final determination of suitability of any material is the sole responsibility of the user. All materials may present unknown hazards and should be used with caution. Although certain hazards are described herein, we cannot guarantee that these are the only hazards that exist.

ATTACHMENT F

JOBSITE SAFETY INSPECTION CHECKLIST

Jobsite Safety Inspection Checklist

Date: _____ **Inspected By:** _____

Location: _____ **Project #:** _____

Check one of the following: **A:** Acceptable **NA:** Not Applicable **D:** Deficiency

	A	NA	D	Remark
1. CHASP available onsite for inspection?				
2. Health & Safety Compliance agreement (in HASP) appropriately signed by Langan employees and contractors?				
3. Hospital route map with directions posted on site?				
4. Emergency Notification List posted on site?				
5. First Aid kit available and properly stocked?				
6. Personnel trained in CPR/First Aid on site?				
7. MSDSs readily available, and all workers knowledgeable about the specific chemicals and compounds to which they may be exposed?				
8. Appropriate PPE being worn by Langan employees and contractors?				
9. Project site safe practices ("Standing Orders") posted?				
10. Project staff have 40-hr./8-hr./Supervisor HAZWOPER training?				
11. Project staff medically cleared to work in hazardous waste sites and fit-tested to wear respirators, if needed?				
12. Respiratory protection readily available?				
13. Health & Safety Incident Report forms available?				
14. Air monitoring instruments calibrated daily and results recorded on the Daily Instrument Calibration check sheet?				
15. Air monitoring readings recorded on the air monitoring data sheet/field log book?				
16. Subcontract workers have received 40-hr./8-hr./Spvsr. HAZWOPER training, as appropriate?				
17. Subcontract workers medically cleared to work on site, and fit-tested for respirator wear?				
18. Subcontract workers have respirators readily available?				
19. Mark outs of underground utilities done prior to initiating any subsurface activities?				
20. Decontamination procedures being followed as outlined in HASP?				
21. Are tools in good condition and properly used?				
22. Drilling performed in areas free from underground objects including utilities?				

23. Adequate size/type fire extinguisher supplied?				
24. Equipment at least 20 feet from overhead power lines?				
25. Evidence that drilling operator is responsible for the safety of his rig.				
26. Trench sides shored, layer back, or boxed?				
27. Underground utilities located and authorities contacted before digging?				
28. Ladders in trench (25-foot spacing)?				
29. Excavated material placed more than 2 feet away from excavation edge?				
30. Public protected from exposure to open excavation?				
31. People entering the excavation regarding it as a permit-required confined space and following appropriate procedures?				
32. Confined space entry permit is completed and posted?				
33. All persons knowledgeable about the conditions and characteristics of the confined space?				
34. All persons engaged in confined space operations have been trained in safe entry and rescue (non-entry)?				
35. Full body harnesses, lifelines, and hoisting apparatus available for rescue needs?				
36. Attendant and/or supervisor certified in basic first aid and CPR?				
37. Confined space atmosphere checked before entry and continuously while the work is going on?				
38. Results of confined space atmosphere testing recorded?				
39. Evidence of coordination with off-site rescue services to perform entry rescue, if needed?				
40. Are extension cords rated for this work being used and are they properly maintained?				
41. Are GFCIs provided and being used?				

Unsafe Acts: _____

Notes: _____

ATTACHMENT G

JOB SAFETY ANALYSIS FORM



Job Safety Analysis (JSA) Health and Safety

JSA TITLE:

DATE CREATED:

CREATED BY:

JSA NUMBER:

REVISION DATE:

REVISED BY:

Langan employees must review and revise the Job Safety Analysis (JSA) as needed to address the any site specific hazards not identified. Employees must provide their signatures on the last page of the JSA indicating they have review the JSA and are aware the potential hazards associated with this work and will follow the provided preventive or corrective measures.

PERSONAL PROTECTIVE EQUIPMENT REQUIRED: (PPE): Required As Needed

Steel-toed boots Nitrile gloves Dermal Protection (Specify)

Long-sleeved shirt Leather/ Cut-resistant gloves High visibility vest/clothing

Safety glasses Face Shield Hard hat

ADDITIONAL PERSONAL PROTECTIVE EQUIPMENT NEEDED (Provide specific type(s) or descriptions)

Air Monitoring: Respirators: Other:

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE OR CORRECTIVE ACTION
1.	1. 2.	1a. 1b. 2a. 2b.
2.	1.	1
Additional items identified in the field.		
Additional Items.		

If additional items are identified during daily work activities, please notify all relevant personnel about the change and document on this JSA.

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: COVID-19 Awareness – Site Work
JSA Number: JSA046-00

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work “TAKE 5” and conduct a Last Minute Risk Assessment.



- S – Stop, what has changed?
- T – Think about the task
- E – Evaluate potential hazards
- P – Plan safe approach
- S – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Boots	<input type="checkbox"/> Long Sleeves	<input type="checkbox"/> Safety Vest (Class 2)	<input type="checkbox"/> Hard Hat	<input type="checkbox"/> Hearing Protection
<input type="checkbox"/> Safety Glasses	<input type="checkbox"/> Safety Goggles	<input type="checkbox"/> Face Shield	<input type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input type="checkbox"/> Leather Gloves	<input type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input checked="" type="checkbox"/> Other: Alcohol-based hand sanitizer, disinfectant wipes/spray				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
1. All Activities	1. Transmittal/exposure of COVID-19	<ol style="list-style-type: none"> 1. Ask yourself and your managers – is this work essential? Can this be done remotely? 2. Stay home if sick or showing symptoms of COVID-19 (e.g. fever, cough, etc.). 3. Carry nitrile gloves, alcohol-based hand sanitizer, face coverings and disinfectant wipes/spray during field work. 4. Check federal, state, and/or local travel restrictions prior to travel. Many states, counties, and cities are passing strict “shelter-in-place” or business restrictions in response to COVID-19. 5. Immediately notify Beverly Williams or Rory Johnston (Supervisor if employee chooses) if you display symptoms of COVID-19. Symptoms include fever (over 100.4 F), cough, and shortness of breath. 6. Notify Beverly Williams or Rory Johnston, Supervisor and Coronavirus Task Force if you had close contact with an individual who tested positive or displayed symptoms of COVID-19. 7. Do not touch your face, to the extent possible. 8. Wear face coverings when around other worker to minimize spread of COVID-19. (May be required in certain states or locations.)

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
		<ol style="list-style-type: none"> 9. Practice social distancing, maintaining at least 6 feet of distance between yourself and others. Avoid gatherings of more than 10 people. Limit, to the extent possible, contact with public items/objects. 10. Clean your hands frequently with soap and water for at least 20 seconds especially after you have been in a public place, or after blowing your nose, coughing, sneezing, or using the rest room. 11. If soap and water are not readily available, use a hand sanitizer that contains at least 60% alcohol. Cover all surfaces of your hands and rub them together until they feel dry. 12. Cover your mouth and nose with a tissue when you cough or sneeze or use the inside of your elbow. 13. Clean and disinfect frequently touched surfaces daily, for example, cell phones, computer equipment, headsets, tables, doorknobs, light switches, countertops, handles, desks, toilets, faucets, and sinks.
<ol style="list-style-type: none"> 2. Travel to Jobsite 	<ol style="list-style-type: none"> 1. Transmittal/exposure of COVID-19 between passengers 2. Transmittal/exposure of COVID-19 from previous occupants (rental and fleet vehicles) 3. Transmittal/exposure of COVID-19 while refueling 	<ol style="list-style-type: none"> 1. Limit the number of occupants to each vehicle to 2 people. Employees should sit as far away from each other as possible. 2. Disinfect high "hand-traffic" areas of the vehicle: Door handles, steering wheel, turn signal and control rods, dashboard controls, seatbelts, armrests, etc. To the extent possible, do not use recycled air for heat/AC and travel with the windows open. 3. Use hand sanitizer before and after pumping gas and only return to the inside of the vehicle after refueling is complete. 4. Wear nitrile gloves if available or disinfect the key pad, pump handle, and fuel grade button prior to use. 5. Recommend face coverings are worn to minimize spread of COVID-19.
<ol style="list-style-type: none"> 3. Conduct Tailgate Safety Meeting & Complete H&S Paperwork 	<ol style="list-style-type: none"> 1. Transmittal/exposure of COVID-19 between meeting participants 	<ol style="list-style-type: none"> 1. Practice social distancing, maintaining at least 6 feet of distance between yourself and others. 2. Recommend face coverings are worn when around other workers to minimize spread of COVID-19, 3. Hold meetings outside and keep in mind wind direction. To the extent possible, remain cross-wind from other people. 4. Designate a single person to maintain sign-in sheets/permits throughout the day to limit the passing of pens/clipboards between people. 5. Each person should complete their own JSA, even if they are completing similar tasks as others in order to limit the passing of paper/pens/clipboards between people. 6. Include COVID-19 topics and prevention measures in safety meetings.
<ol style="list-style-type: none"> 4. Conduct Site Work 	<ol style="list-style-type: none"> 1. Transmittal/exposure of COVID-19 between site workers and public. 	<ol style="list-style-type: none"> 1. Practice social distancing maintaining 6 feet of distance between yourself and others. 2. Recommend face coverings are worn when around other workers to minimize spread of COVID-19, 3. To the extent possible, do not interact with the public. If it is necessary, politely explain you are practicing social distance and request they stay at least 6 feet away and they do not attempt to pass objects to you. 4. Wear nitrile gloves during site work underneath the appropriate gloves for your task. Utilize appropriate decontamination procedures, securely bag all waste (including nitrile gloves) generated during site work and dispose of.

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
		<ol style="list-style-type: none"> 5. Do not share tools. Each person should be equipped with the tools to complete their task or tasks should be divided to remove the need to share tools. If tools must be shared, surfaces should be disinfected. 6. Clean and disinfect surfaces of rental tools and equipment upon receipt. To the extent possible rent equipment from Langan's internal equipment reservation center, where cleaning/disinfecting procedures can be verified.
5. Use of Construction Trailers	1. Transmittal/exposure of COVID-19 between site workers and others.	<ol style="list-style-type: none"> 1. Avoid use of shared trailers, if possible. Minimize trailer use to essential personnel. 2. Practice social distancing; maintaining 6 feet of distance between yourself and others in trailer. 3. Clean and disinfect areas including desks, phones, chairs and other common areas, before and after use.
6. Purchasing Food from a Restaurant	1. Transmittal/exposure of COVID-19 from other customers, staff, surfaces.	<ol style="list-style-type: none"> 1. To the extent possible, bring your own food. 2. If you must visit a restaurant, call ahead for take-out or "contactless delivery". Do not dine in. When picking up food, follow guidelines for <u>Job Step #8: Purchasing Supplies at Retail/Shipping Centers</u>. 3. Wash hands before and after eating.
7. Smoking Cigarettes	1. Transmittal/exposure of COVID-19 by touching mouth with hands	<ol style="list-style-type: none"> 1. Cigarette smokers maybe at greater risk of complications arising from COVID-19. Nicotine patches/lozenges/gum, smoking cessation programs, and prescription medications may aid in "kicking the habit" if you decide to quit. 2. Wash hands thoroughly before and after smoking. 3. Discard cigarette butts properly. Do not light cigarettes from others and do not give cigarettes to others.
8. Hotel Stay	1. Transmittal/exposure of COVID-19 from previous occupants, hotel staff, common areas.	<ol style="list-style-type: none"> 1. Verify the hotel chain/brand has modified cleaning procedures to reflect risk of COVID-19. Most hotel companies have issued statements on their websites and in email blasts reflecting these new procedures. 2. Use the front door, and not peripheral entrances. Front doors of hotels are generally automatic. 3. Request ground floor room to avoid elevator use and a room that has not be utilized in 48-72 hours. 4. If elevator use is required, do not directly touch elevator buttons with your hands. Do not ride elevators with other people, to the extent possible. 5. Bring disinfecting wipes or sanitizing spray. Upon arrival, disinfect high "hand-traffic" areas of the hotel room: Door handles, light switches, shower/sink faucet handles, TV remote, curtain/blind handles. Clean these surfaces daily. 6. Place the "Do Not Disturb" Sign on your door to prevent people (housekeeping) from entering your room. 7. Avoid common spaces and hotel sponsored events where crowds will be present. 8. Confirm hotel cleaning procedures have been modified to address COVID-19. Confirm no COVID-19 cases have occurred in hotel
9. Purchasing Supplies at Retail/Shipping Centers	1. Transmittal/exposure of COVID-19 from other customers, staff, surfaces.	<ol style="list-style-type: none"> 1. Plan your travel to limit the need to visit retail/shipping centers. 2. Practice social distancing, maintaining at least 6 feet of distance between yourself and others. If the store is too crowded/small, consider visiting another store or returning at a different time. 3. Avoid high "hand-traffic" items/areas like door handles (i.e. use your shoulder, hip/butt, or open with a disposable napkin/paper towel), credit cards terminals (i.e. use Apple/Android pay if available), shopping carts/baskets (i.e. bring your own shopping

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
		bags), counter tops (i.e. ask clerk if you can hold the items while they are scanned) and bulk/buffet items (i.e. just avoid them). 4. Disinfect your hands before and after visiting a retail/shipping center.

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<i>Prepared by:</i>		
<i>Reviewed by:</i>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: Environmental Sampling
JSA Number: JSA021-01

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



- S – Stop, what has changed?
- T – Think about the task
- E – Evaluate potential hazards
- P – Plan safe approach
- S – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input type="checkbox"/> Safety Goggles	<input type="checkbox"/> Face Shield	<input checked="" type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input type="checkbox"/> Leather Gloves	<input type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input checked="" type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input checked="" type="checkbox"/> Insect/Animal Repellent	<input checked="" type="checkbox"/> Ivy Blocker/Cleaner	<input type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input checked="" type="checkbox"/> Other: Tyvek Sleeves				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
1. Drive to sample location	1. Rough/Off Road terrain	1. Pay attention to road conditions such as road erosion, unprotected embankments, and soft road conditions.
2. Sample Collection (Walking)	<ol style="list-style-type: none"> Slip/Trips/Falls Back strains Wildlife (Insects, Stray animals, rodents) Poisonous vegetation 	<ol style="list-style-type: none"> Minimize distance to sample area/ Plan route and check surface prior to carrying heavy equipment/ Locate safest access point/ Follow good housekeeping procedures/ Mark significant below grade hazards (holes, trenches) with spray paint or cones/ Wear foot protection with ankle support and gripping soles. Use proper lifting techniques/ Use wheeled transport/ Obtain assistance where and when needed/ Consider load weight when evaluating what is safe and unsafe to carry. Be aware of surroundings for the presence of wildlife. Do not approach stray animals. Carry and use animal repellent when needed/ Use bug spray when needed. Keep skin covered/ Identify and avoid poisonous vegetation/ Clean areas after contact with suspected vegetation.
3. Sample Collection (Water)	<ol style="list-style-type: none"> Drowning Hazards Chemical burns (when adding acid preservative to sample) Back Strains Ergonomic issues Slip/Trips/Falls 	<ol style="list-style-type: none"> Use buddy system/ Wear flotation vest if water is deeper than 2 feet or swift moving/ Select working area with stable footing. Do not attempt to cross or stand in swift moving water. Wear proper PPE (Nitrile gloves, Tyvek Sleeves) Use proper lifting techniques/ Use wheeled transport/ Obtain assistance where and when needed/ Consider load weight when evaluating what is safe or unsafe to carry. When possible avoid bending over for long periods of time/ Use a small stool for sitting or knee pad for kneeling.

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
		5. Minimize distance to sample area/ Plan route and check surface prior to carrying heavy equipment/ Locate safest access point/ Follow good housekeeping procedures/ Mark significant below grade hazards (holes, trenches) with spray paint or cones/ Wear foot protection with ankle support and gripping soles/ Avoid standing water or slippery terrain.
4.All activities	1. Slips/ Trips/ Falls 2. Hand injuries, cuts or lacerations during manual handling of materials 3. Foot injuries 4. Back injuries 5. Traffic 6. Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 7. High Noise levels 8. Overhead hazards 9. Heat Stress/ Cold Stress 10. Eye Injuries	1. Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards 2. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves 3. Wear Langan approved safety shoes 4. Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible 5. Wear high visibility clothing & vest / Use cones or signs to designate work area 6. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellent / Use bug spray when needed 7. Wear hearing protection 8. Wear hard hat / Avoid areas where overhead hazards exist. 9. Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Takes breaks as necessary to avoid heat/cold stress 10. Wear safety glasses
Additional items.		
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<u>Prepared by:</u>		
<u>Reviewed by:</u>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: 55-gallon Drum Sampling
JSA Number: JSA043-01

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



- S** – Stop, what has changed?
- T** – Think about the task
- E** – Evaluate potential hazards
- P** – Plan safe approach
- S** – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input checked="" type="checkbox"/> Safety Goggles	<input checked="" type="checkbox"/> Face Shield	<input checked="" type="checkbox"/> Nitrile Gloves	<input checked="" type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input checked="" type="checkbox"/> Other: All Drums are required to be labeled. Langan employees do not open or move undocumented drums or unlabeled drums without proper project manager authorization.				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
5. Unpack/Transport equipment to work area.	2. Back Strains 3. Slip/Trips/Falls 4. Cuts/Abrasions from equipment 4. Contusions from dropped equipment	1. Use proper lifting techniques/Use wheeled transport 2. Minimize distance to work area/Unobstructed path to work area/follow good housekeeping procedures. Mark slip/trip/fall hazards with orange safety cones. 3. Wear proper PPE (leather gloves, long sleeves). 4. Wear proper PPE (Langan approved safety shoes).
6. Open Drums	1. Hand Injuries, cuts or lacerations when untightening drum locking bolt, removing drum lid strap, or removing lid. 2. Pressure from drums.	1. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves. Use non-metallic mallet and non-sparking tools/wrenches. 2. Open drum slowly to relieve pressure. Wear proper PPE: face shield and goggles; correct gloves; and over garments.
7. Collecting Soil/Fluid Sample	5. Irritation to eye from vapor, soil dust, or splashing 6. Irritation to exposed skin	5. Wear proper eye protection including safety glasses/ face shield/goggles and when necessary, splash guard. If dust or vapor phase is present, wear appropriate safety breathing gear (1/2 mask or full face mask with correct filter) 6. Wear proper skin protection including nitrile gloves.
8. Closing Drums	1. Hand Injuries, cuts or lacerations when untightening drum locking bolt, removing drum lid strap, or removing lid.	6. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves. Use non-metallic mallet and non-sparking tools/wrenches.
9. Moving Drums	1. Hand Injuries, cuts or lacerations when untightening drum locking bolt, removing drum lid strap, or removing lid.	1. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
	2. Back Strains	objects before handling / Wear leather/ cut-resistant gloves. Use non-metallic mallet and non-sparking tools/wrenches. 2. Use proper lifting techniques/Use wheeled transport
10. All activities	1. Slips/ Trips/ Falls 2. Hand injuries, cuts or lacerations during manual handling of materials 3. Foot injuries 4. Back injuries 5. Traffic 6. Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 7. High Noise levels 8. Overhead hazards 9. Heat Stress/ Cold Stress 10. Eye Injuries	1. Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards 2. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves 3. Wear Langan approved safety shoes 4. Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible 5. Wear high visibility clothing & vest / Use cones or signs to designate work area 6. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellant / Use bug spray when needed 7. Wear hearing protection 8. Wear hard hat / Avoid areas were overhead hazards exist. 9. Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Takes breaks as necessary to avoid heat/cold stress 10. Wear safety glasses
Additional items.		
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<u>Prepared by:</u>		
<u>Reviewed by:</u>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: Equipment Transportation and Set-up
JSA Number: JSA012-01

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



- S – Stop, what has changed?
- T – Think about the task
- E – Evaluate potential hazards
- P – Plan safe approach
- S – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input checked="" type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input type="checkbox"/> Safety Goggles	<input type="checkbox"/> Face Shield	<input type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	

Other:

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
11. Transport equipment to work area	5. Back Strain 6. Slips/ Trips/ Falls 7. Traffic 8. Cuts/abrasions from equipment 9. Contusions from dropped equipment	1. Use proper lifting techniques / Use wheeled transport 2. Minimize distance to work area / Have unobstructed path to work area / Follow good housekeeping procedures 3. Wear proper PPE (high visibility vest or clothing) 4. Wear proper PPE (leather gloves, long sleeves) 5. Wear proper PPE (safety shoes)
12. Moving equipment to its planned location	7. Pinch Hazard 8. Slips/ Trips/ Falls	1. Wear proper PPE (leather gloves) 2. Be aware of potential trip hazards / Practice good housekeeping procedures / Mark significant below-grade hazards (i.e. holes, trenches) with safety cones or spray paint
13. Equipment Set-up	6. Pinch Hazard 7. Cuts/abrasions to knuckles/hands 8. Back Strain	1. Wear proper PPE (leather gloves) 2. Wear proper PPE (leather gloves) 3. Use proper lifting techniques / Use wheeled transport
14. All activities	11. Slips/ Trips/ Falls 12. Hand injuries, cuts or lacerations during manual handling of materials 13. Foot injuries 14. Back injuries 15. Traffic 16. Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 17. High Noise levels 18. Overhead hazards	11. Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards 12. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves 13. Wear Langan approved safety shoes 14. Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
4. All activities (cont'd)	19. Heat Stress/ Cold Stress 20. Eye Injuries	15. Wear high visibility clothing & vest / Use cones or signs to designate work area 16. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellent / Use bug spray when needed 17. Wear hearing protection 18. Wear hard hat / Avoid areas where overhead hazards exist. 19. Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Take breaks as necessary to avoid heat/cold stress 20. Wear safety glasses
Additional items.		
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<u>Prepared by:</u>		
<u>Reviewed by:</u>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: Field Sampling
JSA Number: JSA022-01

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



S – Stop, what has changed?
T – Think about the task
E – Evaluate potential hazards
P – Plan safe approach
S – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input checked="" type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input type="checkbox"/> Safety Goggles	<input type="checkbox"/> Face Shield	<input checked="" type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input checked="" type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input type="checkbox"/> Other: _____				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
15. Unpack/Transport equipment to work area.	10. Back Strains 11. Slip/Trips/Falls 12. Cuts/Abrasions from equipment 13. Contusions from dropped equipment	4. Use proper lifting techniques/Use wheeled transport 5. Minimize distance to work area/Unobstructed path to work area/follow good housekeeping procedures. Mark slip/trip/fall hazards with orange safety cones. 6. Wear proper PPE (leather gloves, long sleeves). 7. Wear proper PPE (Langan approved safety shoes).
16. Initial Site Arrival-Site Assessment	9. Traffic	7. Situational awareness (be alert of your surroundings). Secure area from through traffic.
17. Surface Water Sampling	9. Contaminated media. Skin/eye contact with biological agents and/or chemicals.	7. Wear appropriate PPE (Safety glasses, appropriate gloves). Review (MSDS for all chemicals being.
18. Sampling from bridges	3. Struck by vehicles	3. Wear appropriate PPE (Safety Vest). Use buddy system and orange safety cones.
19. Icing of Samples/ Transporting coolers/equipment from work area.	21. Back Strains 22. Slips/Trips/Falls 23. Cuts/Abrasions from equipment 24. Pinch/Crushing Hazards.	21. Drain coolers of water. Use proper lifting techniques. Use wheeled transport. 22. Have unobstructed path from work area. Aware of surroundings. 23. Wear proper PPE (Leather gloves, long sleeves) 24. Wear proper PPE (Leather gloves, long sleeves)
20. Site Departure	1. Contaminated PPE/Vehicle	1. Contaminated PPE should be disposed of on-site. Remove boots and soiled clothing for secure storage in trunk. Wash hands promptly.
21. All activities	1. Slips/ Trips/ Falls 2. Hand injuries, cuts or lacerations during manual	1. Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards 2. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
	handling of materials 3. Foot injuries 4. Back injuries 25. Traffic 26. Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 27. High Noise levels 28. Overhead hazards 29. Heat Stress/ Cold Stress 30. Eye Injuries	before handling / Wear leather/ cut-resistant gloves 3. Wear Langan approved safety shoes 4. Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible 25. Wear high visibility clothing & vest / Use cones or signs to designate work area 26. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellant / Use bug spray when needed 27. Wear hearing protection 28. Wear hard hat / Avoid areas were overhead hazards exist. 29. Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Takes breaks as necessary to avoid heat/cold stress 30. Wear safety glasses
Additional items.		
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<u>Prepared by:</u>		
<u>Reviewed by:</u>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: Excavation Oversight
JSA Number: JSA041-01

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



- S – Stop, what has changed?
- T – Think about the task
- E – Evaluate potential hazards
- P – Plan safe approach
- S – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input checked="" type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input type="checkbox"/> Safety Goggles	<input type="checkbox"/> Face Shield	<input checked="" type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input checked="" type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input type="checkbox"/> Other: _____				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
22. Transport equipment to work area	14. Back Strain 15. Slips/Trips/Falls 16. Traffic 17. Cuts/abrasions/contusions from equipment	8. Use proper lifting techniques / Use wheeled transport 9. Minimize distance to work area / Have unobstructed path to work area / Follow good housekeeping procedures 10. Wear proper PPE (high visibility vest or clothing) 11. Wear proper PPE (leather gloves, long sleeves, safety shoes)
23. Earth Moving Equipment	10. Equipment running over employee	8. Ensure you have direct line of sight with operator of equipment; don't walk behind equipment; maintain a safe distance away from equipment. 9. Wear proper PPE (high vis vest/clothing)
24. Excavation	10. Excavation collapse 11. Confined space 12. Soil	8. Use proper shoring/benching/sloping techniques; Ladder is properly situated in excavation; no water in excavation; competent person has inspected excavation prior to allow employees to enter. 9. Langan employees are not authorized to enter a confined space; 10. Soil and equipment is kept at least 2 feet from edge of excavation
25. Excavated soil	1. Hazardous substances	1. Use proper equipment to monitor excavated soil for contaminants; ensure levels do not exceed PEL's for contaminants; Wear proper PPE
26. All activities	31. Slips/ Trips/ Falls 32. Hand injuries, cuts or lacerations during manual handling of materials 33. Foot injuries 34. Back injuries	31. Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards 32. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
	35. Traffic 36. Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 37. High Noise levels 38. Overhead hazards 39. Heat Stress/ Cold Stress 40. Eye Injuries	33. Wear proper PPE (Langan approved safety shoes) 34. Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible 35. Wear high visibility clothing & vest / Use cones or signs to designate work area 36. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellant / Use bug spray when needed 37. Wear hearing protection 38. Wear hard hat / Avoid areas were overhead hazards exist. 39. Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Takes breaks as necessary to avoid heat/cold stress 40. Wear safety glasses
Additional items.		
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<u>Prepared by:</u>		
<u>Reviewed by:</u>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: Subsurface Investigation
JSA Number: JSA030-01

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



- S** – Stop, what has changed?
- T** – Think about the task
- E** – Evaluate potential hazards
- P** – Plan safe approach
- S** – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input checked="" type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input checked="" type="checkbox"/> Safety Goggles	<input type="checkbox"/> Face Shield	<input type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input checked="" type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input checked="" type="checkbox"/> Other: Dielectric Overshoes, Sun Block				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
27. Transport equipment to work area	18. Back/strain 19. Slip/Trip/Falls 20. Traffic 21. Cuts/abrasions/contusions from equipment 22. Accidents due to vehicle operations	12. Use proper lifting techniques/Use wheeled transport 13. Minimize distance to work area/unobstructed path to work area/follow good housekeeping procedures 14. Wear proper PPE (high visibility vest or clothing) 15. Wear proper PPE (leather gloves, long sleeves, Langan approved safety shoes) 16. Observe posted speed limits/ Wear seat belts at all times
28. Traffic	1. Hit by moving vehicle	1. Use traffic cones and signage/ Use High visibility traffic vests and clothing/ Caution tape when working near active roadways.
29. Field Work (drilling, resistivity testing, and inspection)	1. Biological Hazards: insects, rats, snakes, poisonous plants, and other animals 2. Heat stress/injuries 3. Cold Stress/injuries 4. High Energy Transmission Lines 5. Underground Utilities 6. Electrical (soil resistivity testing)	41. Inspect work area to identify biological hazards. Wear light colored long sleeve shirt and long pants/ Use insect repellent as necessary/ Beware of tall grass, bushes, woods and other areas where ticks may live/ Avoid leaving garbage on site to prevent attracting animals/ Identify and avoid contact with poisonous plants/Beware of rats, snakes, or stray animals. 42. Wear proper clothing (light colored)/ drink plenty of water/ take regular breaks/use sun block 43. Wear proper clothing/ dress in layers/ take regular breaks. 44. Avoid direct contact with high energy transmission lines/ position equipment at least 15 feet or as required by PSE&G from the transmission lines/ wear proper PPE (dielectric overshoes 15 kV minimum rating).

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
		45. Call one-call service before performing intrusive field work/ Review utility mark-outs and available utility drawings (with respect to proposed work locations)/ Follow Underground Utility Guidelines 46. See AGI Sting R1 operating manual for specific concerns during operating instrument
30. All activities	41. Slips/ Trips/ Falls 42. Hand injuries, cuts or lacerations during manual handling of materials 43. Foot injuries 44. Back injuries 45. Traffic 46. Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 47. High Noise levels 48. Overhead hazards 49. Heat Stress/ Cold Stress 50. Eye Injuries	47. Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards 48. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves 49. Wear Langan approved safety shoes 50. Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible 51. Wear high visibility clothing & vest / Use cones or signs to designate work area 52. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellant / Use bug spray when needed 53. Wear proper hearing protection 54. Wear hard hat / Avoid areas where overhead hazards exist. 55. Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Take breaks as necessary to avoid heat/cold stress 56. Wear safety glasses
Additional items.		
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<u>Prepared by:</u>		
<u>Reviewed by:</u>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: Direct-Push Soil Borings
JSA Number: JSA004-01

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



- S** – Stop, what has changed?
- T** – Think about the task
- E** – Evaluate potential hazards
- P** – Plan safe approach
- S** – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT REQUIRED:

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input checked="" type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input type="checkbox"/> Safety Goggles	<input type="checkbox"/> Face Shield	<input checked="" type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input checked="" type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input checked="" type="checkbox"/> Other: Half-face respirator, dust cartridges, PID (if applicable)				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
31. Move equipment to work site	23. Back strain when lifting equipment 24. Slips/ Trips/ Falls while moving equipment 25. Traffic (if applicable) 26. Pinched fingers or running over toes during geoprobe set-up 27. Overturn drilling rig while transporting to loading dock on flat-bed tow truck	17. Use proper lifting technique (use legs for bending and lifting and not the back)/ Use wheeled transport for heavy equipment / Get assistance when handling loads greater than 50 lbs. / Minimize distance to vehicle 18. Use proper lifting technique (use legs for bending and lifting and not the back) / Use wheeled transport for heavy equipment / Get assistance when handling loads greater than 50 lbs. / Minimize distance to vehicle / Have unobstructed path to vehicle or collection point / Do not lift/walk with boxes that are heavy/difficult to lift 19. Wear high visibility safety vests or clothing / Exercise caution 20. Wear proper PPE (cut-resistant gloves) / Stay alert, be aware of geoprobe rig at all times 21. Drill rig should be parked in center of flat-bed tow truck / Emergency brake shall be used at all times during transport on the flat-bed truck/ All unnecessary personnel should stay away from the flat-bed truck during moving activities
32. Calibration of monitoring equipment	11. Skin or eye contact with calibration chemicals 12. Pinch fingers in monitoring equipment	10. Wear proper PPE (safety glasses/ goggles) 11. Wear proper PPE (leather gloves)
33. Set-up geoprobe rig	13. Geoprobe rig movement	11. All field personnel should stay clear of the geoprobe rig while moving / Use a spotter when backing up the geoprobe
34. Advance geoprobe rods below ground surface to desired depth	4. Underground utilities 5. High noise levels	4. Clean all subsurface soil borings to a minimum of 5 feet below grade 5. Wear proper PPE (hearing protection)
35. Remove and open acetate liner	51. Pinched fingers while removing macrocore	1. Wear proper PPE (nitrile gloves, cut-resistant or leather gloves) 2. Wear proper PPE (cut-resistant or leather gloves)

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
5. Remove and open acetate liner (cont'd)	52. Cuts/lacerations when cutting acetate liner open 53. Exposure to hazardous vapors 54. Skin contact with contaminated soil	3. Do not place face over acetate liner when opening / Monitor hazardous vapors in air with PID / Upgrade PPE as necessary based on levels contained in the Health and Safety Plan 4. Wear proper PPE (nitrile gloves)
36. Sample Collections a) Monitor parameters b) Prepare sample containers and labels	1. Contact with potentially contaminated soil 2. Lacerations from broken sample bottles 3. Back strain while transporting full coolers 4. Internal exposure to contaminants and metals through inhalation of dust 5. Slips/ Trips/ Falls	1. Use monitoring devices / Wear proper PPE (safety glasses, nitrile gloves) 2. Do not over-tighten bottle caps / Handle bottles safely to prevent breakage 6. Use proper lifting techniques / Do not lift heavy loads without assistance 7. Avoid creating dust / If necessary, wear a half mask respirator with applicable dust cartridge / Inspect respirator for damage and cleanliness prior to use / Clean respirator after each use and store in a clean, secure location 8. Be alert / Follow good housekeeping procedures
37. Remove excess soil from acetate liner and place in 55-gallon drum (IF NOT PERFORMED BY LANGAN, REMOVE!)	1. Cuts/lacerations from acetate liner 2. Pinched fingers/hand while opening/closing drum 3. Skin contact with contaminated soil 4. Soil debris in eyes	1. Wear proper PPE (cut-resistant or leather gloves) 2. Wear proper PPE (cut-resistant or leather gloves) 3. Wear proper PPE (nitrile gloves) 4. Wear proper PPE (safety glasses)

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
8. Transport drums to central staging location (IF NOT PERFORMED BY LANGAN, REMOVE!)	1. Back, arm or shoulder strain from moving drums 2. Pinch fingers/hand in drum cart when moving drums 3. Pinch fingers/hand when operating lift-gate on vehicle 4. Contact with potentially contaminated groundwater when moving improperly sealed drums 5. Slips when moving drums 6. Drop drum on feet/toes	57. Use drum cart for moving drums / Use proper lifting techniques / Do not lift heavy loads without assistance 58. Wear proper PPE (cut-resistant or leather gloves) 59. Wear proper PPE (cut-resistant or leather gloves) 60. Wear proper PPE (nitrile gloves underneath work gloves) 61. Follow good housekeeping procedures / Ensure route to move drum and storage space is free from obstructions 62. Wear proper PPE (safety shoes) / Work in a safe manner to prevent dropped drum
9. All activities	1. Slips/ Trips/ Falls 2. Hand injuries, cuts or lacerations during manual handling of materials 3. Foot injuries 4. Back injuries 5. Traffic 6. Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 7. High Noise levels 8. Overhead hazards 9. Heat Stress/ Cold Stress	1. Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards 2. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves 3. Wear Langan approved safety shoes 4. Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible 5. Wear high visibility clothing & vest / Use cones or signs to designate work area 6. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellent / Use bug spray when needed 7. Wear hearing protection 8. Wear hard hat / Avoid areas where overhead hazards exist. 9. Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Take breaks as necessary to avoid heat/cold stress 10. Wear safety glasses
9. All activities (cont'd)	10. Eye Injuries	
Additional items.		
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
-------------------	------------------	-------------

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: General Construction Activities
JSA Number: JSA010-01

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



- S** – Stop, what has changed?
- T** – Think about the task
- E** – Evaluate potential hazards
- P** – Plan safe approach
- S** – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input checked="" type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input type="checkbox"/> Safety Goggles	<input checked="" type="checkbox"/> Face Shield	<input checked="" type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input checked="" type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input type="checkbox"/> Other:				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
38. Transport equipment to work area	28. Back Strain 29. Slips/ Trips/ Falls 30. Traffic 31. Cuts/abrasions from equipment 32. Contusions from dropped equipment	6. Use proper lifting techniques / Use wheeled transport 7. Minimize distance to work area / Have unobstructed path to work area / Follow good housekeeping procedures 8. Wear proper PPE (high visibility vest or clothing) 9. Wear proper PPE (leather gloves, long sleeves) 10. Wear proper PPE (safety shoes)
39. Installation of piping from vapor wells to skid connections and from discharge pipping to effluent stack	13. Pinch fingers when connecting pipes 14. Slips/ Trips/ Falls 15. Machinery Hazards	3. Wear proper PPE (leather gloves) 4. Be aware of potential trip hazards / Practice good housekeeping procedures / Mark significant below-grade hazards (i.e. holes, trenches) with safety cones or spray paint 5. Wear proper PPE (safety vest) / Maintain safe distance from operating machinery
40. Remediation equipment installation	14. Back strain when lifting heavy equipment 15. Slips/ Trips/ Falls 16. Traffic	5. Use proper lifting techniques / Use wheeled transport / Minimize distance to vehicle 6. Be aware of potential trip hazards / Practice good housekeeping procedures / Mark significant below-grade hazards (i.e. holes, trenches) with safety cones or spray pain 7. Wear proper PPE (safety vest)
41. All activities	55. Slips/ Trips/ Falls 56. Hand injuries, cuts or lacerations during manual handling of materials 57. Foot injuries 58. Back injuries 59. Traffic	63. Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards 64. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves 65. Wear Langan approved safety shoes

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
4. All activities (cont'd)	60. Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 61. High Noise levels 62. Overhead hazards 63. Heat Stress/ Cold Stress 64. Eye Injuries	66. Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible 67. Wear high visibility clothing & vest / Use cones or signs to designate work area 68. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellant / Use bug spray when needed 69. Wear hearing protection 70. Wear hard hat / Avoid areas were overhead hazards exist. 71. Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Takes breaks as necessary to avoid heat/cold stress 72. Wear safety glasses
Additional items.		
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<u>Prepared by:</u>		
<u>Reviewed by:</u>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: Site Inspection
JSA Number: JSA024-01

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



- S – Stop, what has changed?
- T – Think about the task
- E – Evaluate potential hazards
- P – Plan safe approach
- S – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input checked="" type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input type="checkbox"/> Safety Goggles	<input type="checkbox"/> Face Shield	<input checked="" type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input checked="" type="checkbox"/> Rubber Boots
<input checked="" type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input checked="" type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input type="checkbox"/> Other: _____				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
42. Jobsite Pre-briefing	33. None	22. Review JSA, SOP's, and discuss hazards that may be present and control measures for present hazards while on-site.

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
2. Working near railroads	1. Passing Trains. 2. Slip/Trips/Falls.	1. Wear reflective vest/ Stay away from tracks/ Do not cross tracks within 10 ft. of train car or when there is a train within view/listen for train horn. 2. Be aware of tripping hazards/ Follow good housekeeping procedures/ Mark significant hazards with spray paint or cones.
3. Walking around site	6. Uneven terrain 7. Wildlife: Stray animals, mice/rats, vectors (i.e. mosquitoes, bees, etc.) 8. Weather: Heat/cold stress 9. Slip/Trips/Falls 10. Foot injuries 11. Eye injuries	9. Pay attention to surrounding area (puddles, wet, frozen, uneven areas); Mark with cones or spray paint. 10. Use bug spray/ Avoid stray animals/Use repellent when needed. 11. Dress for the correct weather situation/ Use sunscreen or protective clothing in sunlight, layers in cold weather/ Drink plenty of fluids/ Take breaks when needed. 4. Be aware of tripping hazards/ Follow good housekeeping procedures/ Mark significant hazards with spray paint or cones. 5. Wear proper PPE (Langan approved safety shoes)/ Change wet socks during cold weather. 6. Wear proper PPE (safety glasses/goggles).
4. Working near road	1. Passing vehicles 2. Slip/Trips/Falls	1. Wear reflective vest/ Stay away from roadway/ Use buddy system/ Place signage or cones when needed. 2. Be aware of tripping hazards/ Follow good housekeeping procedures/ Mark significant hazards with spray paint or cones.
5. All activities	65. Slips/ Trips/ Falls 66. Hand injuries, cuts or lacerations during manual handling of materials 67. Foot injuries 68. Back injuries 69. Traffic 70. Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 71. High Noise levels 72. Overhead hazards 73. Heat Stress/ Cold Stress 74. Eye Injuries	73. Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards 74. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves 75. Wear Langan approved safety shoes 76. Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible 77. Wear high visibility clothing & vest / Use cones or signs to designate work area 78. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellent / Use bug spray when needed 79. Wear hearing protection 80. Wear hard hat / Avoid areas where overhead hazards exist. 81. Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Takes breaks as necessary to avoid heat/cold stress 82. Wear safety glasses
Additional items.		

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<i>Prepared by:</i>		
<i>Reviewed by:</i>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: Building Construction Oversight
JSA Number: JSA006-01

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventative/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



- S** – Stop, what has changed?
- T** – Think about the task
- E** – Evaluate potential hazards
- P** – Plan safe approach
- S** – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input checked="" type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input type="checkbox"/> Safety Goggles	<input checked="" type="checkbox"/> Face Shield	<input checked="" type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input checked="" type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	

Other:

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
43. Transport equipment to work area	34. Back Strain 35. Slips/ Trips/ Falls 36. Traffic 37. Cuts/abrasions from equipment 38. Contusions from dropped equipment	11. Use proper lifting techniques / Use wheeled transport 12. Minimize distance to work area / Have unobstructed path to work area / Follow good housekeeping procedures 13. Wear proper PPE (high visibility vest or clothing) 14. Wear proper PPE (leather gloves, long sleeves) 15. Wear proper PPE (safety shoes)
44. Drilling/anchor bolt installation	16. Hazards associated with drilling, flying objects, heavy equipment, ground level hazards and dust 17. Slips/ Trips/ Falls 18. Hazards associated with concrete work	6. Maintain a safe distance from drilling operation / Wear proper PPE (hard hat, safety glasses, safety shoes, safety vest) 7. Be aware of potential trip hazards / Follow good housekeeping procedures / Mark significant below-grade hazards (i.e. holes, trenches) with safety cones or spray paint / Wear the proper PPE (safety shoes) 8. Maintain a safe distance from pouring operation
45. Steel building erection	17. Overhead hazards, falling objects 18. Pinching/crushing hazards	8. Wear proper PPE (hard hat, safety glasses, safety vest) / Be aware of overhead hazards and maintain a safe distance of at least 10 ft. 9. All personnel should make others aware of moving objects or their intent to move objects / Avoid areas where pinching and crushing hazards are possible
46. All activities	75. Slips/ Trips/ Falls 76. Hand injuries, cuts or lacerations during manual handling of materials 77. Foot injuries 78. Back injuries 79. Traffic	83. Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards 84. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves 85. Wear Langan approved safety shoes

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
4. All activities (cont'd)	80. Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 81. High Noise levels 82. Overhead hazards 83. Heat Stress/ Cold Stress 84. Eye Injuries	86. Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible 87. Wear high visibility clothing & vest / Use cones or signs to designate work area 88. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellent / Use bug spray when needed 89. Wear hearing protection 90. Wear hard hat / Avoid areas where overhead hazards exist. 91. Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Takes breaks as necessary to avoid heat/cold stress 92. Wear safety glasses
Additional items.		
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<u>Prepared by:</u>		
<u>Reviewed by:</u>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: Groundwater Sampling
JSA Number: JSA008-01

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



- S** – Stop, what has changed?
- T** – Think about the task
- E** – Evaluate potential hazards
- P** – Plan safe approach
- S** – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input checked="" type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input type="checkbox"/> Safety Goggles	<input type="checkbox"/> Face Shield	<input checked="" type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input type="checkbox"/> Cut Resist. Gloves	<input checked="" type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input checked="" type="checkbox"/> Other: Tyvek sleeves, Dermal Protection, PID				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
47. Transport equipment to work area	<ol style="list-style-type: none"> Back Strain Slips/ Trips/ Falls Traffic Cuts/abrasions from equipment Contusions from dropped equipment 	<ol style="list-style-type: none"> Use proper lifting techniques / Use wheeled transport Minimize distance to work area / Have unobstructed path to work area / Follow good housekeeping procedures Wear proper PPE (high visibility vest or clothing) Wear proper PPE (leather gloves, long sleeves) Wear proper PPE (safety shoes)
48. Remove well cover	<ol style="list-style-type: none"> Scrape knuckles/hand Strain wrist/bruise palm Pinch fingers or hand 	<ol style="list-style-type: none"> Wear proper PPE (leather gloves) Using a hammer, tap the end of the wrench to loosen grip of bolts Wear proper PPE (leather gloves)
49. Remove well cap and lock	<ol style="list-style-type: none"> Well can pops from pressure Exposure to hazardous substances through inhalation or dermal exposure Scrape knuckles/hand Strain wrist/bruise palm 	<ol style="list-style-type: none"> Remove cap slowly to relieve pressure / Do not place face over well when opening / Wear proper PPE (safety glasses) Use direct air monitoring/reading instrument (i.e. PID) / Be familiar with and follow actions prescribed in the HASP / Wear proper PPE (nitrile gloves) Wear proper PPE (leather gloves) Using hammer, tap the end of the wrench to loosen grip
50. Measure head-space vapor levels	<ol style="list-style-type: none"> Exposure to hazardous substances through inhalation 	<ol style="list-style-type: none"> Do not place face over well when collecting measurement
51. Remove dedicated tubing (if necessary)	<ol style="list-style-type: none"> Exposure to hazardous substances through inhalation or dermal exposure Tubing swings around after removal 	<ol style="list-style-type: none"> Wear proper PPE (nitrile gloves, Tyvek sleeves) Wear proper PPE (safety glasses)
52. Set-up plastic sheeting for work site around the well	<ol style="list-style-type: none"> Lacerations when cutting plastic sheeting 	<ol style="list-style-type: none"> Use scissors to cut plastic sheeting / Cut motions should always be away from body and body parts

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
53. Measure depth to water	<ol style="list-style-type: none"> 1. Exposure to hazardous substances through inhalation or dermal exposure 2. Pinch fingers or hand in water level instrument 	<ol style="list-style-type: none"> 1. Wear proper PPE (nitrile gloves) 2. Wear proper PPE (leather gloves)
54. Calibrate monitoring equipment	<ol style="list-style-type: none"> 1. Skin or eye contact with calibration chemicals 2. Pinch fingers or hand in monitoring equipment 	<ol style="list-style-type: none"> 1. Wear proper PPE (safety glasses, nitrile gloves) 2. Wear proper PPE (leather gloves) / Avoid pinch points
55. Install sampling pump in well	<ol style="list-style-type: none"> 1. Hand injuries during installation of pump 2. Lacerations when cutting tubing 3. Back strain during installation of pump 4. Physical hazards associated with manual lifting of heavy equipment 5. Back strain from starting generator 6. Burns from hot exhaust from generator 7. Electrical shock from improper use of generator and pump 8. Contaminated water spray from loose connections 	<ol style="list-style-type: none"> 1. Wear proper PPE (leather gloves, nitrile gloves) 2. Use safety tubing cutter 3. Use proper lifting techniques 4. Use proper lifting techniques / Use wheeled transport for heavy equipment 5. Use arm when starting generator / Do not over-strain if generator does not start 6. Do not touch generator near exhaust / Use proper handle to carry / Allow generator to cool down before moving 7. Properly plug in pump to generator / Do not allow the pump or generator to contact water / Check for breaks in the cord 8. Check all tubing connections to ensure they are tight and secure

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
10. Purge water	<ol style="list-style-type: none"> 1. Contact with potentially contaminated groundwater 2. Back strain from lifting buckets of water 3. Tripping potential on sample discharge lines and pump electric line 	<ol style="list-style-type: none"> 1. Wear proper PPE (safety glasses, nitrile gloves) 2. Use proper lifting techniques / Use wheeled transport 3. Organize discharge of electric line to keep out of way as much as possible / Mark potential tripping hazards with caution tape or safety cones
11. Sample water collection	<ol style="list-style-type: none"> 1. Contact with potentially contaminated groundwater through dermal exposure 2. Contact with and burns from acid used for sample preservation 3. Tripping potential on sample discharge lines and pump electric line 4. Lacerations from broken sample bottles 5. Back strain when transporting coolers full of collected samples 6. Slips/ Trips/ Falls 	<ol style="list-style-type: none"> 1. Wear proper PPE (safety glasses, nitrile gloves) 2. Wear proper PPE (safety glasses, nitrile gloves) / Ensure sample bottle lids are secure before use and after sample collection 3. Organize line to keep out of the way as much as possible / Mark potential tripping hazards with caution tape or safety cones 4. Do not over-tighten bottle caps / Handle bottles safely to prevent breakage / Wrap glass bottles in bubble wrap, if possible 5. Use proper lifting techniques / Use wheeled transport / Seek assistance if coolers weight exceeds 50lbs. / Minimize distance to vehicle 6. Have unobstructed path to vehicle or collection point / Follow good housekeeping procedures / Do not lift/walk with coolers that are too heavy/difficult to lift
12. Remove pump and pack up equipment	<ol style="list-style-type: none"> 1. Back strain when removing pump or lifting heavy equipment 	<ol style="list-style-type: none"> 1. Use proper lifting technique / Use wheeled transport for heavy equipment
13. Replace well cap and lock	<ol style="list-style-type: none"> 1. Scrape fingers/hand 2. Strain wrist/bruise palm 	<ol style="list-style-type: none"> 1. Wear proper PPE (leather gloves) 2. Using hammer, tap the end of the well cap to tighten grip
14. Replace well cover	<ol style="list-style-type: none"> 1. Scrape knuckles/hand 2. Strain wrist/bruise palm 3. Pinch fingers or hand 	<ol style="list-style-type: none"> 1. Wear proper PPE (leather gloves) 2. Using hammer, tap the end of the wrench to tighten the grip of the bolts 3. Wear proper PPE (leather gloves)
15. Transport drums to disposal staging location	<ol style="list-style-type: none"> 1. Back, arm or shoulder strain from moving drums 2. Pinch hazard 3. Contact with potentially contaminated groundwater when moving improperly sealed drums 4. Slips/ Trips/ Falls when moving drum 5. Drop drum on feet/toes 	<ol style="list-style-type: none"> 1. Use drum cart for moving drums / Use proper lifting techniques / Obtain assistance, if needed 2. Wear proper PPE (leather gloves) 3. Wear proper PPE (nitrile gloves under leather gloves) / Properly seal drum to prevent leak 4. Ensure route to move drum to storage space is dry and free from obstructions 5. Wear proper PPE (safety shoes)
16. Place used PPE in designated disposal drum	<ol style="list-style-type: none"> 1. Pressure build-up inside drum 2. Pinch hazard 	<ol style="list-style-type: none"> 1. Remove cap from bung hole in drum to relieve pressure 2. Wear proper PPE (leather gloves)
17. Decontaminate equipment	<ol style="list-style-type: none"> 1. Splashing water/soap from decontamination 2. Contact with potentially contaminated groundwater through dermal exposure 3. Electrical shock from broken electric cords 	<ol style="list-style-type: none"> 1. Wear proper PPE (safety glasses) 2. Wear proper PPE (safety glasses, dermal protection) 3. Properly plug in pump to generator / Do not allow the pump or generator to contact water / Check for breaks in the cord
18. All activities	<ol style="list-style-type: none"> 85. Slips/ Trips/ Falls 86. Hand injuries, cuts or lacerations during manual handling of materials 87. Foot injuries 88. Back injuries 89. Traffic 90. Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 	<ol style="list-style-type: none"> 93. Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards 94. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves 95. Wear Langan approved safety shoes

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
	91. High Noise levels 92. Overhead hazards 93. Heat Stress/ Cold Stress 94. Eye Injuries	96. Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible 97. Wear high visibility clothing & vest / Use cones or signs to designate work area 98. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellent / Use bug spray when needed 99. Wear hearing protection 100. Wear hard hat / Avoid areas where overhead hazards exist. 101. Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Take breaks as necessary to avoid heat/cold stress 102. Wear safety glasses
Additional items.		
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<i>Prepared by:</i>		
<i>Reviewed by:</i>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: Well Installation
JSA Number: JSA019-01

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



- S** – Stop, what has changed?
- T** – Think about the task
- E** – Evaluate potential hazards
- P** – Plan safe approach
- S** – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT REQUIRED:

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input checked="" type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input type="checkbox"/> Safety Goggles	<input type="checkbox"/> Face Shield	<input checked="" type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input checked="" type="checkbox"/> Other: PID, Tyvek sleeves				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
56. Move equipment to work site	39. Back strain when lifting equipment 40. Slips/ Trips/ Falls while moving equipment 41. Traffic (if applicable) 42. Pinched fingers or running over toes during geoprobe set-up 43. Overturn drilling rig while transporting to loading dock on flat-bed tow truck	23. Use proper lifting technique (use legs for bending and lifting and not the back)/ Use wheeled transport for heavy equipment / Get assistance when handling loads greater than 50 lbs. / Minimize distance to vehicle 24. Use proper lifting technique (use legs for bending and lifting and not the back) / Use wheeled transport for heavy equipment / Get assistance when handling loads greater than 50 lbs. / Minimize distance to vehicle / Have unobstructed path to vehicle or collection point / Do not lift/walk with boxes that are heavy/difficult to lift 25. Wear high visibility safety vests or clothing / Exercise caution 26. Wear proper PPE (cut-resistant gloves) / Stay alert, be aware of geoprobe rig at all times 27. Drill rig should be parked in center of flat-bed tow truck / Emergency brake shall be used at all times during transport on the flat-bed truck/ All unnecessary personnel should stay away from the flat-bed truck during moving activities
57. Calibration of monitoring equipment	22. Skin or eye contact with calibration chemicals 23. Pinch fingers in monitoring equipment	12. Wear proper PPE (safety glasses/ goggles) 13. Wear proper PPE (leather gloves)
14. Set-up geoprobe rig	23. Geoprobe rig movement	12. All field personnel should stay clear of the geoprobe rig while moving/ Use a spotter when backing up the geoprobe
15. Advance geoprobe rods below ground surface to desired depth	12. Underground utilities 13. High noise levels	12. Clean all subsurface soil borings to a minimum of 5 feet below grade 13. Wear proper PPE (hearing protection)

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
16. Remove and open acetate liner 5. Remove and open acetate liner (cont'd)	95. Pinched fingers while removing macrocore 96. Cuts/lacerations when cutting acetate liner open 97. Exposure to hazardous vapors 98. Skin contact with contaminated soil	5. Wear proper PPE (nitrile gloves, cut-resistant or leather gloves) 6. Wear proper PPE (cut-resistant or leather gloves) 7. Do not place face over acetate liner when opening / Monitor hazardous vapors in air with PID / Upgrade PPE as necessary based on levels contained in the Health and Safety Plan 8. Wear proper PPE (nitrile gloves)
6. Remove excess soil from acetate liner and place in 55-gallon drum (IF NOT PERFORMED BY LANGAN, REMOVE!)	5. Cuts/lacerations from acetate liner 6. Pinched fingers/hand while opening/closing drum 7. Skin contact with contaminated soil 8. Soil debris in eyes	5. Wear proper PPE (cut-resistant or leather gloves) 6. Wear proper PPE (cut-resistant or leather gloves) 7. Wear proper PPE (nitrile gloves) 8. Wear proper PPE (safety glasses)
7. Attach hollow-stem augers to the geoprobe rig; Advance augers and attach additional augers until desired depth is reached	1. Strain wrist/bruise palm 2. Pinched fingers 3. Back Strain 4. Clothing entanglement 5. Carbon monoxide poisoning 6. Bruise toes/foot 7. High noise levels 8. Skin contact with contaminated soil	1. Wear proper PPE (cut-resistant or leather gloves) 2. Wear proper PPE (cut-resistant or leather gloves) 3. Use proper lifting techniques 4. Wear proper work attire(no loose clothing/strings) 5. Properly ventilate work area 6. Wear proper PPE (safety shoes) 7. Wear proper PPE (hearing protection) 8. Wear proper PPE (Tyvek sleeves, nitrile gloves)
8. Install monitoring well	1. Pinched fingers 2. Lacerations/abrasions 3. Back Strain	1. Wear proper PPE (cut-resistant or leather gloves) 2. Wear proper PPE (cut-resistant or leather gloves) 3. Use proper lifting techniques
9. Tremie-grout annulus space above bentonite seal	1. Back strain 2. Pinched fingers	1. Use proper lifting techniques 2. Wear proper PPE (cut-resistant or leather gloves)
10. Install flush-mount monitoring well pad	1. Splashed concrete 2. Pinched fingers 3. Cuts/lacerations	1. Wear proper PPE (safety glasses) 2. Wear proper PPE (cut-resistant or leather gloves) 3. Wear proper PPE (cut-resistant or leather gloves)
11. Decontaminate equipment	1. Splashing water/soap 2. Contact with potentially contaminated groundwater/soil through dermal exposure 3. Electrical shock from broken electric cords	1. Wear proper PPE (safety glasses) 2. Wear proper PPE (safety glasses, dermal protection) 3. Properly plug in pump to generator / Do not allow the pump or generator to contact water / Check for breaks in the cord
12. Transport drums to central staging location (IF NOT PERFORMED BY LANGAN, REMOVE!)	7. Back, arm or shoulder strain from moving drums 8. Pinch fingers/hand in drum cart when moving drums 9. Pinch fingers/hand when operating lift-gate on vehicle 10. Contact with potentially contaminated groundwater when moving improperly sealed drums 11. Slips when moving drums 12. Drop drum on feet/toes	103. Use drum cart for moving drums / Use proper lifting techniques / Do not lift heavy loads without assistance 104. Wear proper PPE (cut-resistant or leather gloves) 105. Wear proper PPE (cut-resistant or leather gloves) 106. Wear proper PPE (nitrile gloves underneath work gloves) 107. Follow good housekeeping procedures / Ensure route to move drum and storage space is free from obstructions 108. Wear proper PPE (safety shoes) / Work in a safe manner to prevent dropped drum

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
<p>13. All activities</p> <p>13. All activities (cont'd)</p>	<p>11. Slips/ Trips/ Falls</p> <p>12. Hand injuries, cuts or lacerations during manual handling of materials</p> <p>13. Foot injuries</p> <p>14. Back injuries</p> <p>15. Traffic</p> <p>16. Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.)</p> <p>17. High Noise levels</p> <p>18. Overhead hazards</p> <p>19. Heat Stress/ Cold Stress</p> <p>20. Eye Injuries</p>	<p>11. Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards</p> <p>12. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves</p> <p>13. Wear Langan approved safety shoes</p> <p>14. Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible</p> <p>15. Wear high visibility clothing & vest / Use cones or signs to designate work area</p> <p>16. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellant / Use bug spray when needed</p> <p>17. Wear hearing protection</p> <p>18. Wear hard hat / Avoid areas were overhead hazards exist.</p> <p>19. Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Takes breaks as necessary to avoid heat/cold stress</p> <p>20. Wear safety glasses</p>
Additional items.		
<p>Additional Items identified while in the field.</p> <p>(Delete row if not needed.)</p>		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<u>Prepared by:</u>		
<u>Reviewed by:</u>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: **Monitoring Well Development**
JSA Number: **JSA026-01**

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



- S** – Stop, what has changed?
- T** – Think about the task
- E** – Evaluate potential hazards
- P** – Plan safe approach
- S** – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input type="checkbox"/> Safety Goggles	<input checked="" type="checkbox"/> Face Shield	<input checked="" type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input checked="" type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input checked="" type="checkbox"/> Other: Tyvek Sleeves				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
58. Transport equipment to work area	44. Back Strains 45. Slips/Trips/Falls 46. Traffic 47. Cuts/Abrasions/Contusions from equipment	28. Use proper lifting techniques/ Use wheeled transport/ use buddy system when lifting equipment. 29. Minimize distance from work area/ unobstructed path to collection points and vehicle/ Follow good housekeeping procedures. 30. Wear high-visibility vest or clothing/Exercise caution/ Use traffic cones or signage if needed. 31. Wear proper PPE (leather gloves, long sleeves, Langan approved safety shoes).
59. Measure depth of water	24. Exposure to hazardous substances 25. Pinched fingers	17. Wear proper PPE (Nitrile gloves, Safety glasses/Face shield). 18. Wear proper PPE (cut-resistant gloves).
60. Install Tremie pipe in the monitoring well and connect to water source.	24. Hand injuries during installation (pinched fingers/hands). 25. Back strain from holding Tremie pipe. 26. High pressure water spray.	13. Wear proper PPE (Nitrile gloves/cut-resistant gloves). 14. Use proper lifting techniques/ Use two personnel when lowering pump greater than 80 feet. 15. Ensure all hose connections are tight and secure/ Use proper PPE (face shield and safety glasses).
61. Install pump in to well a. Connect pump to sample tubing. b. Lower pump to desired depth in well. c. Connect sample tubing to flow cell d. Connect pump to power source	14. Hand injuries during pump installation and sample tubing cutting. 15. Back strain 16. Electric shock 17. Exhaust gases from generator 18. Burns from hot equipment	14. Wear proper PPE when installing pump and cutting sample tubing (Nitrile and cut-resistant gloves)/ Use tubing cutter. 15. Proper lifting techniques/ Two personnel when installing pump at depths greater than 80 feet/ Use buddy when lifting heavy loads (pump, generator)/Use wheeled transport. 16. Ensure equipment is (LO/TO: locked out/tagged out) prior to performing any electrical connections/ Inspect wires for frays or cuts/Ensure generator is properly grounded prior to starting.

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
(generator) e. Turn on power source (generator)		17. Position generator so that exhaust is flowing away from work area. 18. Do not touch exhaust or any hot part of generator/ Allow equipment time to cool down prior to carrying/ Use proper PPE (long sleeves, leather gloves)
62. Develop monitoring well a. Jet water into well using Tremie pipe b. Turn pump on and adjust to desired flow rate. c. Surge pump up and down well to remove sediment from screen d. Containerize all purge water from well.	99. Hand injuries 100.Face injuries 101.Contaminated spray from water	109.Wear proper PPE (cut-resistant gloves and nitrile gloves). 110.Wear proper PPE (face shield and safety glasses)/do not stand over well opening. 111.Wear proper PPE (Face shield and safety goggles)/Tyvek over garments/ Ensure all connections are secure and tight/ Tubing outlet is contained in an overflow container.
63. Drum staging area.	1. Back, Arm, and shoulder strain. 2. Pinch points 3. Cross contamination 4. Slip/Trips/Falls	1. Use proper lifting techniques/ Use drum carts when moving drums/ use buddy system for moving of drums if needed/Move drums shortest distance needed. 2. Keep fingers and feet away from pinch points/ Use proper PPE (cut-resistant gloves, Langan approved safety shoes) 3. Use proper PPE (Nitrile gloves, Tyvek sleeves) 4. Ensure pathway is clear prior to moving equipment/ Mark all hazards/ Use additional person as a spotter if needed.
64. Equipment pack-up	1. Back Strains 2. Slips/Trips/Falls 3. Traffic 4. Cuts/Abrasions/Contusions from equipment.	1. Use proper lifting techniques/ Use wheeled transport/ use buddy system when lifting equipment. 2. Minimize distance from work area/ Unobstructed path to collection points and vehicle/ Follow good housekeeping procedures. 3. Wear high-visibility vest or clothing/Exercise caution/ Use traffic cones or signage if needed. 112.Wear proper PPE (leather gloves, long sleeves, Langan approved safety shoes).
65. All activities	1. Slips/ Trips/ Falls 2. Hand injuries, cuts or lacerations during manual handling of materials 3. Foot injuries 102.Back injuries 103.Traffic 104.Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 105.High Noise levels 106.Overhead hazards 107.Heat Stress/ Cold Stress 108.Eye Injuries	1. Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards 2. Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves 3. Wear Langan approved safety shoes 4. Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible 5. Wear high visibility clothing & vest / Use cones or signs to designate work area 6. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellent / Use bug spray when needed 7. Wear hearing protection 8. Wear hard hat / Avoid areas where overhead hazards exist. 9. Wear proper attire for weather conditions (sunscreen or protective clothing)

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
		in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Takes breaks as necessary to avoid heat/cold stress 10. Wear safety glasses.
Additional items.		
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<u>Prepared by:</u>		
<u>Reviewed by:</u>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: Hammer Drill
JSA Number: JSA049

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventative/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



- S** – Stop, what has changed?
- T** – Think about the task
- E** – Evaluate potential hazards
- P** – Plan safe approach
- S** – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input checked="" type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input type="checkbox"/> Safety Goggles	<input checked="" type="checkbox"/> Face Shield	<input checked="" type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input checked="" type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input type="checkbox"/> Other:				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
66. Transport equipment to work area	48. Back Strain 49. Slips/ Trips/ Falls 50. Traffic 51. Cuts/abrasions from equipment 52. Contusions from dropped equipment	16. Use proper lifting techniques / Use wheeled transport 17. Minimize distance to work area / Have unobstructed path to work area / Follow good housekeeping procedures 18. Wear proper PPE (high visibility vest or clothing) 19. Wear proper PPE (leather gloves, long sleeves) 20. Wear proper PPE (safety shoes)
67. Electrical Connection	26. Inspect electrical cord to drill 27. Inspect hammer drill 28. Inspect extension cord 29. Test GFCI	12. Check the plug, insure all connections are in place, and check cord for frayed sections. If plug or cord are worn, do not use equipment until repaired 13. Inspect chuck for proper grasping and holding of bit, check that plastic housing is not cracked or missing pieces. Do not use if chuck doesn't work properly or housing is compromised. 14. Inspect extension cord, if worn or stripped pull from service and replace 15. Test GFCI, replace if GFCI fails
68. Drill Bit	1. Inspect drill bit	1. Replace if worn 2. Wear proper PPE (leather gloves) when installing and removing drill bit. 3. Ensure equipment is unplugged from electrical power when removing and installing drill bit.
69. Use of Hammer Drill	1. Hazards associated with using hammer drill, flying objects, heavy equipment, ground level hazards and dust 2. Slips/ Trips/ Falls 3. Hazards associated drilling into concrete slab	1. Maintain a safe distance from other site operations / Wear proper PPE (hard hat, safety glasses, safety shoes, safety vest, ear protection and leather gloves) 2. Be aware of potential trip hazards / Follow good housekeeping procedures / Mark extension cord pathway with safety cones 3. Do not push hammer drill during use.

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
70. All activities 4. All activities (cont'd)	109.Slips/ Trips/ Falls 110.Hand injuries, cuts or lacerations during manual handling of materials 111.Foot injuries 112.Back injuries 113.Traffic 114.Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 115.High Noise levels 116.Overhead hazards 117.Heat Stress/ Cold Stress 118.Eye Injuries	113.Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards 114.Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves 115.Wear Langan approved safety shoes 116.Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible 117.Wear high visibility clothing & vest / Use cones or signs to designate work area 118. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellent / Use bug spray when needed 119.Wear hearing protection 120.Wear hard hat / Avoid areas where overhead hazards exist. 121.Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Take breaks as necessary to avoid heat/cold stress 122. Wear safety glasses
Additional items.		
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<u>Prepared by:</u>		
<u>Reviewed by:</u>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: Indoor Air Sampling
JSA Number: JSA007-01

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



S – Stop, what has changed?
T – Think about the task
E – Evaluate potential hazards
P – Plan safe approach
S – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input checked="" type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input type="checkbox"/> Safety Goggles	<input type="checkbox"/> Face Shield	<input checked="" type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input checked="" type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input checked="" type="checkbox"/> Other: PID, Respiratory Protection (if necessary)				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
71. Building walkthrough and background contaminant removal	53. Slips / Trips/ Falls 54. Exposure to substances/vapors during removal	21. Be aware of potential trip hazards / Follow good housekeeping procedures / Mark significant below-grade hazards (i.e. holes, trenches) with safety cones or spray paint 22. Monitor indoor air concentrations with a PID / Wear proper PPE (nitrile gloves) / Wear proper respiratory protection if necessary
72. Transport equipment to work area	6. Back Strain 7. Slips/ Trips/ Falls 8. Traffic 9. Cuts/abrasions from equipment 10. Contusions from dropped equipment	6. Use proper lifting techniques / Use wheeled transport 7. Minimize distance to work area / Have unobstructed path to work area / Follow good housekeeping procedures 8. Wear proper PPE (high visibility vest or clothing) 9. Wear proper PPE (leather gloves, long sleeves) 10. Wear proper PPE (safety shoes)
73. Mark out areas for indoor air sampling	30. Slips/ Trips/ Falls	16. Be aware of potential trip hazards / Follow good housekeeping procedures / Mark significant below-grade hazards (i.e. holes, trenches) with safety cones or spray paint
74. Set-up canisters and begin indoor air sampling	27. Dropping crates or canisters 28. Pinch hazard	14. Exercise caution when moving crates and canisters / Use proper housekeeping of materials during sample events / Do not carry too many items at one time / Perform several trips, if necessary 15. Wear proper PPE (leather gloves)
75. Sample collection	2. Dropping crates or canisters 3. Pinched fingers from opening valves	2. Exercise caution when moving crates and canisters / Use proper housekeeping of materials during sample events / Do not carry too many items at one time / Perform several trips, if necessary 3. Wear proper PPE (leather gloves) / Keep fingers away from pinch points
76. Pack up equipment	3. Back strain	3. Use proper lifting techniques / Use wheeled transport

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
	4. Slips/ Trips/ Falls 5. Traffic	4. Be aware of potential trip hazards / Follow good housekeeping procedures / Minimize distance to vehicle 5. Wear proper PPE (safety vest)
77. All activities	119.Slips/ Trips/ Falls 120.Hand injuries, cuts or lacerations during manual handling of materials 121.Foot injuries 122.Back injuries 123.Traffic 124.Wildlife: Stray dogs, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 125.High Noise levels 126.Overhead hazards 127.Heat Stress/ Cold Stress 128.Eye Injuries	123.Be aware of potential trip hazards / Follow good housekeeping procedures/ Mark significant hazards 124.Inspect for jagged/sharp edges, and rough or slippery surfaces / Keep fingers away from pinch points / Wipe off greasy, wet, slippery or dirty objects before handling / Wear leather/ cut-resistant gloves 125.Wear Langan approved safety shoes 126.Use proper lifting techniques / Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift / Obtain assistance when possible 127.Wear high visibility clothing & vest / Use cones or signs to designate work area 128. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray dogs / Carry/use dog/animal repellant / Use bug spray when needed 129.Wear hearing protection 130.Wear hard hat / Avoid areas were overhead hazards exist. 131.Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather) / Drink plenty of fluids to avoid dehydration / Takes breaks as necessary to avoid heat/cold stress 132. Wear safety glasses
Additional items.		
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<u>Prepared by:</u>		
<u>Reviewed by:</u>		

LANGAN

Job Safety Analysis (JSA) Health and Safety

JSA Title: Sub-slab soil gas temporary point installation and sampling
JSA Number: JSA037-01

A Job Safety Analysis (JSA) must identify all job steps required to complete the task, the potential hazards employees could be exposed to while performing the job step and the preventative/corrective actions required to reduce/mitigate the identified potential hazards. Employees must certify that they have either prepared the JSA or have reviewed the JSA and are aware of the potential hazards associated with this task and will follow the provided preventive/corrective actions. Prior to the start of any work "TAKE 5" and conduct a Last Minute Risk Assessment.



- S** – Stop, what has changed?
- T** – Think about the task
- E** – Evaluate potential hazards
- P** – Plan safe approach
- S** – Start task / Stop & regroup

PERSONAL PROTECTIVE EQUIPMENT (Required or to be worn as needed):

<input checked="" type="checkbox"/> Safety Shoes	<input checked="" type="checkbox"/> Long Sleeves	<input checked="" type="checkbox"/> Safety Vest (Class 2)	<input checked="" type="checkbox"/> Hard Hat	<input type="checkbox"/> Hearing Protection
<input checked="" type="checkbox"/> Safety Glasses	<input checked="" type="checkbox"/> Safety Goggles	<input type="checkbox"/> Face Shield	<input checked="" type="checkbox"/> Nitrile Gloves	<input type="checkbox"/> PVC Gloves
<input checked="" type="checkbox"/> Leather Gloves	<input type="checkbox"/> Cut Resist. Gloves	<input type="checkbox"/> Fall Protection	<input type="checkbox"/> Fire Resistant Clothing	<input type="checkbox"/> Rubber Boots
<input checked="" type="checkbox"/> Insect/Animal Repellent	<input type="checkbox"/> Ivy Blocker/Cleaner	<input checked="" type="checkbox"/> Traffic Cones/Signs	<input type="checkbox"/> Life Vest/Jacket	
<input checked="" type="checkbox"/> Other: Tyvek Sleeves				

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
78. Transport equipment to work site	55. Back injuries 56. Slips/Trips/Falls 57. Traffic 58. Hand injuries	32. Use proper lifting techniques/ Use wheeled transport/ Get assistance when need with moving equipment/ Minimize distance from vehicle 33. Minimize distance from vehicle/ Have unobstructed pathway to vehicle and collection points/ Mark tripping hazards with spray paint, cones, or caution tape/ Observe good housekeeping procedures. 34. Wear proper PPE (High Visibility vest and clothing)/ Exercise caution (stay alert-stay alive) 35. Wear proper PPE (leather gloves)/ Keep finger and hands clear of pinch points.
79. Mark area for drilling	31. Slips/Trips/Falls	19. Minimize distance from vehicle/ Have unobstructed pathway to vehicle and collection points/ Mark tripping hazards with spray paint, cones, or caution tape/ Observe good housekeeping procedures
80. Drill sampling points with hammer drill	29. Eye injuries 30. Dust exposure 31. Hand injuries 32. Catch items (clothing) 33. Electric shock 34. Chemical atmosphere hazard (vapor) 35. Slips/Trips/Falls	16. Wear proper PPE (safety glasses) 17. Wear proper PPE (dust mask) 18. Wear proper PPE (leather gloves)/ Keep hands and fingers out of pinch points/ Avoid drill catching on ground and twisting wrist or hand/ Release drill grip if drill becomes caught/ Ensure drill is unplugged prior to inserting bit. 19. Tie up or tuck-in all loose clothing/ Maintain distance from drill 20. Inspect power cable for cuts or nicks before use/ Use GFCI outlet on power cord/ Do not use in wet conditions 21. Monitor air, vapors with Photo-ionization detector (PID)

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
		22. Minimize distance from vehicle/ Have unobstructed pathway to vehicle and collection points/ Mark tripping hazards with spray paint, cones, or caution tape/ Observe good housekeeping procedures
81.Measure vapor content and depth to bottom of hole	1. Chemical atmosphere hazard (vapors)	1. Monitor air, vapors with Photo-ionization detector (PID)/ Keep face away from opening of hole while collecting measurements
82.Set-up of shroud and sampling canister system	1. Hand injuries 2. Chemical atmosphere hazard (vapors) 3. Slips/Trips/Falls	1. Wear proper PPE (leather gloves, nitrile gloves)/ Keep fingers away from pinch points when installing pump/ Do not use open blades, use tubing cutter 2. Monitor air, vapors with Photo-ionization detector (PID)/ Keep face away from opening of hole while collecting measurements 3. Minimize distance from vehicle/ Have unobstructed pathway to vehicle and collection points/ Mark tripping hazards with spray paint, cones, or caution tape/ Observe good housekeeping procedures
83.Purge soil gas	1. Chemical atmosphere hazard (vapors)	1. Monitor air, vapors with Photo-ionization detector (PID)/ Keep face away from exhaust port of pump
84.Sample collection (opening and closing valves)	1. Hand injuries	1. Wear proper PPE (leather gloves)/ Keep fingers away from pinch points
85.Sealing sampling holes	1. Back injuries 2. Concrete dust 3. Eye injuries	1. Use proper lifting techniques for lifting of cement bags 2. Wear proper PPE (dust mask) 3. Wear proper PPE (safety glasses)
86. All activities	129.Slips/ Trips/ Falls 130.Hand injuries, cuts or lacerations during manual handling of materials 131.Foot injuries 132.Back injuries 133.Traffic 134.Wildlife: Stray animals, Mice/rats, Vectors (i.e. mosquitoes, bees, etc.) 135.High Noise levels 136.Overhead hazards 137.Heat or cold injuries 138.Eye Injuries	133. Be aware of potential trip hazards/ Follow good housekeeping procedures/ Mark significant hazards 134. Inspect for jagged/sharp edges, and rough or slippery surfaces/ Keep fingers away from pinch points/ Wipe off greasy, wet, slippery or dirty objects before handling/ Wear leather/ cut-resistant gloves Wear proper PPE (Langan approved safety shoes) 135. Use proper lifting techniques/ Consider load location, task repetition, and load weigh when evaluating what is safe or unsafe to lift/ Obtain assistance when possible 136. Wear high visibility clothing & vest/ Use cones or signs to designate work area 137. Be aware of surroundings at all times, including the presence of wildlife/ Do not approach stray animals/ Carry and use animal repellent when needed/ Use bug spray when needed 138. Wear hearing protection 139. Wear hard hat/ Avoid areas where overhead hazards exist. 140. Wear proper attire for weather conditions (sunscreen or protective clothing in sunlight, layers for cold weather)/ Drink plenty of fluids to avoid dehydration/ Takes breaks as necessary to avoid heat/cold stress 141. Wear safety glasses

JOB STEPS	POTENTIAL HAZARDS	PREVENTATIVE / CORRECTIVE ACTION
Additional items.		
Additional Items identified while in the field. (Delete row if not needed.)		

<u>Print Name</u>	<u>Sign Name</u>	<u>Date</u>
<i>Prepared by:</i>		
<i>Reviewed by:</i>		

ATTACHMENT H

TAILGATE SAFETY BRIEFING FORM

LANGAN TAILGATE SAFETY BRIEFING

Date: _____

Time: _____

Leader: _____

Location: _____

Work Task:

SAFETY TOPICS (provide some detail of discussion points)

Chemical Exposure Hazards and Control: _____

Physical Hazards and Control: _____

Air Monitoring: _____

PPE: _____

Communications: _____

Safe Work Practices: _____

Emergency Response: _____

Hospital/Medical Center Location: _____

Phone Nos.: _____

Other: _____

FOR FOLLOW-UP (the issues, responsibilities, due dates, etc.)

ATTENDEES

PRINT NAME	COMPANY	SIGNATURE