

FIRST PARISH CEMETERY GRAVESTONE RESTORATION PROJECT V

Descriptive photos with restoration costs

EXPENSES:	Colonial Stone Restoration Fees	\$16,765
	Contingency	\$1,150
	TOTAL PROJECT EXPENSES:	\$17,915
INCOME SOURCES:		
	First Parish Cemetery Association	\$750
	Norwell Historical Society	\$250
	Community Preservation Act Request	\$16,915
	TOTAL INCOME RECEIVED:	\$17,915

1) PERKINS CLAPP GRAVESTONE = \$1,900

1 marble headstone: *The base of this headstone was missing when excavated last year. As a result of the cost of building a new base, the restoration of the stone was delayed. Because it is loose in the cemetery, it will be removed to a safe location until next year. The stone will be cleaned and reset with a new foundation of compacted stone dust.*

(This stone was slated to be restored last year.)



2) ABIAL TURNER = \$700 (+\$400 contingency)

1 slate headstone: *This slate was supposed to be restored last year, but only the one next to it (Elizabeth Turner) was done. It has a failed foundation and will need to be removed, and a new foundation will be installed. The stone will be cleaned, delamination areas will be filled, and it will be re-set.*

(Because of the danger of below-grade conditions being worse than anticipated, a contingency has been added to this price.)

(This stone was slated to be restored last year.)



3) + 4) LITCHFIELD FAMILY GRAVESTONES = \$750 X 2 = \$1,500


2 marble headstones: *These 2-piece stones both have failed foundations. They will need carbon fiber internal rods (replacing the old metal ones) to fit the two pieces together, and they will be cleaned and re-set.*

(These stones were slated to be restored last year.)



5) JENKINS GRAVESTONE = \$550

1 granite headstone: *This stone is currently loose on the ground. The stone will be removed to a safe storage location until next year. It will receive a new foundation, then be cleaned and reinstalled*

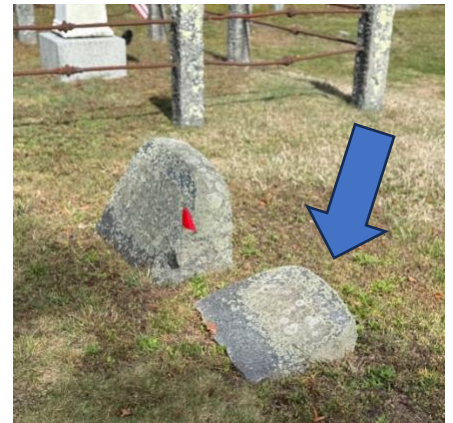

6) 7) 8) RANDALL FAMILY PLOT = \$885 X 3 = \$2,655

3 slate headstones: *All stones need to be cleaned and re-set with new foundations of compacted stone dust. All voids will be filled with color-matched lime mortar. Two of the names are unreadable but perhaps will be again with cleaning. Any delamination will be filled with lime mortar.*

(These stones were slated to be restored last year.)



9) ELISHA RANDALL = \$885


1 slate headstone: *In front of the other Randall stones, this stone is delaminating on the back side and a small section has broken off. The stone will be removed, cleaned, a new foundation will be installed, and it will be re-assembled with a 2-part commercial epoxy. Any voids will be filled with lime mortar.*



10) ALAN BOWKER STONE = \$875 (+\$500 contingency)

1 marble headstone: *This stone has a failed foundation, and the slotted base is currently buried and loose. Stone will be removed, repairs to the base will be made, a new foundation will be installed, and it will be cleaned.*

(Because of the danger of below-grade conditions being worse than anticipated, a contingency has been added to this price).

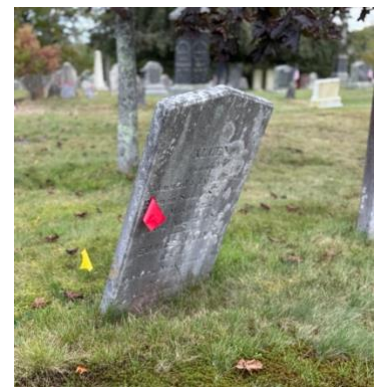

11) ELIZABETH STUDLEY STONE = \$1,000 (+\$250 contingency)

1 marble headstone: *This stone has a failed foundation, and the slotted base is currently buried and loose. Stone will be removed, repairs to the base will be made, a new foundation will be installed, and it will be cleaned.*

(Because of the danger of below-grade conditions being worse than anticipated, a contingency has been added to this price).

(This stone was slated to be restored last year.)



12) SARAH STANLEY STONE = \$1,800

1 marble headstone: *This stone is toppled and was buried under ground until recently. The stone will be excavated, all pieces will be cleaned, the break will be repaired with a carbon fiber rod and epoxy, a new foundation will be installed, and any voids will be filled with lime mortar.*



13) SYLVESTER/GEORGE LEE STONE = \$2,900

1 granite headstone: *This stone will need a crane to remove it because of its weight. It currently has no foundation, it is just propped up with loose stones and sits on a hillside in danger of falling down. A foundation will be installed, the stone will be cleaned, and it will re-installed and secured.*



15) SAMPSON FAMILY GRAVESTONES = \$1,000 X 2 = \$2,000

2 marble headstones: *These headstones are displaced from their bases, which are missing, and laying in the grass at the cemetery. They will be removed to a safe storage location until next year. The stones will need to be cleaned and re-set into new bases with new carbon fiber rods (you can see the holes for the rods in this photo at right).*

(These stones were slated to be restored last year.)



	NAME	COST	CONTINGENCY
1	Clapp	\$ 1,900.00	
2	Turner	\$ 700.00	\$ 400.00
3	Litchfield 1	\$ 750.00	
4	Litchfield 2	\$ 750.00	
5	Jenkins	\$ 550.00	
6	Randall 1	\$ 885.00	
7	Randall 2	\$ 885.00	
8	Randall 3	\$ 885.00	
9	Elisha Randall	\$ 885.00	
10	Bowker	\$ 875.00	\$ 500.00
11	Studley	\$ 1,000.00	\$ 250.00
12	Stanley	\$ 1,800.00	
13	Sylvester/Lee	\$ 2,900.00	
14	Sampson 1	\$ 1,000.00	
15	Sampson 2	\$ 1,000.00	
		\$ 16,765.00	\$ 1,150.00
	COST +		
	CONTINGENCY	\$ 17,915.00	
	FPCA \$	\$ 750.00	
	NHS \$	\$ 250.00	
	CPC \$	\$ 16,915.00	