

The Fluke 170 Series Digital Multimeters


Brains and Brawn



Tough. Precise. Packed with features:

- Lifetime warranty
- IEC 1010 CAT IV 600V safety rating
- 6000 count display
- True-rms ac voltage and current
- Min/Max/Average
- Frequency and capacitance capabilities
- Easy access battery door
- The 179 measures temperature in °C and °F

Hang meter using Fluke ToolPak™ Strap and Magnet

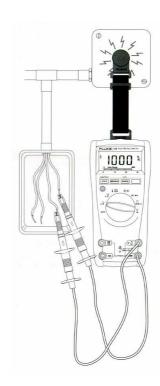

Get our optional ToolPak™ Strap and Magnet and free both hands for finishing jobs faster and easier. You get a powerful magnet, a loop hanger and two straps — for hanging your meter from almost anything while you work.

Features	175	177	179
6000 count display	•	٠	•
Auto Hold and Manual Hold	•	•	•
IEC 1010 Rating: CAT IV 600V / CAT III 1000V	•	•	•
Backlight for measurements in low visibility environments		•	•
Temperature measurements in °C and °F, Thermocouple included			•
Battery door provides battery access without breaking the calibration seal	•	•	•
Compatible with Fluke ToolPak™ meter hanging kit	•	•	•

		Fluke 175	Fluke 177	Fluke 179	
	Range	0.01 mA to 10.00A	0.01 mA to 10.00A	0.01 mA to 10.00A	
AC Amps		(20A overload for 30	(20A overload for 30	20A overload for (30	
AO Amps	_	seconds) ± (1.5% of reading	seconds) ± (1.5% of reading	seconds) ± (1.5% of reading	
	Accuracy	plus 3 counts)	plus 3 counts)	plus 3 counts)	
	Crest Factor	pius 3 courits) ≤ 3	pius 3 courits) ≤ 3	pius 3 courits) ≤ 3	
			_ •	_ •	
	AC Response	45 Hz to 1 kHz	45 Hz to 1 kHz	45 Hz to 1 kHz	
	Range	0.01 mA to 10.00A	0.01 mA to 10.00A	0.01 mA to 10.00A	
DC Amps		(20A overload for 30	(20A overload for 30	(20A overload for 30	
DO Allips		seconds)	seconds)	seconds)	
	Accuracy	± (1.0% of reading	± (1.0% of reading	± (1.0% of reading	
	Banas	plus 3 counts) 0.1 mV to 1000V	plus 3 counts) 0.1 mV to 1000V	plus 3 counts) 0.1 mV to 1000V	
	Range				
	Accuracy	45 Hz to 500 Hz	45 Hz to 500 Hz	45 Hz to 500 Hz	
Volts AC		1% of rdg + 3 counts 500 Hz to 1 kHz	1% of rdg + 3 counts 500 Hz to 1 kHz	1% of rdg + 3 counts 500 Hz to 1 kHz	
		2% of rdg + 3 counts	2% of rdg + 3 counts	2% of rdg + 3 counts	
	AC Response	45 Hz to 1 kHz	45 Hz to 1 kHz	45 Hz to 1 kHz	
V. I. DO		0.1 mV to 1000V	0.1 mV to 1000V	0.1 mV to 1000V	
Volts DC	Range				
	Accuracy	± (0.15% of reading	± (0.09% of reading	± (0.09% of reading	
	,	plus 2 counts)	plus 2 counts)	plus 2 counts)	
Resistance	Range	0.1Ω to 50.00 MΩ	0.1Ω to 50.00 MΩ	0.1Ω to 50.00 MΩ	
	Best Accuracy	± (0.9% of reading	± (0.9% of reading	± (0.9% of reading	
		plus 1 count)	plus 1 count)	plus 1 count)	
Capacitance	Range	1 nF to 9999 μF	1 nF to 9999 μF	1 nF to 9999 μF	
	Best Accuracy	± (1.2% of reading	± (1.2% of reading	± (1.2% of reading	
		plus 2 counts)	plus 2 counts)	plus 2 counts)	
Continuity			050	500	
•		Beeper guaranteed on $<25\Omega$, guaranteed off $>250\Omega$; detects opens or shorts of 250 µs or longer			
		detects opens of short	is of 250 µs of longer		
	D	Voltage Input:	Voltage Input:	Voltage Input:	
	Range	2 Hz to 100 kHz	2 Hz to 100 kHz	2 Hz to 100 kHz	
Hz		Current Input:	Current Input:	Current Input:	
		2 Hz to 30 kHz	2 Hz to 30 kHz	2 Hz to 30 kHz	
	Accuracy	± (0.1% of reading	± (0.1% of reading	± (0.1% of reading	
	, toodi doy	plus 1 count)	plus 1 count)	plus 1 count)	
Temp	Range			-40°C to +400°C,	
				-40°F to +752°F	
	Accuracy	1		°C 1% + 10.	

Available Fluke Accessories	175, 177, 179
Meter Hanging	ToolPak magnet and strap kit
Cases	C510 leather meter case
	C50 padded meter case
	C20 hard meter case
Test Leads	All Fluke Test Leads
Current Clamp	All Fluke Current Clamp Accessories
Temperature	80TK Thermocouple Module
	80T-150U Univ. Temperature Probe
	80AK Thermocouple Adapter (179 only)
	80T-IR/80PK-IR Temperature Probe
Specialty	80K-6, 80K-40 High Voltage Probe
	PV350 Pressure Module
	FOM Fiber Optic Meter

For detailed specifications contact your local Fluke representative, or visit www.fluke.com. Specifications are subject to change without notice.

Ordering Information

Fluke 175 Digital Multimeter Fluke 177 Digital Multimeter Fluke 179 Digital Multimeter Need Technical Assistance? Call:

1-800-44-FLUKE

Toll-free in the U.S. (800) 36-FLUKE in Canada (425) 446-5500 other countries

For more information to be sent to you by fax, call 1-800-FLUKE-FAX in the U.S. and Canada. Or, visit our website at http://www.fluke.com