



CASCADE TESTING LLC

Information Sheet

626 Messick road
Yuba City, CA 95991
530-532-2509

www.cascadetestingllc.com

COMPANY	E55 Technologies
Unit #	1350-045
LOCATION	Folsom, CA
DOT SPECIFICATION	SP- 15136
MANUFACTURER	GTM Technologies
LATEST RETEST DATE	7-2024
RETEST PRESSURE	5400 PSI
Number of Tubes	16
SERVICE PRESSURE	3600
Water Volume	155.5 SCF



CASCADE TESTING LLC

626 Messick Road Yuba City, CA 95991

(530) 532-2509

Purge Form

Company E55 Technologies

Unit NO. 1350-045

Purge Date: 6/27/2024

Type of media used : Nitrogen

Trailer Or Cylinder has been purged with Nitrogen and rendered inert for Testing or Repair

YES

NO

☒

Notes:

I certify that the above information is true.

Travis Pierson

Date:

6/27/2024

Name of person performing purge (print)

Travis Pierson

Signature of person performing purge

626 Messick Rd Yuba City, CA 95991

Address where Purge was performed

Company Tested For: E55 Technologies



Sheet No. 1 of 1

Test Date: 7/1/2024

Trailer # 1350-045

RIN# N289

CASCADE TESTING LLC

Hydraulic Retest Data Sheet

	Serial No.	Ident. Symbol	Size Dia X lght	DOT / ICC Special Permit	Date Mfg.	Last Test	Tube Pressure	Test Pressure	Time held Pressure	Gas Service	Visual Insp.	Disp. Code*	Tested By
****	Master Gauge	*****	*****	*****	*****	*****	*****	*****	*****	*****	*****	*****	*****
1	3589	AIY	15" X 9'	SP- 15136	Jul-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
2	4158	AIY	15" X 9'	SP- 15136	Aug-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
3	4131	AIY	15" X 9'	SP- 15136	Aug-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
4	4156	AIY	15" X 9'	SP- 15136	Aug-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
5	3577	AIY	15" X 9'	SP- 15136	Jul-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
6	4159	AIY	15" X 9'	SP- 15136	Aug-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
7	4157	AIY	15" X 9'	SP- 15136	Aug-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
8	4154	AIY	15" X 9'	SP- 15136	Aug-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
9	3553	AIY	15" X 9'	SP- 15136	Jul-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
10	3580	AIY	15" X 9'	SP- 15136	Jul-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
11	3590	AIY	15" X 9'	SP- 15136	Jul-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
12	4130	AIY	15" X 9'	SP- 15136	Aug-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
13	3555	AIY	15" X 9'	SP- 15136	Jul-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
14	3554	AIY	15" X 9'	SP- 15136	Jul-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
15	3591	AIY	15" X 9'	SP- 15136	Jul-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
16	4132	AIY	15" X 9'	SP- 15136	Aug-13	Jul-18	3600	5,400	3 MIN	1049	OK	A	JG II
17													
18													
19													
20													

*Disposition Code:

A Return to Service

Hose Leak

Test Pressure = To 1.5 Times Marked Pressure Held for Min. Of 1 Minutes

I hereby certify that all the above tests were made under my supervision and in accordance with DOT regulations.

Authorized Tester Cascade Testing LLC

Signature

Latest Retest Date: 7-2024

Tubes: 16

D.O.T. Rated Service Pressure: 3600 PSI



CASCADE TESTING LLC


Yuba City, CA (530) 532-2509

Company: E55 TECH

Job # E55 TECH-045

Date: 7-2-24

Trailer # 1350-045

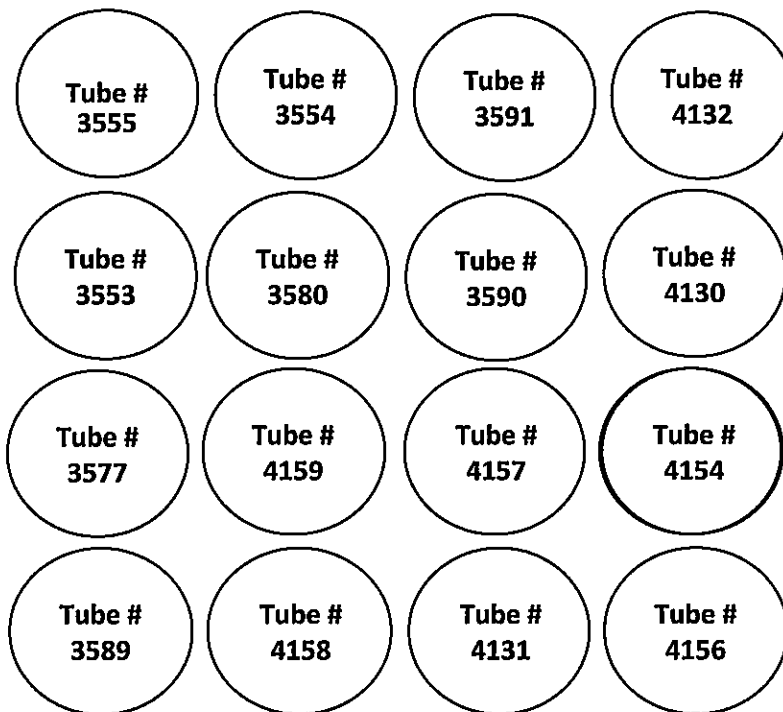



CASCADE TESTING LLC

626 Messick Road Yuba City, CA 95991

(530) 532-2509

MANIFOLD PRESSURE TEST

Company E55 TECH

Date: 7/3/2024

Unit No. 1350-045

Job # E55 TECH -045

Time Held 15 Minutes Test Pressure 3,600

Type of test media used : Nitrogen

	YES	NO
Visual inspection complete?	☒	☐
Inspect piping for leaks. Are there any leaks?	☐	☒
Has the test pressure been held for 15 minutes without decay?	☒	☐

CAUTION: Release pressure in hose before disconnecting.

If Manifold fails to hold test pressure or any leaks have been detected, note method used to repair each defect.
Defects noted and location. _____

Have all leaks been corrected? ☐ ☐

I certify that the above information is true.

Jeffrey Gamble II

Date: 7/3/2024

Name of person preparing test (print)



Signature of person performing test

626 Messick Road Yuba City, CA 95991

Address where test was performed

Hydrostatically Tested & Refurbished By:



CASCADE TESTING LLC

626 Messick Rd.
Yuba City, CA 95991

(530) 532-2509

TRAILER #

1350-045

WATER VOLUME

155.5

C.F.

D.O.T. RATED SERVICE PRESSURE

3600

P.S.I.

LATEST RETEST DATE

7-2024

gtm
Gas Transport Module



**DATA PLATE
INFORMATION**

Unit Serial Number

1350-045

Test Date

07-2013

Retest Date

07-2018



CASCADE TESTING LLC

Yuba City, CA

530-532-2509

ATTENTION:

This E55 Technologies Trailer # 1350-045 is
returning from being hydro-tested and
contains 5 psi of dry nitrogen gas.

www.cascadetestingllc.com

7/3/2024

DATE