
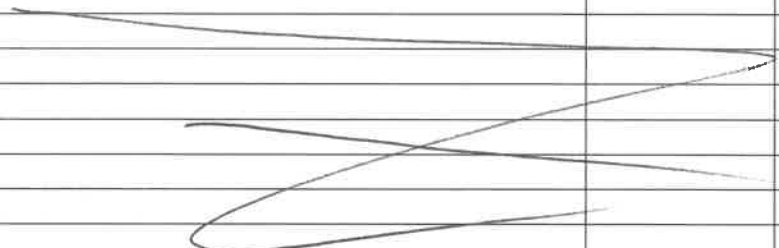


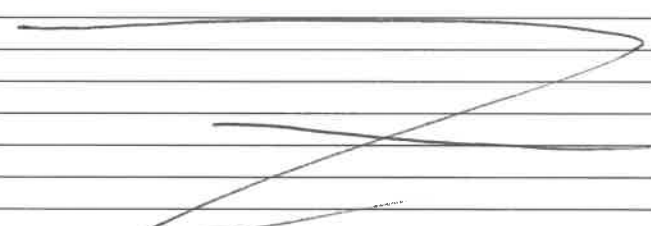

SOCOTEC

Plant Service Record

BREAU DOWN TLC

Date: 21-XI-2024	Fitter's name: DOM	
Plant Item: COMACCHIO - 405	Plant no.: R-68	
Hour reading: 4482.7		
Description of work carried out	Time taken (hours)	Initials
REPLACE SEALS AND LEVER HOUSING ON VALVE BLOCK RESPONSIBLE FOR LOWERING / RISING DRILLING HEAD		DD
TOP UP HYDRAULIC OIL		
		
Parts/materials used	Quantity	
LEVER HOUSING + O-RINGS	1 + 3	
HYD OIL BIO-46	20L	
		
Fitter's comments: ATTEND TO SITE WITH REPLACEMENT LEVER. REPLACE LEVER AFTER TEST FOUND LEAK FROM A VALVE BLOCK AREA. FOUND WORN O-RINGS REPLACE O-RINGS WITH NEW ONES AFTER TEST NO LEAKS FOUND		
		

Fitter's Signature (work complete)

22-XI-2024 